


Operating Instructions

Proline Promag D 400

HART

Electromagnetic flowmeter

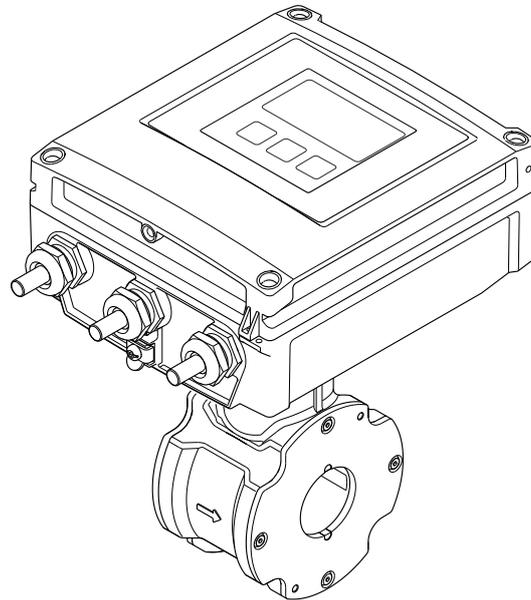

- Make sure the document is stored in a safe place such that it is always available when working on or with the device.
- To avoid danger to individuals or the facility, read the "Basic safety instructions" section carefully, as well as all other safety instructions in the document that are specific to working procedures.
- The manufacturer reserves the right to modify technical data without prior notice. Your Endress+Hauser Sales Center will supply you with current information and updates to these Instructions.

Table of contents

1	Document information	6		
1.1	Document function	6		
1.2	Symbols used	6		
1.2.1	Safety symbols	6		
1.2.2	Electrical symbols	6		
1.2.3	Tool symbols	7		
1.2.4	Symbols for certain types of information	7		
1.2.5	Symbols in graphics	7		
1.3	Documentation	8		
1.3.1	Standard documentation	8		
1.3.2	Supplementary device-dependent documentation	8		
1.4	Registered trademarks	8		
2	Basic safety instructions	9		
2.1	Requirements for the personnel	9		
2.2	Designated use	9		
2.3	Workplace safety	10		
2.4	Operational safety	10		
2.5	Product safety	10		
2.6	IT security	11		
3	Product description	12		
3.1	Product design	12		
4	Incoming acceptance and product identification	13		
4.1	Incoming acceptance	13		
4.2	Product identification	14		
4.2.1	Transmitter nameplate	14		
4.2.2	Sensor nameplate	15		
4.2.3	Symbols on measuring device	15		
5	Storage and transport	16		
5.1	Storage conditions	16		
5.2	Transporting the product	16		
5.3	Packaging disposal	17		
6	Installation	18		
6.1	Installation conditions	18		
6.1.1	Mounting position	18		
6.1.2	Requirements from environment and process	20		
6.1.3	Special mounting instructions	22		
6.2	Mounting the measuring device	22		
6.2.1	Required tools	22		
6.2.2	Preparing the measuring device	22		
6.2.3	Mounting the sensor	23		
6.2.4	Mounting the transmitter of the remote version	26		
6.2.5	Turning the transmitter housing	27		
6.2.6	Turning the display module	29		
6.3	Post-installation check	30		
7	Electrical connection	31		
7.1	Connection conditions	31		
7.1.1	Required tools	31		
7.1.2	Requirements for connecting cable	31		
7.1.3	Terminal assignment	33		
7.1.4	Pin assignment, device plug	34		
7.1.5	Preparing the measuring device	34		
7.1.6	Preparing the connecting cable for the remote version	35		
7.2	Connecting the measuring device	36		
7.2.1	Connecting the transmitter	36		
7.2.2	Connecting the remote version	37		
7.2.3	Ensuring potential equalization	39		
7.3	Special connection instructions	41		
7.3.1	Connection examples	41		
7.4	Ensuring the degree of protection	41		
7.4.1	Degree of protection IP66/67, Type 4X enclosure	41		
7.5	Post-connection check	41		
8	Operation options	43		
8.1	Overview of operation options	43		
8.2	Structure and function of the operating menu	44		
8.2.1	Structure of the operating menu	44		
8.2.2	Operating philosophy	45		
8.3	Access to the operating menu via the local display	46		
8.3.1	Operational display	46		
8.3.2	Navigation view	48		
8.3.3	Editing view	50		
8.3.4	Operating elements	51		
8.3.5	Opening the context menu	52		
8.3.6	Navigating and selecting from list	54		
8.3.7	Calling the parameter directly	54		
8.3.8	Calling up help text	55		
8.3.9	Changing the parameters	56		
8.3.10	User roles and related access authorization	57		
8.3.11	Disabling write protection via access code	57		
8.3.12	Enabling and disabling the keypad lock	57		
8.4	Access to the operating menu via the Web browser	58		
8.4.1	Function range	58		
8.4.2	Prerequisites	58		
8.4.3	Establishing a connection	59		
8.4.4	Logging on	59		
8.4.5	User interface	60		

8.4.6	Disabling the Web server	61	11.5	Adapting the measuring device to the process conditions	101
8.4.7	Logging out	61	11.6	Performing a totalizer reset	101
8.5	Access to the operating menu via the operating tool	61	11.6.1	Function scope of "Control Totalizer" parameter	101
8.5.1	Connecting the operating tool	62	11.6.2	Function scope of "Reset all totalizers" parameter	102
8.5.2	Field Xpert SFX100	63	11.7	Showing data logging	102
8.5.3	FieldCare	63	12	Diagnostics and troubleshooting	104
8.5.4	AMS Device Manager	64	12.1	General troubleshooting	104
8.5.5	SIMATIC PDM	64	12.2	Diagnostic information via light emitting diodes	105
8.5.6	Field Communicator 475	65	12.2.1	Transmitter	105
9	System integration	66	12.3	Diagnostic information on local display	107
9.1	Overview of device description files	66	12.3.1	Diagnostic message	107
9.1.1	Current version data for the device	66	12.3.2	Calling up remedial measures	109
9.1.2	Operating tools	66	12.4	Diagnostic information in the Web browser	110
9.2	Measured variables via HART protocol	66	12.4.1	Diagnostic options	110
9.3	Other settings	67	12.4.2	Calling up remedy information	110
10	Commissioning	68	12.5	Diagnostic information in FieldCare	111
10.1	Function check	68	12.5.1	Diagnostic options	111
10.2	Switching on the measuring device	68	12.5.2	Calling up remedy information	112
10.3	Setting the operating language	68	12.6	Diagnostic information in FieldCare	112
10.4	Configuring the measuring device	68	12.6.1	Diagnostic options	112
10.4.1	Defining the tag name	69	12.6.2	Calling up remedy information	113
10.4.2	Configuring the status input	70	12.7	Adapting the diagnostic information	113
10.4.3	Configuring the current output	71	12.7.1	Adapting the diagnostic behavior	113
10.4.4	Configuring the pulse/frequency/switch output	72	12.8	Overview of diagnostic information	115
10.4.5	Configuring the local display	79	12.9	Pending diagnostic events	118
10.4.6	Configuring the HART input	81	12.10	Diagnostic list	119
10.4.7	Configuring the output conditioning	82	12.11	Event logbook	119
10.4.8	Configuring the low flow cut off	84	12.11.1	Event history	119
10.4.9	Configuring empty pipe detection	86	12.11.2	Filtering the event logbook	120
10.5	Advanced settings	88	12.11.3	Overview of information events	120
10.5.1	Setting the system units	89	12.12	Resetting the measuring device	121
10.5.2	Carrying out a sensor adjustment	90	12.13	Device information	121
10.5.3	Configuring the totalizer	90	12.14	Firmware history	123
10.5.4	Carrying out additional display configurations	91	13	Maintenance	124
10.6	Simulation	93	13.1	Maintenance tasks	124
10.7	Protecting settings from unauthorized access	95	13.1.1	Exterior cleaning	124
10.7.1	Write protection via access code	95	13.1.2	Interior cleaning	124
10.7.2	Write protection via write protection switch	96	13.1.3	Replacing seals	124
11	Operation	98	13.2	Measuring and test equipment	124
11.1	Reading device locking status	98	13.3	Endress+Hauser services	124
11.2	Adjusting the operating language	98	14	Repair	125
11.3	Configuring the display	98	14.1	General notes	125
11.4	Reading measured values	98	14.2	Spare parts	125
11.4.1	Process variables	98	14.3	Endress+Hauser services	125
11.4.2	Totalizer	99	14.4	Return	125
11.4.3	Input values	99	14.5	Disposal	125
11.4.4	Output values	100	14.5.1	Removing the measuring device	125
			14.5.2	Disposing of the measuring device	126

15	Accessories	127
15.1	Device-specific accessories	127
15.1.1	For the transmitter	127
15.1.2	For the sensor	127
15.2	Communication-specific accessories	127
15.3	Service-specific accessories	128
15.4	System components	128
16	Technical data	129
16.1	Application	129
16.2	Function and system design	129
16.3	Input	129
16.4	Output	130
16.5	Power supply	133
16.6	Performance characteristics	134
16.7	Installation	135
16.8	Environment	135
16.9	Process	136
16.10	Mechanical construction	136
16.11	Operability	142
16.12	Certificates and approvals	143
16.13	Application packages	144
16.14	Accessories	144
16.15	Documentation	144
17	Appendix	146
17.1	Overview of the operating menu	146
Index	167

1 Document information

1.1 Document function

These Operating Instructions contain all the information that is required in various phases of the life cycle of the device: from product identification, incoming acceptance and storage, to mounting, connection, operation and commissioning through to troubleshooting, maintenance and disposal.

1.2 Symbols used

1.2.1 Safety symbols

Symbol	Meaning
 A0011189-EN	DANGER! This symbol alerts you to a dangerous situation. Failure to avoid this situation will result in serious or fatal injury.
 A0011190-EN	WARNING! This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in serious or fatal injury.
 A0011191-EN	CAUTION! This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in minor or medium injury.
 A0011192-EN	NOTICE! This symbol contains information on procedures and other facts which do not result in personal injury.

1.2.2 Electrical symbols

Symbol	Meaning
 A0011197	Direct current A terminal to which DC voltage is applied or through which direct current flows.
 A0011198	Alternating current A terminal to which alternating voltage is applied or through which alternating current flows.
 A0017381	Direct current and alternating current <ul style="list-style-type: none"> ▪ A terminal to which alternating voltage or DC voltage is applied. ▪ A terminal through which alternating current or direct current flows.
 A0011200	Ground connection A grounded terminal which, as far as the operator is concerned, is grounded via a grounding system.
 A0011199	Protective ground connection A terminal which must be connected to ground prior to establishing any other connections.
 A0011201	Equipotential connection A connection that has to be connected to the plant grounding system: This may be a potential equalization line or a star grounding system depending on national or company codes of practice.

1.2.3 Tool symbols

Symbol	Meaning
 A0013442	Torx screwdriver
 A0011219	Phillips head screwdriver
 A0011222	Open-ended wrench

1.2.4 Symbols for certain types of information

Symbol	Meaning
 A0011182	Allowed Indicates procedures, processes or actions that are allowed.
 A0011183	Preferred Indicates procedures, processes or actions that are preferred.
 A0011184	Forbidden Indicates procedures, processes or actions that are forbidden.
 A0011193	Tip Indicates additional information.
 A0011194	Reference to documentation Refers to the corresponding device documentation.
 A0011195	Reference to page Refers to the corresponding page number.
 A0011196	Reference to graphic Refers to the corresponding graphic number and page number.
	Series of steps
	Result of a sequence of actions
 A0013562	Help in the event of a problem

1.2.5 Symbols in graphics

Symbol	Meaning
1, 2, 3,...	Item numbers
	Series of steps
A, B, C, ...	Views
A-A, B-B, C-C, ...	Sections
 A0013441	Flow direction
 A0011187	Hazardous area Indicates a hazardous area.
 A0011188	Safe area (non-hazardous area) Indicates a non-hazardous area.

1.3 Documentation

-  The following document types are available:
- On the CD-ROM supplied with the device
 - In the Download Area of the Endress+Hauser Internet site: www.endress.com → Download
-  For a detailed list of the individual documents along with the documentation code (→  144)

1.3.1 Standard documentation

Document type	Purpose and content of the document
Technical Information	Planning aid for your device The document contains all the technical data on the device and provides an overview of the accessories and other products that can be ordered for the device.
Brief Operating Instructions	Guide that takes you quickly to the 1st measured value The Brief Operating Instructions contain all the essential information from incoming acceptance to initial commissioning.

1.3.2 Supplementary device-dependent documentation

Additional documents are supplied depending on the device version ordered: Always comply strictly with the instructions in the supplementary documentation. The supplementary documentation is an integral part of the device documentation.

1.4 Registered trademarks

HART®

Registered trademark of the HART Communication Foundation, Austin, USA

Microsoft®

Registered trademark of the Microsoft Corporation, Redmond, Washington, USA

Applicator®, FieldCare®, Field Xpert™, HistoROM®, Heartbeat Technology™

Registered or registration-pending trademarks of the Endress+Hauser Group

2 Basic safety instructions

2.1 Requirements for the personnel

The personnel for installation, commissioning, diagnostics and maintenance must fulfill the following requirements:

- ▶ Trained, qualified specialists must have a relevant qualification for this specific function and task
- ▶ Are authorized by the plant owner/operator
- ▶ Are familiar with federal/national regulations
- ▶ Before beginning work, the specialist staff must have read and understood the instructions in the Operating Instructions and supplementary documentation as well as in the certificates (depending on the application)
- ▶ Following instructions and basic conditions

The operating personnel must fulfill the following requirements:

- ▶ Being instructed and authorized according to the requirements of the task by the facility's owner-operator
- ▶ Following the instructions in these Operating Instructions

2.2 Designated use

Application and media

The measuring device described in these Instructions is intended only for flow measurement of liquids with a minimum conductivity of 5 $\mu\text{S}/\text{cm}$.

Depending on the version ordered, the measuring device can also measure potentially explosive, flammable, poisonous and oxidizing media.

Measuring devices for use in hazardous areas, in hygienic applications or in applications where there is an increased risk due to process pressure, are labeled accordingly on the nameplate.

To ensure that the measuring device remains in proper condition for the operation time:

- ▶ Only use the measuring device in full compliance with the data on the nameplate and the general conditions listed in the Operating Instructions and supplementary documentation.
- ▶ Based on the nameplate, check whether the ordered device is permitted for the intended use in the hazardous area (e.g. explosion protection, pressure vessel safety).
- ▶ Use the measuring device only for media against which the process-wetted materials are adequately resistant.
- ▶ If the measuring device is not operated at atmospheric temperature, compliance with the relevant basic conditions specified in the device documentation provided (on the CD-ROM) is absolutely essential.

Incorrect use

Non-designated use can compromise safety. The manufacturer is not liable for damage caused by improper or non-designated use.

WARNING

Danger of breakage of the sensor due to corrosive or abrasive fluids!

- ▶ Verify the compatibility of the process fluid with the sensor material.
- ▶ Ensure the resistance of all fluid-wetted materials in the process.
- ▶ Observe the specified pressure and temperature range.

Verification for borderline cases:

- ▶ For special fluids and fluids for cleaning, Endress+Hauser is glad to provide assistance in verifying the corrosion resistance of fluid-wetted materials, but does not accept any

warranty or liability as minute changes in the temperature, concentration or level of contamination in the process can alter the corrosion resistance properties.

Residual risks

The external surface temperature of the housing can increase by max. 10 K due to the power consumption of the electronic components. Hot process fluids passing through the measuring device will further increase the surface temperature of the housing. The surface of the sensor, in particular, can reach temperatures which are close to the fluid temperature.

Possible burn hazard due to fluid temperatures!

- ▶ For elevated fluid temperature, ensure protection against contact to prevent burns.

2.3 Workplace safety

For work on and with the device:

- ▶ Wear the required personal protective equipment according to federal/national regulations.

For welding work on the piping:

- ▶ Do not ground the welding unit via the measuring device.

If working on and with the device with wet hands:

- ▶ It is recommended to wear gloves on account of the higher risk of electric shock.

2.4 Operational safety

Risk of injury.

- ▶ Operate the device in proper technical condition and fail-safe condition only.
- ▶ The operator is responsible for interference-free operation of the device.

Conversions to the device

Unauthorized modifications to the device are not permitted and can lead to unforeseeable dangers.

- ▶ If, despite this, modifications are required, consult with Endress+Hauser.

Repair

To ensure continued operational safety and reliability,

- ▶ Carry out repairs on the device only if they are expressly permitted.
- ▶ Observe federal/national regulations pertaining to repair of an electrical device.
- ▶ Use original spare parts and accessories from Endress+Hauser only.

Environmental requirements

If a plastic transmitter housing is permanently exposed to certain steam and air mixtures, this can damage the housing.

- ▶ If you are unsure, please contact your Endress+Hauser Sales Center for clarification.
- ▶ If used in an approval-related area, observe the information on the nameplate.

2.5 Product safety

This measuring device is designed in accordance with good engineering practice to meet state-of-the-art safety requirements, has been tested, and left the factory in a condition in which it is safe to operate.

It meets general safety standards and legal requirements. It also complies with the EC directives listed in the device-specific EC Declaration of Conformity. Endress+Hauser confirms this by affixing the CE mark to the device.

2.6 IT security


We only provide a warranty if the device is installed and used as described in the Operating Instructions. The device is equipped with security mechanisms to protect it against any inadvertent changes to the device settings.

IT security measures in line with operators' security standards and designed to provide additional protection for the device and device data transfer must be implemented by the operators themselves.

Endress+Hauser can be contacted to provide support in performing this task.

3 Product description

3.1 Product design

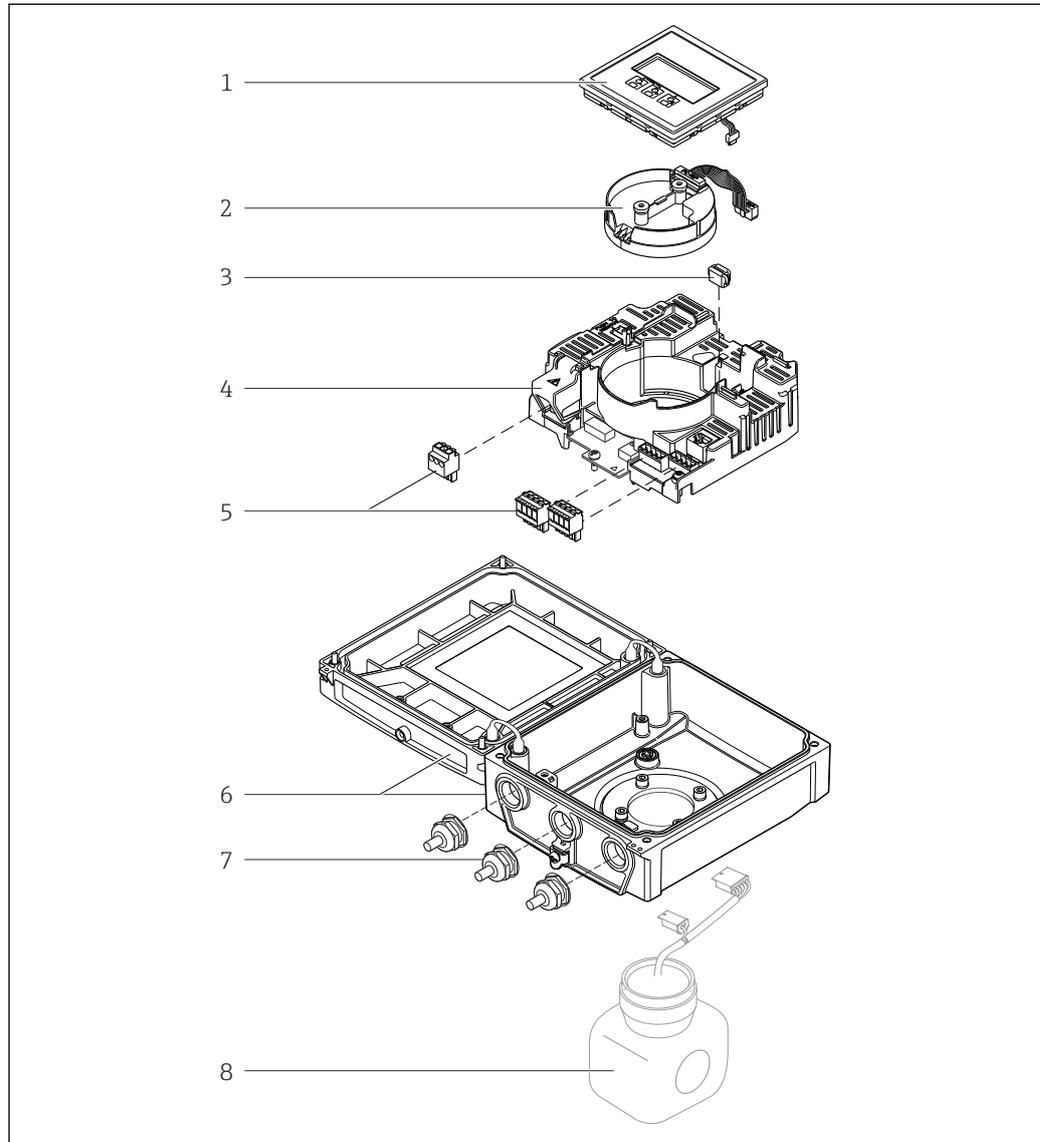


A0021563

1 Important components of the compact version

- 1 Display module
- 2 Smart sensor electronics module
- 3 HistoROM DAT (plug-in memory)
- 4 Main electronics module
- 5 Terminals (screw terminals, some available as plug-in terminals)
- 6 Transmitter housing, compact version
- 7 Cable glands
- 8 Sensor, compact version


4 Incoming acceptance and product identification

4.1 Incoming acceptance

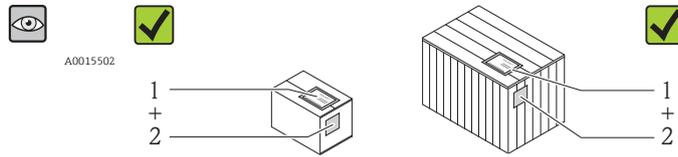


A0013843

Is the order code on the delivery note (1) identical to the order code on the product sticker (2)?

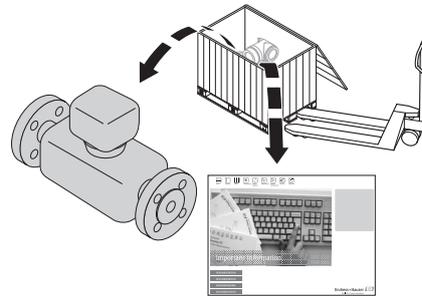


A0013695

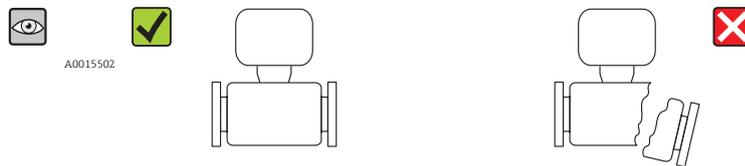


A0013698

Are the goods undamaged?

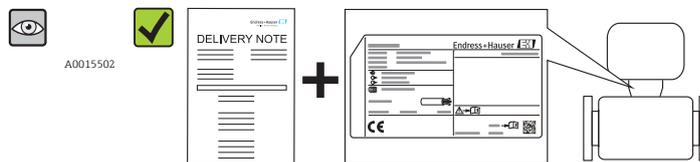

A0013699

Do the nameplate data match the ordering information on the delivery note?

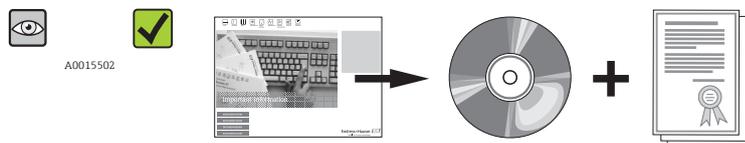

A0013697

Is the CD-ROM with the Technical Documentation and documents present?

 If one of the conditions is not satisfied, contact your Endress+Hauser Sales Center.

4.2 Product identification


The following options are available for identification of the measuring device:

- Nameplate specifications
- Order code with breakdown of the device features on the delivery note
- Enter serial numbers from nameplates in *W@M Device Viewer* (www.endress.com/deviceviewer): All information about the measuring device is displayed.

For an overview of the scope of the Technical Documentation provided, refer to the following:

- The "Additional standard documentation on the device" (→  8) and "Supplementary device-dependent documentation" (→  8) sections
- The *W@M Device Viewer*: Enter the serial number from the nameplate (www.endress.com/deviceviewer)

4.2.1 Transmitter nameplate

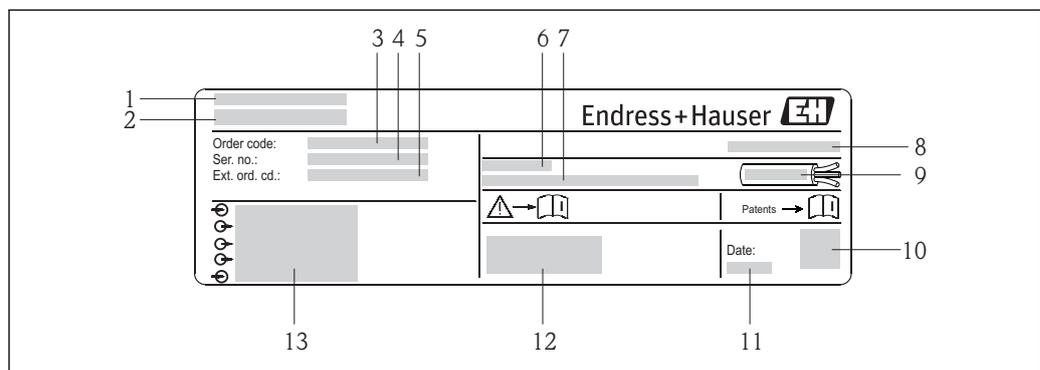


A0017346

 2 Example of a transmitter nameplate

- 1 Manufacturing location
- 2 Name of the transmitter
- 3 Order code
- 4 Serial number
- 5 Extended order code
- 6 Permitted ambient temperature range (T_a)
- 7 Firmware version (FW) and device revision (Dev.Rev.) from the factory
- 8 Degree of protection
- 9 Permitted temperature range for cable
- 10 2-D matrix code
- 11 Manufacturing date: year-month
- 12 CE mark, C-Tick
- 13 Electrical connection data, e.g. available inputs and outputs, supply voltage

4.2.2 Sensor nameplate

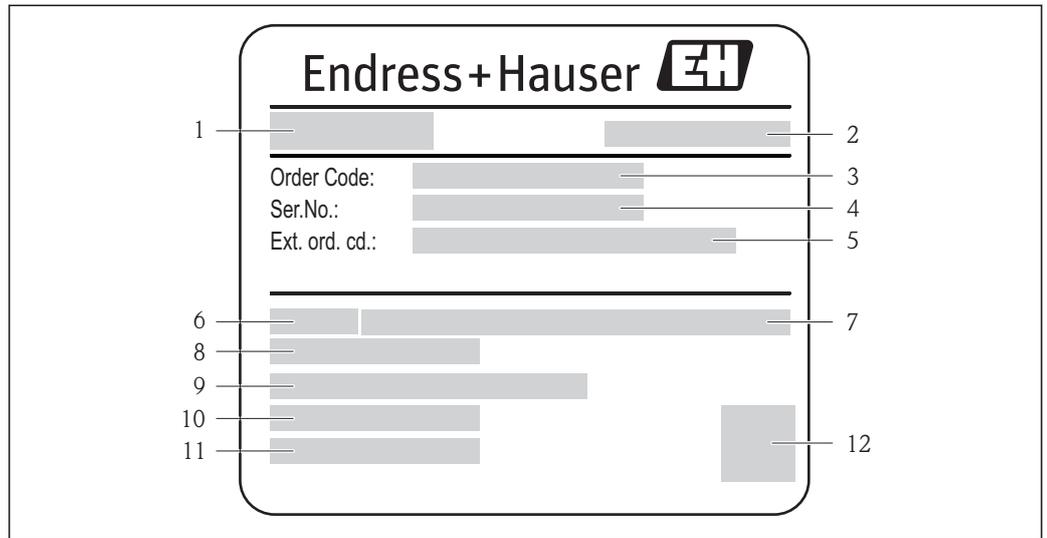

A0017224

3 Example of sensor nameplate

- 1 Name of the sensor
- 2 Manufacturing location
- 3 Order code
- 4 Serial number (Ser. no.)
- 5 Extended order code (Ext. ord. cd.)
- 6 Nominal diameter of sensor
- 7 Nominal pressure
- 8 Fluid temperature range
- 9 Material of lining and electrodes
- 10 Permitted ambient temperature range
- 11 Degree of protection
- 12 2-D matrix code

Order code

The measuring device is reordered using the order code.

Extended order code

- The device type (product root) and basic specifications (mandatory features) are always listed.
- Of the optional specifications (optional features), only the safety and approval-related specifications are listed (e.g. LA). If other optional specifications are also ordered, these are indicated collectively using the # placeholder symbol (e.g. #LA#).
- If the ordered optional specifications do not include any safety and approval-related specifications, they are indicated by the + placeholder symbol (e.g. XXXXXX-ABCDE+).

4.2.3 Symbols on measuring device

Symbol	Meaning
	WARNING! This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in serious or fatal injury.
 <small>A0011194</small>	Reference to documentation Refers to the corresponding device documentation.
 <small>A0011199</small>	Protective ground connection A terminal which must be connected to ground prior to establishing any other connections.

5 Storage and transport

5.1 Storage conditions

Observe the following notes for storage:

- Store in the original packaging to ensure protection from shock.
- Do not remove protective covers or protective caps installed on process connections. They prevent mechanical damage to the sealing surfaces and contamination in the measuring tube.
- Protect from direct sunlight to avoid unacceptably high surface temperatures.
- Select a storage location where moisture cannot collect in the measuring device as fungus and bacteria infestation can damage the lining.
- Store in a dry and dust-free place.
- Do not store outdoors.
- Storage temperature(→ 📄 135)


5.2 Transporting the product

⚠ WARNING

Center of gravity of the measuring device is higher than the suspension points of the webbing slings.

Risk of injury if the measuring device slips.

- ▶ Secure the measuring device from rotating or slipping.
- ▶ Observe the weight specified on the packaging (stick-on label).
- ▶ Observe the transport instructions on the stick-on label on the electronics compartment cover.

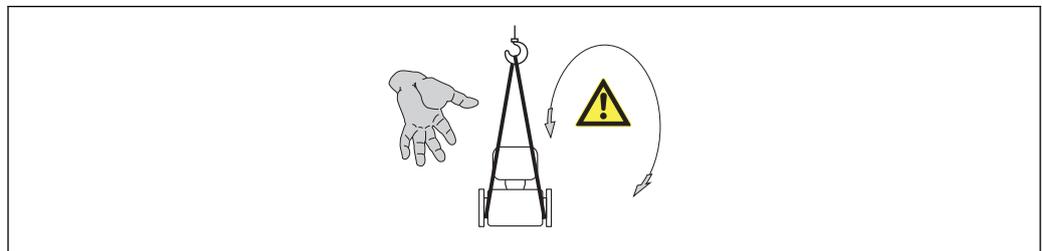

A0015606

Observe the following notes during transport:

- Transport the measuring device to the measuring point in the original packaging.
- Lifting gear
 - Webbing slings: Do not use chains, as they could damage the housing.
 - For wood crates, the floor structure enables these to be loaded lengthwise or broadside using a forklift.
- Use the webbing slings to lift the measuring device at the process connections; do not lift at the transmitter housing or the connection housing of the remote version.
- Do not remove protective covers or protective caps installed on process connections. They prevent mechanical damage to the sealing surfaces and contamination in the measuring tube.

5.3 Packaging disposal

All packaging materials are environmentally friendly and 100% recyclable:

- Measuring device secondary packaging: polymer stretch film that conforms to EC Directive 2002/95/EC (RoHS).
- Packaging:
 - Wood crate, treated in accordance with ISPM 15 standard, which is confirmed by the affixed IPPC logo.
 - or
 - Carton in accordance with European Packaging Directive 94/62EC; recyclability is confirmed by the affixed RESY symbol.
- Seaworthy packaging (optional): Wood crate, treated in accordance with ISPM 15 standard, which is confirmed by the affixed IPPC logo.
- Carrying and mounting hardware:
 - Disposable plastic pallet
 - Plastic straps
 - Plastic adhesive strips
- Dunnage: Paper cushion

6 Installation


6.1 Installation conditions

No special measures such as supports are necessary. External forces are absorbed by the construction of the device.

6.1.1 Mounting position

Mounting location

Preferably install the sensor in an ascending pipe, and ensure a sufficient distance to the next pipe elbow: $h \geq 2 \times DN$

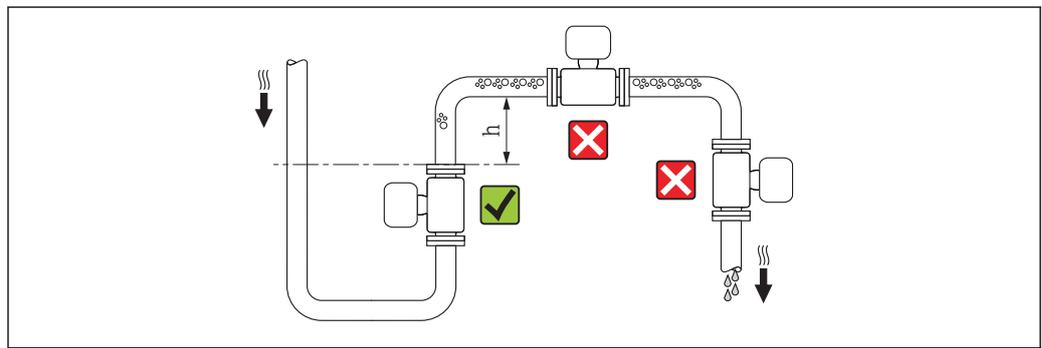

A0017061


To prevent measuring errors arising from accumulation of gas bubbles in the measuring tube, avoid the following mounting locations in the pipe:

- Highest point of a pipeline.
- Directly upstream of a free pipe outlet in a down pipe.

Installation in down pipes

Install a siphon or a vent valve downstream of the sensor in down pipes whose length $h \geq 5$ m (16.4 ft). This precaution is to avoid low pressure and the consequent risk of damage to the measuring tube. This measure also prevents the system losing prime, which could cause air pockets.

 For information on the liner's resistance to partial vacuum (\rightarrow  136)

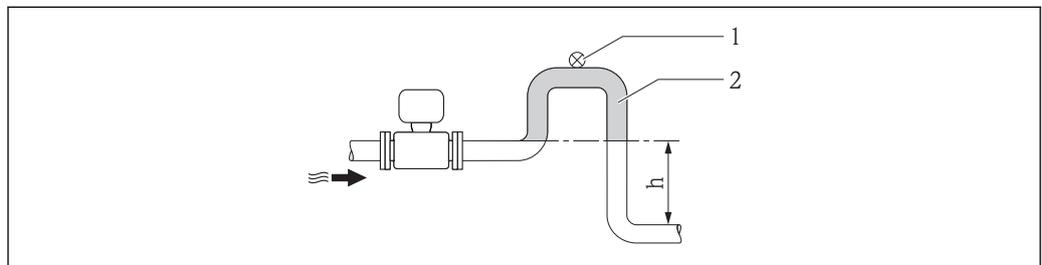

A0017064


 4 Installation in a down pipe

- 1 Vent valve
- 2 Pipe siphon
- h Length of down pipe

Installation in partially filled pipes

A partially filled pipe with a gradient necessitates a drain-type configuration. The empty pipe detection (EPD) function offers additional protection by detecting empty or partially filled pipes.

- Do not install the sensor at the lowest point in the drain: risk of solids accumulating.
- It is advisable to install a cleaning valve.

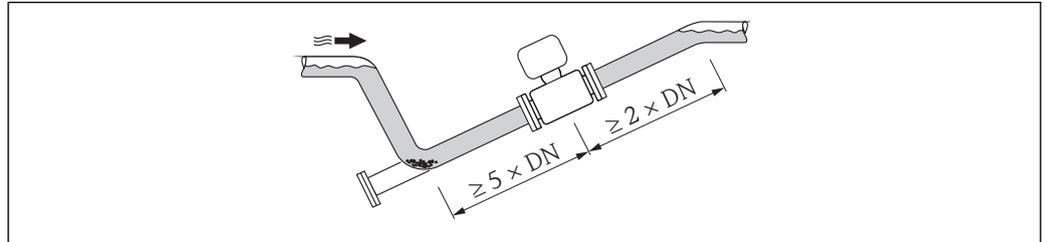

A0017063


Orientation

The direction of the arrow on the sensor nameplate helps you to install the sensor according to the flow direction (direction of medium flow through the piping).

An optimum orientation position helps avoid gas and air accumulations and deposits in the measuring tube.

Vertical


This is the optimum orientation for self-emptying piping systems.

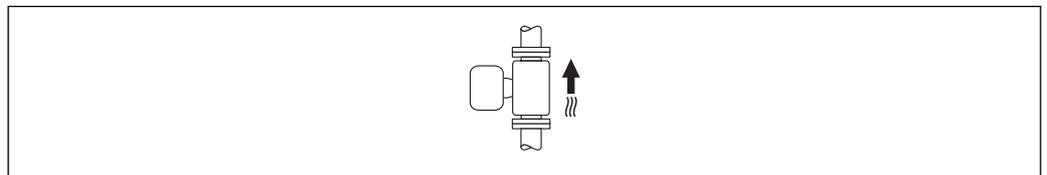

A0015591

Horizontal

The measuring electrode plane must be horizontal. This prevents brief insulation of the two measuring electrodes by entrained air bubbles.

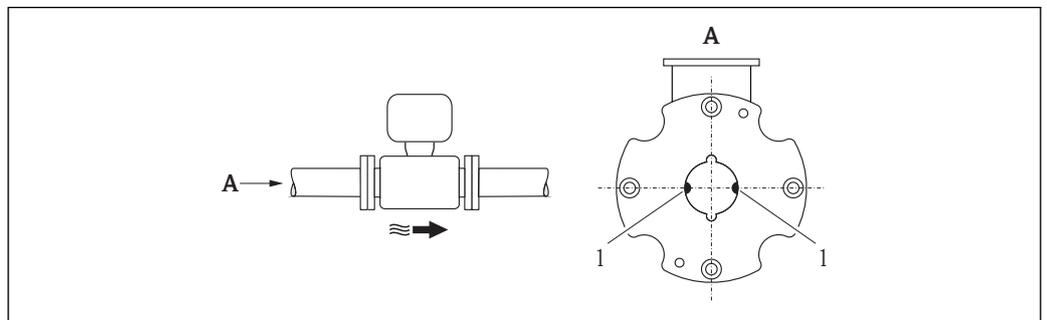

A0017195

5 Horizontal orientation


1 Measuring electrodes for signal detection

Inlet and outlet runs

If possible, install the sensor upstream from fittings such as valves, T-pieces or elbows.

Observe the following inlet and outlet runs to comply with accuracy specifications:

- Inlet run $\geq 5 \times \text{DN}$
- Outlet run $\geq 2 \times \text{DN}$

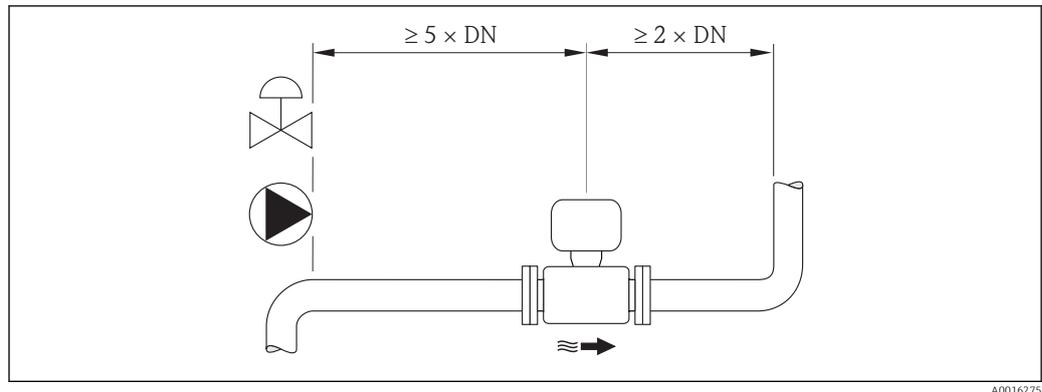

Installation dimensions

 For the dimensions and installation lengths of the device, see the "Technical Information" document, "Mechanical construction" section

6.1.2 Requirements from environment and process

Ambient temperature range

Transmitter	-40 to +60 °C (-40 to +140 °F)
Local display	-20 to +60 °C (-4 to +140 °F), the readability of the display may be impaired at temperatures outside the temperature range.
Sensor	-20 to +60 °C (-4 to +140 °F) Mount the transmitter separately from the sensor if both the ambient and fluid temperatures are high.
Liner	Do not exceed or fall below the permitted temperature range of the liner (→  136).

If operating outdoors:


- Install the measuring device in a shady location.
- Avoid direct sunlight, particularly in warm climatic regions.
- Avoid direct exposure to weather conditions.
- Protect the display against impact.
- Protect the display from abrasion by sand in desert areas.

 A display protector can be ordered from Endress+Hauser: "Accessories" section (→  127)

System pressure

- Never install the sensor on the pump suction side in order to avoid the risk of low pressure, and thus damage to the liner.
- Furthermore, install pulse dampers if reciprocating, diaphragm or peristaltic pumps are used.

 ■ For information on the liner's resistance to partial vacuum (→  136)
 ■ For information on the measuring system's resistance to vibration and shock (→  135), (→  136)

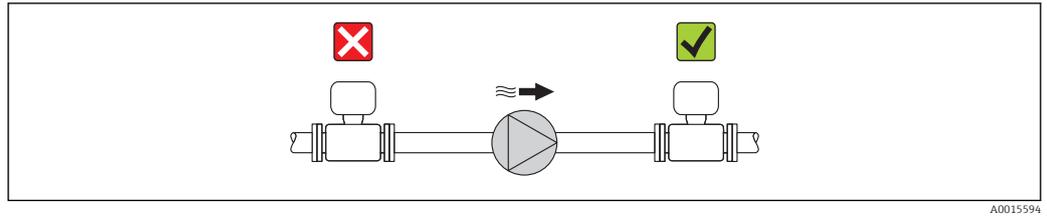


A0015594

Vibrations

In the event of very strong vibrations, the pipe and sensor must be supported and fixed.

It is also advisable to mount the sensor and transmitter separately.

i For information on the permitted resistance to vibration and shock (→ 135), (→ 136)

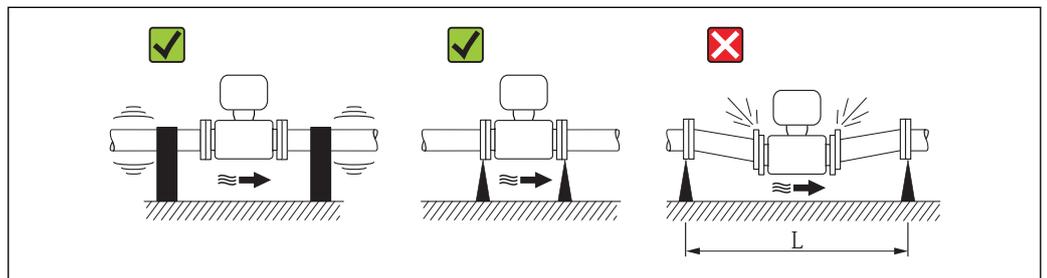

A0016266

6 Measures to prevent vibration of the device


$L > 10\text{ m (33 ft)}$

Adapters

Suitable adapters to DIN EN 545 (double-flange reducers) can be used to install the sensor in larger-diameter pipes. The resultant increase in the rate of flow improves measuring accuracy with very slow-moving fluids. The nomogram shown here can be used to calculate the pressure loss caused by reducers and expanders.

i The nomogram only applies to liquids with a viscosity similar to that of water.

1. Calculate the ratio of the diameters d/D .
2. From the nomogram read off the pressure loss as a function of flow velocity (downstream from the reduction) and the d/D ratio.

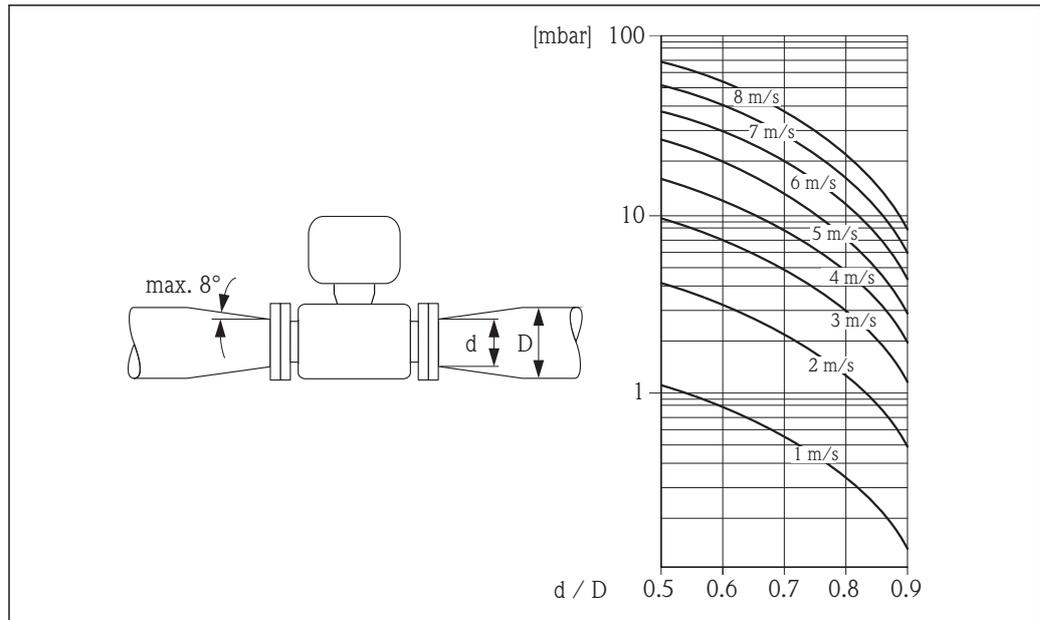

A0016359

6.1.3 Special mounting instructions

Display protection

- ▶ To ensure that the optional display protection can be easily opened, maintain the following minimum head clearance: 350 mm (13.8 in)

6.2 Mounting the measuring device

6.2.1 Required tools

For transmitter

- Torque wrench
- For wall mounting:
 - Open-ended wrench for hexagonal screw max. M5
- For pipe mounting:
 - Open-ended wrench AF 8
 - Phillips head screwdriver PH 2
- For turning the transmitter housing (compact version):
 - Phillips head screwdriver PH 2
 - Torx screwdriver TX 20
 - Open-ended wrench AF 7

For sensor

For flanges and other process connections:

- Screws, nuts, seals etc. are not included in the scope of supply and must be provided by the customer.
- Appropriate mounting tools

6.2.2 Preparing the measuring device

1. Remove all remaining transport packaging.
2. Remove any protective covers or protective caps present from the sensor.


3. Remove stick-on label on the electronics compartment cover.

6.2.3 Mounting the sensor

Mounting kit

The sensor is installed between the pipe flanges using a mounting kit. The device is centered using the recesses on the sensor. Centering sleeves are also provided depending on the flange standard or the diameter of the pitch circle.

i A mounting kit – consisting of mounting bolts, seals, nuts and washers – can be ordered separately (see "Accessories" section (→ 127)).

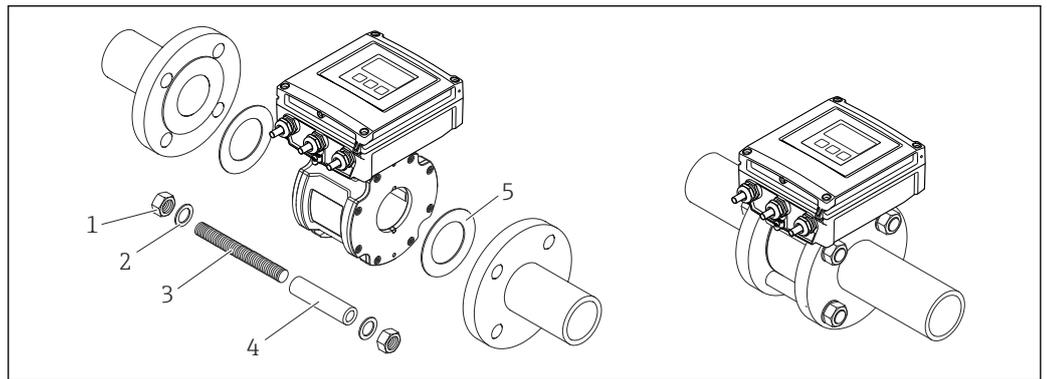

A0018060









i 7 *Mounting the sensor*

- 1 Nut
- 2 Washer
- 3 Mounting bolts
- 4 Centering sleeve
- 5 Seal

Arranging the mounting bolts and centering sleeves

The device is centered using recesses on the sensor. The arrangement of the mounting bolts and the use of the centering sleeves supplied depend on the nominal diameter, the flange standard and the diameter of the pitch circle.

Nominal diameter		Process connection		
[mm]	[in]	EN 1092-1 (DIN 2501)	ASME B16.5	JIS B2220
25...40	1...1 ½	<p>A0010896</p>	<p>A0010824</p>	<p>A0010896</p>
50	2	<p>A0010897</p>	<p>A0010825</p>	<p>A0010825</p>

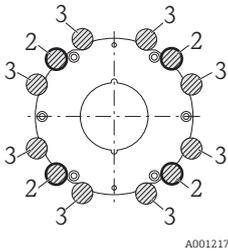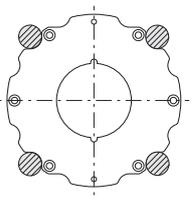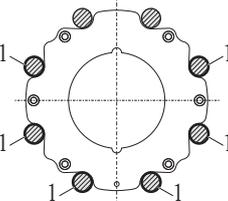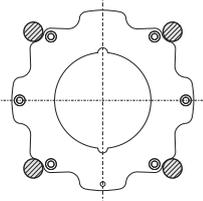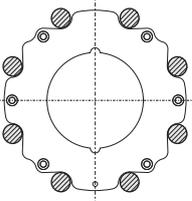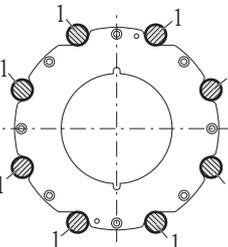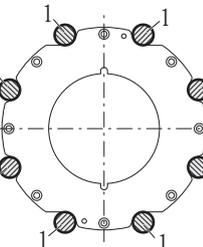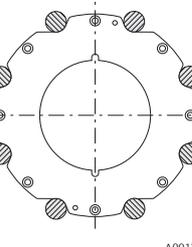Nominal diameter		Process connection		
[mm]	[in]5	EN 1092-1 (DIN 2501)	ASME B16.5	JIS B2220
65	2 ½	 A0012170	—	 A0012171
80	3	 A0010898	 A0010827	 A0010826
100	4	 A0012168	 A0012168	 A0012169
1 = Mounting bolts with centering sleeves 2 = EN (DIN) flange: 4-hole → with centering sleeves 3 = EN (DIN) flange: 8-hole → without centering sleeves				

Mounting the seals



An electrically conductive layer could form on the inside of the measuring tube!

Risk of measuring signal short circuit.

- ▶ Do not use electrically conductive sealing compounds such as graphite.

Comply with the following instructions when installing seals:

- Make sure that the seals do not protrude into the piping cross-section.
- For DIN flanges: only use seals according to DIN EN 1514-1.
- Use seals with a hardness rating of 70° Shore.

Mounting the ground cable/ground disks

Comply with the information on potential equalization and detailed mounting instructions for the use of ground cables/ground disks (→ 39).

Screw tightening torques

Please note the following:

- The screw tightening torques listed below apply only to lubricated threads and to pipes not subjected to tensile stress.
- Tighten the screws uniformly and in diagonally opposite sequence.
- Overtightening the screws will deform the sealing faces or damage the seals.

The tightening torques apply to situations where an EPDM soft material flat seal (e.g. 70° Shore) is used.

Screw tightening torques, mounting bolts and centering sleeves for EN 1092-1 (DIN 2501), PN 16

Nominal diameter [mm]	Mounting bolts [mm]	Length Centering sleeve [mm]	Max. screw tightening torque [Nm] for a process flange with ...	
			smooth seal face	Raised face
25	4 × M12 × 145	54	19	19
40	4 × M16 × 170	68	33	33
50	4 × M16 × 185	82	41	41
65 ¹⁾	4 × M16 × 200	92	44	44
65 ²⁾	8 × M16 × 200	– ³⁾	29	29
80	8 × M16 × 225	116	36	36
100	8 × M16 × 260	147	40	40

- 1) EN (DIN) flange: 4-hole → with centering sleeves
- 2) EN (DIN) flange: 8-hole → without centering sleeves
- 3) A centering sleeve is not required. The device is centered directly via the sensor housing.

Screw tightening torques, mounting bolts and centering sleeves for ASME B16.5, Class 150

Nominal diameter		Mounting bolts [in]	Length Centering sleeve [in]	Max. screw tightening torque [Nm] ([lbf · ft]) for a process flange with ...	
[mm]	[in]			smooth seal face	Raised face
25	1	4 × UNC ½" × 5.70	– ¹⁾	19 (14)	10 (7)
40	1 ½	4 × UNC ½" × 6.50	– ¹⁾	29 (21)	19 (14)
50	2	4 × UNC 5/8" × 7.50	– ¹⁾	41 (30)	37 (27)
80	3	4 × UNC 5/8" × 9.25	– ¹⁾	43 (31)	43 (31)
100	4	8 × UNC 5/8" × 10.4	5.79	38 (28)	38 (28)

- 1) A centering sleeve is not required. The device is centered directly via the sensor housing.

Screw tightening torques, mounting bolts and centering sleeves for JIS B2220, 10K

Nominal diameter [mm]	Mounting bolts [mm]	Length Centering sleeve [mm]	Max. screw tightening torque [Nm] for a process flange with ...	
			smooth seal face	Raised face
25	4 × M16 × 170	54	24	24
40	4 × M16 × 170	68	32	25
50	4 × M16 × 185	– ¹⁾	38	30
65	4 × M16 × 200	– ¹⁾	42	42
80	8 × M16 × 225	– ¹⁾	36	28
100	8 × M16 × 260	– ¹⁾	39	37

- 1) A centering sleeve is not required. The device is centered directly via the sensor housing.

6.2.4 Mounting the transmitter of the remote version

⚠ CAUTION

Ambient temperature too high!

Danger of electronics overheating and housing deformation.

- ▶ Do not exceed the permitted maximum ambient temperature (→ 20).
- ▶ If operating outdoors: Avoid direct sunlight and exposure to weathering, particularly in warm climatic regions.

⚠ CAUTION


Excessive force can damage the housing!

- ▶ Avoid excessive mechanical stress.

The transmitter of the remote version can be mounted in the following ways:

- Wall mounting
- Pipe mounting

Wall mounting

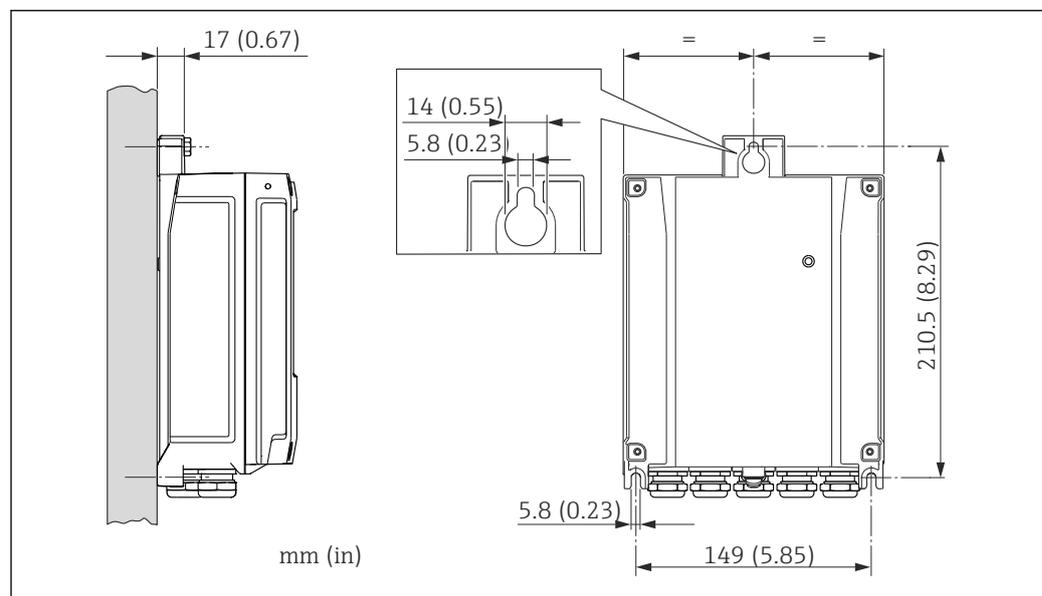


1. Drill the holes.
2. Insert wall plugs into the drilled holes.
3. Screw in the securing screws slightly at first.
4. Fit the transmitter housing over the securing screws and mount in place.
5. Tighten the securing screws.

Pipe mounting

For plastic housing

Max. tightening torque	2 Nm
------------------------	------

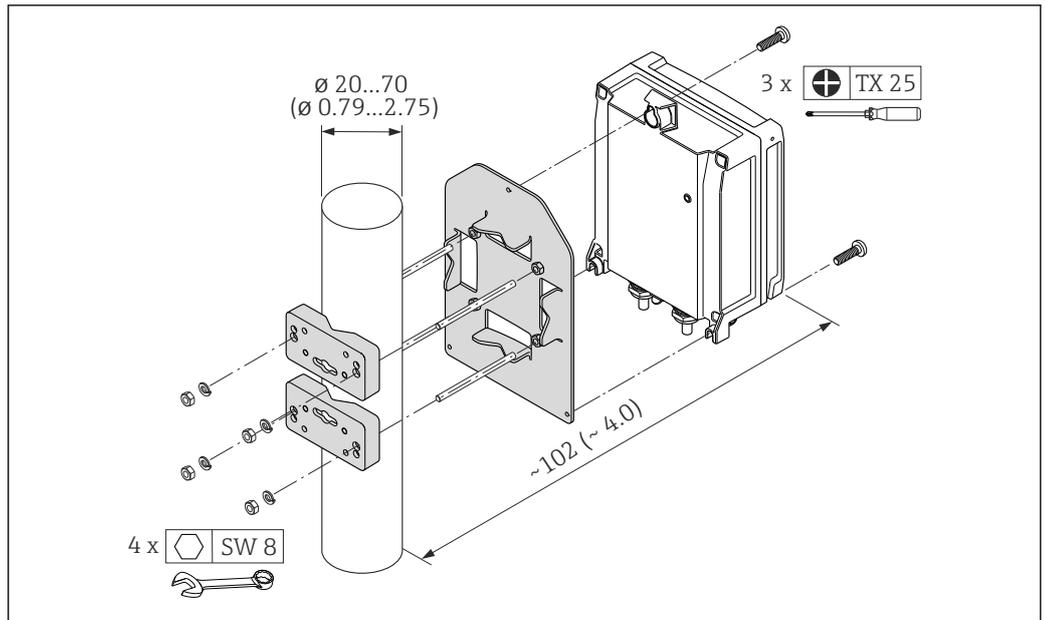

A0020705


i A separate mounting kit can be ordered from Endress+Hauser for pipe mounting (→ 127).

6.2.5 Turning the transmitter housing


To provide easier access to the display module in the compact device version, the transmitter housing can be turned:

Tightening torques for plastic housing


Housing cover fixing screw	Max.1.3 Nm
Main electronics module fixing screw	Max.1.5 Nm

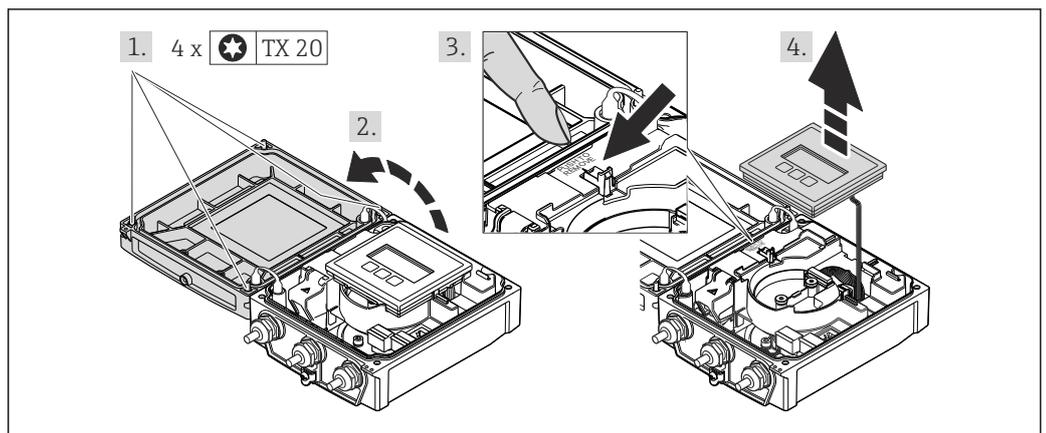


A0021602

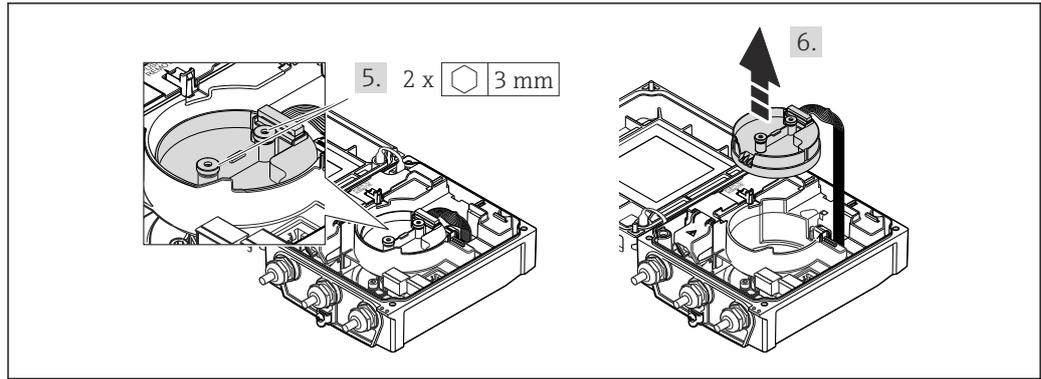


A0021603

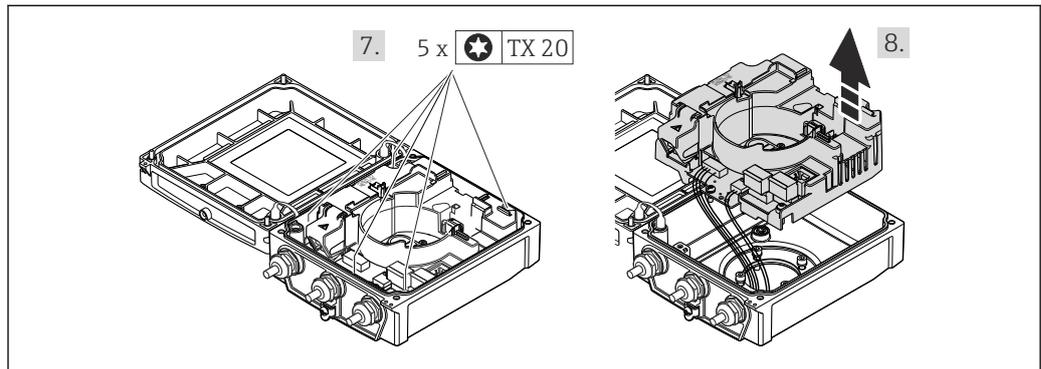

A0021830

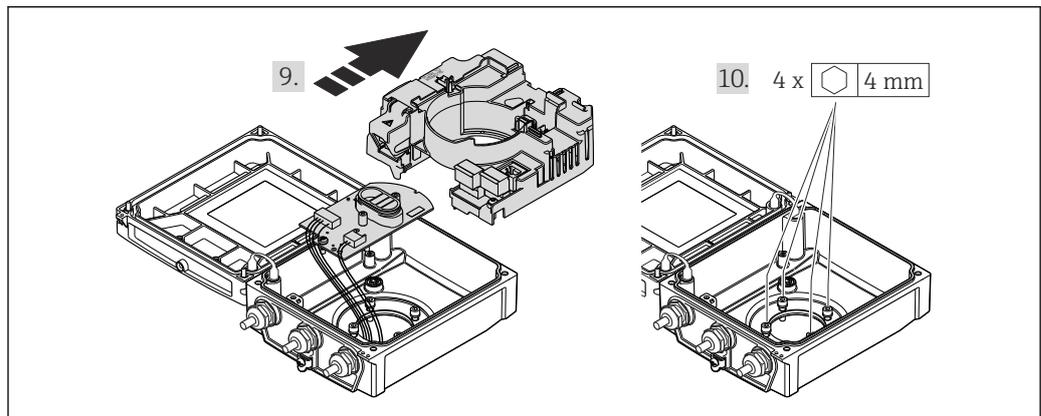

A0021831

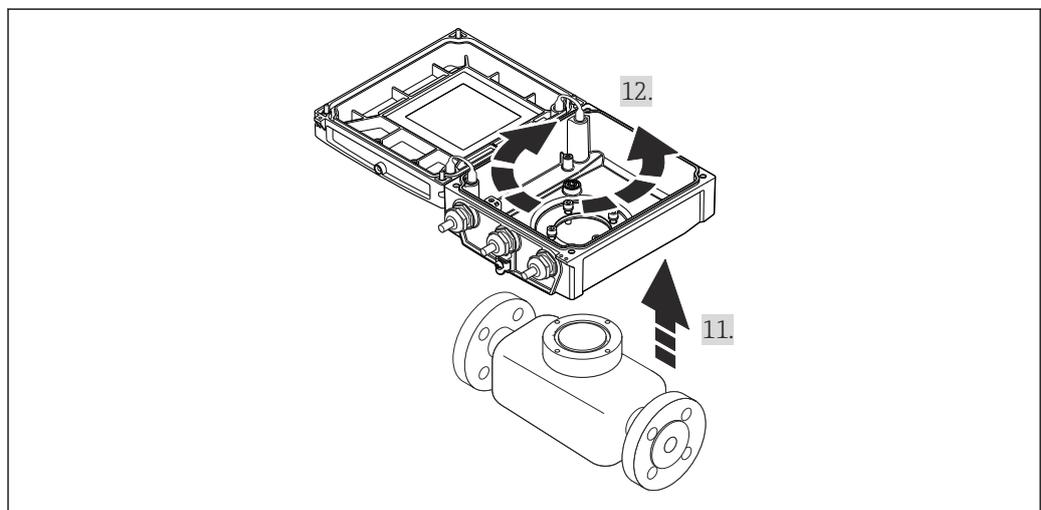

A0021832

1. Loosen the fixing screws of the housing cover.


2. Open the housing cover.
3. Unlock the display module.
4. Remove the display module.
5. Loosen the fixing screws of the smart sensor electronics module.
6. Remove the smart sensor electronics module.
7. Loosen the fixing screws of the main electronics module.
8. Remove the main electronics module.
9. Remove the electronics module from the main electronics module.
10. Loosen the fixing screws of the transmitter housing.
11. Lift the transmitter housing.
12. Turn the housing to the desired position in increments of 90°.
13. **WARNING!** Excessive tightening torque applied to the fixing screws! Risk of damaging the plastic transmitter. Tighten the fixing screws as per the tightening torque (→ 27).
NOTICE! Plug of the smart sensor electronics module connected incorrectly! No measuring signal is output. Plug in the plug of the smart sensor electronics module as per the coding.
NOTICE! Incorrect routing of the connecting cables between the sensor and transmitter in the transmitter housing! This can interfere with the measuring signal. Route the connecting cables directly at the level of the plugs.
 Reverse the procedure to reassemble the measuring device.

6.2.6 Turning the display module

The display module can be turned to optimize display readability and operability.

Tightening torques for plastic housing

Housing cover fixing screw	Max. 1.3 Nm
----------------------------	-------------

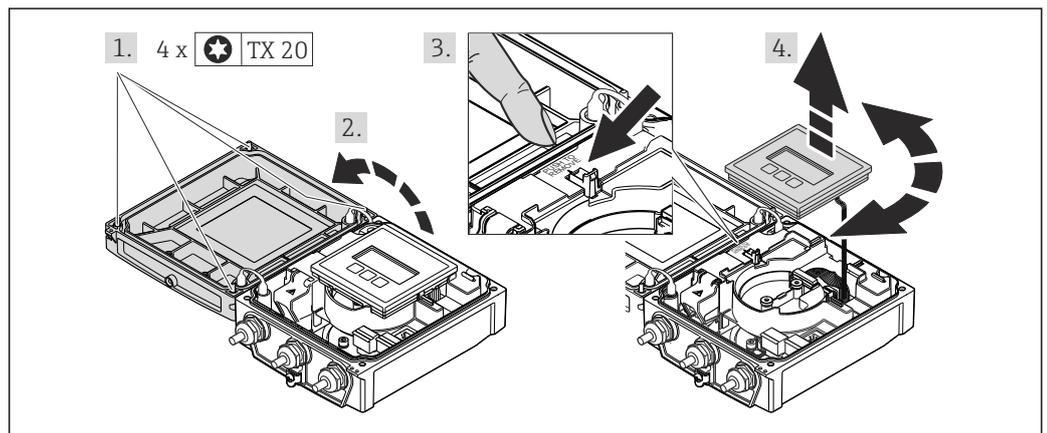

A0021617

1. Loosen the fixing screws of the housing cover.
2. Open the housing cover.
3. Unlock the display module.
4. Pull out the display module and turn it to the desired position in increments of 90°.
5. **WARNING!** Excessive tightening torque applied to the fixing screws! Risk of damaging the plastic transmitter. Tighten the fixing screws as per the tightening torque (→ 27).
 Reverse the procedure to reassemble the measuring device.

6.3 Post-installation check

Is the device undamaged (visual inspection)?	<input type="checkbox"/>
Does the measuring device conform to the measuring point specifications? For example: <ul style="list-style-type: none"> ▪ Process temperature ▪ Process pressure (refer to the section on "Pressure-temperature ratings" in the "Technical Information" document) ▪ Ambient temperature ▪ Measuring range 	<input type="checkbox"/>
Has the correct orientation for the sensor been selected (→  19)? <ul style="list-style-type: none"> ▪ According to sensor type ▪ According to medium temperature ▪ According to medium properties (outgassing, with entrained solids) 	<input type="checkbox"/>
Does the arrow on the sensor nameplate match the direction of flow of the fluid through the piping (→  19)?	<input type="checkbox"/>
Are the measuring point identification and labeling correct (visual inspection)?	<input type="checkbox"/>
Is the device adequately protected from precipitation and direct sunlight?	<input type="checkbox"/>
Have the fixing screws been tightened with the correct tightening torque?	<input type="checkbox"/>

7 Electrical connection

 The measuring device does not have an internal circuit breaker. For this reason, assign the measuring device a switch or power-circuit breaker so that the power supply line can be easily disconnected from the mains.

7.1 Connection conditions

7.1.1 Required tools

- Torque wrench
- For cable entries: Use corresponding tools
- For housing cover: Torx screwdriver or flat-blade screwdriver
- Wire stripper
- When using stranded cables: crimping tool for ferrule

7.1.2 Requirements for connecting cable

The connecting cables provided by the customer must fulfill the following requirements.

Electrical safety

In accordance with applicable federal/national regulations.

Permitted temperature range

- -40 °C (-40 °F) to $+80\text{ °C}$ ($+176\text{ °F}$)
- Minimum requirement: cable temperature range \geq ambient temperature $+20\text{ K}$

Power supply cable

Standard installation cable is sufficient.

Signal cable

Current output

- For 0-20 mA and 4-20 mA: standard installation cable is sufficient.
- For 4-20 mA HART: Shielded cable recommended. Observe grounding concept of the plant.

Pulse/frequency/switch output

Standard installation cable is sufficient.

Status input

Standard installation cable is sufficient.

Connecting cable for remote version


Electrode cable

Standard cable	3 \times 0.38 mm ² (20 AWG) with common, braided copper shield ($\phi \sim 7\text{ mm}$ (0.28")) and individually shielded cores
Conductor resistance	$\leq 50\text{ }\Omega/\text{km}$ (0.015 Ω/ft)

Capacitance: core/shield	≤420 pF/m (128 pF/ft)
Operating temperature	-20 to +80 °C (-68 to +176 °F)

Coil current cable

Standard cable	2 × 0.75 mm ² (18 AWG) with common, braided copper shield (ϕ ~ 7 mm (0.28")) and individually shielded cores
Conductor resistance	≤37 Ω/km (0.011 Ω/ft)
Capacitance: core/core, shield grounded	≤120 pF/m (37 pF/ft)
Operating temperature	-20 to +80 °C (-68 to +176 °F)
Test voltage for cable insulation	≤ AC 1433 V r.m.s. 50/60 Hz or ≥ DC 2026 V

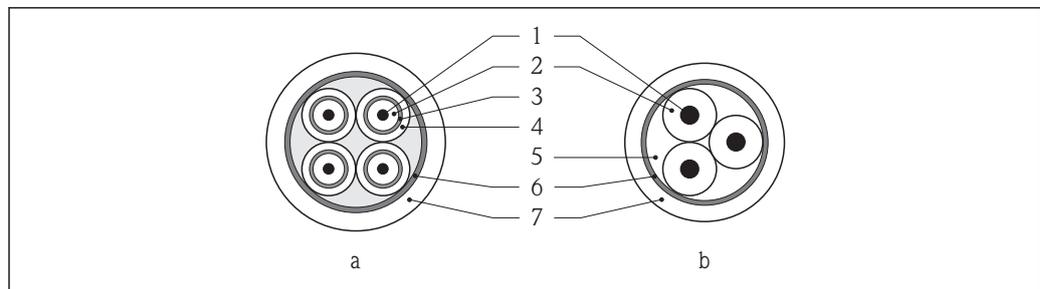

8 Cable cross-section

- a Electrode cable
- b Coil current cable
- 1 Core
- 2 Core insulation
- 3 Core shield
- 4 Core jacket
- 5 Core reinforcement
- 6 Cable shield
- 7 Outer jacket

Operation in zones of severe electrical interference

The measuring system meets the general safety requirements (→ 143) and EMC specifications (→ 136).

Grounding is by means of the ground terminal provided for the purpose inside the connection housing. The stripped and twisted lengths of cable shield to the ground terminal must be as short as possible.


Cable diameter

- Cable glands supplied:
 - For standard cable: M20 × 1.5 with cable ϕ6 to 12 mm (0.24 to 0.47 in)
 - For reinforced cable: M20 × 1.5 with cable ϕ9.5 to 16 mm (0.37 to 0.63 in)
- (Plug-in) spring terminals for wire cross-sections 0.5 to 2.5 mm² (20 to 14 AWG)

7.1.3 Terminal assignment

Transmitter

0-20 mA/4-20 mA HART connection version with additional outputs and inputs

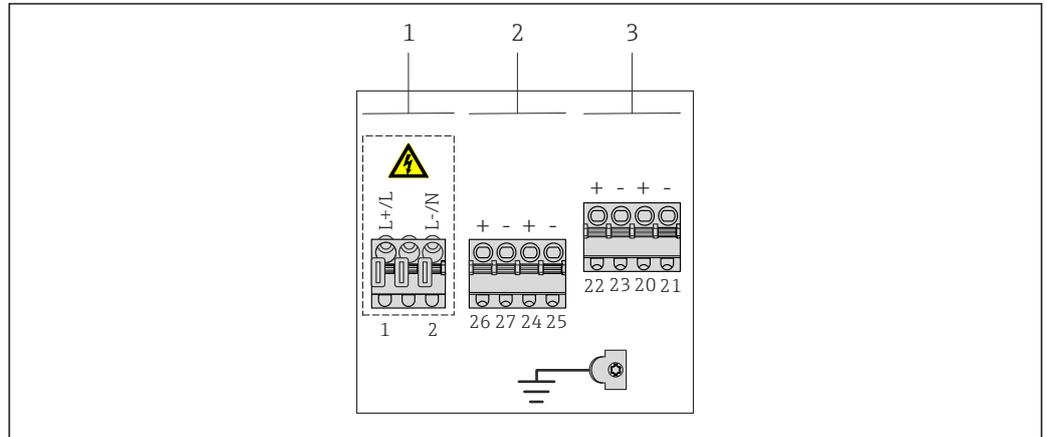

A0020424


- 1 Supply voltage
- 2 Output 1 (26/27) and output 2 (24/25)
- 3 Output 3 (22/23) and input 1 (20/21)

Supply voltage

Order code for "Power supply"	Terminal numbers	
	1 (L+/L)	2 (L-/N)
Option L (wide range power unit)	AC100 to 240 V	
	AC/DC24 V	

Signal transmission 0-20 mA/4-20 mA HART with additional outputs and inputs

Order code for "Output" and "Input"	Terminal numbers							
	Output 1		Output 2		Output 3		Input	
	26 (+)	27 (-)	24 (+)	25 (-)	22 (+)	23 (-)	20 (+)	21 (-)
Option H	<ul style="list-style-type: none"> ▪ 4-20 mA HART (active) ▪ 0-20 mA (active) 		Pulse/frequency output (passive)		Switch output (passive)		-	
Option I	<ul style="list-style-type: none"> ▪ 4-20 mA HART (active) ▪ 0-20 mA (active) 		Pulse/frequency/switch output (passive)		Pulse/frequency/switch output (passive)		Status input	

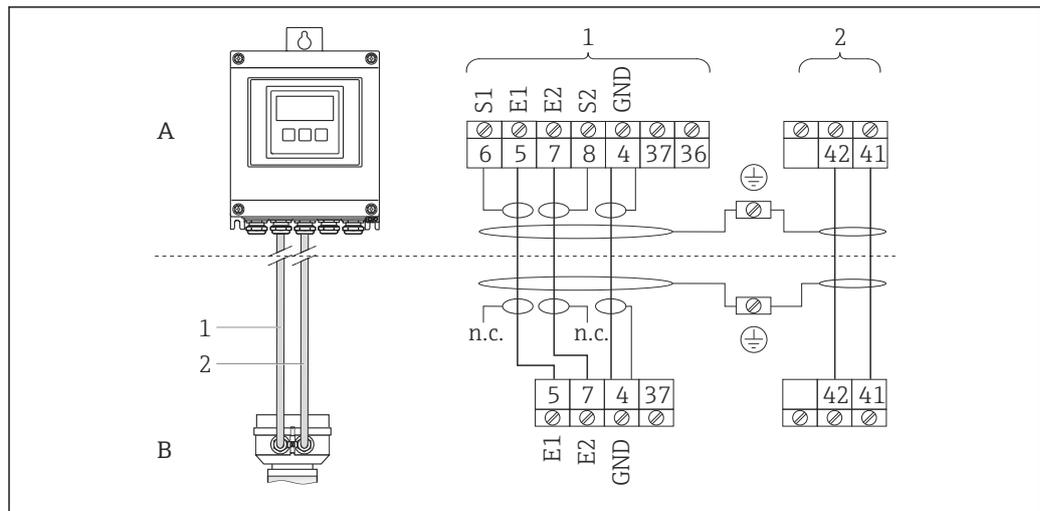Remote version

A0020539

9 Remote version terminal assignment

A Transmitter wall-mount housing

B Sensor connection housing

1 Electrode cable

2 Coil current cable

n.c. Not connected, insulated cable shields

Terminal No. and cable colors: 6/5 = brown; 7/8 = white; 4 = green

7.1.4 Pin assignment, device plug**7.1.5 Preparing the measuring device**

1. Remove dummy plug if present.
2. If measuring device is delivered with cable glands:
Observe cable specification (→ 31).

7.1.6 Preparing the connecting cable for the remote version


When terminating the connecting cable, pay attention to the following points:

- In the case of electrode cables, make sure that the ferrules do not touch the core shields on the sensor side. Minimum distance = 1 mm (exception: green "GND" cable)
- In the case of coil current cables, insulate one core of the three-core wire at the level of the core reinforcement. You only require two cores for the connection.
- Fit the fine-wire cores with ferrules.

Transmitter

Electrode cable	Coil current cable
<p style="text-align: right; margin-right: 20px;">A</p> <p style="text-align: right; margin-right: 20px;">B</p> <p style="text-align: right; margin-right: 20px;">GND</p> <p style="text-align: right; margin-right: 20px;">10</p> <p style="text-align: right; margin-right: 20px;">Engineering unit mm (in)</p> <p style="text-align: right; margin-right: 20px; font-size: small;">A0021324</p>	<p style="text-align: right; margin-right: 20px;">A</p> <p style="text-align: right; margin-right: 20px;">B</p> <p style="text-align: right; margin-right: 20px;">11</p> <p style="text-align: right; margin-right: 20px;">Engineering unit mm (in)</p> <p style="text-align: right; margin-right: 20px; font-size: x-small;">A0021325</p>
<p>A = Termination of the cables B = Termination of the fine-wire cores with ferrules 1 = Red ferrules, ϕ1.0 mm (0.04 in) 2 = White ferrules, ϕ0.5 mm (0.02 in) * = Stripping only for reinforced cables</p>	

Sensor

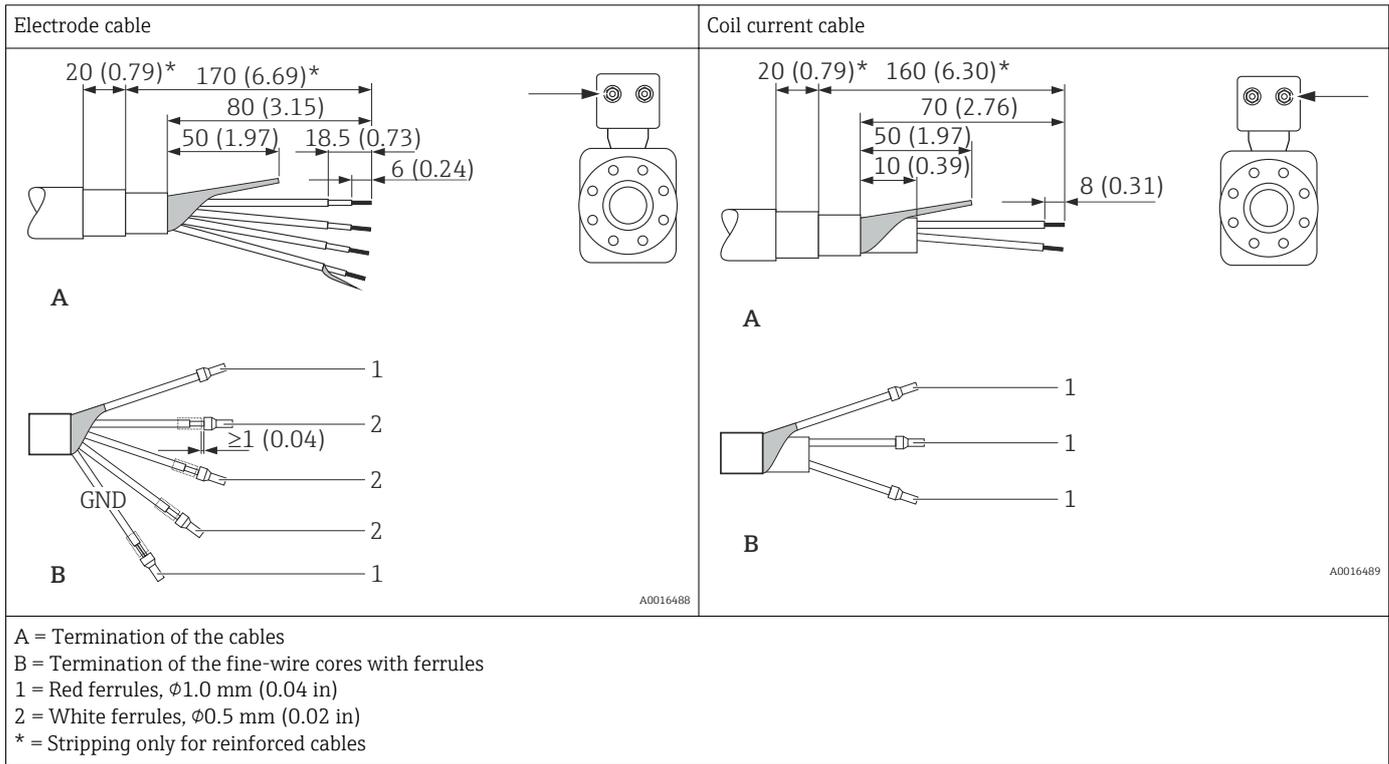

7.2 Connecting the measuring device

⚠ WARNING

Risk of electric shock! Components carry dangerous voltages!


- ▶ Have electrical connection work carried out by correspondingly trained specialists only.
- ▶ Observe applicable federal/national installation codes and regulations.
- ▶ Comply with local workplace safety regulations.
- ▶ Observe grounding concept of the plant.
- ▶ Never mount or wire the measuring device while it is connected to the supply voltage.
- ▶ Before the supply voltage is applied, connect the protective ground to the measuring device.

Tightening torques for plastic housing

Housing cover fixing screw	Max. 1.3 Nm
Cable entry	Max. 4.5 to 5 Nm
Ground terminal	Max. 2.5 Nm

7.2.1 Connecting the transmitter

Connection via terminals

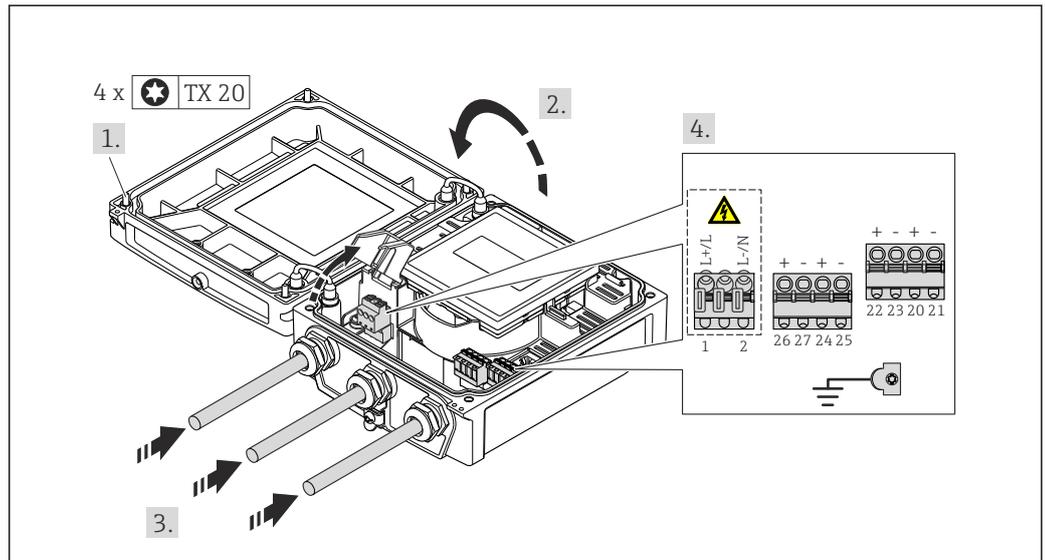

A0017268

12 Connecting the supply voltage and 0-20 mA/4-20 mA HART with additional outputs and inputs

1. Loosen the 4 fixing screws on the housing cover.
2. Open the housing cover.
3. Push the cable through the cable entry . To ensure tight sealing, do not remove the sealing ring from the cable entry.
4. Strip the cable and cable ends. In the case of stranded cables, also fit ferrules.
5. Connect the cable in accordance with the terminal assignment . For supply voltage: open the shock protection cover. For HART communication: When connecting the cable shielding to the ground terminal, observe the grounding concept of the facility.
6. Firmly tighten the cable glands.
7. **WARNING!** Housing degree of protection voided due to insufficient sealing of the housing. Screw in the screw without using any lubricant.
Reverse the removal procedure to reassemble the transmitter.

7.2.2 Connecting the remote version


WARNING

Risk of damaging the electronic components!

- ▶ Ground the remote version and in doing so connect the sensor and transmitter to the same potential equalization.
- ▶ Only connect the sensor to a transmitter with the same serial number.
- ▶ Ground the connection housing of the sensor via the external screw terminal.

The following procedure (in the action sequence given) is recommended for the remote version:


1. Mount the transmitter and sensor.
2. Connect the connecting cable.
3. Connect the transmitter.

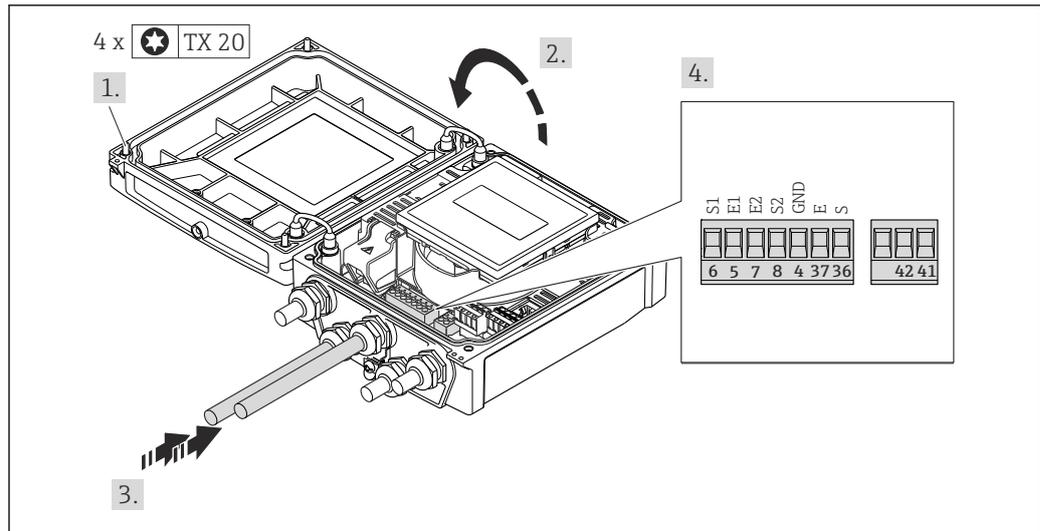

A0017445

13 Transmitter: main electronics module with terminals

1. Loosen the 4 fixing screws on the housing cover.
2. Open the housing cover.
3. Push the cable through the cable entry . To ensure tight sealing, do not remove the sealing ring from the cable entry.
4. Strip the cable and cable ends. In the case of stranded cables, also fit ferrules (→ 35).
5. Connect the cable in accordance with the terminal assignment (→ 34).
6. Firmly tighten the cable glands.
7. **WARNING!** Housing degree of protection voided due to insufficient sealing of the housing. Screw in the screw without using any lubricant.
Reverse the removal procedure to reassemble the transmitter.

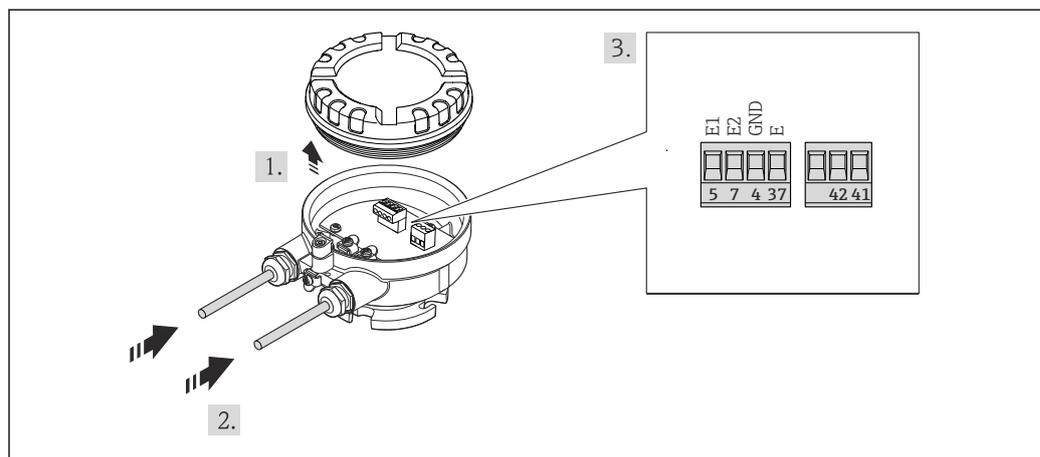

A0017446

14 Sensor: connection module

1. Loosen the securing clamp of the housing cover.
2. Unscrew and lift off the housing cover.
3. Push the cable through the cable entry . To ensure tight sealing, do not remove the sealing ring from the cable entry.
4. Strip the cable and cable ends. In the case of stranded cables, also fit ferrules (→ 35).
5. Connect the cable in accordance with the terminal assignment (→ 34).

- 6. Firmly tighten the cable glands.
- 7. **WARNING!** Housing degree of protection voided due to insufficient sealing of the housing. Screw in the screw without using any lubricant. The threads on the cover are coated with a dry lubricant.
Reverse the procedure to reassemble the sensor.

7.2.3 Ensuring potential equalization

⚠ CAUTION

Electrode damage can result in the complete failure of the device!


- ▶ Make sure that the fluid and sensor have the same electrical potential.
- ▶ Pay attention to internal grounding concepts in the company.
- ▶ Pay attention to the pipe material or grounding.

Connection examples for standard situations

Metal, grounded pipe

This connection method also applies:

- For plastic pipes
- For pipes with insulating liner

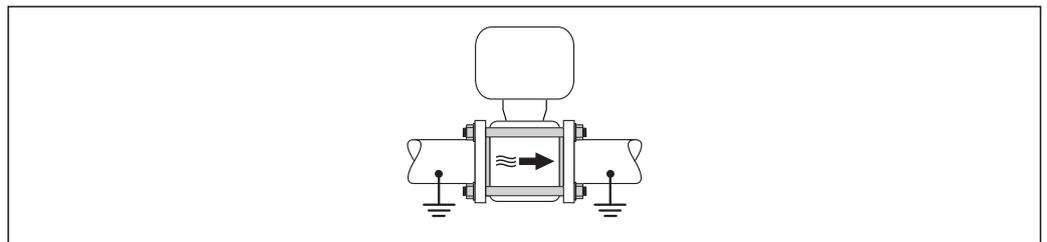


A0017516

Connection example in special situations

Unlined and ungrounded metal pipe

This connection method also applies in situations where:

- The customary potential equalization is not used
- Equalizing currents are present

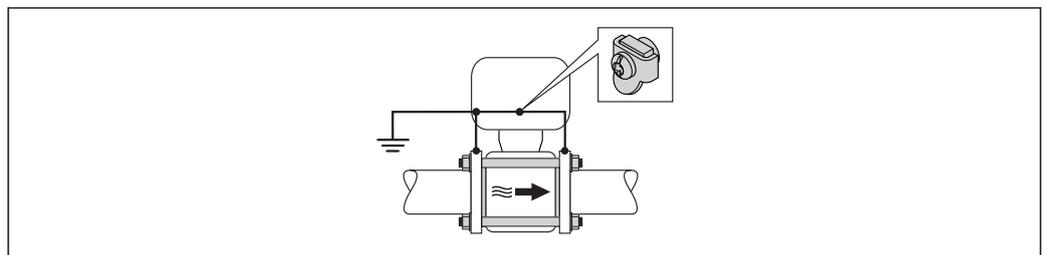

A0017517

Ground cable	Copper wire, at least 6 mm ² (0.0093 in ²)
---------------------	---

- 1. Connect both pipe flanges to one another via a ground cable and ground them.
- 2. Mount the ground cable directly on the conductive flange coating of the pipe with the flange screws.


3. Connect the connection housing of the transmitter or sensor to ground potential by means of the ground terminal provided for the purpose.

i For remote device versions, the ground terminal in the example always refers to the sensor and **not** to the transmitter.

Pipe with a cathodic protection unit

This connection method is only used if the following two conditions are met:

- Metal pipe without liner or pipe with electrically conductive liner
- Cathodic protection is integrated in the personal protection equipment

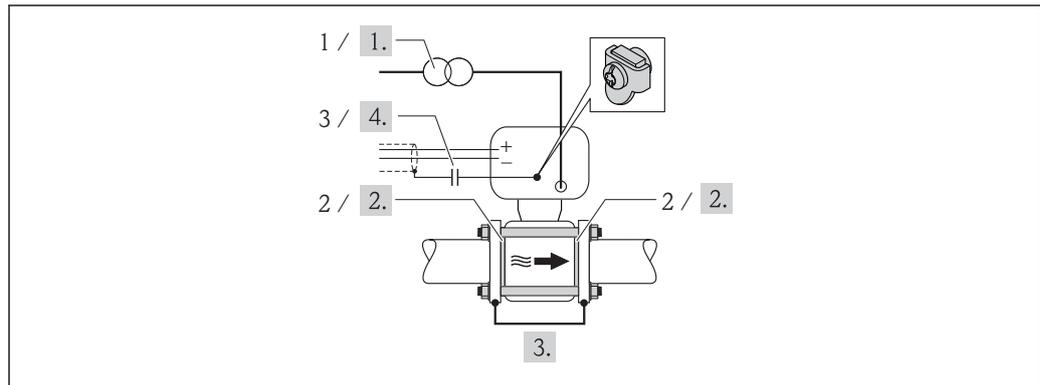

A0017518

Ground cable	Copper wire, at least 6 mm ² (0.0093 in ²)
---------------------	---


1. Connect the measuring device to the power supply such that it is floating in relation to the protective ground.
2. Install the sensor in the pipe in a way that provides electrical insulation.
3. Connect the two flanges of the pipe to one another via a ground cable.
4. Guide the shield of the signal lines through a capacitor.

i For remote device versions, the ground terminal in the example always refers to the sensor and **not** to the transmitter.

7.3 Special connection instructions

7.3.1 Connection examples

Status input

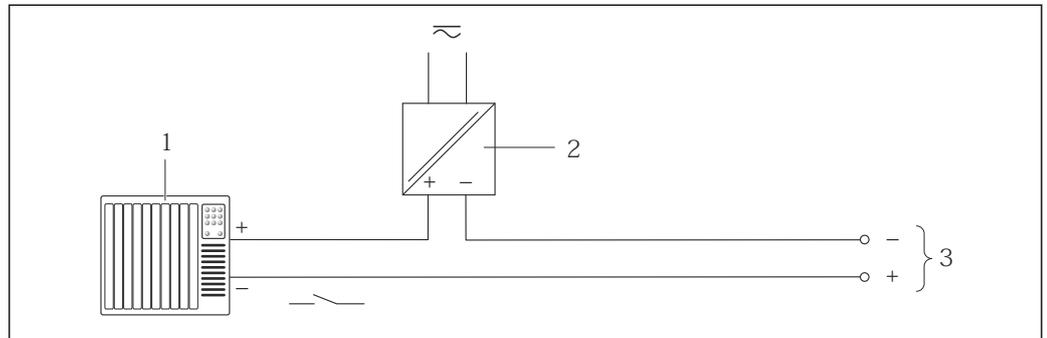

15 Connection example for status input

- 1 Automation system with status output (e.g. PLC)
- 2 Power supply
- 3 Transmitter: observe input values


7.4 Ensuring the degree of protection

7.4.1 Degree of protection IP66/67, Type 4X enclosure

The measuring device fulfills all the requirements for the IP66/67 degree of protection, Type 4X enclosure.

To guarantee IP66/67 degree of protection, Type 4X enclosure, carry out the following steps after the electrical connection:

1. Check that the housing seals are clean and fitted correctly. Dry, clean or replace the seals if necessary.
2. Tighten all housing screws and screw covers.
3. Firmly tighten the cable glands.
4. To ensure that moisture does not enter the cable entry, route the cable so that it loops down before the cable entry ("water trap").

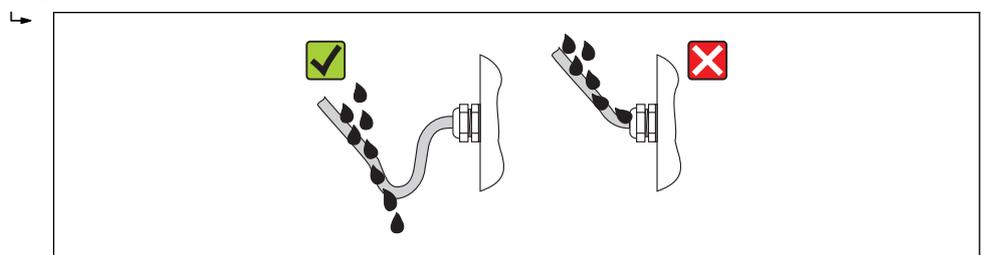

5. Insert dummy plugs into unused cable entries.


7.5 Post-connection check

Are cables or the device undamaged (visual inspection)?	<input type="checkbox"/>
Do the cables comply with the requirements (→ 31)?	<input type="checkbox"/>

Do the cables have adequate strain relief?	<input type="checkbox"/>
Are all the cable glands installed, firmly tightened and leak-tight? Cable run with "water trap" (→  41) ?	<input type="checkbox"/>
Only for remote version: is the sensor connected to the right transmitter? Check the serial number on the nameplate of the sensor and transmitter.	<input type="checkbox"/>
Does the supply voltage match the specifications on the transmitter nameplate (→  133)?	<input type="checkbox"/>
Is the terminal assignment correct (→  33)?	<input type="checkbox"/>
If supply voltage is present, do values appear on the display module?	<input type="checkbox"/>
Is the potential equalization established correctly (→  39)?	<input type="checkbox"/>
Are all housing covers installed and the screws tightened with the correct tightening torque?	<input type="checkbox"/>

8 Operation options

8.1 Overview of operation options

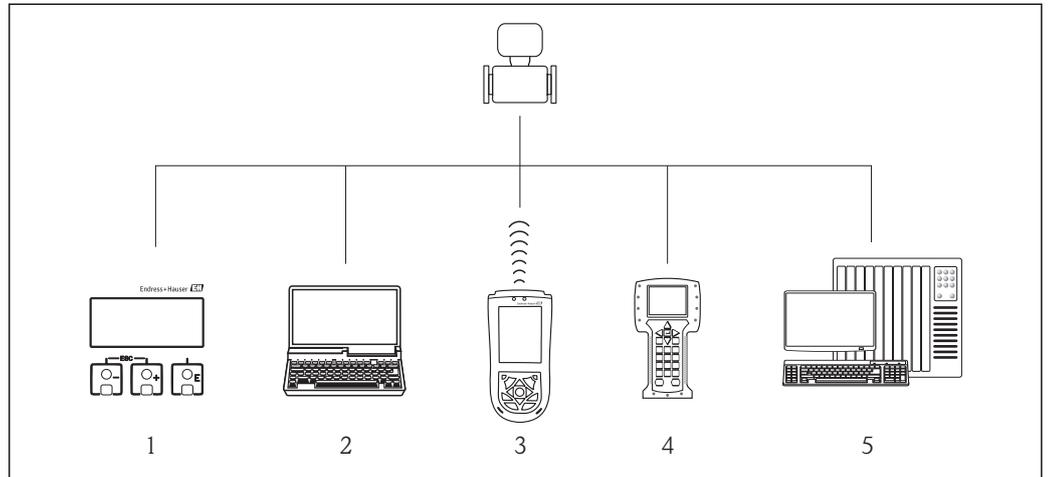


- 1 Local operation via display module
- 2 Computer with Web browser (e.g. Internet Explorer) or with operating tool (e.g. FieldCare, AMS Device Manager, SIMATIC PDM)
- 3 Field Xpert SFX100
- 4 Field Communicator 475
- 5 Control system (e.g. PLC)

8.2 Structure and function of the operating menu

8.2.1 Structure of the operating menu

 For an overview of the operating menu with menus and parameters (→  146)

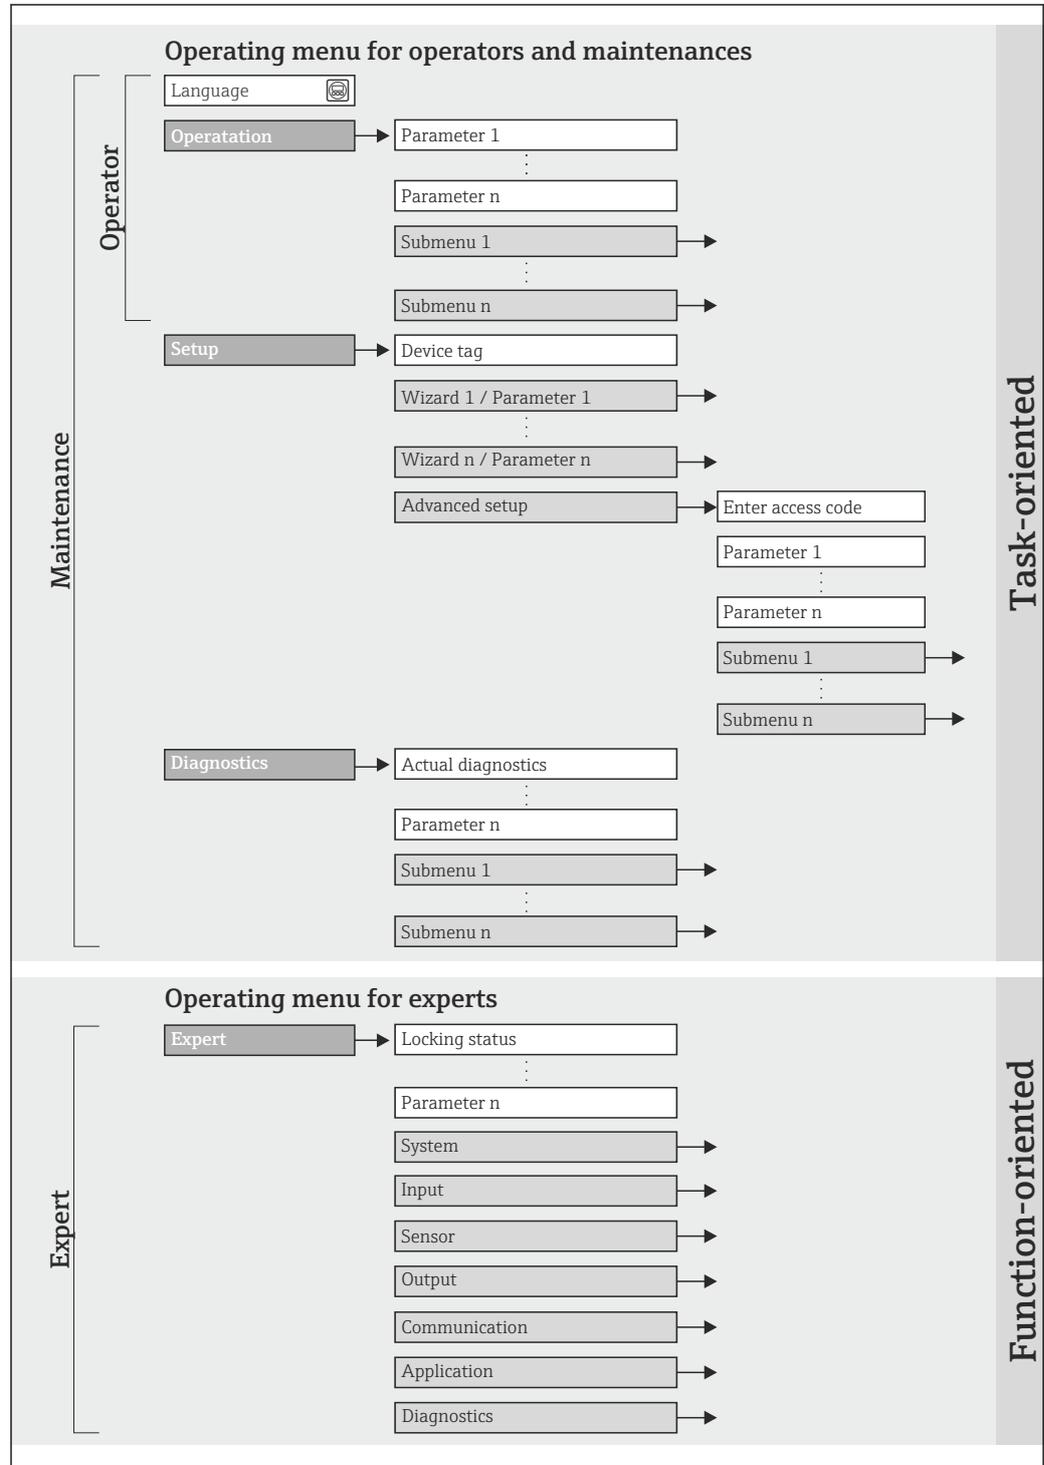

A0018237-EN

 16 Schematic structure of the operating menu


8.2.2 Operating philosophy

The individual parts of the operating menu are assigned to certain user roles. Each user role corresponds to typical tasks within the device lifecycle.

Menu		User role and tasks	Content/meaning
Language	task-oriented	Role "Operator", "Maintenance" Tasks during operation:	Defining the operating language
Operation		<ul style="list-style-type: none"> ▪ Configuring the operational display ▪ Reading measured values 	<ul style="list-style-type: none"> ▪ Configuring the operational display (e.g. display format, display contrast) ▪ Resetting and controlling totalizers
Setup		"Maintenance" role Commissioning: <ul style="list-style-type: none"> ▪ Configuration of the measurement ▪ Configuration of the inputs and outputs 	Wizards for fast commissioning: <ul style="list-style-type: none"> ▪ Setting the input ▪ Configuring the outputs ▪ Configuring the operational display ▪ Defining the output conditioning ▪ Configuring the low flow cut off ▪ Configuring the empty pipe detection "Advanced setup" submenu: <ul style="list-style-type: none"> ▪ For more customized configuration of the measurement (adaptation to special measuring conditions) ▪ Configuration of totalizers ▪ Configuration of electrode cleaning (optional) ▪ Administration (define access code, reset measuring device)
Diagnostics	"Maintenance" role Fault elimination: <ul style="list-style-type: none"> ▪ Diagnostics and elimination of process and device errors ▪ Measured value simulation 	Contains all parameters for error detection and analyzing process and device errors: <ul style="list-style-type: none"> ▪ "Diagnostic list" submenu Contains up to 5 currently pending diagnostic messages. ▪ "Event logbook" submenu Contains up to 20 or 100 (order option "Extended HistoROM") event messages that have occurred. ▪ "Device information" submenu Contains information for identifying the device. ▪ "Measured values" submenu Contains all current measured values. ▪ "Data logging" submenu (order option "Extended HistoROM") Storage and visualization of up to 1000 measured values ▪ "Heartbeat Technology" submenu The functionality of the device is checked on demand and the verification results are documented. ▪ "Simulation" submenu Is used to simulate measured values or output values. 	
Expert	function-oriented	Tasks that require detailed knowledge of the function of the device: <ul style="list-style-type: none"> ▪ Commissioning measurements under difficult conditions ▪ Optimal adaptation of the measurement to difficult conditions ▪ Detailed configuration of the communication interface ▪ Error diagnostics in difficult cases 	Contains all the parameters of the device and makes it possible to access these parameters directly using an access code. The structure of this menu is based on the function blocks of the device: <ul style="list-style-type: none"> ▪ "System" submenu Contains all higher-order device parameters that do not pertain either to measurement or the measured value communication. ▪ "Sensor" submenu Configuration of the measurement. ▪ "Input" submenu (order option) Configuring the status input. ▪ "Output" submenu Configuring of the analog current outputs as well as the pulse/frequency and switch output. ▪ "Communication" submenu Configuration of the digital communication interface and the Web server. ▪ "Application" submenu Configuration of the functions that go beyond the actual measurement (e.g. totalizer). ▪ "Diagnostics" submenu Error detection and analysis of process and device errors and for device simulation and Heartbeat Technology.

8.3 Access to the operating menu via the local display

8.3.1 Operational display

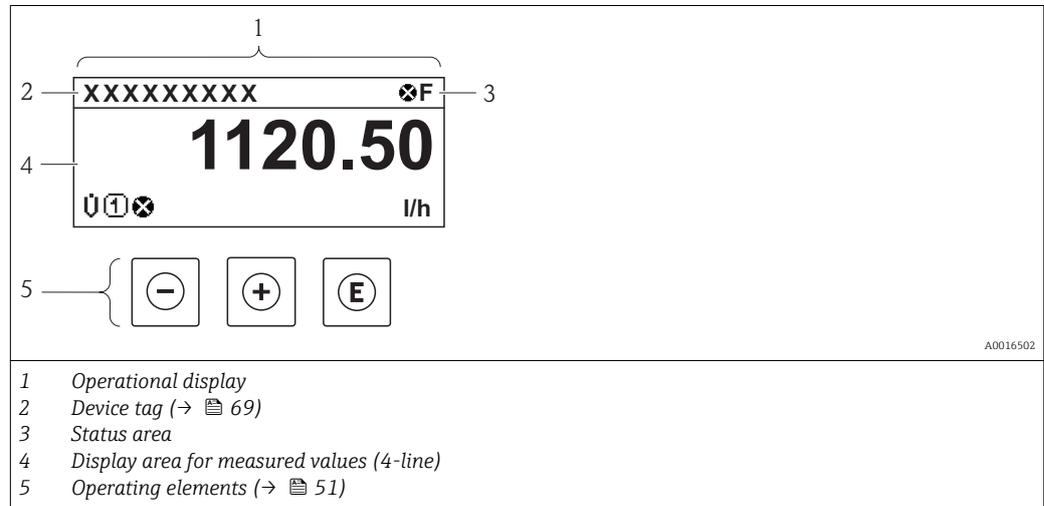

Status area

The following symbols appear in the status area of the operational display at the top right:

- Status signals(→ 107)
- Diagnostic behavior(→ 108)
- Locking
- Communication

Locking


Symbol	Meaning
 <small>A0013963</small>	Device locked The measuring device is hardware locked (→ 96).

Communication

Symbol	Meaning
 <small>A0013965</small>	Communication via remote operation is active.

Display area


In the display area, each measured value is prefaced by certain symbol types for further description:

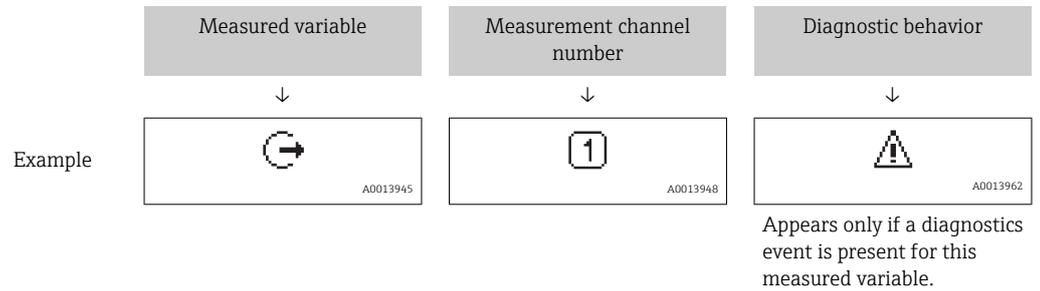

Measured variables

Symbol	Meaning
 A0013711	Volume flow
 A0013710	Mass flow
 A0013943	Totalizer  The measurement channel number indicates which of the three totalizers is displayed.
 A0013945	Output  The measurement channel number indicates which of the outputs is displayed.
 A0017270	Status input

Measurement channel numbers

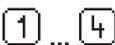
Symbol	Meaning
 A0016325	Measurement channel 1 to 4
The measurement channel number is displayed only if more than one channel is present for the same measured variable type (e.g. Totalizer 1 to 3).	

Diagnostic behavior

The diagnostic behavior pertains to a diagnostic event that is relevant to the displayed measured variable. For information on the symbols (→  108)


 The number and display format of the measured values can be configured via the **"Format display" parameter**(→  79). "Operation" menu → Display → Format display

8.3.2 Navigation view

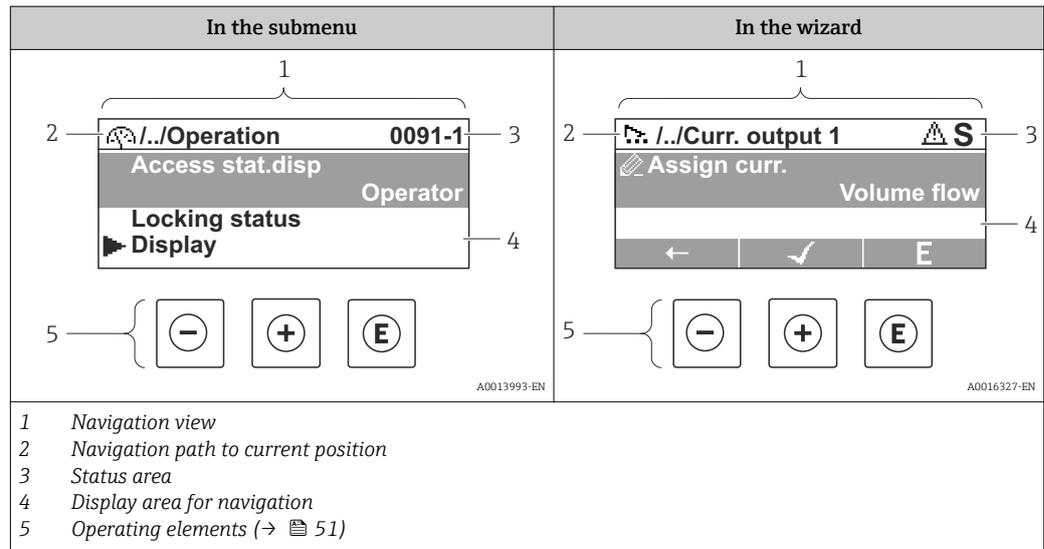

Navigation path

The navigation path - displayed at the top left in the navigation view - consists of the following elements:

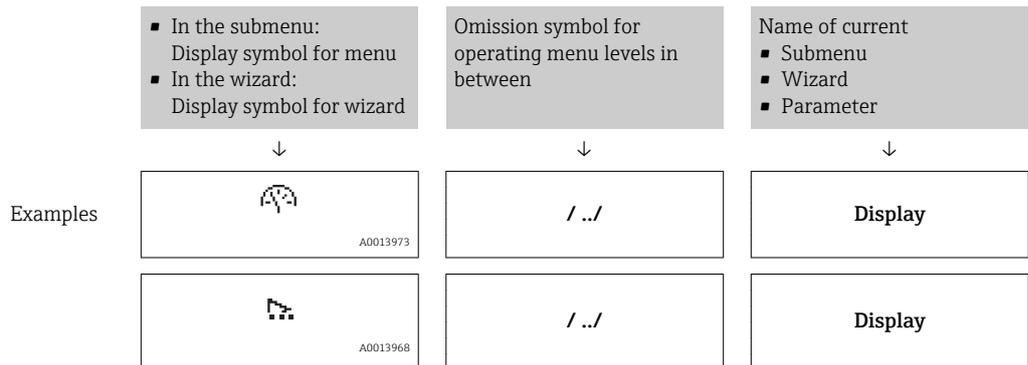

i For more information about the menu icons, refer to the "Display area" section (→ 49)

Status area

The following appears in the status area of the navigation view in the top right corner:

- Of the submenu
 - The direct access code for the parameter you are navigating to (e.g. 0022-1)
 - If a diagnostic event is present, the diagnostic behavior and status signal
 - In the wizard
 - If a diagnostic event is present, the diagnostic behavior and status signal
- i**
 - For information on the diagnostic behavior and status signal (→ 107)
 - For information on the function and entry of the direct access code (→ 54)

Display area

Menus

Symbol	Meaning
 A0013973	Operation Appears: <ul style="list-style-type: none"> ▪ In the menu next to the "Operation" selection ▪ At the left in the navigation path in the "Operation" menu
 A0013974	Setup Appears: <ul style="list-style-type: none"> ▪ In the menu next to the "Setup" selection ▪ At the left in the navigation path in the "Setup" menu
 A0013975	Diagnostics Appears: <ul style="list-style-type: none"> ▪ In the menu next to the "Diagnostics" selection ▪ At the left in the navigation path in the "Diagnostics" menu
 A0013966	Expert Appears: <ul style="list-style-type: none"> ▪ In the menu next to the "Expert" selection ▪ At the left in the navigation path in the "Expert" menu

Submenus, wizards, parameters

Symbol	Meaning
 A0013967	Submenu
 A0013968	Wizard
 A0013972	Parameters within a wizard  No display symbol exists for parameters in submenus.


Locking

Symbol	Meaning
 A0013963	Parameter locked When displayed in front of a parameter name, indicates that the parameter is locked. <ul style="list-style-type: none"> ▪ By a user-specific access code (→ ⓘ 95) ▪ By the hardware write protection switch (→ ⓘ 96)

Wizard operation

Symbol	Meaning
 A0013978	Switches to the previous parameter.
 A0013976	Confirms the parameter value and switches to the next parameter.
 A0013977	Opens the editing view of the parameter.

8.3.3 Editing view

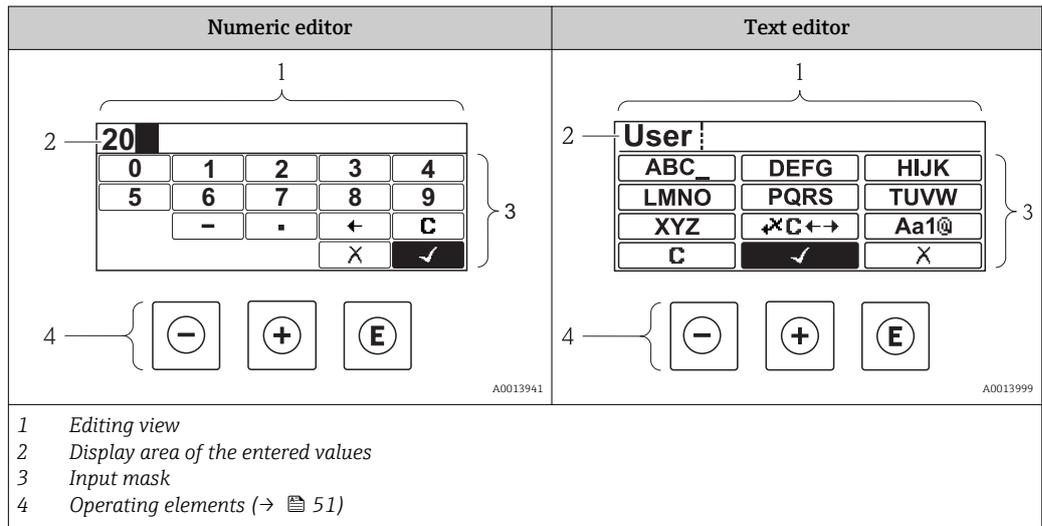

Input mask


The following input symbols are available in the input mask of the numeric and text editor:

Numeric editor

Symbol	Meaning
	Selection of numbers from 0 to 9.
	Inserts decimal separator at the input position.
	Inserts minus sign at the input position.
	Confirms selection.
	Moves the input position one position to the left.
	Exits the input without applying the changes.
	Clears all entered characters.

Text editor

Symbol	Meaning
	Toggle <ul style="list-style-type: none"> Between upper-case and lower-case letters For entering numbers For entering special characters
	Selection of letters from A to Z.

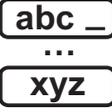
 <p>A0019094</p>	Selection of letters from a to z.
 <p>A0019095</p>	Selection of special characters.
 <p>A0013985</p>	Confirms selection.
 <p>A0013987</p>	Switches to the selection of the correction tools.
 <p>A0013986</p>	Exits the input without applying the changes.
 <p>A0014040</p>	Clears all entered characters.

Correction symbols under 

Symbol	Meaning
 <p>A0013989</p>	Clears all entered characters.
 <p>A0013991</p>	Moves the input position one position to the right.
 <p>A0013990</p>	Moves the input position one position to the left.
 <p>A0013988</p>	Deletes one character immediately to the left of the input position.

8.3.4 Operating elements

Key	Meaning
 <p>A0013969</p>	<p>Minus key</p> <p><i>In a menu, submenu</i> Moves the selection bar upwards in a choose list.</p> <p><i>With a Wizard</i> Confirms the parameter value and goes to the previous parameter.</p> <p><i>With a text and numeric editor</i> In the input mask, moves the selection bar to the left (backwards).</p>
 <p>A0013970</p>	<p>Plus key</p> <p><i>In a menu, submenu</i> Moves the selection bar downwards in a choose list.</p> <p><i>With a Wizard</i> Confirms the parameter value and goes to the next parameter.</p> <p><i>With a text and numeric editor</i> Moves the selection bar to the right (forwards) in an input screen.</p>

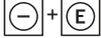Key	Meaning
 <small>A0013952</small>	<p>Enter key</p> <p><i>For operational display</i></p> <ul style="list-style-type: none"> Pressing the key briefly opens the operating menu. Pressing the key for 2 s opens the context menu. <p><i>In a menu, submenu</i></p> <ul style="list-style-type: none"> Pressing the key briefly: <ul style="list-style-type: none"> Opens the selected menu, submenu or parameter. Starts the wizard. If help text is open, closes the help text of the parameter. Pressing the key for 2 s for parameter: <ul style="list-style-type: none"> If present, opens the help text for the function of the parameter. <p><i>With a Wizard</i></p> <p>Opens the editing view of the parameter.</p> <p><i>With a text and numeric editor</i></p> <ul style="list-style-type: none"> Pressing the key briefly: <ul style="list-style-type: none"> Opens the selected group. Carries out the selected action. Pressing the key for 2 s confirms the edited parameter value.
 <small>A0013971</small>	<p>Escape key combination (press keys simultaneously)</p> <p><i>In a menu, submenu</i></p> <ul style="list-style-type: none"> Pressing the key briefly: <ul style="list-style-type: none"> Exits the current menu level and takes you to the next higher level. If help text is open, closes the help text of the parameter. Pressing the key for 2 s returns you to the operational display ("home position"). <p><i>With a Wizard</i></p> <p>Exits the wizard and takes you to the next higher level.</p> <p><i>With a text and numeric editor</i></p> <p>Closes the text or numeric editor without applying changes.</p>
 <small>A0013953</small>	<p>Minus/Enter key combination (press the keys simultaneously)</p> <p>Reduces the contrast (brighter setting).</p>
 <small>A0013954</small>	<p>Plus/Enter key combination (press and hold down the keys simultaneously)</p> <p>Increases the contrast (darker setting).</p>
 <small>A0013955</small>	<p>Minus/Plus/Enter key combination (press the keys simultaneously)</p> <p><i>For operational display</i></p> <p>Enables or disables the keypad lock.</p>

8.3.5 Opening the context menu


Using the context menu, the user can call up the following menus quickly and directly from the operational display:

- Setup
- Simulation

Calling up and closing the context menu

The user is in the operational display.

1. Press  for 2 s.
 - ↳ The context menu opens.

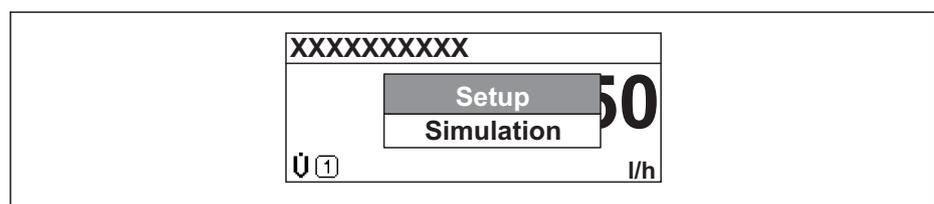

2. Press  +  simultaneously.

↳ The context menu is closed and the operational display appears.

Calling up the menu via the context menu


1. Open the context menu.
2. Press  to navigate to the desired menu.
3. Press  to confirm the selection.
 - ↳ The selected menu opens.

8.3.6 Navigating and selecting from list

Different operating elements are used to navigate through the operating menu. The navigation path is displayed on the left in the header. Icons are displayed in front of the individual menus. These icons are also shown in the header during navigation.

i For an explanation of the navigation view with symbols and operating elements (→ 48)

Example: Setting the number of displayed measured values to "2 values"

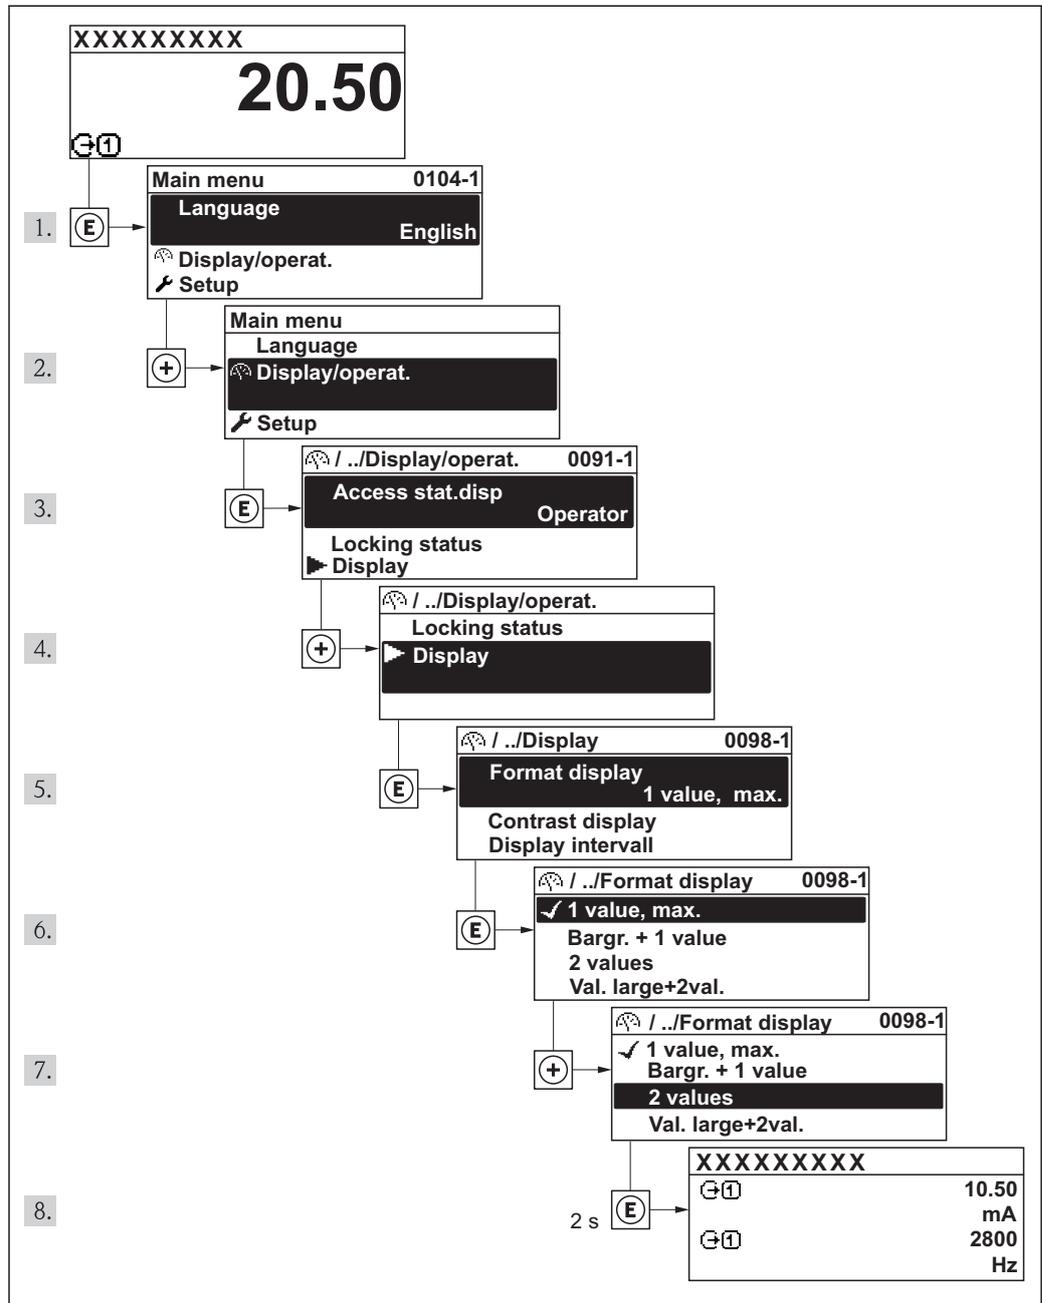

A0017448-EN


8.3.7 Calling the parameter directly

A parameter number is assigned to every parameter to be able to access a parameter directly via the onsite display. Entering this access code in the **Direct access** parameter calls up the desired parameter directly.

Navigation path

"Expert" menu → Direct access

The direct access code consists of a 4-digit number and the channel number, which identifies the channel of a process variable: e.g. 0914-1. In the navigation view, this appears on the right-hand side in the header of the selected parameter.

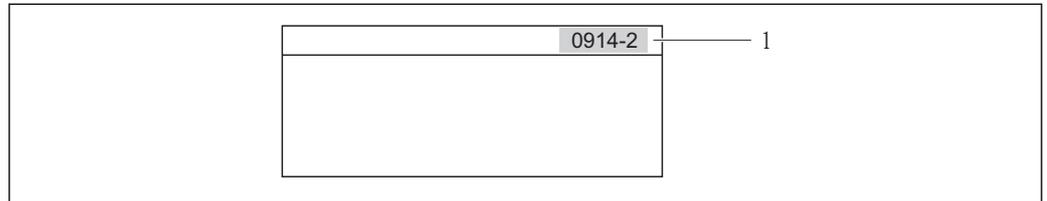

A0017223

1 Direct access code

Note the following when entering the direct access code:

- The leading zeros in the direct access code do not have to be entered.
Example: Input of "914" instead of "0914"
- If no channel number is entered, channel 1 is jumped to automatically.
Example: Input of "0914" → Parameter **Totalizer 1**
- If a different channel is jumped to: Enter the direct access code with the corresponding channel number.
Example: Input of "0914-2" → Parameter **Totalizer 2**



For the direct access codes of the individual parameters


8.3.8 Calling up help text

For some parameters, help texts exist, which the user can call up from the navigation view. These briefly describe the function of the parameter and thus support fast and reliable commissioning.

Calling up and closing the help text

The user is in the navigation view and the selection bar is on a parameter.

1. Press  for 2 s.
 - ↳ The help text for the selected parameter opens.

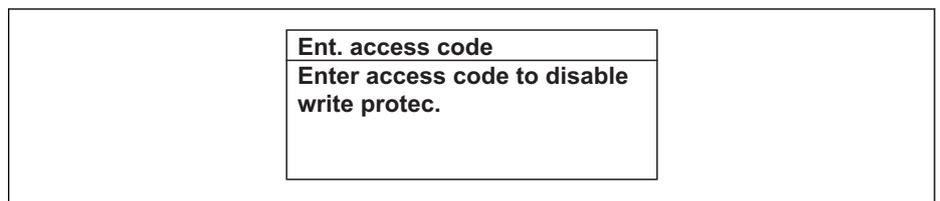

A0014002-EN


 17 Example: Help text for parameter "Enter access code"

2. Press  +  simultaneously.
 - ↳ The help text is closed.

8.3.9 Changing the parameters


i For a description of the editing display - consisting of text editor and numeric editor - with symbols (→ 50), for a description of the operating elements (→ 51)

Example: Changing the tag name in the "Tag description" parameter from 001-FT-101 to 001-FT-102

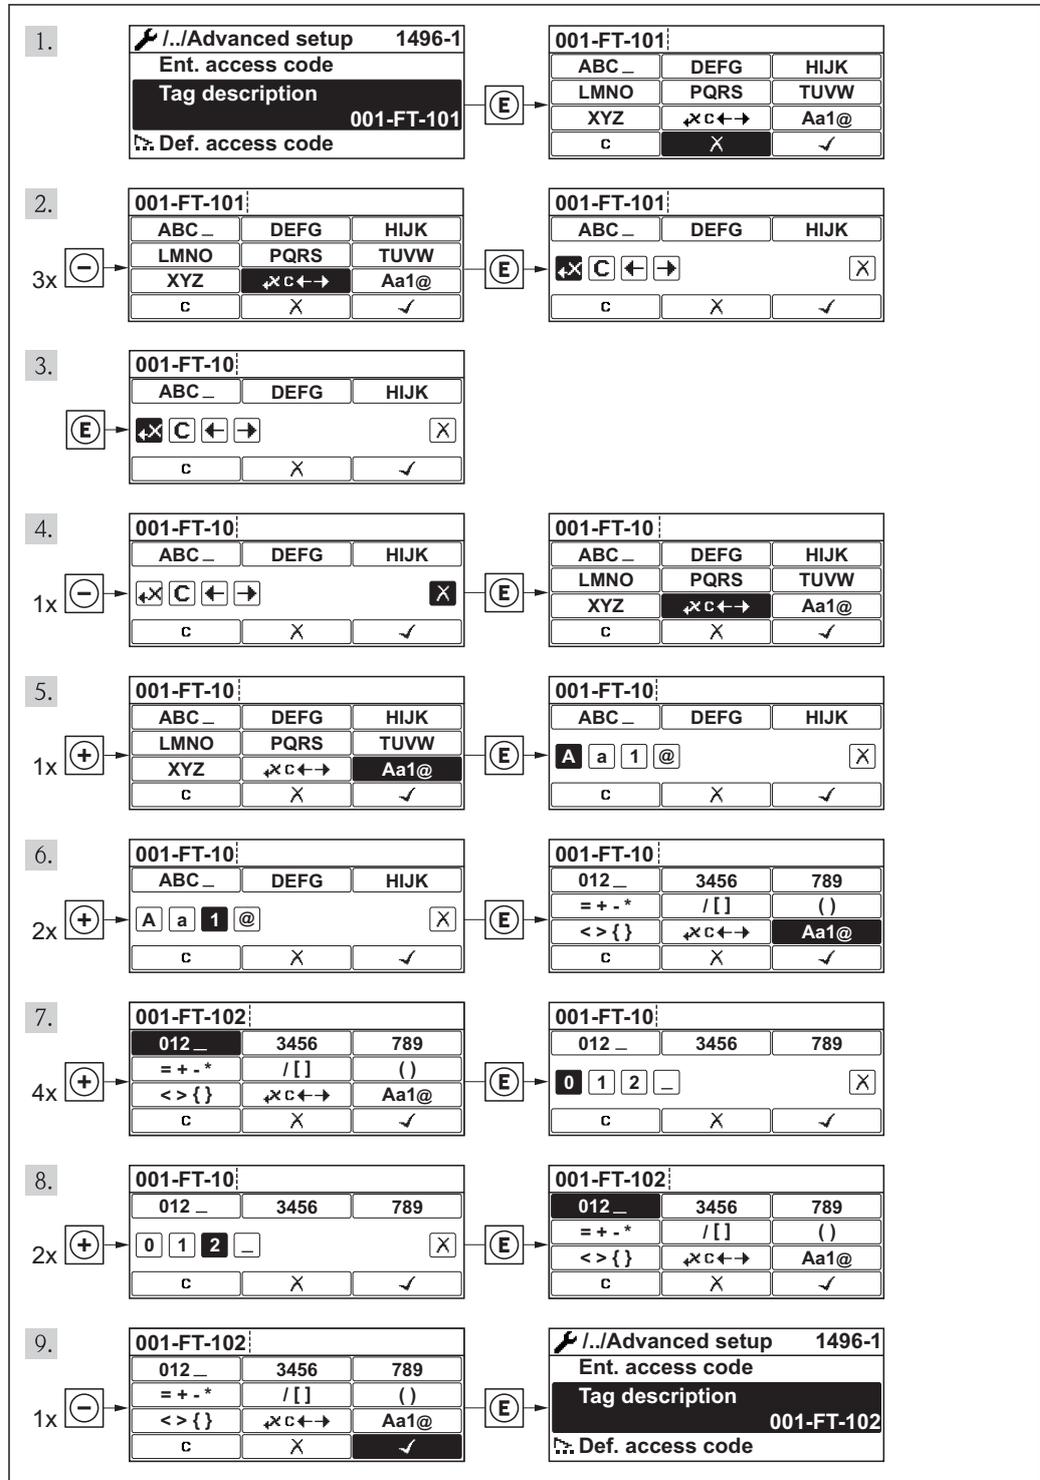

A0014020-EN

A message is displayed if the value entered is outside the permitted value range.

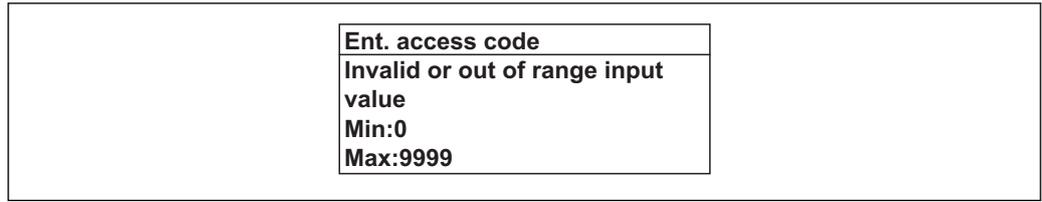

A0014049-EN

8.3.10 User roles and related access authorization

The two user roles "Operator" and "Maintenance" have different write access to the parameters if the customer defines a user-specific access code. This protects the device configuration via the local display from unauthorized access (→ 95).

Access authorization to parameters

User role	Read access		Write access	
	Without access code (from the factory)	With access code	Without access code (from the factory)	With access code
Operator	✓	✓	✓	-- 1)
Maintenance	✓	✓	✓	✓

- 1) Despite the defined access code, certain parameters can always be modified and thus are exempted from the write protection, as they do not affect the measurement. Refer to the "Write protection via access code" section

If an incorrect access code is entered, the user obtains the access rights of the "Operator" role.

 The user role with which the user is currently logged on is indicated by the **Access status display** parameter. Navigation path: Operation → Access status display

8.3.11 Disabling write protection via access code

If the -symbol appears on the local display in front of a parameter, the parameter is write-protected by a user-specific access code and its value cannot be changed at the moment using the local display (→ 95).

The locking of the write access via local operation can be disabled by entering the customer-defined access code via the respective access option.

1. After you press , the input prompt for the access code appears.
2. Enter the access code.
 - ↳ The -symbol in front of the parameters disappears; all previously write-protected parameters are now re-enabled.


8.3.12 Enabling and disabling the keypad lock

The keypad lock makes it possible to block access to the entire operating menu via local operation. As a result, it is no longer possible to navigate through the operating menu or change the values of individual parameters. Users can only read the measured values on the operational display.


The keypad lock is enabled and disabled in the same way:

The user is in the operational display.

- ▶ By simultaneously pressing the  +  +  keys.
 - ↳ After enabling the keypad lock:

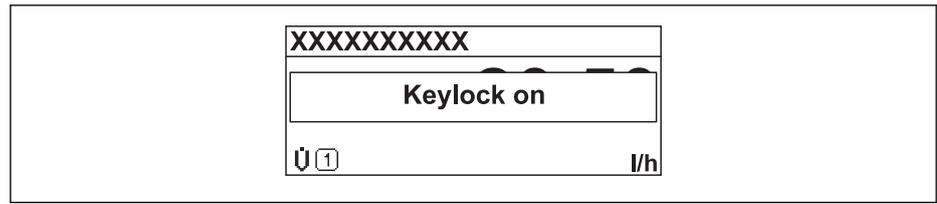

After disabling the keypad lock:

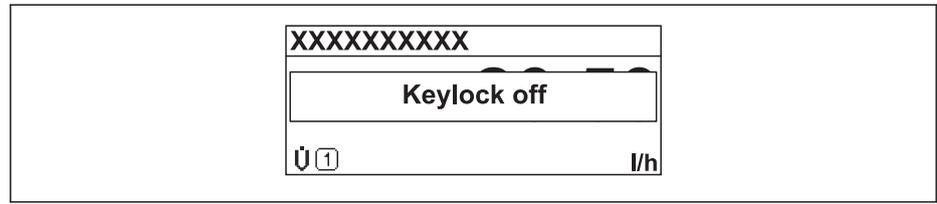

i If the user attempts to access the operating menu while the keylock is enabled, the message **Keylock on** also appears.

8.4 Access to the operating menu via the Web browser

8.4.1 Function range

Thanks to the integrated Web server the device can be operated and configured via a Web browser. The operating menu structure is the same as in the local display. In addition to the measured values, status information on the device is also displayed and allows the user to monitor the status of the device. Furthermore the device data can be managed and the network parameters can be configured.

8.4.2 Prerequisites

Hardware

Connecting cable	Standard Ethernet cable with RJ45 connector
Computer	RJ45 interface
Measuring device	Web server must be enabled; factory setting: ON i For information on enabling the Web server (→ 61)

Software of the computer

Web browsers supported	<ul style="list-style-type: none"> ▪ Microsoft Internet Explorer 7.x, 8.x, 9.x ▪ Mozilla Firefox 4.x, 5.x, 8.x ▪ Google chrome 15.x
Recommended operating systems	<ul style="list-style-type: none"> ▪ Windows XP ▪ Windows 7
User rights for TCP/IP settings	Admin rights required (e.g. for changing the IP address, subnet mask)
Computer configuration	<ul style="list-style-type: none"> ▪ JavaScript is enabled ▪ If JavaScript cannot be enabled, enter <code>http://192.168.1.212/basic.html</code> in the address line of the Web browser. A fully functional but simplified version of the operating menu structure starts in the Web browser.

-  When installing a new firmware version:
To enable correct data display, clear the temporary memory (cache) of the Web browser under **Internet options**.

8.4.3 Establishing a connection

Configuring the Internet protocol of the computer


IP address	192.168.1.XXX; for XXX all numerical values except: 0, 212 and 255 → e.g. 192.168.1.213
Subnet mask	255.255.255.0
Default gateway	192.168.1.212 or 0.0.0.0

1. Switch on the measuring device and connect to the computer via the cable (→  62).
2. Configure the properties of the Internet protocol (TCP/IP) as defined in the table above.

Starting the Web browser

1. Start the Web browser on the computer.
2. Enter the IP address of the Web server in the address line of the Web browser:
192.168.1.212

The login page appears.

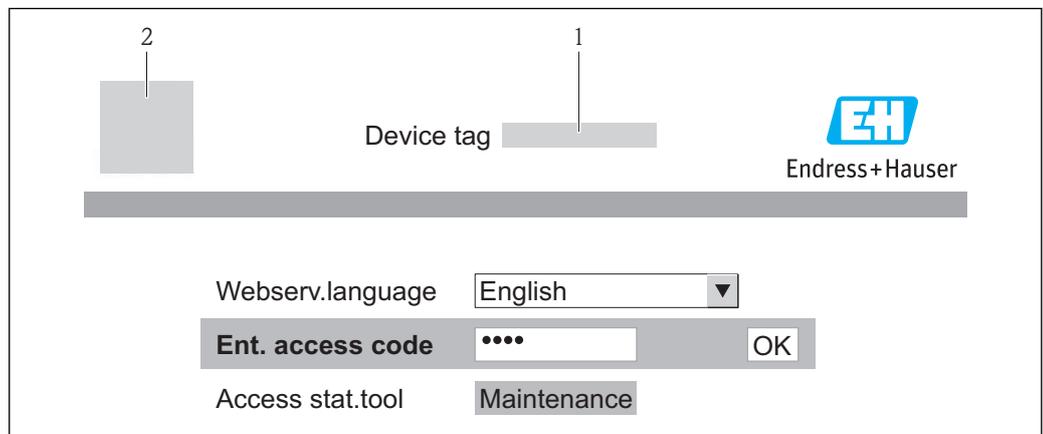

A0017362

- 1 Device tag (→  69)
- 2 Picture of device

-  If a login page does not appear, or if the page is incomplete
-  The IP address of the Web server (factory setting) is also indicated on the connection nameplate.


8.4.4 Logging on

1. Select the preferred operating language for the Web browser.
2. Enter the access code.
3. Press **OK** to confirm your entry.

Access code	0000 (factory setting); can be changed by customer (→  95)
--------------------	---

 If no action is performed for 10 minutes, the Web browser automatically returns to the login page.

8.4.5 User interface

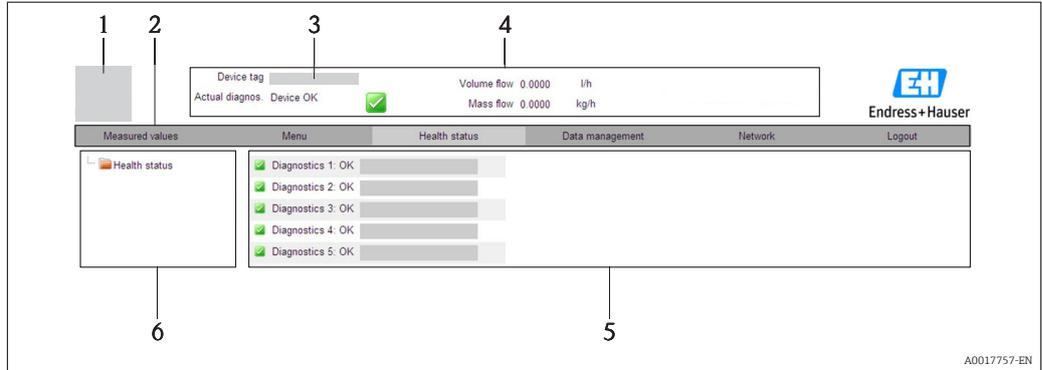

1 Picture of device
 2 Function row with 6 functions
 3 Device tag
 4 Header
 5 Working area
 6 Navigation area

A0017757-EN

Header

The following information appears in the header:

- Device tag (→  69)
- Device status with status signal (→  110)
- Current measured values (→  98)

Function row

Functions	Meaning
Measured values	The measured values of the device are displayed
Menu	Access to the operating menu structure of the device, same as for the local display and operating tool
Device status	Displays the diagnostic messages currently pending, listed in order of priority
Data management	Data exchange between PC and measuring device: <ul style="list-style-type: none"> - Upload the configuration from the device (XML format, create configuration backup) - Save the configuration to the device (XML format) - Export the event list (.csv file) - Export parameter settings (.csv file, create documentation of the measuring point) - Export the Heartbeat verification log (PDF file, only available with the "Heartbeat Verification" application package)
Network configuration	Configuration and checking of all the parameters required for establishing the connection to the device: <ul style="list-style-type: none"> ▪ Network settings (e.g. IP address, MAC address) ▪ Device information (e.g. serial number, firmware version)
Logout	End the operation and call up the login page

Navigation area

If a function is selected in the function bar, the submenus of the function open in the navigation area. The user can now navigate through the menu structure.

Working area

Depending on the selected function and the related submenus, various actions can be performed in this area:

- Configuring parameters
- Reading measured values
- Calling up help text
- Starting an upload/download

8.4.6 Disabling the Web server

The Web server for the measuring device can be enabled and disabled as required via the **Web server functionality** parameter.

Navigation

"Expert" menu → Communication → Web server

Parameter overview with brief description

Parameters	Description	Selection	Factory setting
Web server functionality	Switch the Web server on and off.	<ul style="list-style-type: none"> ▪ Off ▪ On 	On

Enabling the Web server

If the Web server is disabled it can only be re-enabled with the **Web server functionality** parameter via the following operating options:

- Via local display
- Via "FieldCare" operating tool

8.4.7 Logging out

 Before logging out, perform a data backup via the **Data management** function (upload configuration from device) if necessary.


1. Click on **Logout**.
↳ The home page with the Login box appears.
2. Close the Web browser.
3. Reset the modified properties of the Internet protocol (TCP/IP) if they are no longer needed (→  59).

8.5 Access to the operating menu via the operating tool

The structure of the operating menu in the operating tools is the same as for operation via the local display.

8.5.1 Connecting the operating tool


Via HART protocol

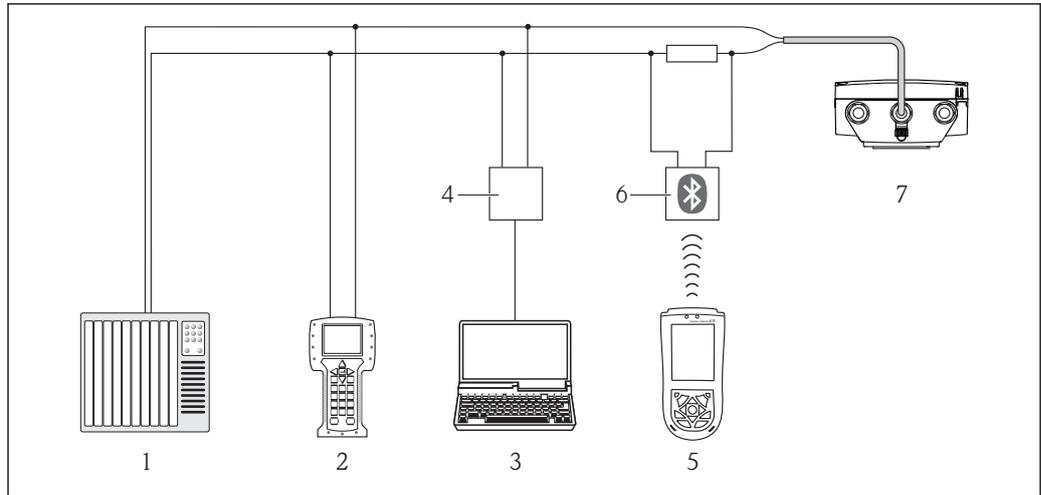

18 Options for remote operation via HART protocol

- 1 Control system (e.g. PLC)
- 2 Field Communicator 475
- 3 Computer with operating tool (e.g. FieldCare, AMS Device Manager, SIMATIC PDM)
- 4 Commubox FXA195 (USB)
- 5 Field Xpert SFX100
- 6 VIATOR Bluetooth modem with connecting cable
- 7 Transmitter

Via service interface (CDI-RJ45)

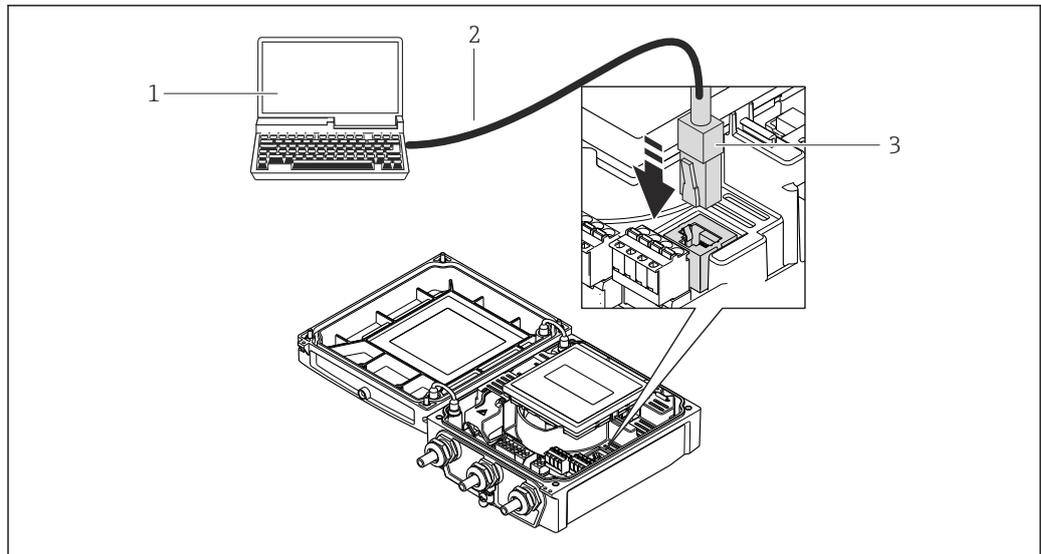

- 1 Computer with Web browser (e.g. Internet Explorer) for accessing the integrated device Web server or with "FieldCare" operating tool with COM DTM "CDI Communication TCP/IP"
- 2 Standard Ethernet connecting cable with RJ45 plug
- 3 Service interface (CDI -RJ45) of the measuring device with access to the integrated Web server

8.5.2 Field Xpert SFX100

Function scope

Compact, flexible and robust industrial handheld terminal for remote configuration and measured value display via HART protocol.

 For details, see Operating Instructions BA00060S

Source for device description files

See data (→  66)

8.5.3 FieldCare

Function scope

FDT-based plant asset management tool from Endress+Hauser. It can configure all smart field devices in a system and helps you manage them. By using the status information, it is also a simple but effective way of checking their status and condition.

Access takes place via:

- HART protocol (→  62)
- Service interface CDI-RJ45 (→  62)

Typical functions:

- Configuring parameters of transmitters
- Loading and saving device data (upload/download)
- Documentation of the measuring point
- Visualization of the measured value memory (line recorder) and event logbook

 For details, see Operating Instructions BA00027S and BA00059S

Source for device description files

See data (→  66)


Establishing a connection

Via service interface (CDI-RJ45)

1. Start FieldCare and launch the project.
2. In the network: Add a device.
 - ↳ The **Add device** window opens.
3. Select the **CDI Communication TCP/IP** option from the list and press **OK** to confirm.
4. Right-click **CDI Communication TCP/IP** and select the **Add device** option in the context menu that opens.
5. Select the desired device from the list and press **OK** to confirm.
 - ↳ The **CDI Communication TCP/IP (Configuration)** window opens.
6. Enter the device address in the **IP address** field: 192.168.1.212 and press **Enter** to confirm.
7. Establish the online connection to the device.

 For details, see Operating Instructions BA00027S and BA00059S

User interface

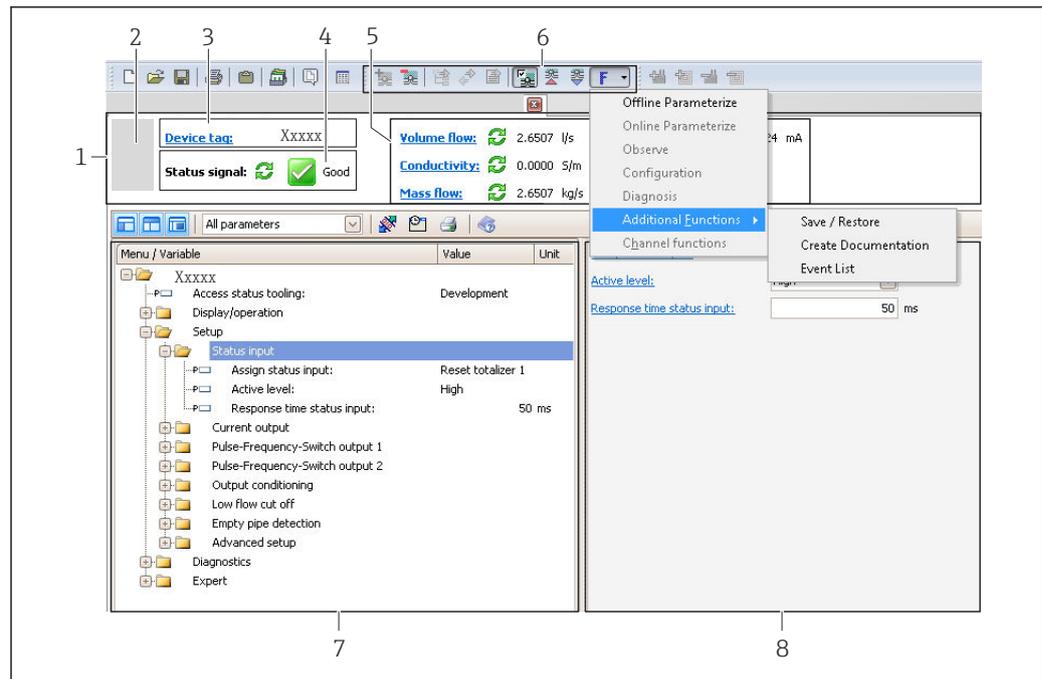

A0021053-EN

- 1 Header
- 2 Picture of device
- 3 Device tag (→ 69)
- 4 Status area with status signal (→ 110)
- 6 Display area for current measured values (→ 98)
- 5 Event list with additional functions such as save/load, events list and document creation
- 7 Navigation area with operating menu structure
- 8 Working area

8.5.4 AMS Device Manager

Function scope

Program from Emerson Process Management for operating and configuring measuring devices via HART protocol.

Source for device description files

See data (→ 66)

8.5.5 SIMATIC PDM

Function scope

SIMATIC PDM is a standardized, manufacturer-independent program from Siemens for the operation, configuration, maintenance and diagnosis of intelligent field devices via HART protocol.

Source for device description files

See data (→ 66)

8.5.6 Field Communicator 475

Function scope

Industrial handheld terminal from Emerson Process Management for remote configuration and measured value display via HART protocol.

Source for device description files

See data (→  66)

9 System integration

9.1 Overview of device description files

9.1.1 Current version data for the device

Firmware version	01.04.00	<ul style="list-style-type: none"> ▪ On the title page of the Operating instructions ▪ On transmitter nameplate(→ 14) ▪ Parameter firmware version Diagnostics → Device info → Firmware version
Release date of firmware version	10.2013	---
Manufacturer ID	0x11	Manufacturer ID parameter Diagnostics → Device info → Manufacturer ID
Device type ID	0x67	Device type parameter Diagnostics → Device info → Device type
HART protocol revision	6.0	---
Device revision	5	<ul style="list-style-type: none"> ▪ On transmitter nameplate(→ 14) ▪ Device revision parameter Diagnostics → Device info → Device revision

9.1.2 Operating tools

The suitable device description file for the individual operating tools is listed in the table below, along with information on where the file can be acquired.

Operating tool via HART protocol	Sources for obtaining device descriptions
Field Xpert SFX100	Use update function of handheld terminal
FieldCare	<ul style="list-style-type: none"> ▪ www.endress.com → Download Area ▪ CD-ROM (contact Endress+Hauser) ▪ DVD (contact Endress+Hauser)
AMS Device Manager (Emerson Process Management)	www.endress.com → Download Area
SIMATIC PDM (Siemens)	www.endress.com → Download Area
Field Communicator 475 (Emerson Process Management)	Use update function of handheld terminal

9.2 Measured variables via HART protocol

The following measured variables (HART device variables) are assigned to the dynamic variables at the factory:

Dynamic variables	Measured variables (HART device variables)
Primary dynamic variable (PV)	Volume flow
Secondary dynamic variable (SV)	Totalizer 1
Tertiary dynamic variable (TV)	Totalizer 2
Quaternary dynamic variable (QV)	Totalizer 3

The assignment of the measured variables to the dynamic variables can be modified and assigned as desired via local operation and the operating tool using the following parameters:

- Expert → Communication → HART output → Output → Assign PV
- Expert → Communication → HART output → Output → Assign SV
- Expert → Communication → HART output → Output → Assign TV
- Expert → Communication → HART output → Output → Assign QV

The following measured variables can be assigned to the dynamic variables:

Measured variables for PV (primary dynamic variable)

- Off
- Volume flow
- Mass flow
- Flow velocity
- Conductivity
- Electronics temperature

Measured variables for SV, TV, QV (secondary, tertiary and quaternary dynamic variable)

- Volume flow
- Mass flow
- Conductivity
- Electronics temperature
- Totalizer 1
- Totalizer 2
- Totalizer 3

9.3 Other settings

In the **Configuration** submenu you can configure other settings for the HART protocol (e.g. Burst mode).

 An external pressure or temperature sensor must be in the Burst mode.

Navigation

"Expert" menu → Communication → HART output → Configuration

Parameter overview with brief description

Parameters	Description	Selection	Factory setting
Burst mode	Switch burst mode on/off.	<ul style="list-style-type: none"> ■ Off ■ On 	Off

10 Commissioning

10.1 Function check

Before commissioning the device, make sure that the post-installation and post-connection checks have been performed.

- "Post-installation check" checklist (→ 📄 30)
- "Post-connection check" checklist (→ 📄 41)

10.2 Switching on the measuring device


After a successful function check, switch on the measuring device.

After a successful startup, the local display switches automatically from the startup display to the operational display.

i If nothing appears on the local display or a diagnostic message is displayed, refer to the section on "Diagnostics and troubleshooting" (→ 📄 104).

10.3 Setting the operating language

Factory setting: English or ordered local language

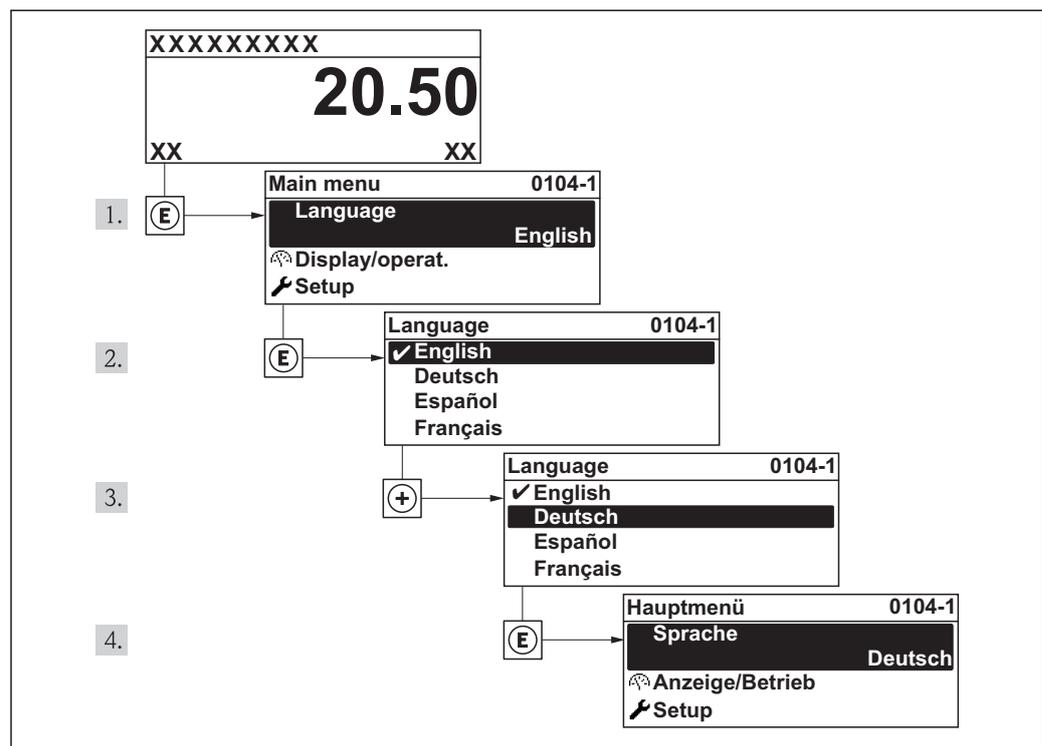


📄 19 Taking the example of the local display

A0013996

10.4 Configuring the measuring device

The **Setup** menu with its guided wizards contains all the parameters needed for standard operation.


Navigation to the **Setup** menu

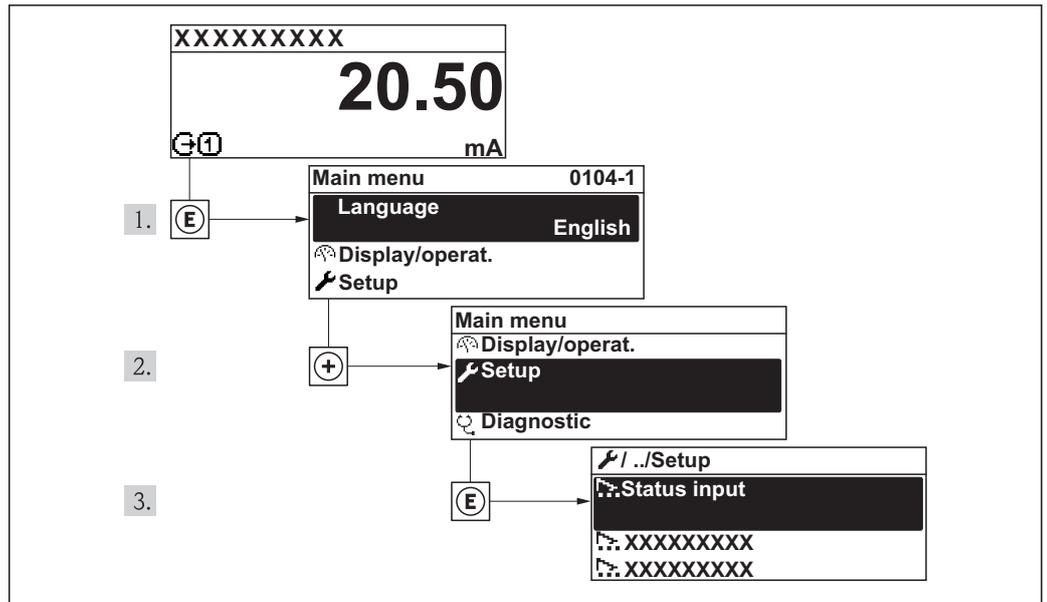

A0017444-EN

20 Illustrated using the example of the local display

Overview of the wizards in the "Setup" menu

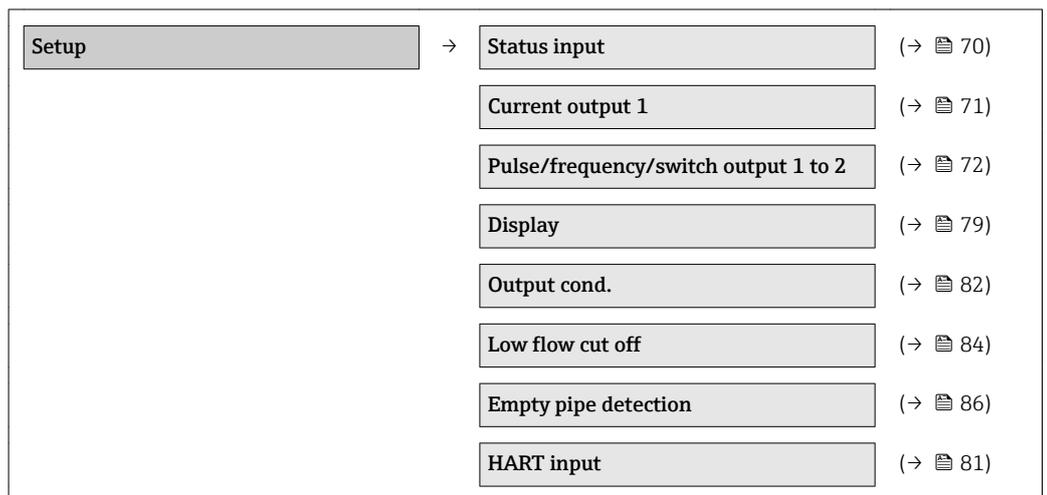


10.4.1 Defining the tag name

To enable fast identification of the measuring point within the system, you can enter a unique designation using the **"Device tag" parameter** and thus change the factory setting.

i The number of characters displayed depends on the characters used.

i For information on the tag name in the "FieldCare" operating tool (→ 64)

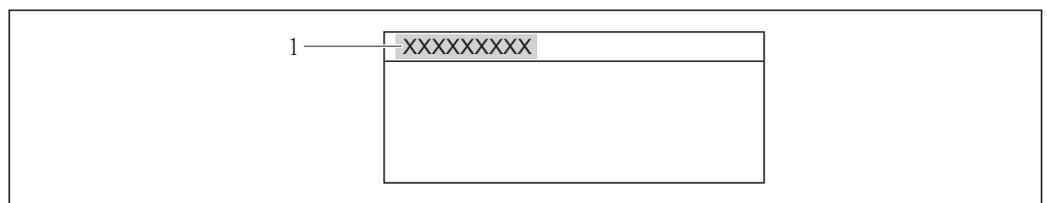

A0013375

21 Header of the operational display with tag name

1 Device tag

Navigation

"Setup" menu → Device tag

Parameter overview with brief description

Parameters	Description	User entry	Factory setting
Device tag	Enter tag for measuring point.	Max. 32 characters, such as letters, numbers or special characters (e.g. @, %, /).	Promag


10.4.2 Configuring the status input

The **Status input** submenu guides you systematically through all the parameters that have to be set for configuring the input.

 The submenu only appears if the device was ordered with a status input (→  33).

Navigation

"Setup" menu → Status input

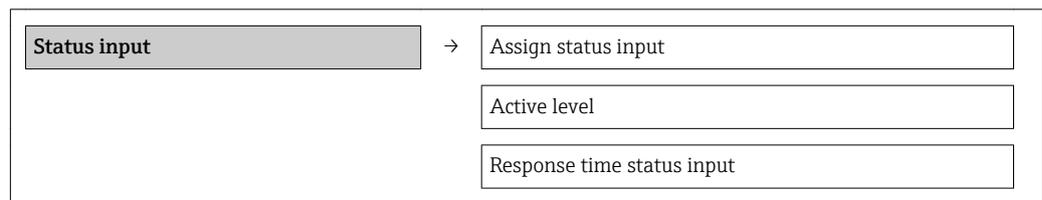Structure of the submenu**Parameter overview with brief description**

Parameters	Description	Selection / User entry	Factory setting
Assign status input	Select the function for the status input.	<ul style="list-style-type: none"> ■ Off ■ Reset totalizer 1 ■ Reset totalizer 2 ■ Reset totalizer 3 ■ Reset all totalizers ■ Flow override 	Off
Active level	Specify the input signal level at which the assigned function is triggered.	<ul style="list-style-type: none"> ■ High ■ Low 	High
Response time status input	Specify the minimum amount of time the input signal level must be present before the selected function is triggered.	5 to 200 ms	50 ms


10.4.3 Configuring the current output

The "Current output 1 to 2" wizard guides you systematically through all the parameters that have to be set for configuring the particular current output.

Navigation

"Setup" menu → Current output 1 to 2

Structure of the wizard

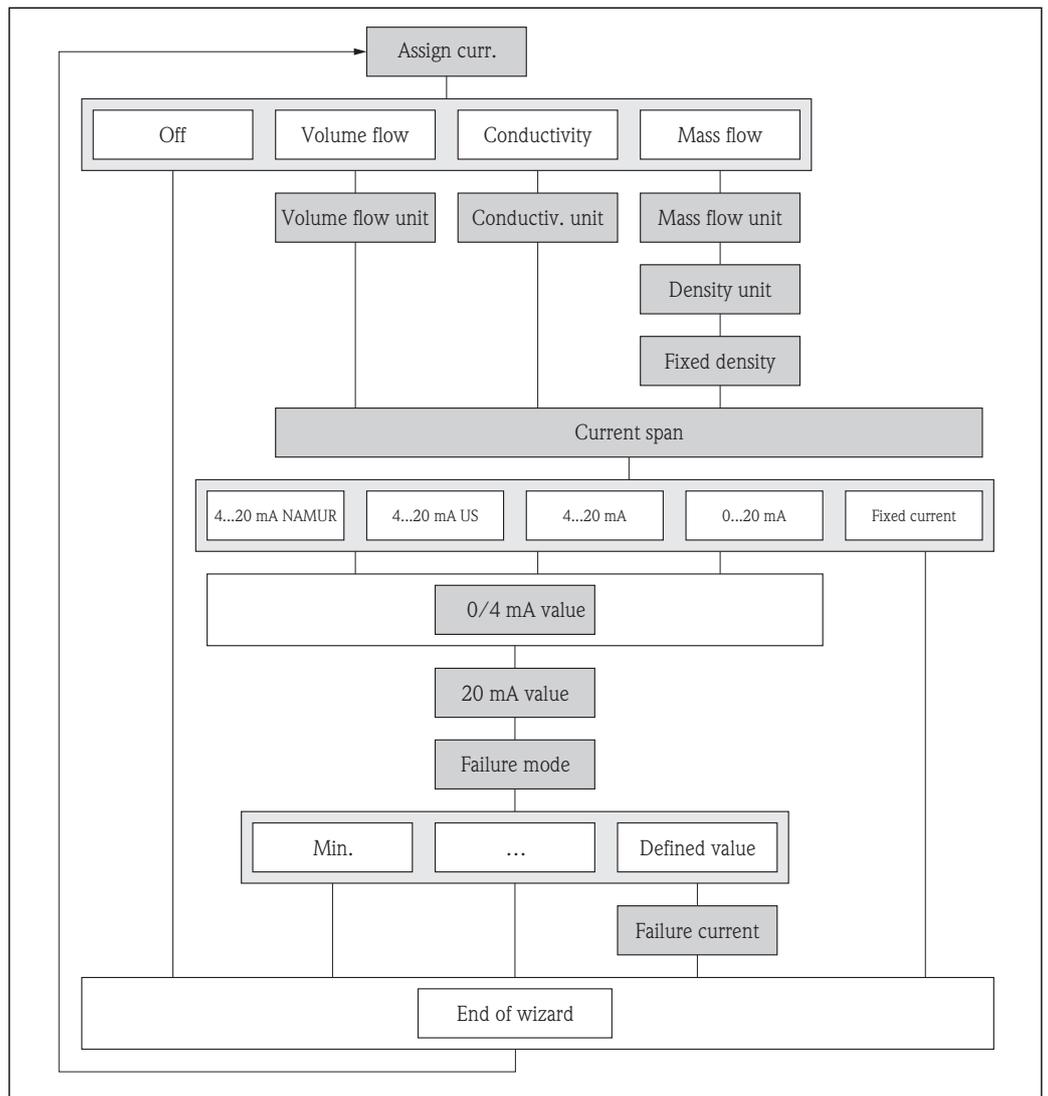

22 Graphic of "Current output" wizard in the "Setup" menu

A0017434-EN

Parameter overview with brief description

Parameters	Description	Selection / User entry	Factory setting
Assign current output	Select process variable for current output.	<ul style="list-style-type: none"> ▪ Off ▪ Volume flow ▪ Mass flow ▪ Flow velocity ▪ Conductivity ▪ Electronic temperature 	Volume flow
Mass flow unit	Select mass flow unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ▪ Output ▪ Low flow cut off ▪ Simulation process variable 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ kg/h ▪ lb/min
Volume flow unit	Select volume flow unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ▪ Output ▪ Low flow cut off ▪ Simulation process variable 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ l/h ▪ gal/min (us)
Conductivity unit	Select conductivity unit.	Unit choose list	µS/cm
Density unit	Select density unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ▪ Output ▪ Simulation process variable ▪ Density adjustment (in Expert menu) 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ kg/l ▪ lb/ft³
Fixed density	Enter fixed value for medium density.	0.01 to 15 000 kg/m ³	1 000 kg/m ³
Current span	Select current range for process value output and upper/lower level for alarm signal.	<ul style="list-style-type: none"> ▪ 4...20 mA NAMUR ▪ 4...20 mA US ▪ 4...20 mA ▪ 0...20 mA ▪ Fixed current 	4...20 mA NAMUR
0/4 mA value	Enter 4 mA value.	Signed floating-point number	0 l/h
20 mA value	Enter 20 mA value.	Signed floating-point number	0.025 l/h
Failure mode	Define output behavior in alarm condition.	<ul style="list-style-type: none"> ▪ Min. ▪ Max. ▪ Last valid value ▪ Actual value ▪ Defined value 	Max.
Failure current	Enter current output value in alarm condition.	3.59 ⁻³ to 22.5 ⁻³ mA	22.5 mA

10.4.4 Configuring the pulse/frequency/switch output


The **Pulse-Frequency-Switch output 1 to 2** wizard guides you systematically through all the parameters that can be set for configuring the selected output type.

Pulse output

Navigation

"Setup" menu → Pulse-Frequency-Switch output 1 to 2

Structure of the wizard for the pulse output

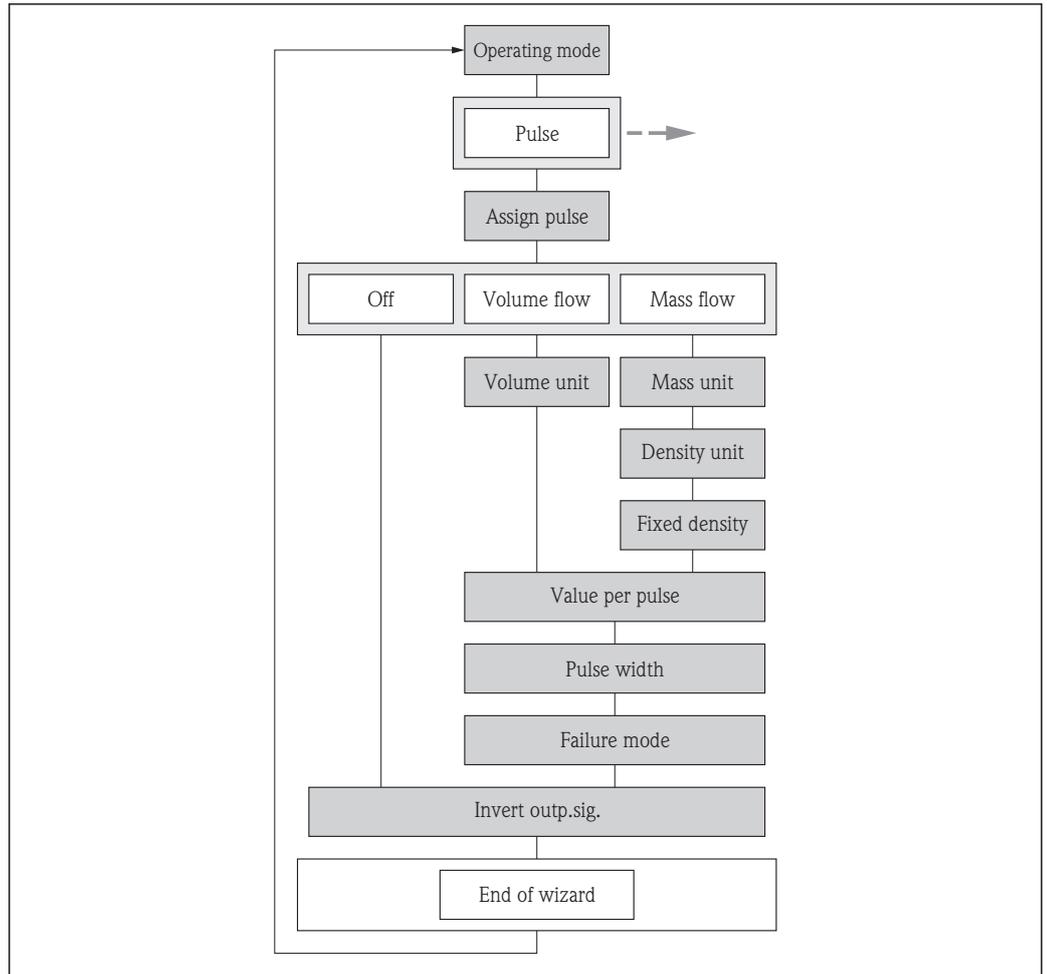

A0017435-EN

23 "Pulse/frequency/switch output 1-2" wizard in the "Setup" menu: "Pulse" operating mode

Parameter overview with brief description

Parameters	Description	Selection / User entry	Factory setting
Operating mode	Define the output as a pulse, frequency or switch output.	<ul style="list-style-type: none"> ■ Pulse ■ Frequency ■ Switch 	Pulse
Assign pulse output	Select process variable for pulse output.	<ul style="list-style-type: none"> ■ Off ■ Volume flow ■ Mass flow 	Off
Volume unit	Select volume unit. Result The selected unit is taken from: Volume flow unit parameter	Unit choose list	Country-specific: <ul style="list-style-type: none"> ■ l ■ gal (us)
Mass unit	Select mass unit. <i>Result</i> The selected unit is taken from: Mass flow unit parameter	Unit choose list	Country-specific: <ul style="list-style-type: none"> ■ kg ■ lb


Parameters	Description	Selection / User entry	Factory setting
Density unit	Select density unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ■ Output ■ Simulation process variable ■ Density adjustment (in Expert menu) 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ■ kg/l ■ lb/ft³
Fixed density	Enter fixed value for medium density.	0.01 to 15 000 kg/m ³	1 000 kg/m ³
Value per pulse	Enter measured value at which a pulse is output.	Signed floating-point number	0
Pulse width	Define time width of the output pulse.	0.05 to 2 000 ms	100 ms
Failure mode	Define output behavior in alarm condition.	<ul style="list-style-type: none"> ■ Actual value ■ No pulses 	No pulses
Invert output signal	Invert the output signal.	<ul style="list-style-type: none"> ■ No ■ Yes 	No

Frequency output

Navigation

"Setup" menu → Pulse-Frequency-Switch output 1 to 2

Structure of the wizard for the frequency output

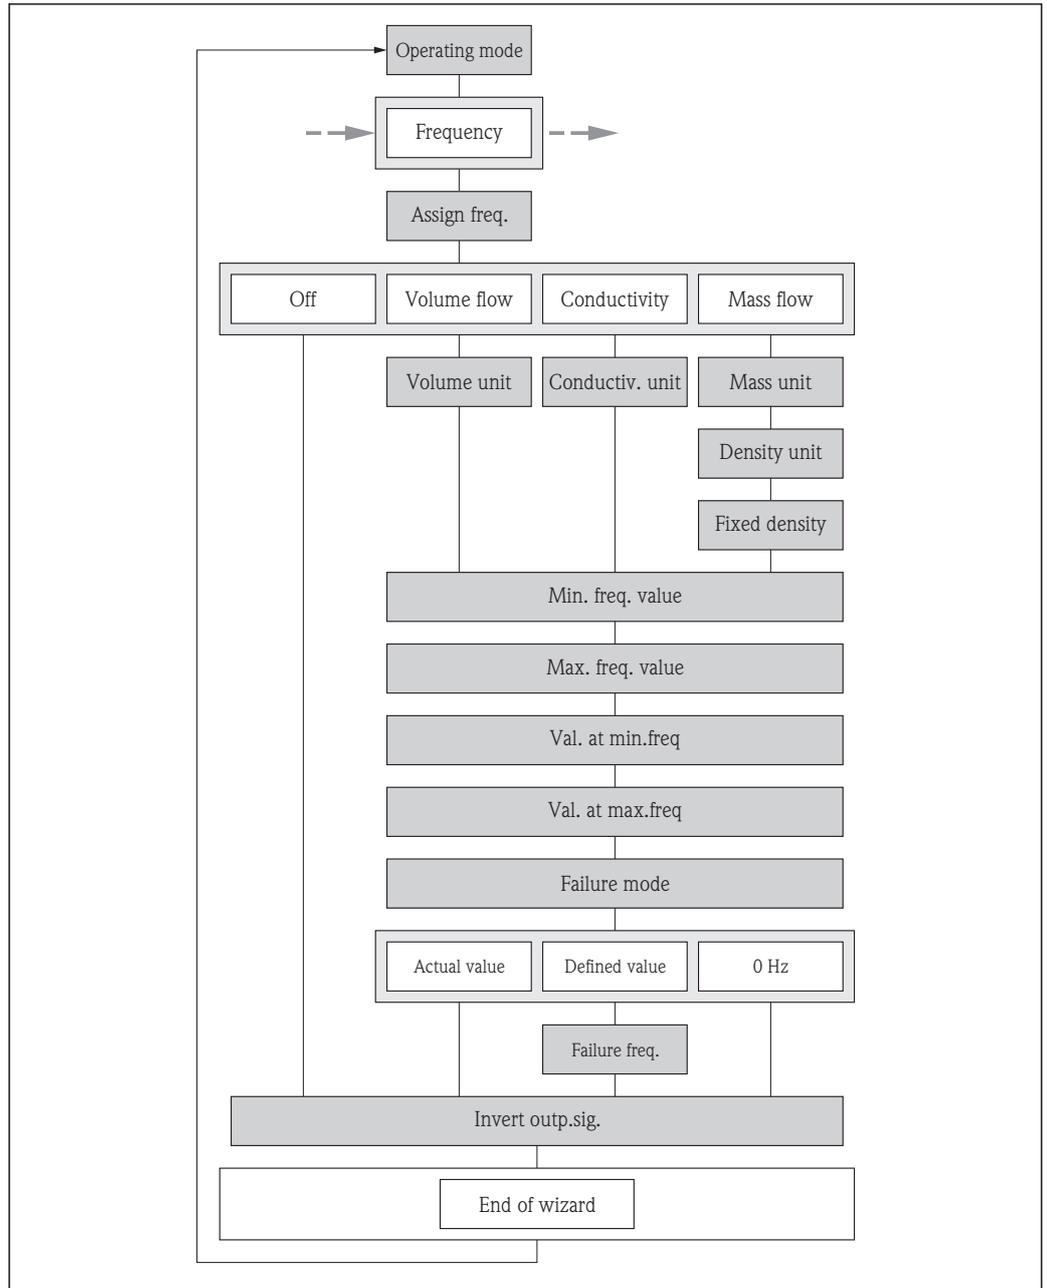

A0017436-EN

24 "Pulse/frequency/switch output 1-2" wizard in the "Setup" menu: "Frequency" operating mode

Parameter overview with brief description

Parameters	Description	Selection / User entry	Factory setting
Operating mode	Define the output as a pulse, frequency or switch output.	<ul style="list-style-type: none"> ■ Pulse ■ Frequency ■ Switch 	Pulse
Assign frequency output	Select process variable for frequency output.	<ul style="list-style-type: none"> ■ Off ■ Volume flow ■ Mass flow ■ Flow velocity ■ Conductivity ■ Electronic temperature 	Off


Parameters	Description	Selection / User entry	Factory setting
Volume flow unit	Select volume flow unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ■ Output ■ Low flow cut off ■ Simulation process variable 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ■ l/h ■ gal/min (us)
Mass flow unit	Select mass flow unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ■ Output ■ Low flow cut off ■ Simulation process variable 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ■ kg/h ■ lb/min
Conductivity unit	Select conductivity unit.	Unit choose list	µS/cm
Minimum frequency value	Enter minimum frequency.	0.0 to 12 500.0 Hz	0.0 Hz
Maximum frequency value	Enter maximum frequency.	0.0 to 12 500.0 Hz	12 500.0 Hz
Measuring value at minimum frequency	Enter measured value for minimum frequency.	Signed floating-point number	0
Measuring value at maximum frequency	Enter measured value for maximum frequency.	Signed floating-point number	0
Failure mode	Define output behavior in alarm condition.	<ul style="list-style-type: none"> ■ Actual value ■ Defined value ■ 0 Hz 	0 Hz
Failure frequency	Enter frequency output value in alarm condition.	0.0 to 12 500.0 Hz	0.0 Hz
Invert output signal	Invert the output signal.	<ul style="list-style-type: none"> ■ No ■ Yes 	No

Switch output

Navigation


"Setup" menu → Pulse-Frequency-Switch output 1 to 2

Structure of the wizard for the switch output

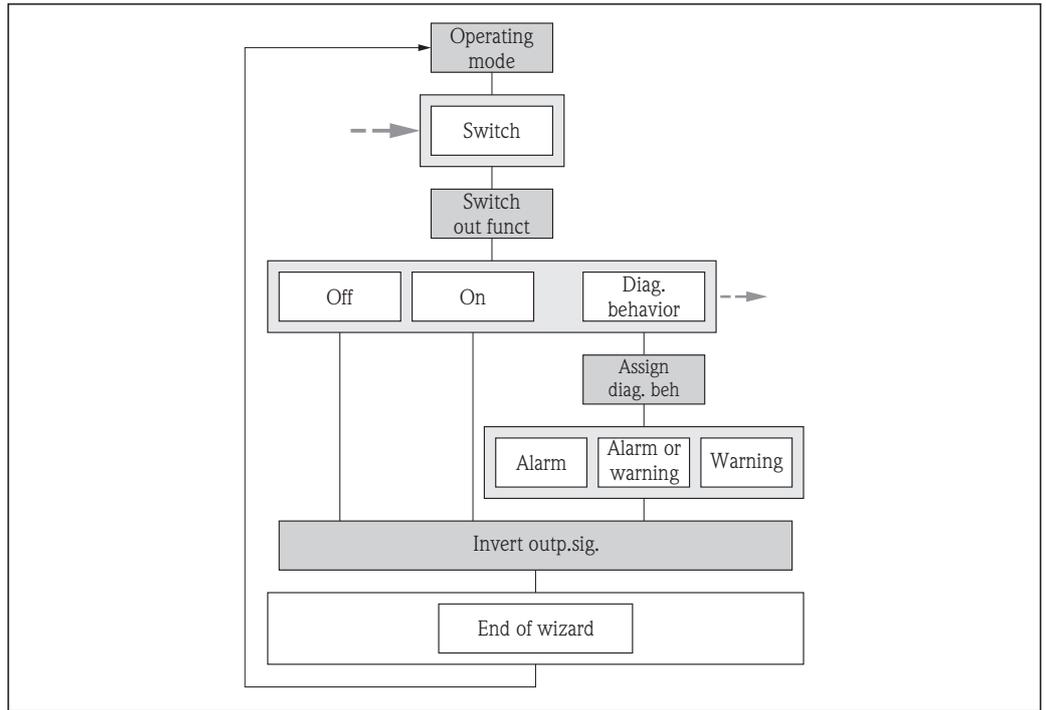

A0017439-EN

25 "Pulse/frequency/switch output 1-2" wizard in the "Setup" menu: "Switch" operating mode (Part 1)

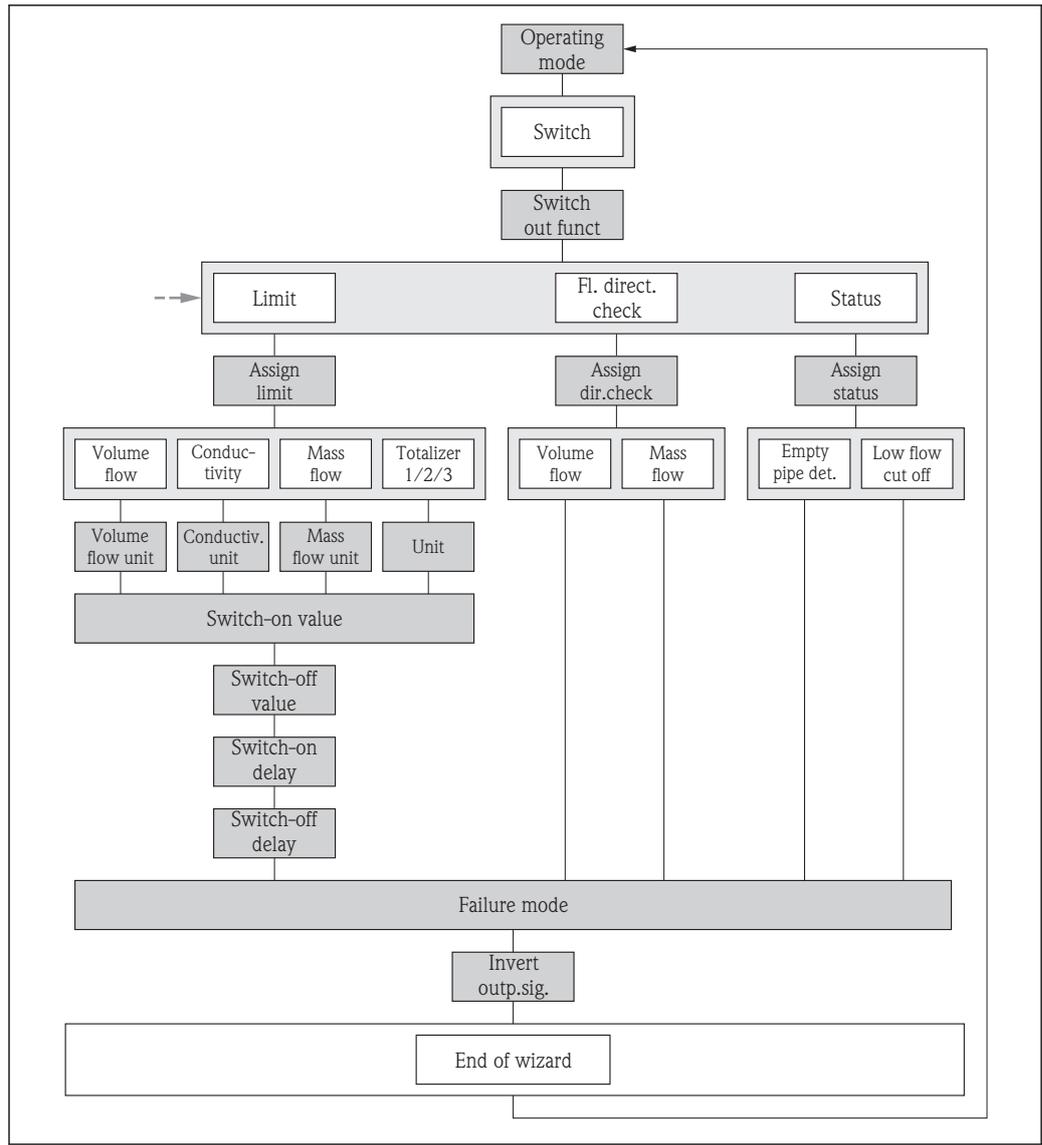

A0017440-EN

26 "Pulse/frequency/switch output 1-2" wizard in the "Setup" menu: "Switch" operating mode (Part 2)

Parameter overview with brief description

Parameters	Description	Selection / User entry	Factory setting
Operating mode	Define the output as a pulse, frequency or switch output.	<ul style="list-style-type: none"> ■ Pulse ■ Frequency ■ Switch 	Pulse
Switch output function	Select function for switch output.	<ul style="list-style-type: none"> ■ Off ■ On ■ Diagnostic behavior ■ Limit ■ Flow direction check ■ Status 	Off
Assign diagnostic behavior	Select diagnostic behavior for switch output.	<ul style="list-style-type: none"> ■ Alarm ■ Alarm or warning ■ Warning 	Alarm

Parameters	Description	Selection / User entry	Factory setting
Assign limit	Select process variable for limit function.	<ul style="list-style-type: none"> ▪ Off ▪ Volume flow ▪ Mass flow ▪ Flow velocity ▪ Conductivity ▪ Totalizer 1 ▪ Totalizer 2 ▪ Totalizer 3 ▪ Electronic temperature 	Volume flow
Assign flow direction check	Select process variable for flow direction monitoring.	<ul style="list-style-type: none"> ▪ Off ▪ Volume flow ▪ Mass flow 	Volume flow
Volume flow unit	Select volume flow unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ▪ Output ▪ Low flow cut off ▪ Simulation process variable 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ l/h ▪ gal/min (us)
Mass flow unit	Select mass flow unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ▪ Output ▪ Low flow cut off ▪ Simulation process variable 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ kg/h ▪ lb/min
Conductivity unit	Select conductivity unit.	Unit choose list	μS/cm
Unit totalizer	Select process variable totalizer unit.	Unit choose list	l
Switch-on value	Enter measured value for the switch-on point.	Signed floating-point number	0 l/h
Switch-off value	Enter measured value for the switch-off point.	Signed floating-point number	0 l/h
Switch-on delay	Define delay for the switch-on of status output.	0.0 to 100.0 s	0.0 s
Switch-off delay	Define delay for the switch-off of status output.	0.0 to 100.0 s	0.0 s
Assign status	Select device status for switch output.	<ul style="list-style-type: none"> ▪ Empty pipe detection ▪ Low flow cut off 	Empty pipe detection
Failure mode	Define output behavior in alarm condition.	<ul style="list-style-type: none"> ▪ Actual status ▪ Open ▪ Closed 	Open
Invert output signal	Invert the output signal.	<ul style="list-style-type: none"> ▪ No ▪ Yes 	No


10.4.5 Configuring the local display

The **Display** wizard guides you systematically through all the parameters that can be configured for configuring the local display.

Navigation

"Setup" menu → Display

Structure of the wizard

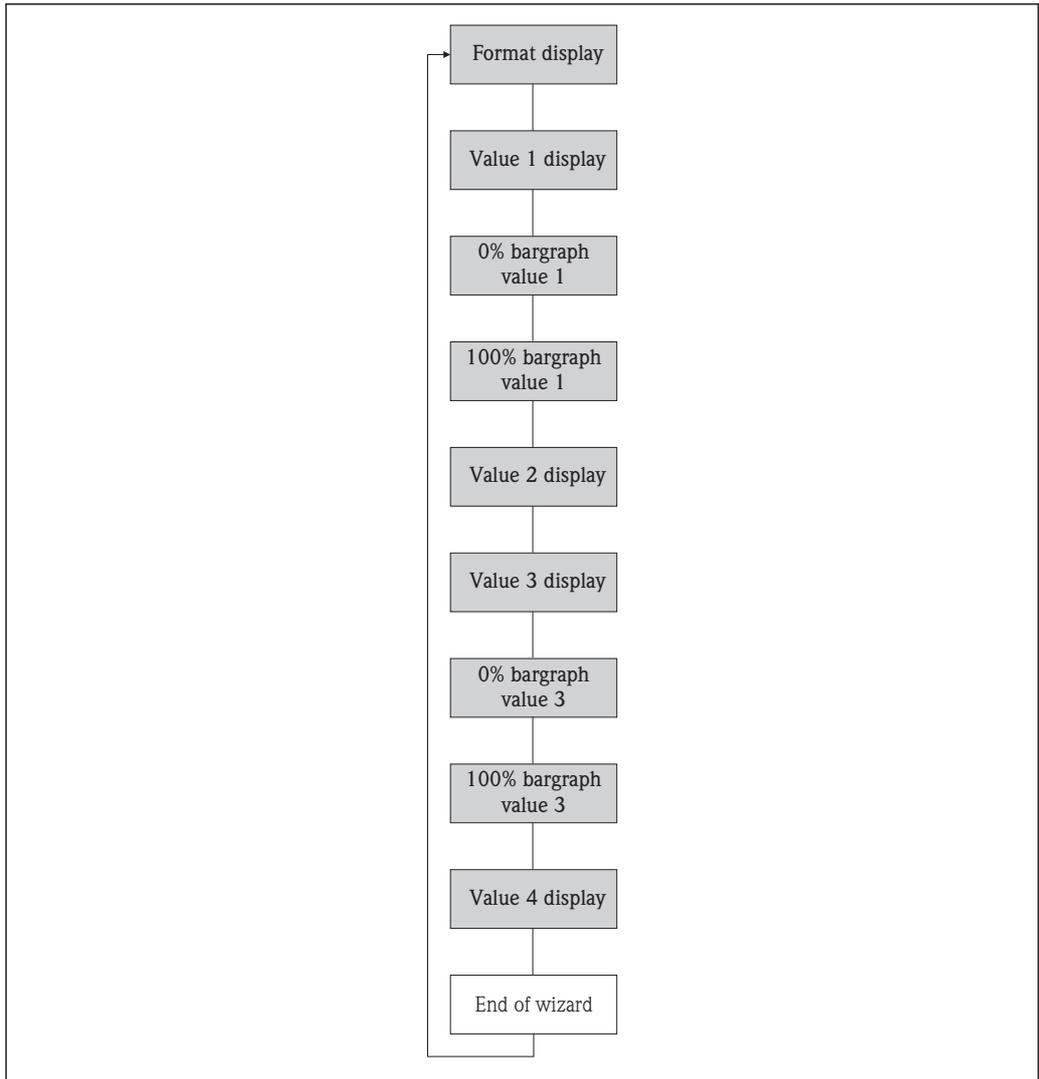

A0013797-EN

27 "Display" wizard in the "Setup" menu

Parameter overview with brief description

Parameters	Description	Selection / User entry	Factory setting
Format display	Select how measured values are shown on the display.	<ul style="list-style-type: none"> ▪ 1 value, max. size ▪ 1 bargraph + 1 value ▪ 2 values ▪ 1 value large + 2 values ▪ 4 values 	1 value, max. size
Value 1 display	Select the measured value that is shown on the local display.	<ul style="list-style-type: none"> ▪ Volume flow ▪ Mass flow ▪ Conductivity ▪ Totalizer 1 ▪ Totalizer 2 ▪ Totalizer 3 ▪ Current output 1 	Volume flow
0% bargraph value 1	Enter 0% value for bar graph display.	Signed floating-point number	0 l/h
100% bargraph value 1	Enter 100% value for bar graph display.	Signed floating-point number	1 l/h
Value 2 display	Select the measured value that is shown on the local display.	Picklist (see 1st display value)	None


Parameters	Description	Selection / User entry	Factory setting
Value 3 display	Select the measured value that is shown on the local display.	Picklist (see 1st display value)	None
0% bargraph value 3	Enter 0% value for bar graph display.	Signed floating-point number	0
100% bargraph value 3	Enter 100% value for bar graph display.	Signed floating-point number	0
Value 4 display	Select the measured value that is shown on the local display.	Picklist (see 1st display value)	None

10.4.6 Configuring the HART input

The **HART input** submenu contains all the parameters that must be configured for the configuration of the HART input.

Navigation

"Expert" menu → Communication → HART input → Configuration

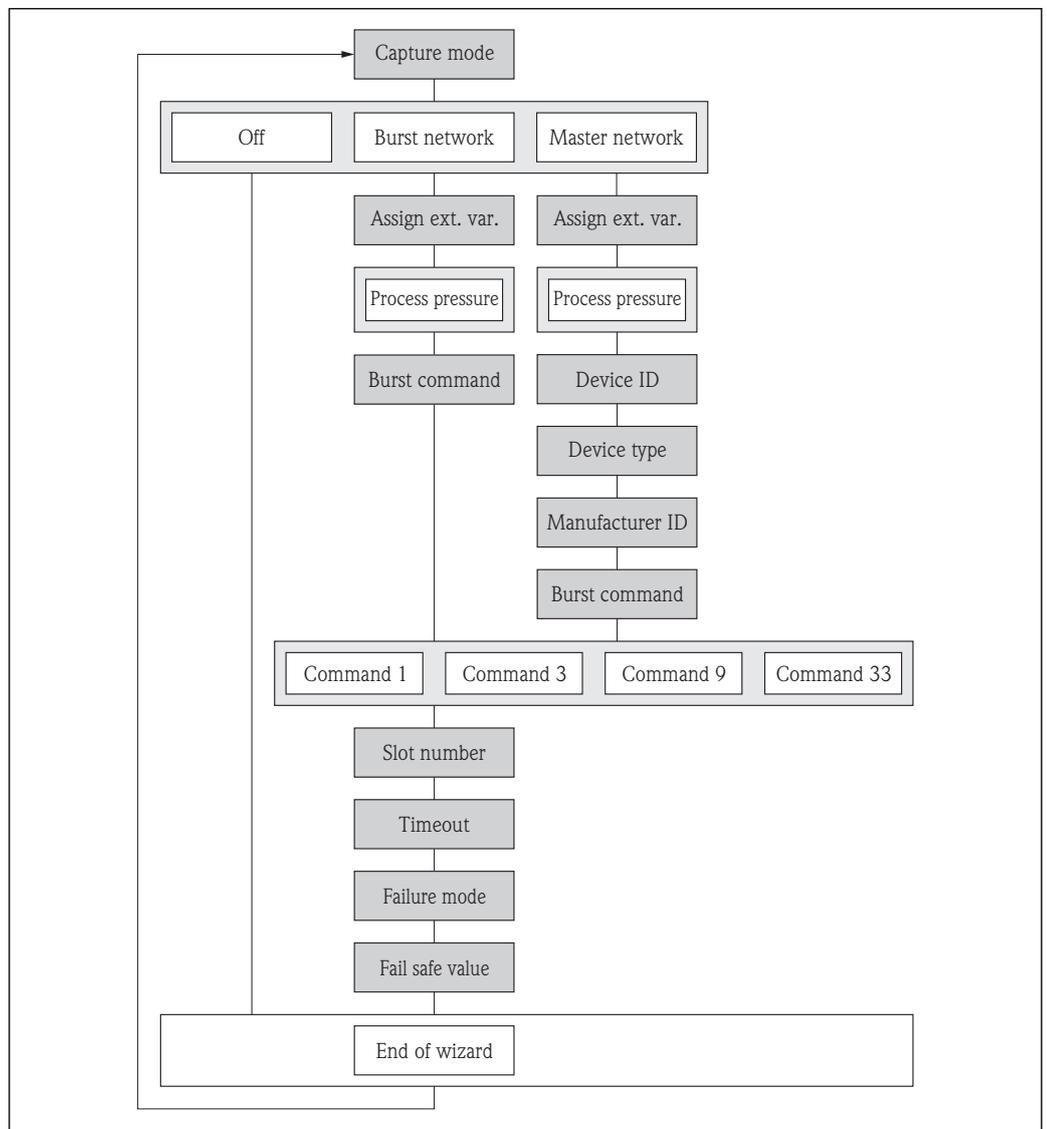

28 "HART input" wizard in the "Setup" menu

Parameter overview with brief description


Parameters	Description	Selection / User entry	Factory setting
Capture mode	Select capture mode via burst or master communication.	<ul style="list-style-type: none"> ▪ Off ▪ Burst network ▪ Master network 	Off
Manufacturer ID	Enter manufacture ID of external device.	0 to 255	0
Device ID	Enter device ID of external device.	Positive integer	0
Device type	Enter device type of external device.	0 to 255	0
Burst command	Select command to read in external process variable.	<ul style="list-style-type: none"> ▪ Command 1 ▪ Command 3 ▪ Command 9 ▪ Command 33 	Command 1
Slot number	Define position of external process variable in burst command.	1 to 4	1
Timeout	Enter deadline for process variable of external device.  If the deadline is exceeded, diagnostic message F410 data transmission is output.	1 to 120 s	5 s
Failure mode	Define behavior if external process variable is missed.	<ul style="list-style-type: none"> ▪ Alarm ▪ Last valid value ▪ Defined value 	Alarm
Failure value	Enter value to be used by the device if input value from external device is missing.	Signed floating-point number	0

10.4.7 Configuring the output conditioning

Navigation

"Setup" menu → Output conditioning

Structure of the wizard

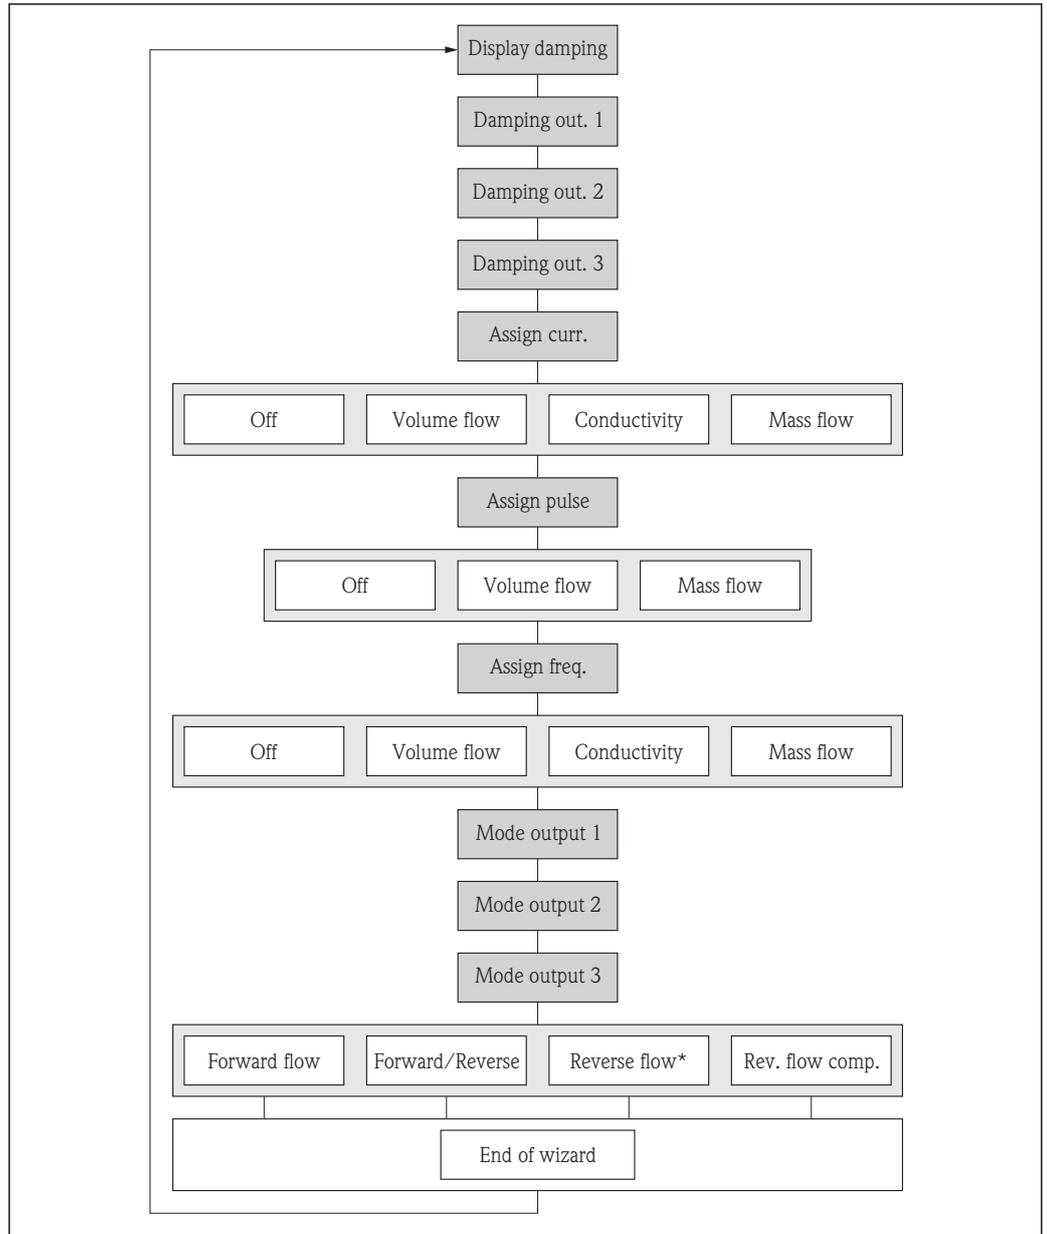

A0017459-EN

29 "Output conditioning" wizard in the "Setup" menu

Reverse flow = option only for pulse and frequency output*

Parameter overview with brief description

Parameters	Description	User entry / Selection	Factory setting
Display damping	Set display reaction time to fluctuations in the measured value.	0.0 to 999.9 s	0.0 s
Damping output	Set reaction time for output signal to fluctuations in the measured value.	0 to 999.9 s	1 s
Damping output	Set reaction time for output signal to fluctuations in the measured value.	0 to 999.9 s	1 s

Parameters	Description	User entry / Selection	Factory setting
Assign current output	Select process variable for current output.	<ul style="list-style-type: none"> ■ Off ■ Volume flow ■ Mass flow ■ Flow velocity ■ Conductivity ■ Electronic temperature 	Volume flow
Assign pulse output	Select process variable for pulse output.	<ul style="list-style-type: none"> ■ Off ■ Volume flow ■ Mass flow 	Off
Assign frequency output	Select process variable for frequency output.	<ul style="list-style-type: none"> ■ Off ■ Volume flow ■ Mass flow ■ Flow velocity ■ Conductivity ■ Electronic temperature 	Off
Measuring mode output	Select measuring mode for output.	<ul style="list-style-type: none"> ■ Forward flow ■ Forward/Reverse flow ■ Reverse flow compensation 	Forward flow
Measuring mode output	Select measuring mode for output.	<ul style="list-style-type: none"> ■ Forward flow ■ Forward/Reverse flow ■ Reverse flow ■ Reverse flow compensation 	Forward flow
Measuring mode output	Select measuring mode for output.	<ul style="list-style-type: none"> ■ Forward flow ■ Forward/Reverse flow ■ Reverse flow ■ Reverse flow compensation 	Forward flow


10.4.8 Configuring the low flow cut off

The **Low flow cut off** wizard guides you systematically through all the parameters that have to be set for configuring the low flow cut off.

Navigation

"Setup" menu → Low flow cut off

Structure of the wizard

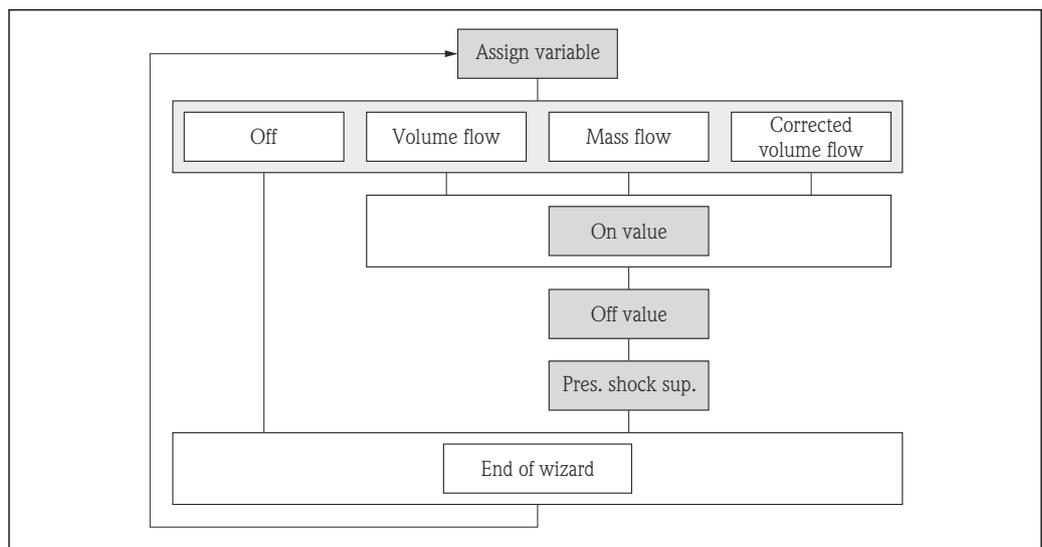

A0020524-EN

30 "Low flow cut off" wizard in the "Setup" menu

Parameter overview with brief description

Parameters	Description	Selection / User entry	Factory setting
Assign process variable	Select process variable for low flow cut off.	<ul style="list-style-type: none"> ■ Off ■ Volume flow ■ Mass flow 	Volume flow
On value low flow cutoff	Enter on value for low flow cut off.	Signed floating-point number	0 l/h
Off value low flow cutoff	Enter off value for low flow cut off.	0 to 100.0 %	50 %
Pressure shock suppression	Enter time frame for signal suppression (= active pressure shock suppression).	0 to 100 s	0 s


10.4.9 Configuring empty pipe detection

The **Empty pipe detection** wizard guides you systematically through all the parameters that have to be set for configuring the low flow cut off.

Navigation

"Setup" menu → Empty pipe detection

Structure of the wizard

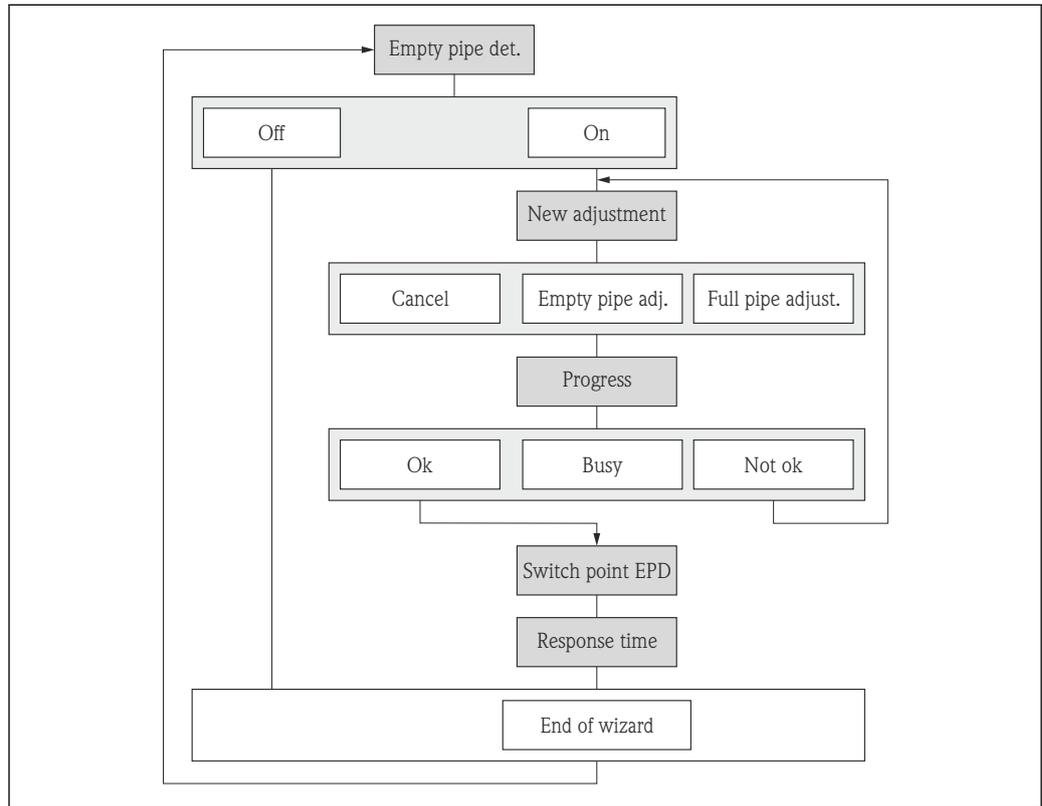


31 "Empty pipe detection" wizard in the "Setup" menu

Parameter overview with brief description

Parameters	Description	Selection / User interface / User entry	Factory setting
Empty pipe detection	Switch empty pipe detection on and off.	<ul style="list-style-type: none"> ■ Off ■ On 	Off
New adjustment	Select type of adjustment.	<ul style="list-style-type: none"> ■ Cancel ■ Empty pipe adjust ■ Full pipe adjust 	Cancel
Progress		<ul style="list-style-type: none"> ■ Ok ■ Busy ■ Not ok 	
Switch point empty pipe detection	Enter hysteresis in %, below this value the measuring tube will detected as empty.	0 to 100 %	50 %
Response time empty pipe detection	Enter the time before diagnostic message S862 "Pipe empty" is displayed for empty pipe detection.	0 to 100 s	1 s

Structure of the wizard

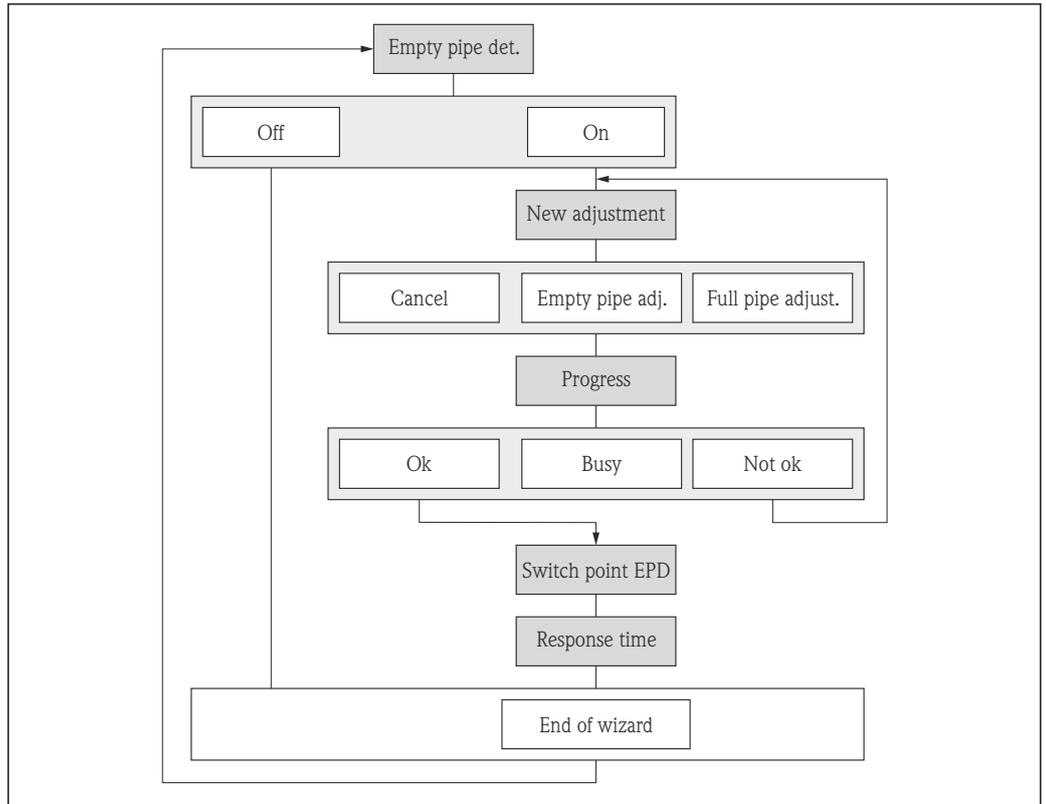

A0017210-EN


32 "Empty pipe detection" wizard in the "Setup" menu

10.5 Advanced settings

The **Advanced setup** submenu with its submenus contains parameters for specific settings.

"Setup" menu → Advanced setup


Navigation to the "Advanced setup" submenu

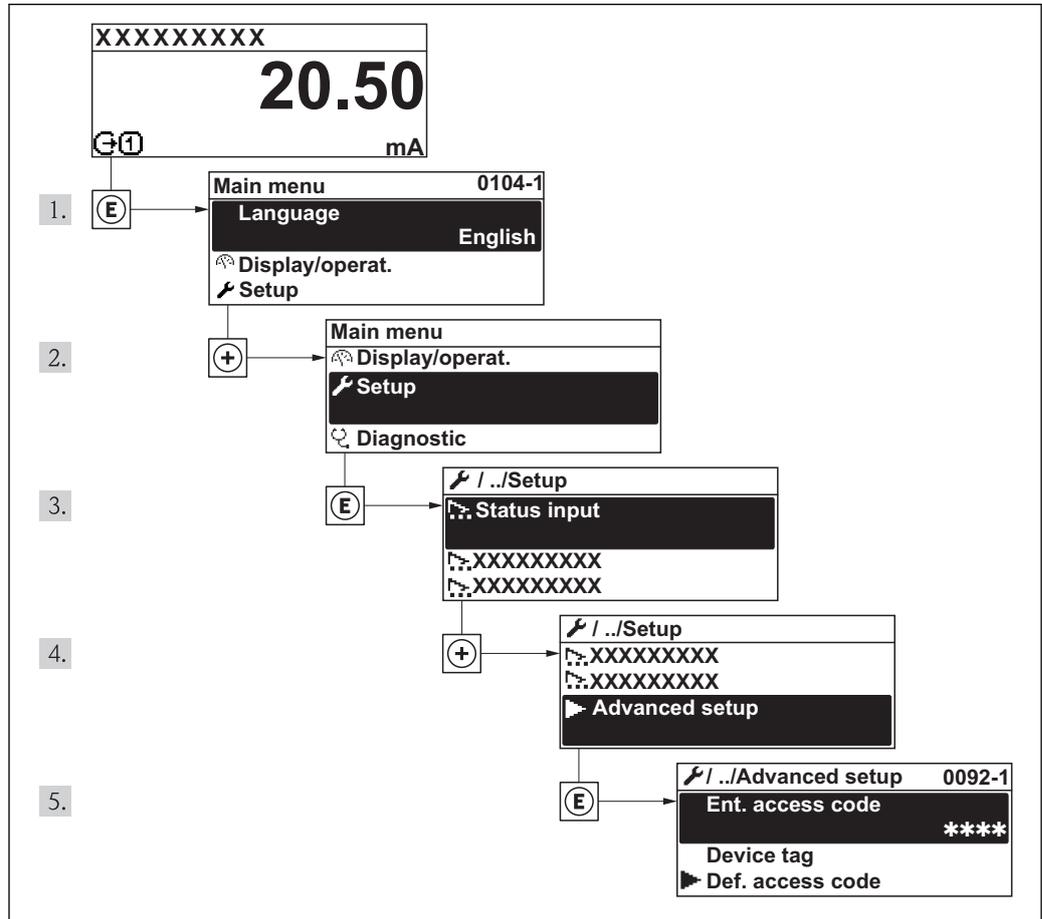

A0017519-EN

33 Illustrated using the example of the local display

Overview of the parameters and submenus in the "Advanced setup" menu

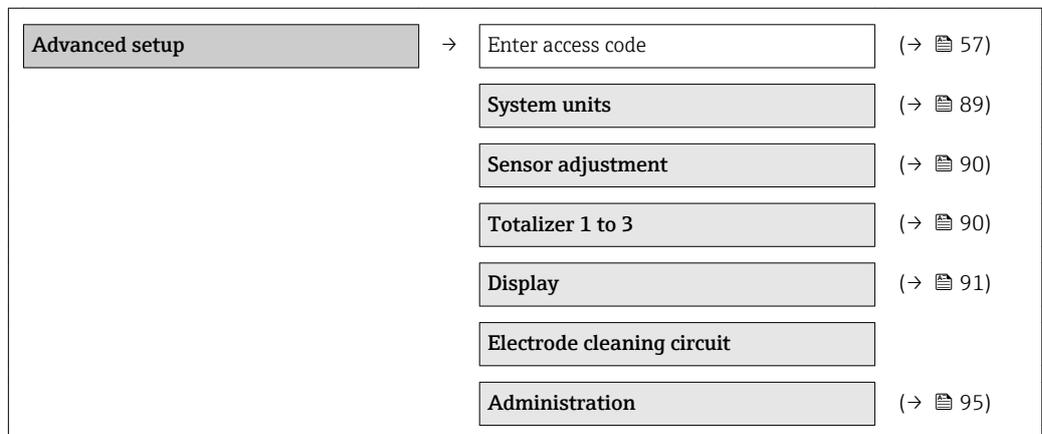


10.5.1 Setting the system units

In the **System units** submenu the units of all the measured values can be set.

Navigation

"Setup" menu → System units

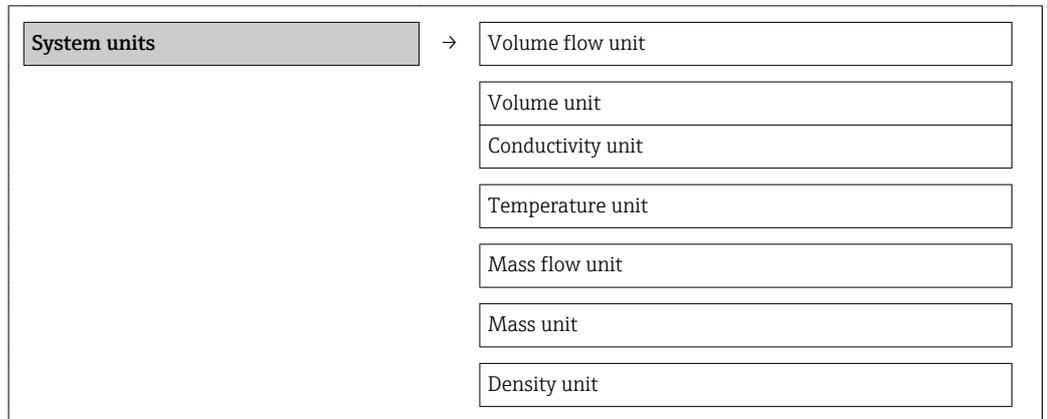

Parameter overview with brief description

Parameters	Description	Selection	Factory setting
Volume flow unit	Select volume flow unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ▪ Output ▪ Low flow cut off ▪ Simulation process variable 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ l/h ▪ gal/min (us)
Volume unit	Select volume unit. Result The selected unit is taken from: Volume flow unit parameter	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ l ▪ gal (us)
Temperature unit	Select temperature unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ▪ Output ▪ Reference temperature ▪ Simulation process variable 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ °C (Celsius) ▪ °F (Fahrenheit)
Mass flow unit	Select mass flow unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ▪ Output ▪ Low flow cut off ▪ Simulation process variable 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ kg/h ▪ lb/min
Mass unit	Select mass unit. <i>Result</i> The selected unit is taken from: Mass flow unit parameter	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ kg ▪ lb
Density unit	Select density unit. <i>Result</i> The selected unit applies for: <ul style="list-style-type: none"> ▪ Output ▪ Simulation process variable ▪ Density adjustment (in Expert menu) 	Unit choose list	Country-specific: <ul style="list-style-type: none"> ▪ kg/l ▪ lb/ft³

10.5.2 Carrying out a sensor adjustment

The **Sensor adjustment** submenu contains parameters that pertain to the functionality of the sensor.

Navigation

"Setup" menu → Advanced setup → Sensor adjustment

Structure of the submenu



Parameter overview with brief description


Parameters	Description	Selection	Factory setting
Installation direction	Set sign of flow direction to match the direction of the arrow on the sensor.	<ul style="list-style-type: none"> ▪ Flow in arrow direction ▪ Flow against arrow direction 	Flow in arrow direction

10.5.3 Configuring the totalizer

In the **"Totalizer 1 to 3"** submenu the individual totalizers can be configured.

Navigation

"Setup" menu → Advanced setup → Totalizer 1 to 3

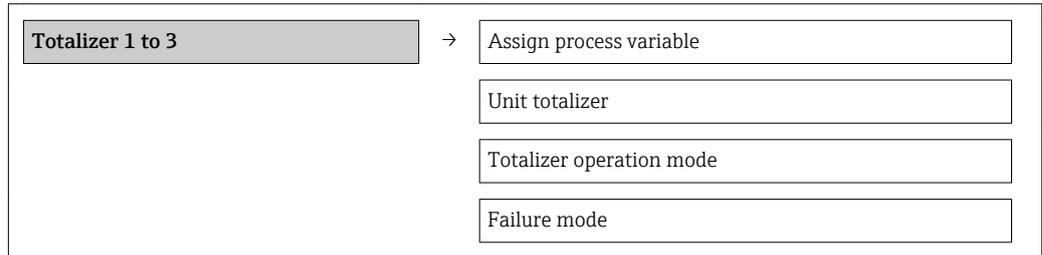

Parameter overview with brief description

Parameters	Description	Selection	Factory setting
Assign process variable	Select process variable for totalizer.	<ul style="list-style-type: none"> ▪ Off ▪ Volume flow ▪ Mass flow 	Volume flow
Unit totalizer	Select process variable totalizer unit.	Unit choose list	1
Totalizer operation mode	Select totalizer calculation mode.	<ul style="list-style-type: none"> ▪ Net flow total ▪ Forward flow total ▪ Reverse flow total 	Net flow total
Failure mode	Define totalizer behavior in alarm condition.	<ul style="list-style-type: none"> ▪ Stop ▪ Actual value ▪ Last valid value 	Stop

10.5.4 Carrying out additional display configurations

In the **"Display"** submenu you can set all the parameters involved in the configuration of the local display.

Navigation

"Setup" menu → Advanced setup → Display

Structure of the submenu

Display	→	Format display
		Value 1 display
		0% bargraph value 1
		100% bargraph value 1
		Decimal places 1
		Value 2 display
		Decimal places 2
		Value 3 display
		0% bargraph value 3
		100% bargraph value 3
		Decimal places 3
		Value 4 display
		Decimal places 4
		Language
		Display interval
		Display damping
		Header
		Header text
		Separator
		Backlight

Parameter overview with brief description

Parameters	Description	Selection / User entry	Factory setting
Format display	Select how measured values are shown on the display.	<ul style="list-style-type: none"> ▪ 1 value, max. size ▪ 1 bargraph + 1 value ▪ 2 values ▪ 1 value large + 2 values ▪ 4 values 	1 value, max. size
Value 1 display	Select the measured value that is shown on the local display.	<ul style="list-style-type: none"> ▪ Volume flow ▪ Mass flow ▪ Conductivity ▪ Totalizer 1 ▪ Totalizer 2 ▪ Totalizer 3 ▪ Current output 1 	Volume flow
0% bargraph value 1	Enter 0% value for bar graph display.	Signed floating-point number	0 l/h
100% bargraph value 1	Enter 100% value for bar graph display.	Signed floating-point number	1 l/h
Decimal places 1	Select the number of decimal places for the display value.	<ul style="list-style-type: none"> ▪ x ▪ x.x ▪ x.xx ▪ x.xxx ▪ x.xxxx 	x.xx
Value 2 display	Select the measured value that is shown on the local display.	Picklist (see 1st display value)	None
Decimal places 2	Select the number of decimal places for the display value.	<ul style="list-style-type: none"> ▪ x ▪ x.x ▪ x.xx ▪ x.xxx ▪ x.xxxx 	x.xx
Value 3 display	Select the measured value that is shown on the local display.	Picklist (see 1st display value)	None
0% bargraph value 3	Enter 0% value for bar graph display.	Signed floating-point number	0
100% bargraph value 3	Enter 100% value for bar graph display.	Signed floating-point number	0
Decimal places 3	Select the number of decimal places for the display value.	<ul style="list-style-type: none"> ▪ x ▪ x.x ▪ x.xx ▪ x.xxx ▪ x.xxxx 	x.xx
Value 4 display	Select the measured value that is shown on the local display.	Picklist (see 1st display value)	None
Decimal places 4	Select the number of decimal places for the display value.	<ul style="list-style-type: none"> ▪ x ▪ x.x ▪ x.xx ▪ x.xxx ▪ x.xxxx 	x.xx

Parameters	Description	Selection / User entry	Factory setting
Display language	Set display language.	<ul style="list-style-type: none"> ▪ English ▪ Deutsch ▪ Français ▪ Español ▪ Italiano ▪ Nederlands ▪ Portuguesa ▪ Polski ▪ русский язык (Russian) ▪ Svenska ▪ Türkçe ▪ 中文 (Chinese) ▪ 日本語 (Japanese) ▪ 한국어 (Korean) ▪ العربية (Arabic) ▪ Bahasa Indonesia ▪ ภาษาไทย (Thai) ▪ tiếng Việt (Vietnamese) ▪ čeština (Czech) 	English
Display interval	Set time measured values are shown on display if display alternates between values.	1 to 10 s	5 s
Display damping	Set display reaction time to fluctuations in the measured value.	0.0 to 999.9 s	0.0 s
Header	Select header contents on local display.	Enter display header text.	Device tag
Header text	Enter display header text.		-----
Separator	Select decimal separator for displaying numerical values.	<ul style="list-style-type: none"> ▪ . ▪ , 	.
Backlight	Switch the local display backlight on and off.	<ul style="list-style-type: none"> ▪ Disable ▪ Enable 	Disable


10.6 Simulation

The **"Simulation"** submenu enables you to simulate, without a real flow situation, various process variables in the process and the device alarm mode and to verify downstream signal chains (switching valves or closed-control loops).

-  The parameters displayed depend on:
- The selected device order
 - The set operating mode of the pulse/frequency/switch outputs (→  72)

Navigation

"Diagnostics" menu → Simulation

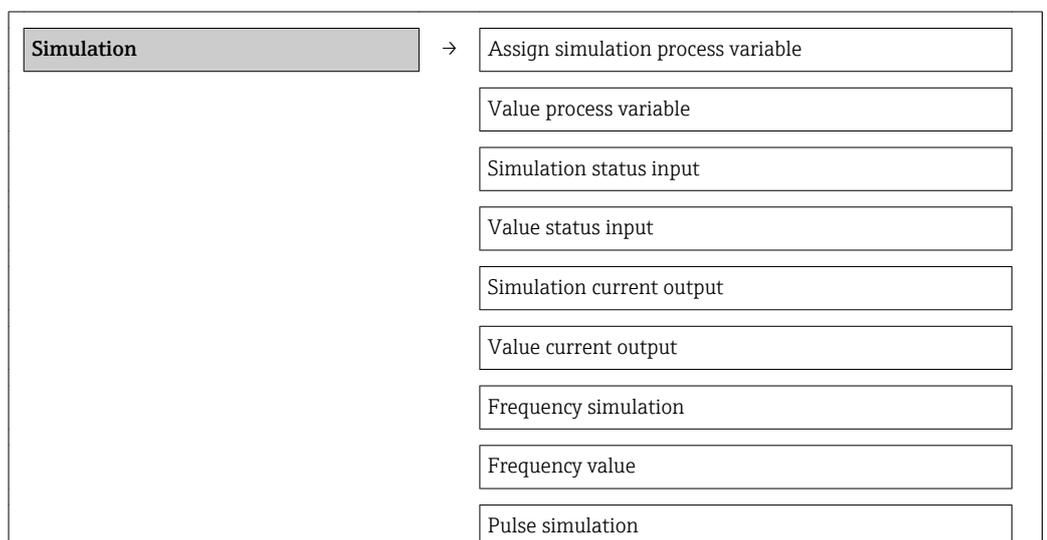

Pulse value
Switch output simulation
Switch status
Simulation device alarm
Simulation diagnostic event

Parameter overview with brief description

Parameters	Prerequisite	Description	Selection / User entry	Factory setting
Assign simulation process variable	–	Select a process variable for the simulation process that is activated.	<ul style="list-style-type: none"> ▪ Off ▪ Volume flow ▪ Mass flow ▪ Conductivity 	Off
Value process variable	A process variable is selected in the Assign simulation process variable parameter.	Enter the simulation value for the selected process variable.	Signed floating-point number	0
Simulation status input	–		<ul style="list-style-type: none"> ▪ Off ▪ On 	Off
Value status input	–		<ul style="list-style-type: none"> ▪ High ▪ Low 	High
Simulation current output	–	Switch simulation of the current output on and off.	<ul style="list-style-type: none"> ▪ Off ▪ On 	Off
Value current output	The On option is selected in the Current output simulation parameter.	Enter the current value for simulation.	3.59 ⁻³ to 22.5 ⁻³ mA	3.59 mA
Frequency simulation	–	Switch simulation of the frequency output on and off.	<ul style="list-style-type: none"> ▪ Off ▪ On 	Off
Frequency value	The On option is selected in the Frequency output simulation parameter.	Enter the frequency value for simulation.	0.0 to 12 500.0 Hz	0.0 Hz
Pulse simulation	The Down-count. val. option is selected in the Simulation pulse output parameter.	Switch simulation of the pulse output on and off.  If the Fixed value option is selected, the Pulse width parameter defines the pulse width of the pulses output.	<ul style="list-style-type: none"> ▪ Off ▪ Fixed value ▪ Down-counting value 	Off
Pulse value	The Down-count. val. option is selected in the Simulation pulse output parameter.	Enter the number of pulses for simulation.	0 to 65 535	0
Switch output simulation	–	Switch simulation of switch output on and off.	<ul style="list-style-type: none"> ▪ Off ▪ On 	Off
Switch status	The On option is selected in the Switch output simulation parameter.	Select the status of the status output for the simulation.	<ul style="list-style-type: none"> ▪ Open ▪ Closed 	Open
Simulation device alarm	–	Switch the device alarm on and off.	<ul style="list-style-type: none"> ▪ Off ▪ On 	Off
Simulation diagnostic event	–	Enter the diagnostic number for the diagnostic event.	Positive integer	65 533

10.7 Protecting settings from unauthorized access

The following options exist for protecting the configuration of the measuring device from unintentional modification after commissioning:

- Write protection via access code for the local display and Web browser (→ 95)
- Write protection via write protection switch (→ 96)
- Write protection via keypad lock (→ 57)

10.7.1 Write protection via access code


The effects of the customer-specific access code are as follows:

- Via local operation, the parameters for the measuring device configuration are write-protected and their values can no longer be changed.
- Device access via the Web browser is protected, as are the parameters for the measuring device configuration.

Navigation

"Setup" menu → Advanced setup → Administration → Define access code

Structure of the submenu

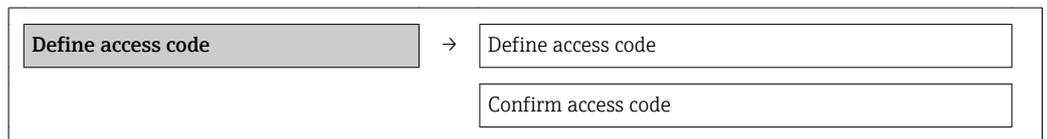

Defining the access code via local display


1. Navigate to the **"Enter access code" parameter**.
2. Define a max. 4-digit numeric code as an access code.
3. Enter the access code again to confirm the code.
 - ↳ The -symbol appears in front of all write-protected parameters.

The device automatically locks the write-protected parameters again if a key is not pressed for 10 minutes in the navigation and editing view. The device locks the write-protected parameters automatically after 60 s if the user skips back to the operational display mode from the navigation and editing view.

- If write access is activated via access code, it can be also be deactivated only via the access code (→ 57).
- The user role with which the user is currently logged on via the local display (→ 57) is indicated by the **"Access status display" parameter**. Navigation path: Operation → Access status display

Parameters which can always be modified via the local display

Certain parameters that do not affect the measurement are excepted from write protection via the local display. Despite the defined access code, these parameters can always be modified even if the other parameters are locked.

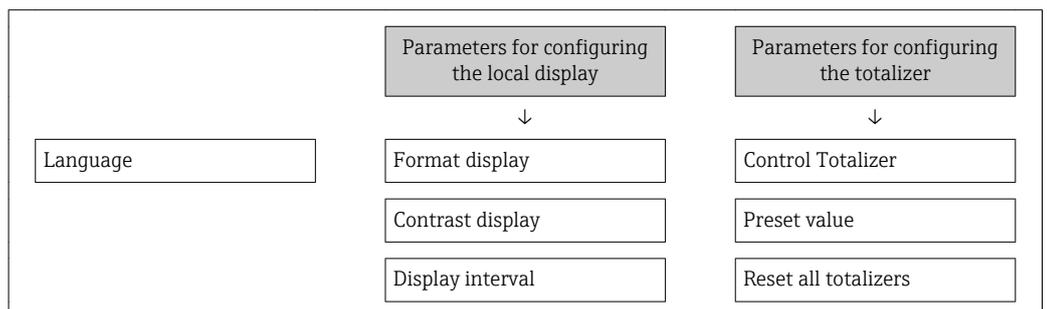

Defining the access code via the Web browser

1. Navigate to the **"Enter access code" parameter**.
2. Define a max. 4-digit numeric code as an access code.
3. Enter the access code again to confirm the code.
 - ↳ The Web browser switches to the login page.

i If no action is performed for 10 minutes, the Web browser automatically returns to the login page.


i The user role with which the user is currently logged on via the Web browser is indicated by the **Access status tooling** parameter. Navigation path: Operation → Access status tooling

10.7.2 Write protection via write protection switch

Unlike write protection via user-specific access code, this allows write access to the entire operating menu - other than the **"Contrast display" parameter** - to be locked.


The parameter values are now read only and cannot be edited any more (exception **"Contrast display" parameter**):

- Via local display
- Via service interface (CDI-RJ45)
- Via HART protocol

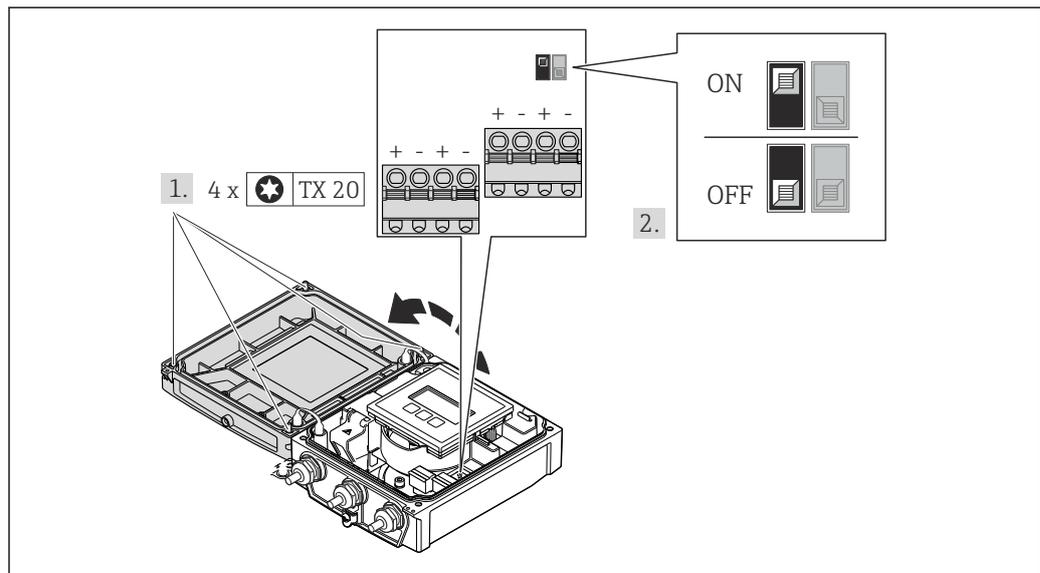

A0017260

1. Loosen the 4 fixing screws on the housing cover and open the housing cover.
2. Setting the write protection switch (WP) on the main electronics module to the ON position enables the hardware write protection. Setting the write protection switch (WP) on the main electronics module to the OFF position (factory setting) disables the hardware write protection.
 - ↳ If hardware write protection is enabled, the **Hardware locked** option is displayed in the **Locking status** parameter (→ 98). In addition, on the local display the **🔒**-symbol appears in front of the parameters in the header of the operational display and in the navigation view.

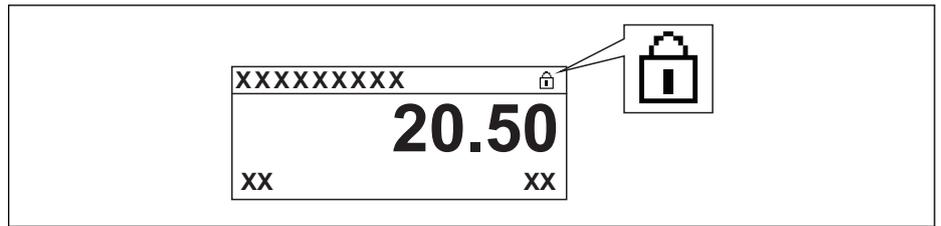

A0015870

If hardware write protection is disabled, no option is displayed in the **Locking status** parameter (→  98). On the local display, the -symbol disappears from in front of the parameters in the header of the operational display and in the navigation view.

- 3. WARNING!** Excessive tightening torque applied to the fixing screws! Risk of damaging the plastic transmitter. Tighten the fixing screws as per the tightening torque (→  27).

Reverse the removal procedure to reassemble the transmitter.

11 Operation

11.1 Reading device locking status

The write protection types that are currently active can be determined using the **"Locking status" parameter**.

"Operation" menu → Locking status

Function scope of "Locking status" parameter

Options	Description
None	The access status displayed in "Access status display" parameter applies (→  57). Only appears on local display.
Hardware locked	The DIP switch for hardware locking is activated on the main electronics module. This prevents write access to the parameters (→  96).
Temporarily locked	Write access to the parameters is temporarily locked on account of internal processes running in the device (e.g. data upload/download, reset etc). Once the internal processing has been completed, the parameters can be changed once again.

11.2 Adjusting the operating language

Information (→  68)

 For information on the operating languages supported by the measuring device (→  142)

11.3 Configuring the display

- Basic settings for local display (→  79)
- Advanced settings for local display (→  91)

11.4 Reading measured values

Using the **Measured values** submenu, it is possible to read all the measured values.

"Diagnostics" menu → Measured values


11.4.1 Process variables

The **Process variables** submenu contains all the parameters needed to display the current measured values for every process variable.

Navigation

"Diagnostics" menu → Measured values → Process variables

Structure of the submenu

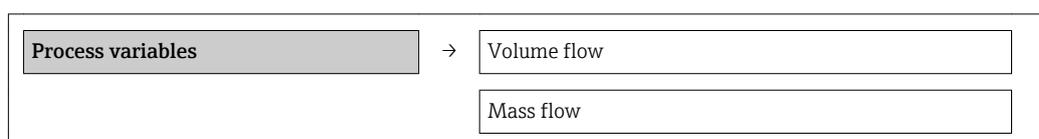

Structure of the submenu

Parameter overview with brief description

Parameters	Description	User interface
Volume flow	Displays the volume flow currently measured.	Signed floating-point number
Mass flow	Displays the mass flow currently calculated.	Signed floating-point number


11.4.2 Totalizer

The "**Totalizer**" submenu contains all the parameters needed to display the current measured values for every totalizer.

Navigation

"Diagnostics" menu → Measured values → Totalizer

Structure of the submenu

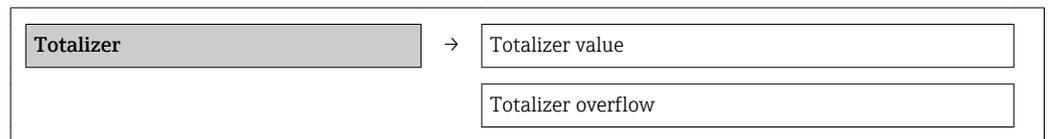

Parameter overview with brief description

Parameters	Prerequisite	Description	User interface	Factory setting
Totalizer value	In the Assign process variable parameter of the Totalizer 1 to 3 submenu one of the following options is selected: <ul style="list-style-type: none"> ▪ Volume flow ▪ Corrected volume flow ▪ Mass flow ▪ Total mass flow ▪ Condensate mass flow ▪ Energy flow ▪ Heat flow difference 	Displays the current totalizer counter value.	Signed floating-point number	01
Totalizer overflow	In the Assign process variable parameter of the Totalizer 1 to 3 submenu one of the following options is selected: <ul style="list-style-type: none"> ▪ Volume flow ▪ Corrected volume flow ▪ Mass flow ▪ Total mass flow ▪ Condensate mass flow ▪ Energy flow ▪ Heat flow difference 	Displays the current totalizer overflow.	-32 000.0 to 32 000.0	0

11.4.3 Input values


The "**Input values**" submenu guides you systematically to the individual input values.

 The submenu only appears if the device was ordered with a status input .

Navigation

"Diagnostics" menu → Measured values → Input values

Structure of the submenu

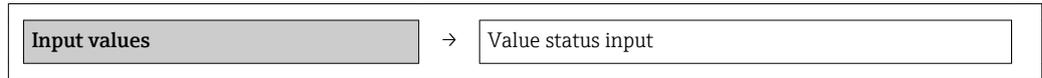

Parameter overview with brief description

Parameters	Description	User interface	Factory setting
Value status input	Displays the current input signal level.	<ul style="list-style-type: none"> ■ High ■ Low 	Low

11.4.4 Output values


The "Output values" submenu contains all the parameters needed to display the current measured values for every output.

-  The parameters displayed depend on:
- The selected device order
 - The set operating mode of the pulse/frequency/switch outputs (→  72)

Navigation

"Diagnostics" menu → Measured values → Output values

Structure of the submenu

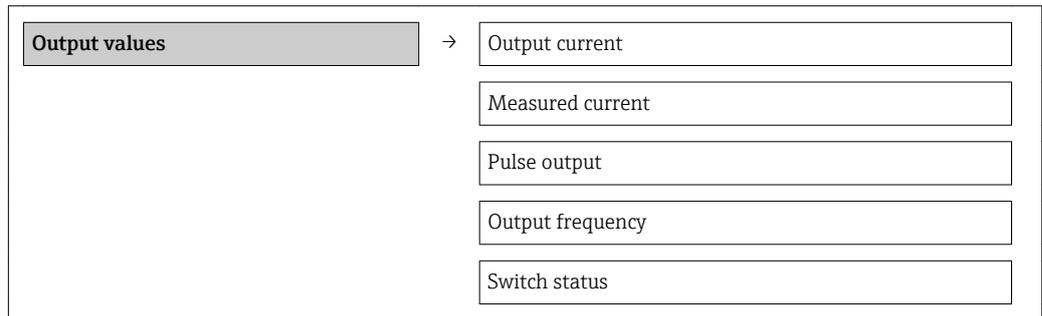

Parameter overview with brief description

Parameters	Description	User interface	Factory setting
Output current	Displays the current value currently calculated for the current output.	3.59 to 22.5 mA	3.59 mA
Measured current	Displays the current value currently measured for the current output.	0 to 30 mA	0 mA
Pulse output	Displays the value currently measured for the pulse output.	Positive floating-point number	0 Hz
Output frequency	Displays the value currently measured for the frequency output.	0.0 to 12 500.0 Hz	0.0 Hz
Switch status	Displays the current switch output status.	<ul style="list-style-type: none"> ■ Open ■ Closed 	Open

11.5 Adapting the measuring device to the process conditions

The following are available for this purpose:

- Basic settings using the **Setup** menu(→ 68)
- Advanced settings using the **Advanced setup** submenu(→ 88)

11.6 Performing a totalizer reset


In the **Operation** submenu the totalizers are reset:

- Control Totalizer
- Reset all totalizers
- Reset all totalizers

Navigation

"Operation" menu → Operation

Structure of the submenu

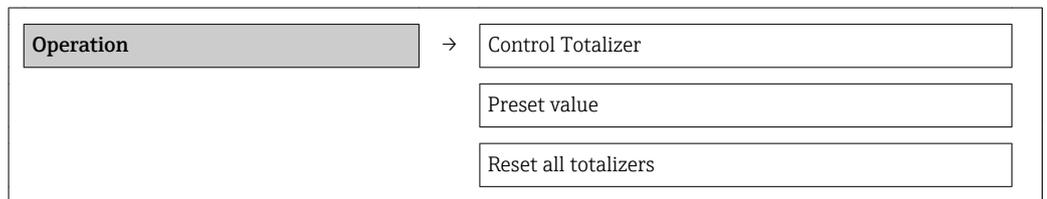

Parameter overview with brief description

Parameters	Description	Selection / User entry	Factory setting
Control Totalizer	Control totalizer value.	<ul style="list-style-type: none"> ■ Totalize ■ Reset + hold ■ Preset + hold ■ Reset + totalize ■ Preset + totalize 	Totalize
Preset value	Specify start value for totalizer.	Signed floating-point number	0 l
Reset all totalizers	Reset all totalizers to 0 and start.	<ul style="list-style-type: none"> ■ Cancel ■ Reset + totalize 	Cancel

11.6.1 Function scope of "Control Totalizer " parameter

Options	Description
Totalize	The totalizer is started.
Reset + hold	The totaling process is stopped and the totalizer is reset to 0.
Preset + hold	The totaling process is stopped and the totalizer is set to its defined start value from the Preset value parameter.
Reset + totalize	The totalizer is reset to 0 and the totaling process is restarted.
Preset + totalize	The totalizer is set to the defined start value in Preset value parameter and the totaling process is restarted.

11.6.2 Function scope of "Reset all totalizers" parameter


Options	Description
Reset + totalize	Resets all totalizers to 0 and restarts the totaling process. This deletes all the flow values previously totalized.

11.7 Showing data logging

In the device, the extended function of the HistoROM must be enabled (order option) so that the "Data logging" submenu appears. This contains all the parameters for the measured value history.

Function scope

- A total of 1000 measured values can be stored
- 4 logging channels
- Adjustable logging interval for data logging
- Display of the measured value trend for each logging channel in the form of a chart

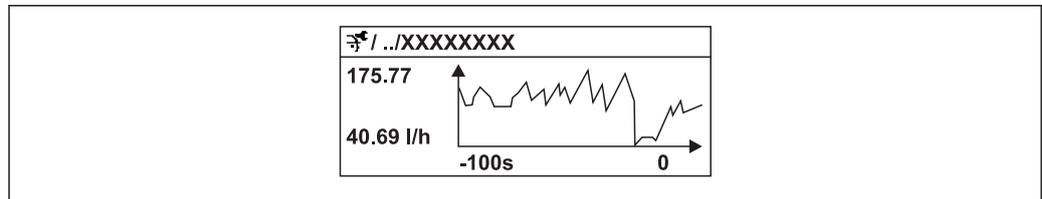

34 Chart of a measured value trend

- x-axis: depending on the number of channels selected displays 250 to 1000 measured values of a process variable.
- y-axis: displays the approximate measured value span and constantly adapts this to the ongoing measurement.

 If the length of the logging interval or the assignment of the process variables to the channels is changed, the content of the data logging is deleted.

Navigation

"Diagnostics" menu → Data logging

"Data logging" submenu

Data logging	→	Assign channel 1
		Assign channel 2
		Assign channel 3
		Assign channel 4
		Logging interval
		Clear logging data

Parameter overview with brief description

Parameters	Description	Selection / User entry	Factory setting
Assign channel 1	Assign process variable to logging channel.	<ul style="list-style-type: none"> ▪ Off ▪ Volume flow ▪ Mass flow ▪ Conductivity ▪ Electronic temperature ▪ Current output 1 	Off
Assign channel 2	Assign process variable to logging channel.	Picklist (see Assign chan. 1 parameter)	Off
Assign channel 3	Assign process variable to logging channel.	Picklist (see Assign chan. 1 parameter)	Off
Assign channel 4	Assign process variable to logging channel.	Picklist (see Assign chan. 1 parameter)	Off
Logging interval	Define the logging interval for data logging. This value defines the time interval between the individual data points in the memory.	1.0 to 3 600.0 s	10.0 s
Clear logging data	Clear the entire logging data.	<ul style="list-style-type: none"> ▪ Cancel ▪ Clear data 	Cancel

12 Diagnostics and troubleshooting

12.1 General troubleshooting

For local display

Problem	Possible causes	Remedy
Local display dark and no output signals	Supply voltage does not match that specified on the nameplate.	Apply the correct supply voltage (→ 36).
Local display dark and no output signals	No contact between connecting cables and terminals.	Check the connection of the cables and correct if necessary.
Local display dark and no output signals	Terminals are not plugged into the main electronics module correctly.	Check terminals.
Local display dark and no output signals	Main electronics module is defective.	Order spare part (→ 125).
Local display dark and no output signals	The connector between the main electronics module and display module is not plugged in correctly.	Check the connection and correct if necessary.
Local display dark and no output signals	The connecting cable is not plugged in correctly.	1. Check the connection of the electrode cable and correct if necessary. 2. Check the connection of the coil current cable and correct if necessary.
Local display is dark, but signal output is within the valid range	Display is set too bright or too dark.	<ul style="list-style-type: none"> ▪ Set the display brighter by simultaneously pressing \boxplus + \boxminus. ▪ Set the display darker by simultaneously pressing \boxminus + \boxplus.
Local display is dark, but signal output is within the valid range	Display module is defective.	Order spare part (→ 125).
Backlighting of local display is red	Diagnostic event with "Alarm" diagnostic behavior has occurred.	Take remedial measures (→ 115)
Text on local display appears in a foreign language and cannot be understood.	Incorrect operating language is configured.	1. Press \boxminus + \boxplus for 2 s ("home position"). 2. Press \boxminus . 3. Set the desired language in the Language parameter.

For output signals

Problem	Possible causes	Remedy
Signal output outside the valid range	Main electronics module is defective.	Order spare part (→ 125).
Device shows correct value on local display, but signal output is incorrect, though in the valid range.	Configuration error	Check and correct parameter configuration.
Device measures incorrectly.	Configuration error or device is operated outside the application.	1. Check and correct parameter configuration. 2. Observe limit values specified in the "Technical Data".

For access

Problem	Possible causes	Remedy
No write access to parameters	Hardware write protection enabled	Set the write protection switch on the main electronics module to the OFF position (→ 96).
No write access to parameters	Current user role has limited access authorization	1. Check user role (→ 57). 2. Enter correct customer-specific access code (→ 57).
No connection via HART protocol	Missing or incorrectly installed communication resistor.	Install the communication resistor (250 Ω) correctly. Observe the maximum load (→ 130).
No connection via HART protocol	Commubox <ul style="list-style-type: none"> ▪ Connected incorrectly ▪ Configured incorrectly ▪ Drivers not installed correctly ▪ USB interface on computer configured incorrectly 	Observe the documentation for the Commubox.  FXA195 HART: Document "Technical Information" TI00404F
Not connecting to Web server	Incorrect IP address	Check the IP address: 192.168.1.212 (→ 59)
Not connecting to Web server	Incorrect setting for the Ethernet interface of the computer	1. Check the properties of the Internet protocol (TCP/IP) (→ 59). 2. Check the network settings with the IT manager.
Not connecting to Web server	Web server disabled	Via the "FieldCare" operating tool check whether the Web server of the measuring device is enabled and enable it if necessary (→ 61).
No or incomplete display of contents in the Web browser	<ul style="list-style-type: none"> ▪ JavaScript not enabled ▪ JavaScript cannot be enabled 	1. Enable JavaScript. 2. Enter http://192.168.1.212/basic.html as the IP address.
Web browser frozen and operation no longer possible	Data transfer active	Wait until data transfer or current action is finished.
Web browser frozen and operation no longer possible	Connection lost	1. Check cable connection and power supply. 2. Refresh the Web browser and restart if necessary.
Content of Web browser incomplete or difficult to read	Not using optimum version of Web server.	1. Use the correct Web browser version (→ 58). 2. Clear the Web browser cache and restart the Web browser.
Content of Web browser incomplete or difficult to read	Unsuitable view settings.	Change the font size/display ratio of the Web browser.

12.2 Diagnostic information via light emitting diodes

12.2.1 Transmitter

Various light emitting diodes (LEDs) on the main electronics module of the transmitter provide information on device status.


LED	Color	Meaning
Power	Off	Supply voltage is off or too low
	Green	Supply voltage is ok
Link/Activity	Orange	Link available but no activity

LED	Color	Meaning
	Flashing orange	Activity present
Communication	Flashing white	HART communication is active.
Alarm	Green	Measuring device is ok
	Flashing green	Measuring device not configured
	Off	Firmware error
	Red	Main error
	Flashing red	Error
	Flashing red/green	Start measuring device

12.3 Diagnostic information on local display

12.3.1 Diagnostic message

Faults detected by the self-monitoring system of the measuring device are displayed as a diagnostic message in alternation with the operational display.

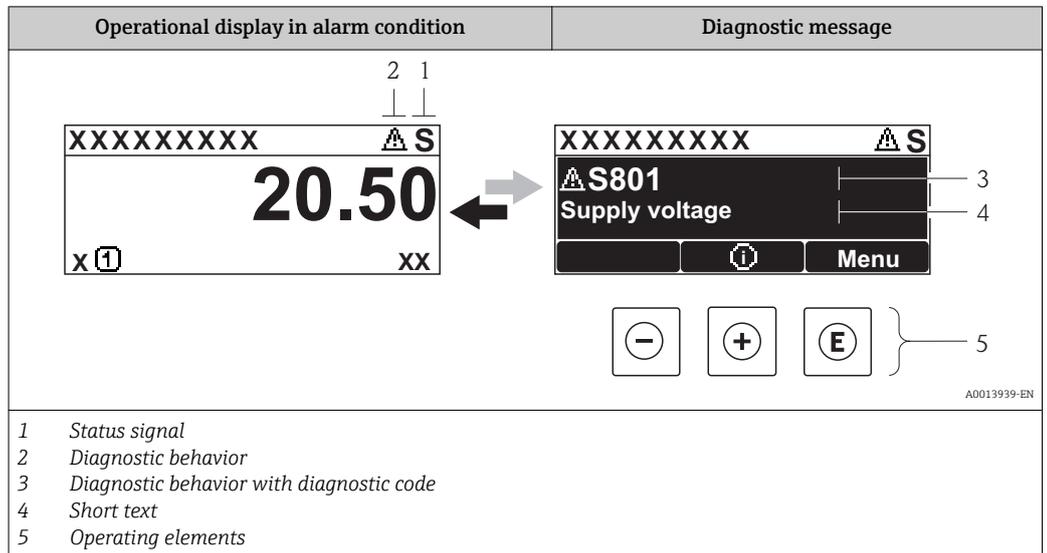

If two or more diagnostic events are pending simultaneously, only the message of the diagnostic event with the highest priority is shown.

- i** Other diagnostic events that have occurred can be called up in the **Diagnostics** menu:
 - Via parameters
 - Via submenus (→ 119)

Status signals

The status signals provide information on the state and reliability of the device by categorizing the cause of the diagnostic information (diagnostic event).

Symbol	Meaning
F <small>A0013956</small>	Failure A device error has occurred. The measured value is no longer valid.
C <small>A0013959</small>	Function check The device is in service mode (e.g. during a simulation).
S <small>A0013958</small>	Out of specification The device is operated: <ul style="list-style-type: none"> ▪ Outside its technical specification limits (e.g. outside the process temperature range) ▪ Outside of the configuration carried out by the user (e.g. maximum flow in parameter 20 mA value)
M <small>A0013957</small>	Maintenance required Maintenance is required. The measured value is still valid.


- i** The status signals are categorized according to VDI/VDE 2650 and NAMUR Recommendation NE 107: F = Failure, C = Function Check, S = Out of Specification, M = Maintenance Required

Diagnostic behavior

Symbol	Meaning
 <small>A0013961</small>	Alarm <ul style="list-style-type: none"> ▪ Measurement is interrupted. ▪ Signal outputs and totalizers assume the defined alarm condition. ▪ A diagnostic message is generated. ▪ The background lighting changes to red.
 <small>A0013962</small>	Warning Measurement is resumed. The signal outputs and totalizers are not affected. A diagnostic message is generated.

Diagnostic information


The fault can be identified using the diagnostic information. The short text helps you by providing information about the fault. In addition, the corresponding symbol for the diagnostic behavior is displayed in front of the diagnostic information on the local display.

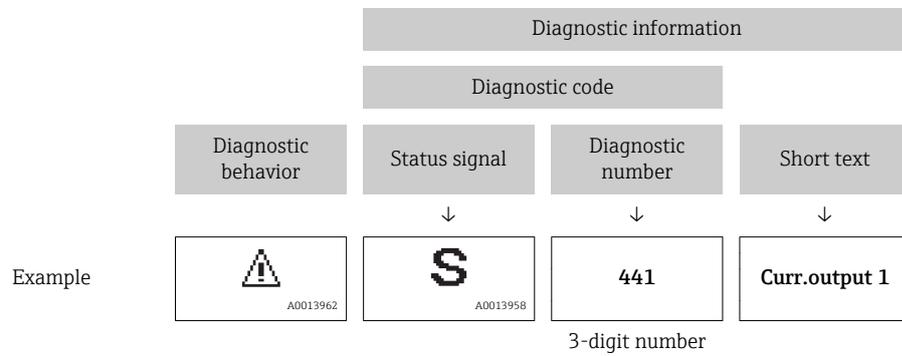

Operating elements

Key	Meaning
 <small>A0013970</small>	Plus key <i>In a menu, submenu</i> Opens the message about the remedial measures.
 <small>A0013952</small>	Enter key <i>In a menu, submenu</i> Opens the operating menu.

12.3.2 Calling up remedial measures

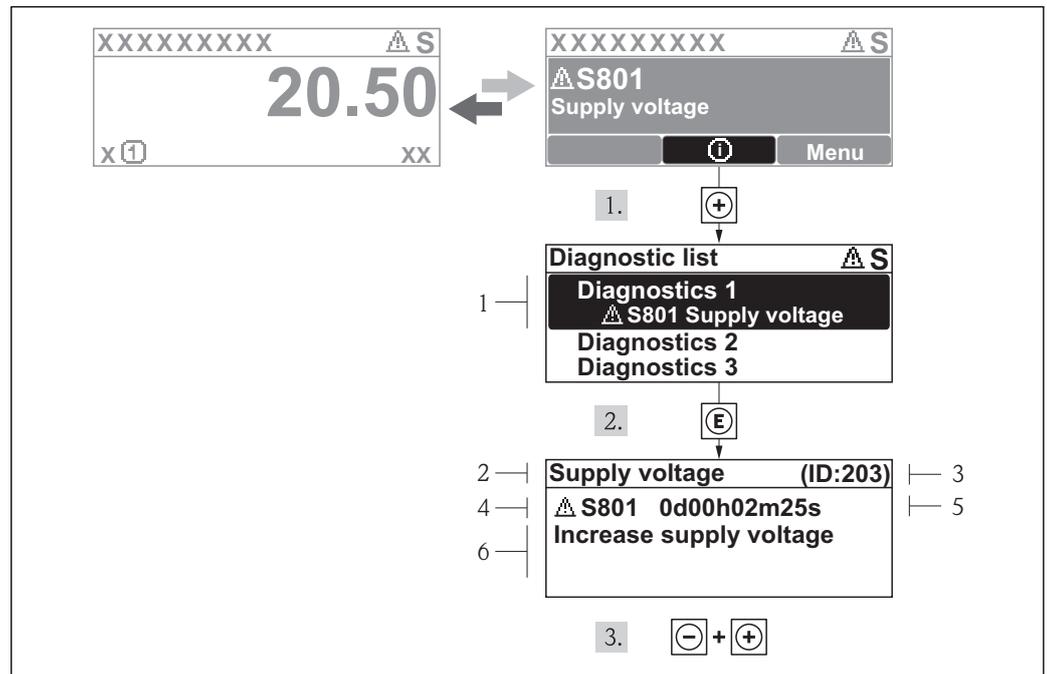

35 Message for remedial measures

- 1 Diagnostic information
- 2 Short text
- 3 Service ID
- 4 Diagnostic behavior with diagnostic code
- 5 Operation time of occurrence
- 6 Remedial measures

The user is in the diagnostic message.

1. Press '+' (i symbol).
 - ↳ The **Diagnostic list** submenu opens.
2. Select the desired diagnostic event with '+' or '-' and press 'E'.
 - ↳ The message for the remedial measures for the selected diagnostic event opens.
3. Press '-' + '+' simultaneously.
 - ↳ The message for the remedial measures closes.

The user is in the **Diagnostics** menu at an entry for a diagnostics event, e.g. in the **Diagnostic list** submenu or the **Previous diagnostics** parameter.

1. Press 'E'.
 - ↳ The message for the remedial measures for the selected diagnostic event opens.
2. Press '-' + '+' simultaneously.
 - ↳ The message for the remedial measures closes.

12.4 Diagnostic information in the Web browser

12.4.1 Diagnostic options

Any faults detected by the measuring device are displayed in the Web browser on the home page once the user has logged on.

1 Status area with status signal
 2 Diagnostic information(→ 108)
 3 Remedial measures with Service ID

- i** Furthermore, diagnostic events that have occurred can be viewed in the **Diagnostics** menu:
 - Via parameters
 - Via submenus (→ 119)

Status signals

The status signals provide information on the state and reliability of the device by categorizing the cause of the diagnostic information (diagnostic event).

Symbol	Meaning
 A0017271	Failure A device error has occurred. The measured value is no longer valid.
 A0017278	Function check The device is in service mode (e.g. during a simulation).
 A0017277	Out of specification The device is operated: <ul style="list-style-type: none"> ▪ Outside its technical specification limits (e.g. outside the process temperature range) ▪ Outside of the configuration carried out by the user (e.g. maximum flow in parameter 20 mA value)
 A0017276	Maintenance required Maintenance is required. The measured value is still valid.

- i** The status signals are categorized in accordance with VDI/VDE 2650 and NAMUR Recommendation NE 107.

12.4.2 Calling up remedy information

Remedy information is provided for every diagnostic event to ensure that problems can be rectified quickly. These measures are displayed in red along with the diagnostic event and the related diagnostic information.

12.5 Diagnostic information in FieldCare

12.5.1 Diagnostic options


Any faults detected by the measuring device are displayed on the home page of the operating tool once the connection has been established.

1 Status area with status signal (→ 107)(→ 110)
 2 Diagnostic information (→ 108)(→ 108)
 3 Remedial measures with Service ID

- Furthermore, diagnostic events that have occurred can be viewed in the **Diagnostics** menu:
 - Via parameters
 - Via submenu (→ 119)

Diagnostic information

The fault can be identified using the diagnostic information. The short text helps you by providing information about the fault. In addition, the corresponding symbol for the diagnostic behavior is displayed in front of the diagnostic information on the local display.

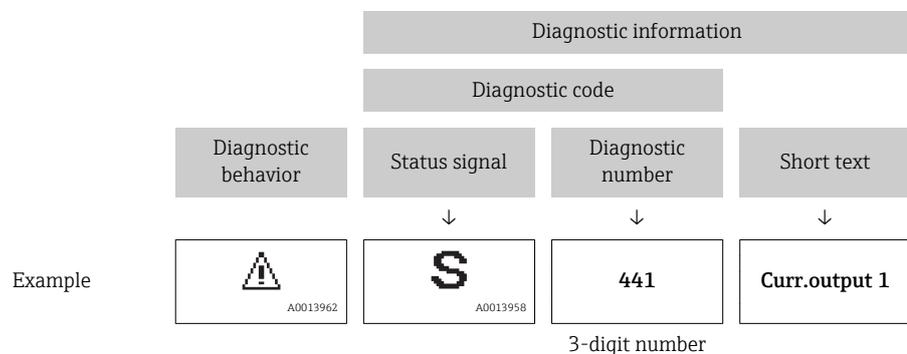

12.5.2 Calling up remedy information

Remedy information is provided for every diagnostic event to ensure that problems can be rectified quickly:

- On the home page
Remedy information is displayed in a separate field below the diagnostics information.
- In the **Diagnostics** menu
Remedy information can be called up in the working area of the user interface.

The user is in the **Diagnostics** menu.

1. Call up the desired parameter.
2. On the right in the working area, mouse over the parameter.
 - ↳ A tool tip with remedy information for the diagnostic event appears.

12.6 Diagnostic information in FieldCare

12.6.1 Diagnostic options

Any faults detected by the measuring device are displayed on the home page of the operating tool once the connection has been established.

The screenshot displays the FieldCare interface. At the top, there are status indicators for 'Device name', 'Device tag', 'Status signal', 'Output current 1', 'Output current 2', 'Mass flow', 'Corrected volume flow', and 'Volume flow'. A 'Status signal' section shows a warning icon and 'Function check (C)'. Below this is a table with columns for 'Menu / Variable', 'Value', and 'Unit'. The 'Diagnostics 1' menu item is selected, showing 'C485 Simulatio...'. To the right, the 'Instrument health status' panel lists various fault types: Failure (F), Function check (C), Out of specification (S), and Maintenance required (M). The 'Function check (C)' section is expanded, showing 'Diagnostics 1' and 'Remedy information: Deactivate simulation (Service ID:147)'. A dropdown menu is open, showing 'C485 Simulation measured variable' and 'Deactivate simulation (Service ID:147)'. Three numbered callouts point to: 1. The status signal area, 2. The diagnostic information section, and 3. The remedial measures with Service ID.


1 Status area with status signal (→ 107)(→ 110)
 2 Diagnostic information (→ 108)(→ 108)
 3 Remedial measures with Service ID

i Furthermore, diagnostic events that have occurred can be viewed in the **Diagnostics** menu:

- Via parameters
- Via submenu (→ 119)

Diagnostic information

The fault can be identified using the diagnostic information. The short text helps you by providing information about the fault. In addition, the corresponding symbol for the diagnostic behavior is displayed in front of the diagnostic information on the local display.

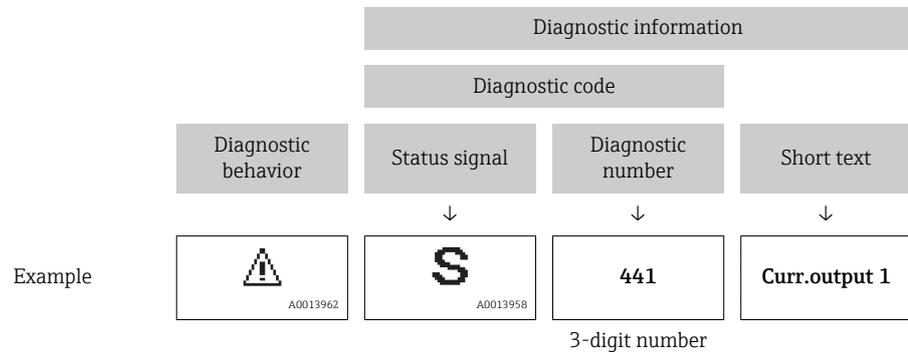

12.6.2 Calling up remedy information

Remedy information is provided for every diagnostic event to ensure that problems can be rectified quickly:

- On the home page
Remedy information is displayed in a separate field below the diagnostics information.
- In the **Diagnostics** menu
Remedy information can be called up in the working area of the user interface.

The user is in the **Diagnostics** menu.


1. Call up the desired parameter.
2. On the right in the working area, mouse over the parameter.
↳ A tool tip with remedy information for the diagnostic event appears.

12.7 Adapting the diagnostic information

12.7.1 Adapting the diagnostic behavior

Each item of diagnostic information is assigned a specific diagnostic behavior at the factory. The user can change this assignment for certain diagnostics information in the **Diagnostic behavior** submenu.

"Expert" menu → System → Diagnostic handling → Diagnostic behavior

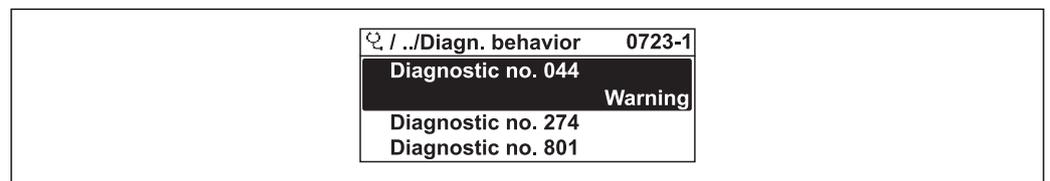

36 Illustrated using the example of the local display

A0014048-EN

You can assign the following options to the diagnostic number as the diagnostic behavior:

Options	Description
Alarm	Measurement is interrupted. Signal outputs and totalizers assume the defined alarm condition. A diagnostic message is generated. The background lighting changes to red.
Warning	Measurement is resumed. The signal outputs and totalizers are not affected. A diagnostic message is generated.
Logbook entry only	The device continues to measure. The diagnostic message is entered in the Event logbook (events list) submenu only and is not displayed in alternation with the measured value display.
Off	The diagnostic event is ignored, and no diagnostic message is generated or entered.

12.8 Overview of diagnostic information

 The amount of diagnostic information and the number of measured variables affected increase if the measuring device has one or more application packages.

Diagnostic number	Short text	Repairing action	Status signal from the factory	Diagnostic behaviour from the factory
Diagnostic of sensor				
004	Sensor defective	1. Check plug connections 2. Change pre-amplifier 3. Change DSC sensor	F	Alarm
022	Temperature sensor defective	1. Check plug connections 2. Change pre-amplifier 3. Change DSC sensor	F	Alarm
046	Sensor limit exceeded	1. Check plug connections 2. Change pre-amplifier 3. Change DSC sensor	S	Warning
062	Sensor connection defective	1. Check plug connections 2. Change pre-amplifier 3. Change DSC sensor	F	Alarm
082	Data storage	1. Change main electronic module 2. Change sensor	F	Alarm
083	Memory content	1. Restart device 2. Restore S-Dat data 3. Change sensor	F	Alarm
114	Sensor leaky	Change DSC sensor	F	Alarm
122	Temperature sensor defective	1. Check plug connections 2. Change pre-amplifier 3. Change DSC sensor	M	Warning
Diagnostic of electronic				
242	Software incompatible	1. Check software 2. Flash or change main electronics module	F	Alarm
252	Modules incompatible	1. Check electronic modules 2. Change I/O or main electronic module	F	Alarm
261	Electronic modules	1. Restart device 2. Check electronic modules 3. Change I/O Modul or main electronics	F	Alarm
262	Module connection	1. Check module connections 2. Change electronic modules	F	Alarm
270	Main electronic failure	Change main electronic module	F	Alarm
271	Main electronic failure	1. Restart device 2. Change main electronic module	F	Alarm
272	Main electronic failure	1. Restart device 2. Contact service	F	Alarm
273	Main electronic failure	1. Emergency operation via display 2. Change main electronics	F	Alarm
275	I/O module failure	Change I/O module	F	Alarm
276	I/O module failure	1. Restart device 2. Change I/O module	F	Alarm
277	Electronics defective	1. Change pre-amplifier 2. Change main electronic module	F	Alarm

Diagnostic number	Short text	Repairing action	Status signal from the factory	Diagnostic behaviour from the factory
282	Data storage	1. Restart device 2. Contact service	F	Alarm
283	Memory content	1. Transfer data or reset device 2. Contact service	F	Alarm
302	Device verification active	Device verification active, please wait.	C	Warning
311	Electronic failure	1. Transfer data or reset device 2. Contact service	F	Alarm
311	Electronic failure	Maintenance required! 1. Do not perform reset 2. Contact service	M	Warning
350	Pre-amplifier defective	Change pre-amplifier	F	Alarm
351	Pre-amplifier defective	Change pre-amplifier	F	Alarm
370	Pre-amplifier defective	1. Check plug connections 2. Check cabel connection of remote version 3. Change pre-amplifier or main electronic module	F	Alarm
371	Temperature sensor defective	1. Check plug connections 2. Change pre-amplifier 3. Change DSC sensor	M	Warning
Diagnostic of configuration				
410	Data transfer	1. Check connection 2. Retry data transfer	F	Alarm
411	Up-/download active	Up-/download active, please wait	C	Warning
431	Trim	Carry out trim	C	Warning
437	Configuration incompatible	1. Restart device 2. Contact service	F	Alarm
438	Dataset	1. Check data set file 2. Check device configuration 3. Up- and download new configuration	M	Warning
441	Current output 1 to 2	1. Check process 2. Check current output settings	S	Warning
442	Frequency output	1. Check process 2. Check frequency output settings	S	Warning
443	Pulse output	1. Check process 2. Check pulse output settings	S	Warning
444	Current input 1	1. Check process 2. Check current input settings	S	Warning
453	Flow override	Deactivate flow override	C	Warning
484	Simulation failure mode	Deactivate simulation	C	Alarm
485	Simulation measured variable	Deactivate simulation	C	Warning
486	Simulation current input 1	Deactivate simulation	C	Warning
491	Simulation current output 1 to 2	Deactivate simulation	C	Warning
492	Simulation frequency output	Deactivate simulation frequency output	C	Warning

Diagnostic number	Short text	Repairing action	Status signal from the factory	Diagnostic behaviour from the factory
493	Simulation pulse output	Deactivate simulation pulse output	C	Warning
494	Switch output simulation	Deactivate simulation switch output	C	Warning
495	Simulation diagnostic event	Deactivate simulation	C	Warning
538	Flow computer configuration incorrect	Check input value (pressure, temperature)	S	Warning
538	Flow computer configuration incorrect	Check entered reference value using the document Operating Instructions	S	Warning
539	Flow computer configuration incorrect	1. Check input value (pressure, temperature) 2. Check allowed values of the medium properties	S	Alarm
539	Flow computer configuration incorrect	Contact service	S	Alarm
570	Inverted delta heat	Check configuration of mounting location (parameter Installation direction)	F	Alarm
Diagnostic of process				
801	Supply voltage too low	Increase supply voltage	S	Warning
803	Current loop	1. Check wiring 2. Change I/O module	F	Alarm
825	Operating temperature	1. Check ambient temperature 2. Check process temperature	F	Alarm
828	Ambient temperature too low	Increase ambient temperature of pre-amplifier	S	Warning
829	Ambient temperature too high	Reduce ambient temperature of pre-amplifier	S	Warning
832	Ambient temperature too high	Reduce ambient temperature	S	Warning
833	Ambient temperature too low	Increase ambient temperature	S	Warning
834	Process temperature too high	Reduce process temperature	S	Warning
835	Process temperature too low	Increase process temperature	S	Warning
841	Flow velocity too high	Reduce flow velocity	S	Warning
842	Process limit	Low flow cut off active! 1. Check low flow cut off configuration	S	Warning
844	Sensor range exceeded	Reduce flow velocity	S	Warning
862	Partly filled pipe	1. Check for gas in process 2. Adjust detection limits	S	Warning
870	Measuring inaccuracy increased	1. Check process 2. Increase flow volume	S	Warning
871	Near steam saturation limit	Check process conditions	S	Warning
872	Wet steam detected	1. Check process 2. Check plant	S	Warning
873	No steam detected	Check process (water in piping)	S	Warning

Diagnostic number	Short text	Repairing action	Status signal from the factory	Diagnostic behaviour from the factory
874	Wet steam detection uncertain	1. Check pressure, temperature 2. Check flow velocity 3. Check for flow fluctuation	S	Warning
882	Input signal	1. Check input configuration 2. Check pressure sensor or process conditions	F	Alarm
945	Sensor range exceeded	Check immediately process conditions (pressure-temperature rating)	S	Warning
946	Vibration detected	Check installation	S	Warning
947	Vibration exceeded	Check installation	S	Alarm

12.9 Pending diagnostic events

The **Diagnostics** menu allows the user to view the current diagnostic event and the previous diagnostic event separately.

 To call up the measures to rectify a diagnostic event:


- Via local display (→  109)
- Via Web browser (→  110)
- Via "FieldCare" operating tool (→  112)

 Other pending diagnostic events can be displayed in the **Diagnostic list** submenu (→  119)

Navigation

"Diagnostics" menu

Structure of the submenu

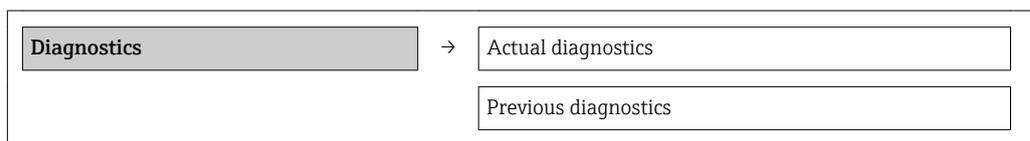

Parameter overview with brief description


Parameters	Prerequisite	Description	User interface	Factory setting
Actual diagnostics	1 diagnostic event has occurred.	Displays the current diagnostic event along with the diagnostic information.  If two or more messages occur simultaneously, the message with the highest priority is shown on the display.	Symbol for diagnostic behavior, diagnostic code and short message.	–
Previous diagnostics	2 diagnostic events have already occurred.	Displays the diagnostic event that occurred prior to the current diagnostic event along with the diagnostic information.	Symbol for diagnostic behavior, diagnostic code and short message.	–

12.10 Diagnostic list

In the **Diagnostic list** submenu, up to 5 currently pending diagnostic events can be displayed along with the related diagnostic information. If more than 5 diagnostic events are pending, the events with the highest priority are shown on the display.

Navigation path

Diagnostics menu → **Diagnostic list** submenu

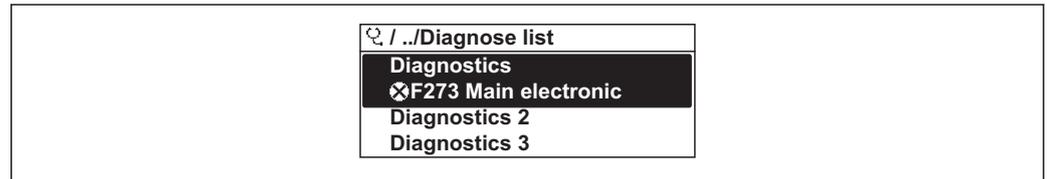

A0014006-EN

37 Illustrated using the example of the local display

To call up the measures to rectify a diagnostic event:

- Via local display (→ 109)
- Via Web browser (→ 110)
- Via "FieldCare" operating tool (→ 112)


12.11 Event logbook

12.11.1 Event history

A chronological overview of the event messages that have occurred is provided in the **Events list** submenu.

Navigation path

"Diagnostics" menu → Event logbook → Events list

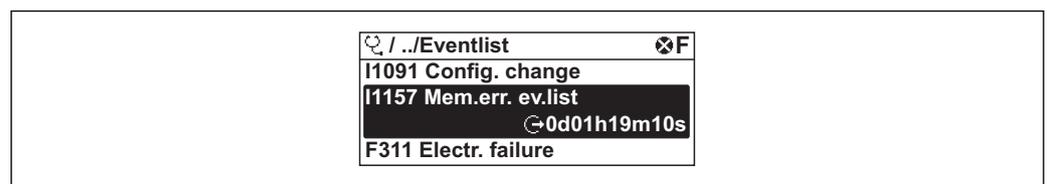

A0014008-EN

38 Illustrated using the example of the local display

A maximum of 20 event messages can be displayed in chronological order. If the advanced HistoROM function is enabled in the device (order option), up to 100 entries can be displayed.

The event history includes entries for:

- Diagnostic events (→ 115)
- Information events (→ 120)

In addition to the operation time of its occurrence, each event is also assigned a symbol that indicates whether the event has occurred or is ended:

- Diagnostic event
 - : Event has occurred
 - : Event has ended
- Information event
 - : Event has occurred

-  To call up the measures to rectify a diagnostic event:
 - Via local display (→  109)
 - Via Web browser (→  110)
 - Via "FieldCare" operating tool (→  112)
-  For filtering the displayed event messages (→  120)

12.11.2 Filtering the event logbook

Using the **Filter options** parameter, you can define which category of event messages is displayed in the **Events list** submenu.

Navigation path

"Diagnostics" menu → Event logbook → Filter options

Filter categories

- All
- Failure (F)
- Function check (C)
- Out of specification (S)
- Maintenance required (M)
- Information (I)

12.11.3 Overview of information events

Unlike a diagnostic event, an information event is displayed in the event logbook only and not in the diagnostic list.

Info number	Info name
I1000	----- (Device ok)
I1089	Power on
I1090	Configuration reset
I1091	Configuration changed
I1110	Write protection switch changed
I1111	Density adjust failure
I1137	Electronic changed
I1151	History reset
I1155	Reset electronic temperature
I1157	Memory error event list
I1185	Display backup done
I1186	Restore via display done
I1187	Settings downloaded with display
I1188	Display data cleared
I1189	Backup compared
I1209	Density adjustment ok
I1221	Zero point adjust failure
I1222	Zero point adjustment ok
I1256	Display: access status changed
I1264	Safety sequence aborted
I1335	Firmware changed
I1361	Wrong web server login
I1397	Fieldbus: access status changed

Info number	Info name
I1398	CDI: access status changed
I1444	Device verification passed
I1445	Device verification failed
I1446	Device verification active
I1447	Record application reference data
I1448	Application reference data recorded
I1449	Recording application ref. data failed
I1450	Monitoring off
I1451	Monitoring on
I1457	Failed:Measured error verification
I1459	Failed: I/O module verification
I1460	Failed: Sensor integrity verification
I1461	Failed: Sensor verification
I1462	Failed:Sensor electronic module verific.

12.12 Resetting the measuring device

Using the **Device reset** parameter it is possible to reset the entire device configuration or some of the configuration to a defined state.

"Setup" menu → Advanced setup → Administration

Function scope of "Device reset" parameter


Options	Description
Cancel	No action is executed and the user exits the parameter.
To delivery settings	Every parameter for which a customer-specific default setting was ordered is reset to this customer-specific value. All other parameters are reset to the factory setting.  This option is not visible if no customer-specific settings have been ordered.
Restart device	The restart resets every parameter whose data are in the volatile memory (RAM) to the factory setting (e.g. measured value data). The device configuration remains unchanged.
History reset	Every parameter is reset to its factory setting.

12.13 Device information

The **Device information** submenu contains all the parameters that display different information for identifying the device.

Navigation

"Diagnostics" menu → Device information

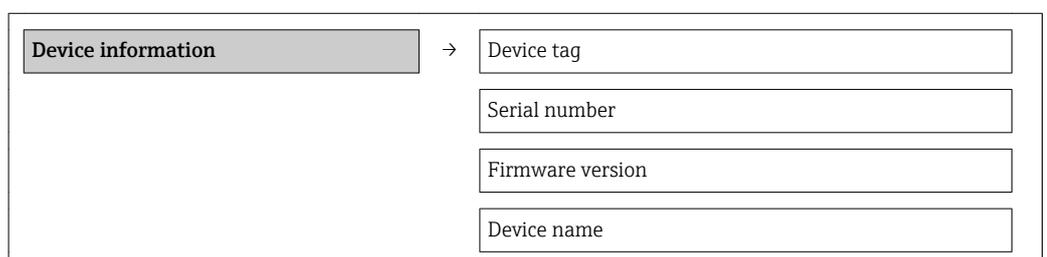

Order code
Extended order code 1
Extended order code 2
Extended order code 3
ENP version
Device revision
Device ID
Device type
Manufacturer ID
IP address
Subnet mask
Default gateway

Parameter overview with brief description

Parameters	Description	User interface	Factory setting
Device tag	Enter tag for measuring point.	Max. 32 characters, such as letters, numbers or special characters (e.g. @, %, /)	Promag 400
Serial number	Displays the serial number of the measuring device.	Max. 11-digit character string comprising letters and numbers.	79AFF16000
Firmware version	Displays the device firmware version installed.	Character string with the following format: xx.yy.zz	01.04
Device name	Displays the name of the transmitter.	Character string composed of letters, numbers and certain punctuation marks.	Promag 400
Order code	Displays the device order code.	Character string composed of letters, numbers and certain punctuation marks	-
Extended order code 1	Displays the 1st part of the extended order code.	Character string	-
Extended order code 2	Displays the 2nd part of the extended order code.	Character string	-
Extended order code 3	Displays the 3rd part of the extended order code.	Character string	-
ENP version	Displays the version of the electronic nameplate.	Character string in the format xx.yy.zz	2.02.00
Device revision	Displays the device revision with which the device is registered with the HART Communication Foundation.	0 to 255	5
Device ID	Displays the device ID for identifying the device in a HART network.	Positive integer	123 456
Device type	Displays the device type with which the measuring device is registered with the HART Communication Foundation.	0 to 255	103

Parameters	Description	User interface	Factory setting
Manufacturer ID	Displays the manufacturer ID with which the measuring device is registered with the HART Communication Foundation.	0 to 255	17
IP address	Displays the IP address of the Web server of the measuring device.	4 octet: 0 to 255 (in the particular octet)	192.168.1.212
Subnet mask	Displays the subnet mask.	4 octet: 0 to 255 (in the particular octet)	255.255.255.0
Default gateway	Displays the default gateway.	4 octet: 0 to 255 (in the particular octet)	192.168.1.212

12.14 Firmware history

Release date	Firmware version	Order code for "Firmware version"	Firmware changes	Documentation type	Documentation
10.2013	01.04.00	Option 76	Original firmware	Operating Instructions	BA01061D/06/EN/02.13

 Flashing the firmware to the current version or to the previous version is possible via the service interface (CDI) (→  142).

 For the compatibility of the firmware version with the previous version, the installed device description files and operating tools, observe the information about the device in the "Manufacturer's information" document.

 The manufacturer's information is available:

- In the Download Area of the Endress+Hauser Internet site: www.endress.com → Download
- Specify the following details:
 - Text search: Manufacturer's information
 - Search range: documentation

13 Maintenance

13.1 Maintenance tasks

No special maintenance work is required.

13.1.1 Exterior cleaning

When cleaning the exterior of measuring devices, always use cleaning agents that do not attack the surface of the housing or the seals.

WARNING

Cleaning agents can damage the plastic transmitter housing!

- ▶ Do not use high-pressure steam.
- ▶ Only use the permitted cleaning agents specified.

Permitted cleaning agents for the plastic transmitter housing

- Commercially available household cleaners
- Methyl alcohol or isopropyl alcohol
- Mild soap solutions

13.1.2 Interior cleaning

No interior cleaning is planned for the device.

13.1.3 Replacing seals

The sensor's seals (particularly aseptic molded seals) must be replaced periodically.

The interval between changes depends on the frequency of the cleaning cycles, the cleaning temperature and the medium temperature.

Replacement seals (accessory) (→  144)

13.2 Measuring and test equipment

Endress+Hauser offers a wide variety of measuring and test equipment, such as W@M or device tests.

 Your Endress+Hauser Sales Center can provide detailed information on the services.

 For a list of some of the measuring and test equipment, refer to the "Accessories" chapter of the "Technical Information" document for the device.

13.3 Endress+Hauser services

Endress+Hauser offers a wide variety of services for maintenance such as recalibration, maintenance service or device tests.

 Your Endress+Hauser Sales Center can provide detailed information on the services.

14 Repair

14.1 General notes

Repair and conversion concept

The Endress+Hauser repair and conversion concept provides for the following:

- The measuring devices have a modular design.
- Spare parts are grouped into logical kits with the associated Installation Instructions.
- Repairs are carried out by Endress+Hauser Service or by correspondingly trained customers.
- Certified devices can be converted into other certified devices by Endress+Hauser Service or at the factory only.

Notes for repair and conversion

For repair and modification of a measuring device, observe the following notes:

- Use only original Endress+Hauser spare parts.
- Carry out the repair according to the Installation Instructions.
- Observe the applicable standards, federal/national regulations, Ex documentation (XA) and certificates.
- Document every repair and each conversion and enter them into the *W@M* life cycle management database.

14.2 Spare parts

W@M Device Viewer (www.endress.com/deviceviewer):

All the spare parts for the measuring device, along with the order code, are listed here and can be ordered. If available, users can also download the associated Installation Instructions.



Measuring device serial number:

- Is located on the nameplate of the device.
- Can be read out via the **Serial number** parameter in the **Device information** submenu (→ 121).

14.3 Endress+Hauser services



Contact your Endress+Hauser Sales Center for information on services and spare parts.

14.4 Return

The measuring device must be returned if repairs or a factory calibration are required, or if the wrong measuring device has been ordered or delivered. According to legal regulations, Endress+Hauser, as an ISO-certified company, is required to follow certain procedures when handling returned products that are in contact with medium.

To ensure swift, safe and professional device returns, please read the return procedures and conditions on the Endress+Hauser website at www.services.endress.com/return-material

14.5 Disposal

14.5.1 Removing the measuring device

1. Switch off the device.

2. **WARNING!** Danger to persons from process conditions. Beware of hazardous process conditions such as pressure in the measuring device, high temperatures or aggressive fluids.

Carry out the mounting and connection steps from the chapters "Mounting the measuring device" and "Connecting the measuring device" in the logically reverse sequence. Observe the safety instructions.

14.5.2 Disposing of the measuring device

WARNING

Danger to personnel and environment from fluids that are hazardous to health.

- ▶ Ensure that the measuring device and all cavities are free of fluid residues that are hazardous to health or the environment, e.g. substances that have permeated into crevices or diffused through plastic.

Observe the following notes during disposal:

- Observe valid federal/national regulations.
- Ensure proper separation and reuse of the device components.

15 Accessories

Various accessories, which can be ordered with the device or subsequently from Endress+Hauser, are available for the device. Detailed information on the order code in question is available from your local Endress+Hauser sales center or on the product page of the Endress+Hauser website: www.endress.com.

15.1 Device-specific accessories

15.1.1 For the transmitter

Accessories	Description
Display protection	Is used to protect the display against impact or scoring from sand in desert areas.  For details, see Special Documentation SD00333F
Connecting cable for remote version	Coil current and electrode cables, various lengths, reinforced cables available on request.
Pipe mounting set	Pipe mounting set for transmitter.
Compact → remote conversion kit	For converting a compact device version to a remote device version.

15.1.2 For the sensor

Accessories	Description
Mounting kit	Consists of: <ul style="list-style-type: none"> ▪ 2 process connections ▪ Threaded fasteners ▪ Seals

15.2 Communication-specific accessories

Accessories	Description
Commubox FXA195 HART	For intrinsically safe HART communication with FieldCare via the USB interface.  For details, see "Technical Information" TI00404F
HART Loop Converter HMX50	Is used to evaluate and convert dynamic HART process variables to analog current signals or limit values.  For details, see "Technical Information" TI00429F and Operating Instructions BA00371F
Wireless HART adapter SWA70	Is used for the wireless connection of field devices. The WirelessHART adapter can be easily integrated into field devices and existing infrastructures, offers data protection and transmission safety and can be operated in parallel with other wireless networks with minimum cabling complexity.  For details, see Operating Instructions BA00061S
Fieldgate FXA320	Gateway for the remote monitoring of connected 4-20 mA measuring devices via a Web browser.  For details, see "Technical Information" TI00025S and Operating Instructions BA00053S

Fieldgate FXA520	<p>Gateway for the remote diagnostics and remote configuration of connected HART measuring devices via a Web browser.</p> <p> For details, see "Technical Information" TI00025S and Operating Instructions BA00051S</p>
Field Xpert SFX100	<p>Compact, flexible and robust industry handheld terminal for remote configuration and for obtaining measured values via the HART current output (4-20 mA).</p> <p> For details, see Operating Instructions BA00060S</p>

15.3 Service-specific accessories

Accessories	Description
Applicator	<p>Software for selecting and sizing Endress+Hauser measuring devices:</p> <ul style="list-style-type: none"> Calculation of all the necessary data for identifying the optimum flowmeter: e.g. nominal diameter, pressure loss, accuracy or process connections. Graphic illustration of the calculation results <p>Administration, documentation and access to all project-related data and parameters over the entire life cycle of a project.</p> <p>Applicator is available:</p> <ul style="list-style-type: none"> Via the Internet: https://wapps.endress.com/applicator On CD-ROM for local PC installation.
W@M	<p>Life cycle management for your plant</p> <p>W@M supports you with a wide range of software applications over the entire process: from planning and procurement, to the installation, commissioning and operation of the measuring devices. All the relevant device information, such as the device status, spare parts and device-specific documentation, is available for every device over the entire life cycle.</p> <p>The application already contains the data of your Endress+Hauser device. Endress+Hauser also takes care of maintaining and updating the data records.</p> <p>W@M is available:</p> <ul style="list-style-type: none"> Via the Internet: www.endress.com/lifecyclemanagement On CD-ROM for local PC installation.
FieldCare	<p>FDT-based plant asset management tool from Endress+Hauser.</p> <p>It can configure all smart field units in your system and helps you manage them. By using the status information, it is also a simple but effective way of checking their status and condition.</p> <p> For details, see Operating Instructions BA00027S and BA00059S</p>

15.4 System components

Accessories	Description
Memograph M graphic display recorder	<p>The Memograph M graphic data manager provides information on all the relevant measured variables. Measured values are recorded correctly, limit values are monitored and measuring points analyzed. The data are stored in the 256 MB internal memory and also on a SD card or USB stick.</p> <p> For details, see "Technical Information" TI00133R and Operating Instructions BA00247R</p>

16 Technical data

16.1 Application

The measuring device described in these Instructions is intended only for flow measurement of liquids with a minimum conductivity of 5 $\mu\text{S}/\text{cm}$.

Depending on the version ordered, the measuring device can also measure potentially explosive, flammable, poisonous and oxidizing media.

To ensure that the device remains in proper operating condition for its service life, use the measuring device only for media against which the process-wetted materials are adequately resistant.

16.2 Function and system design

Measuring principle Electromagnetic flow measurement on the basis of *Faraday's law of magnetic induction*.

Measuring system The device consists of a transmitter and a sensor.
Two device versions are available:

- Compact version - the transmitter and sensor form a mechanical unit.
- Remote version – the transmitter and sensor are mounted separately from one another.

For information on the structure of the device (\rightarrow  12)

16.3 Input

Measured variable **Direct measured variables**
Volume flow (proportional to induced voltage)

Calculated measured variables

Mass flow

Measuring range Typically $v = 0.01$ to 10 m/s (0.03 to 33 ft/s) with the specified accuracy
Electrical conductivity: 5 to $10\,000$ $\mu\text{S}/\text{cm}/\text{cm}$

Flow characteristic values in SI units

Nominal diameter		Recommended flow min./max. full scale value ($v \sim 0.3/10$ m/s) [dm ³ /min]	Factory settings		
[mm]	[in]		Full scale value current output ($v \sim 2.5$ m/s) [dm ³ /min]	Pulse value (~ 2 pulse/s) [dm ³]	Low flow cut off ($v \sim 0.04$ m/s) [dm ³ /min]
25	1	9 to 300	75	0.5	1
40	1 ½	25 to 700	200	1.5	3
50	2	35 to 1 100	300	2.5	5
65	–	60 to 2 000	500	5	8
80	3	90 to 3 000	750	5	12
100	4	145 to 4 700	1 200	10	20

Flow characteristic values in US units

Nominal diameter		Recommended flow min./max. full scale value (v ~ 0.3/10 m/s)	Factory settings		
			Full scale value current output (v ~ 2.5 m/s)	Pulse value (~ 2 pulse/s)	Low flow cut off (v ~ 0.04 m/s)
[in]	[mm]	[gal/min]	[gal/min]	[gal]	[gal/min]
1	25	2.5 to 80	18	0.2	0.25
1 ½	40	7 to 190	50	0.5	0.75
2	50	10 to 300	75	0.5	1.25
-	65	16 to 500	130	1	2
3	80	24 to 800	200	2	2.5
4	100	40 to 1250	300	2	4

Recommended measuring range

"Flow limit" section (→  136)

Operable flow range Over 1000 : 1

Input signal

Status input

Maximum input values	<ul style="list-style-type: none"> ▪ DC 30 V ▪ 6 mA
Response time	Adjustable: 5 to 200 ms
Input signal level	<ul style="list-style-type: none"> ▪ Low signal: DC -3 to +5 V ▪ High signal: DC 12 to 30 V
Assignable functions	<ul style="list-style-type: none"> ▪ Off ▪ Reset totalizers 1-3 separately ▪ Reset all totalizers ▪ Flow override

16.4 Output

Output signal

Current output

Current output	Can be set as: <ul style="list-style-type: none"> ▪ 4-20 mA NAMUR ▪ 4-20 mA US ▪ 4-20 mA HART ▪ 0-20 mA
Maximum output values	<ul style="list-style-type: none"> ▪ DC 24 V (when idle) ▪ 22.5 mA
Load	0 to 700 Ω
Resolution	0.5 μA
Damping	Adjustable: 0.07 to 999 s
Assignable measured variables	<ul style="list-style-type: none"> ▪ Volume flow ▪ Mass flow ▪ Flow velocity ▪ Electronics temperature

Pulse/frequency/switch output

Function	<ul style="list-style-type: none"> ▪ With the order code for "Output; Input", option H: output 2 can be set as a pulse or frequency output ▪ With the order code for "Output; Input", option I: output 2 and 3 can be set as a pulse, frequency or switch output
Version	Passive, open collector
Maximum input values	<ul style="list-style-type: none"> ▪ DC30 V ▪ 250 mA
Voltage drop	For 25 mA: ≤ DC2 V
Pulse output	
Pulse width	Adjustable: 0.05 to 2 000 ms
Maximum pulse rate	10 000 Impulse/s
Pulse value	Adjustable
Assignable measured variables	<ul style="list-style-type: none"> ▪ Volume flow ▪ Mass flow
Frequency output	
Output frequency	Adjustable: 0 to 12 500 Hz
Damping	Adjustable: 0 to 999 s
Pulse/pause ratio	1:1
Assignable measured variables	<ul style="list-style-type: none"> ▪ Volume flow ▪ Mass flow ▪ Flow velocity ▪ Electronics temperature
Switch output	
Switching behavior	Binary, conductive or non-conductive
Switching delay	Adjustable: 0 to 100 s
Number of switching cycles	Unlimited
Assignable functions	<ul style="list-style-type: none"> ▪ Off ▪ On ▪ Diagnostic behavior ▪ Limit value: <ul style="list-style-type: none"> - Off - Volume flow - Mass flow - Flow velocity - Totalizer 1-3 - Electronics temperature ▪ Flow direction monitoring ▪ Status <ul style="list-style-type: none"> - Empty pipe detection - Low flow cut off

Signal on alarm

Depending on the interface, failure information is displayed as follows:

Current output

4-20 mA

Failure mode	Selectable (as per NAMUR recommendation NE 43): <ul style="list-style-type: none"> ▪ Minimum value: 3.6 mA ▪ Maximum value: 22 mA ▪ Defined value: 3.59 to 22.5 mA ▪ Actual value ▪ Last valid value
---------------------	---

0-20 mA

Failure mode	Choose from: <ul style="list-style-type: none"> ■ Maximum alarm: 22 mA ■ Defined value: 0 to 22.5 mA
---------------------	--

HART

Device diagnostics	Device condition can be read out via HART Command 48
---------------------------	--

Pulse/frequency/switch output

Pulse output	
Failure mode	Choose from: <ul style="list-style-type: none"> ■ Actual value ■ No pulses
Frequency output	
Failure mode	Choose from: <ul style="list-style-type: none"> ■ Actual value ■ Defined value: 0 to 12 500 Hz ■ 0 Hz
Switch output	
Failure mode	Choose from: <ul style="list-style-type: none"> ■ Current status ■ Open ■ Closed

Local display

Plain text display	With information on cause and remedial measures
Backlight	Red backlighting indicates a device error.

 Status signal as per NAMUR recommendation NE 107

Operating tool

- Via digital communication:
 - HART protocol
- Via service interface

Plain text display	With information on cause and remedial measures
---------------------------	---

Web browser

Plain text display	With information on cause and remedial measures
---------------------------	---

Low flow cut off The switch points for low flow cut off are user-selectable.

Galvanic isolation The following connections are galvanically isolated from each other:

- Inputs
- Outputs
- Power supply

Protocol-specific data

HART

- For information on the device description files (→ [66](#))
- For information on the dynamic variables and measured variables (HART device variables) (→ [66](#))

16.5 Power supply

Terminal assignment

(→ [33](#))

Supply voltage

Transmitter

Order code for "Power supply"	Terminal voltage	Frequency range
Option L	AC100 to 240 V	50/ 60 Hz, ±4 Hz
	AC/DC24 V	50/ 60 Hz, ±4 Hz

Power consumption

Order code for "Output"	Maximum Power consumption
Option L	30 VA/8 W

Current consumption

Transmitter

Order code for "Power supply"	Maximum Current consumption	Maximum switch-on current
Option L: AC 100 to 240 V	145 mA	25 A (< 5 ms)
Option L: AC/DC 24 V	350 mA	27 A (< 5 ms)

Power supply failure

- Totalizers stop at the last value measured.
- Configuration is retained in the plug-in memory (HistoROM DAT).
- Error messages (incl. total operated hours) are stored.

Electrical connection

(→ [36](#))

Potential equalization

(→ [39](#))

Terminals

Transmitter

- Supply voltage cable: plug-in spring terminals for wire cross-sections 0.5 to 2.5 mm² (20 to 14 AWG)
- Signal cable: plug-in spring terminals for wire cross-sections 0.5 to 2.5 mm² (20 to 14 AWG)
- Electrode cable: spring terminals for wire cross-sections 0.5 to 2.5 mm² (20 to 14 AWG)
- Coil current cable: spring terminals for wire cross-sections 0.5 to 2.5 mm² (20 to 14 AWG)

Sensor connection housingSpring terminals for wire cross-sections 0.5 to 2.5 mm² (20 to 14 AWG)

Cable entries

Cable entry thread

- M20 x 1.5
- Via adapter:
 - NPT 1/2"
 - G 1/2"

Cable gland

- For standard cable: M20 x 1.5 with cable ϕ 6 to 12 mm (0.24 to 0.47 in)
- For reinforced cable: M20 x 1.5 with cable ϕ 9.5 to 16 mm (0.37 to 0.63 in)

 If metal cable entries are used, use a grounding plate.

Cable specification

(→  31)

16.6 Performance characteristics

Reference operating conditions

In accordance with DIN EN 29104

- Fluid temperature: $+28 \pm 2$ °C ($+82 \pm 4$ °F)
- Ambient temperature range: $+22 \pm 2$ °C ($+72 \pm 4$ °F)
- Warm-up period: 30 min

Installation

- Inlet run $> 10 \times$ DN
- Outlet run $> 5 \times$ DN
- Sensor and transmitter grounded.
- The sensor is centered in the pipe.

Maximum measured error


Error limits under reference operating conditions

o.r. = of reading

Volume flow

± 0.5 % o.r. ± 1 mm/s (0.04 in/s)

 Fluctuations in the supply voltage do not have any effect within the specified range.

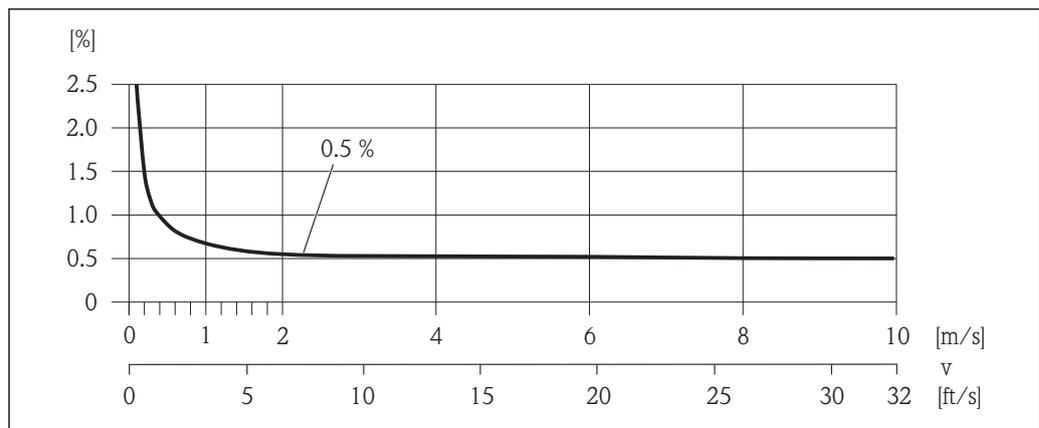

 39 Maximum measured error in % o.r.

Accuracy of outputs

o.r. = of reading; o.f.s. = of full scale value

The outputs have the following base accuracy specifications.

Current output

Accuracy	Max. $\pm 0.025\%$ o.f.s. or $\pm 5\ \mu\text{A}$
-----------------	---

Pulse/frequency output

Accuracy	Max. ± 50 ppm o.r.
-----------------	------------------------

Repeatability

o.r. = of reading

Volume flowMax. $\pm 0.1\%$ o.r. ± 0.5 mm/s (0.02 in/s)

Influence of ambient temperature

o.r. = of reading; o.f.s. = of full scale value

Current output

Temperature coefficient	Typically ± 50 ppm/ $^{\circ}\text{C}$ o.r. or $\pm 1\ \mu\text{A}/^{\circ}\text{C}$
--------------------------------	--

Pulse/frequency output

Temperature coefficient	Max. ± 0.5 ppm v.M./ $^{\circ}\text{C}$
--------------------------------	---

16.7 Installation

"Mounting requirements" ([→](#)  18)

16.8 Environment

Ambient temperature range

([→](#)  20)

Storage temperature

The storage temperature corresponds to the operating temperature range of the measuring transmitter and the appropriate measuring sensors.

- Protect the measuring device against direct sunlight during storage in order to avoid unacceptably high surface temperatures.
- Select a storage location where moisture cannot collect in the measuring device as fungus or bacteria infestation can damage the liner.
- If protection caps or protective covers are mounted these should never be removed before installing the measuring device.

Degree of protection

Transmitter

- As standard: IP66/67, type 4X enclosure
- When housing is open: IP20, type 1 enclosure

Sensor

As standard: IP66/67, type 4X enclosure

Shock resistance

Acceleration up to 2 g following IEC 60068-2-6

Vibration resistance	Acceleration up to 2 g following IEC 60068-2-6
Mechanical load	<ul style="list-style-type: none"> ■ Protect the transmitter housing against mechanical effects, such as shock or impact; the use of the remote version is sometimes preferable. ■ Never use the transmitter housing as a ladder or climbing aid.
Electromagnetic compatibility (EMC)	<ul style="list-style-type: none"> ■ As per IEC/EN 61326 and NAMUR Recommendation 21 (NE 21) ■ Complies with emission limits for industry as per EN 55011 (Class A) <p> Details are provided in the Declaration of Conformity.</p>

16.9 Process

Medium temperature range	0 to +60 °C (+32 to +140 °F) for polyamide
Pressure-temperature ratings	<p> An overview of the material load diagrams (pressure/temperature curves) for the process connections is provided in the "Technical Information" document for the device on the CD-ROM provided.</p>
Pressure tightness	Measuring tube: 0 mbar abs. (0 psi abs.) at a medium temperature of ≤ +60 °C (+140 °F)
Flow limit	<p>The diameter of the pipe and the flow rate determine the nominal diameter of the sensor. The optimum flow velocity is between 2 to 3 m/s (6.56 to 9.84 ft/s). Also match the velocity of flow (v) to the physical properties of the fluid:</p> <ul style="list-style-type: none"> ■ v < 2 m/s (6.56 ft/s): for abrasive fluids (e.g. potter's clay, lime milk, ore slurry) ■ v > 2 m/s (6.56 ft/s): for fluids producing buildup (e.g. wastewater sludges) <p> For an overview of the measuring range full scale values, see the "Measuring range" section (→  129)</p>
Pressure loss	<ul style="list-style-type: none"> ■ No pressure loss occurs if the sensor is installed in a pipe with the same nominal diameter. ■ Pressure losses for configurations incorporating adapters according to DIN EN 545 (→  21)
System pressure	(→  20)
Vibrations	(→  21)

16.10 Mechanical construction

Design, dimensions	<p> For the dimensions and installation lengths of the device, see the "Technical Information" document, "Mechanical construction" section</p>
--------------------	---

Weight

Compact version

Weight data:

- Including the transmitter
 - Polycarbonate plastic: 1.3 kg (2.9 lbs)
 - Aluminum: 2.0 kg (4.4 lbs)
- Excluding packaging material

Weight in SI units

Nominal diameter		EN (DIN), JIS	
[mm]	[in]	Polycarbonate plastic [kg]	Aluminum [kg]
25	1	2.50	3.20
40	1 ½	3.10	3.80
50	2	3.90	4.60
65	–	4.70	5.40
80	3	5.70	6.40
100	4	8.40	9.10

Weight in US units

Nominal diameter		ASME	
[mm]	[in]	Polycarbonate plastic [lbs]	Aluminum [lbs]
25	1	5.51	7.06
40	1 ½	6.84	8.40
50	2	8.60	10.1
65	–	10.4	11.9
80	3	12.6	14.1
100	4	18.5	20.1

Transmitter remote version*Wall-mount housing*

Depends on the material of the wall-mount housing:

- Polycarbonate plastic: 1.3 kg (2.9 lb)
- Aluminum: 2.0 kg (4.4 lb)

Sensor remote version

Weight data:

- Including sensor connection housing
- Excluding the connecting cable
- Excluding packaging material

Weight in SI units

Nominal diameter		EN (DIN), JIS
[mm]	[in]	[kg]
25	1	2.5
40	1 ½	3.1
50	2	3.9
65	–	4.7
80	3	5.7
100	4	8.4

Weight in US units

Nominal diameter		ASME
[mm]	[in]	[lbs]
25	1	5.5
40	1 ½	6.8
50	2	8.6
65	–	10.4
80	3	12.6
100	4	18.5

Measuring tube specification

Pressure rating EN (DIN)

Nominal diameter		Pressure rating	Mounting bolts			Length		internal diameter	
[mm]	[in]			[mm]	[in]	Centering sleeves	Measuring tube	[mm]	[in]
25	1	PN 16	4 × M12 ×	145	5.71	54	2.13	24	0.94
40	1 ½	PN 16	4 × M16 ×	170	6.69	68	2.68	38	1.50
50	2	PN 16	4 × M16 ×	185	7.28	82	3.23	50	1.97
65 ¹⁾	–	PN 16	4 × M16 ×	200	7.87	92	3.62	60	2.36
65 ²⁾	–	PN 16	8 × M16 ×	200	7.87	– ³⁾	– ³⁾	60	2.36
80	3	PN 16	8 × M16 ×	225	8.86	116	4.57	76	2.99
100	4	PN 16	8 × M16 ×	260	10.24	147	5.79	97	3.82

- 1) EN (DIN) flange: 4-hole → with centering sleeves
- 2) EN (DIN) flange: 8-hole → without centering sleeves
- 3) A centering sleeve is not required. The device is centered directly via the sensor housing.

ASME pressure rating

Nominal diameter		Pressure rating	Mounting bolts			Length		internal diameter	
[mm]	[in]			[mm]	[in]	Centering sleeves	Measuring tube	[mm]	[in]
25	1	Class 150	4 × UNC ½" ×	145	5.70	– ¹⁾	– ¹⁾	24	0.94
40	1 ½	Class 150	4 × UNC ½" ×	165	6.50	– ¹⁾	– ¹⁾	38	1.50
50	2	Class 150	4 × UNC 5/8" ×	190.5	7.50	– ¹⁾	– ¹⁾	50	1.97

Nominal diameter		Pressure rating	Mounting bolts			Length		internal diameter	
[mm]	[in]			[mm]	[in]	Centering sleeves [mm]	[in]	Measuring tube [mm]	[in]
80	3	Class 150	8 × UNC 5/8" ×	235	9.25	– ¹⁾	– ¹⁾	76	2.99
100	4	Class 150	8 × UNC 5/8" ×	264	10.4	147	5.79	97	3.82

1) A centering sleeve is not required. The device is centered directly via the sensor housing.

Pressure rating JIS

Nominal diameter		Pressure rating	Mounting bolts			Length		internal diameter	
[mm]	[in]			[mm]	[in]	Centering sleeves [mm]	[in]	Measuring tube [mm]	[in]
25	1	10K	4 × M16 ×	170	6.69	54	2.13	24	0.94
40	1 ½	10K	4 × M16 ×	170	6.69	68	2.68	38	1.50
50	2	10K	4 × M16 ×	185	7.28	– ¹⁾	– ¹⁾	50	1.97
65	–	10K	4 × M16 ×	200	7.87	– ¹⁾	– ¹⁾	60	2.36
80	3	10K	8 × M16 ×	225	8.86	– ¹⁾	– ¹⁾	76	2.99
100	4	10K	8 × M16 ×	260	10.24	– ¹⁾	– ¹⁾	97	3.82

1) A centering sleeve is not required. The device is centered directly via the sensor housing.

Materials

Transmitter housing


Order code for "Housing"

- Compact version, standard:
 - Option **A**: coated aluminum AlSi10Mg
 - Option **M**: polycarbonate plastic
- Compact version, inclined:
 - Option **Q**: polycarbonate plastic
 - Option **R**: coated aluminum AlSi10Mg
- Remote version (wall-mount housing):
 - Option **N**: polycarbonate plastic
 - Option **P**: coated aluminum AlSi10Mg

Window material

Transmitter housing material	Window material
Polycarbonate plastic	Plastic
Aluminum AlSi10Mg	Glass

Cable entries/cable glands

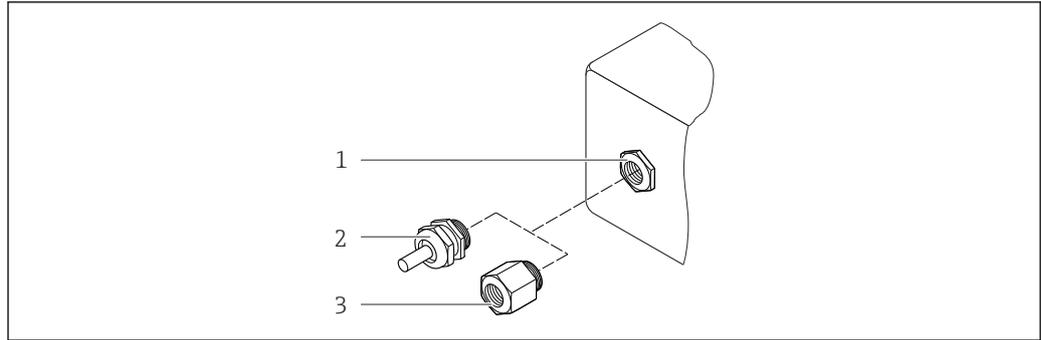

A0020640

40 Possible cable entries/cable glands

- 1 Cable entry in transmitter housing, wall-mount housing or connection housing with internal thread M20 x 1.5
- 2 Cable gland M20 x 1.5
- 3 Adapter for cable entry with internal thread G 1/2" or NPT 1/2"

Compact and remote versions and sensor connection housing

Cable entry/cable gland	Material
Cable gland M20 × 1.5	Plastic
Remote version: cable gland M20 × 1.5 Option of reinforced connecting cable	<ul style="list-style-type: none"> ■ Sensor connection housing: Nickel-plated brass ■ Transmitter wall-mount housing: Plastic
Adapter for cable entry with internal thread G 1/2" or NPT 1/2"	Nickel-plated brass

Device plug

Electrical connection	Material
Plug M12x1	<ul style="list-style-type: none"> ■ Socket: Stainless steel 1.4404 (316L) ■ Contact housing: Polyamide ■ Contacts: Gold-plated brass

Connecting cable for remote version

Electrode and coil current cable

- Standard cable: PVC cable with copper shield
- Reinforced cable: PVC cable with copper shield and additional steel wire braided jacket

Sensor housing

Aluminum coated AlSi10Mg

Sensor connection housing

Aluminum coated AlSi10Mg

Sensor cable entries

Order code for "Housing", option N "Remote, polycarbonate" or option P "Remote, coated aluminum"

The various cable entries are suitable for hazardous and non-hazardous areas.

Electrical connection	Material
Cable gland M20 × 1.5	Nickel-plated brass
Thread G ½" via adapter	Nickel-plated brass
Thread NPT ½" via adapter	Nickel-plated brass

Liner

Polyamide

Electrodes

1.4435 (316L)

Process connections

- EN 1092-1 (DIN 2501)
- ASME B16.5
- JIS B2220

 List of all available process connections (→  141)

Seals

O-rings made from EPDM

Accessories

Display protection

Stainless steel 1.4301

Ground disks

1.4301 (304)

Mounting bolts

Tensile strength

- Galvanized steel mounting bolts: strength category 5.6 or 5.8
- Stainless steel mounting bolts: strength category A2-70

Fitted electrodes

2 measuring electrodes made of 1.4435 (316L)

Process connections

- EN 1092-1 (DIN 2501)
- ASME B16.5
- JIS B2220

 For information on the materials of the process connections (→  141)

16.11 Operability

Local operation

Display elements

- 4-line display
- White background lighting; switches to red in event of device errors
- Format for displaying measured variables and status variables can be individually configured
- Permitted ambient temperature for the display: -20 to +50 °C (-4 to +122 °F)
The readability of the display may be impaired at temperatures outside the temperature range.

Operating elements

External operation via touch control; 3 optical keys: , , 

Additional functionality

- Data backup function
The device configuration can be saved in the display module.
- Data comparison function
The device configuration saved in the display module can be compared to the current device configuration.
- Data transfer function
The transmitter configuration can be transmitted to another device using the display module.

Remote operation

HART protocol

Operation via:

- HART protocol
- Operating tools via FXA191, FXA195
 - FieldCare (→  144)
 - AMS Device Manager
 - SIMATIC PDM
- HART handheld terminals
 - Field Communicator 475
 - Field Xpert SFX100

Service interface (CDI-RJ45)

Operation of the measuring device with the service interface (CDI-RJ45) via:

- Web browser
- "FieldCare" operating tool with COM DTM "CDI Communication TCP/IP"

Languages

Can be operated in the following languages:

- Via local display:
English, German, French, Spanish, Italian, Dutch, Portuguese, Polish, Russian, Turkish, Chinese, Japanese, Bahasa (Indonesian), Vietnamese, Czech
- Via "FieldCare" operating tool:
English, German, French, Spanish, Italian, Dutch, Chinese, Japanese
- Via Web browser
English, German, French, Spanish, Italian, Dutch, Portuguese, Polish, Russian, Turkish, Chinese, Japanese, Bahasa (Indonesian), Vietnamese, Czech

16.12 Certificates and approvals

CE mark	<p>The measuring system is in conformity with the statutory requirements of the applicable EC Directives. These are listed in the corresponding EC Declaration of Conformity along with the standards applied.</p> <p>Endress+Hauser confirms successful testing of the device by affixing to it the CE mark.</p>
C-Tick symbol	<p>The measuring system meets the EMC requirements of the "Australian Communications and Media Authority (ACMA)".</p>
Ex approval	<p>The devices are certified for use in hazardous areas and the relevant safety instructions are provided in the separate "Control Drawing" document. Reference is made to this document on the nameplate.</p>
Drinking water approval	<ul style="list-style-type: none"> ■ ACS ■ KTW/W270 ■ NSF 61 ■ WRAS BS 6920
Other standards and guidelines	<ul style="list-style-type: none"> ■ EN 60529 Degrees of protection by housing (IP code) ■ EN 61010-1 Protection Measures for Electrical Equipment for Measurement, Control, Regulation and Laboratory Procedures. ■ IEC/EN 61326 Emission in accordance with Class A requirements. Electromagnetic compatibility (EMC requirements) ■ ANSI/ISA-61010-1 (82.02.01): 2004 Safety Requirements for Electrical Equipment for Measurement, Control and Laboratory Use - Part 1 General Requirements ■ CAN/CSA-C22.2 No. 61010-1-04 Safety Requirements for Electrical Equipment for Measurement, Control and Laboratory Use - Part 1 General Requirements ■ NAMUR NE 21 Electromagnetic compatibility (EMC) of industrial process and laboratory control equipment. ■ NAMUR NE 32 Data Retention in the Event of a Power Failure in Field and Control Instruments with Microprocessors ■ NAMUR NE 43 Standardization of the signal level for the breakdown information of digital transmitters with analog output signal. ■ NAMUR NE 53 Software of field devices and signal-processing devices with digital electronics ■ NAMUR NE 105 Specifications for Integrating Fieldbus Devices in Engineering Tools for Field Devices ■ NAMUR NE 107 Self-monitoring and diagnosis of field devices ■ NAMUR NE 131 Requirements for field devices for standard applications

16.13 Application packages

Many different application packages are available to enhance the functionality of the device. Such packages might be needed to address safety aspects or specific application requirements.

The application packages can be ordered from Endress+Hauser either directly with the device or subsequently. Detailed information on the order code in question is available from your local Endress+Hauser sales center or on the product page of the Endress+Hauser website: www.endress.com.

Diagnostics functions

Package	Description
HistoROM extended function	<p>Comprises extended functions concerning the event log and the activation of the measured value memory.</p> <p>Event log: Memory volume is extended from 20 message entries (basic version) to up to 100 entries.</p> <p>Data logging (line recorder):</p> <ul style="list-style-type: none"> ▪ Memory capacity for up to 1000 measured values is activated. ▪ 250 measured values can be output via each of the 4 memory channels. The recording interval can be defined and configured by the user. ▪ Data logging is visualized via the local display or FieldCare.

Heartbeat Technology

Package	Description
Heartbeat Verification +Monitoring	<p>Heartbeat Monitoring: Continuously supplies monitoring data, which are characteristic of the measuring principle, for an external condition monitoring system. This makes it possible to:</p> <ul style="list-style-type: none"> ▪ Draw conclusions - using these data and other information - about the impact the measuring application has on the measuring performance over time. ▪ Schedule servicing in time. ▪ Monitor the product quality, e.g. gas pockets. <p>Heartbeat Verification: Makes it possible to check the device functionality on demand when the device is installed, without having to interrupt the process.</p> <ul style="list-style-type: none"> ▪ Access via onsite operation or other interfaces (requires no on-site presence). ▪ End-to-end, traceable documentation of the verification results and verification report. ▪ Extension of calibration intervals.

16.14 Accessories

 Overview of accessories available for order (→  127)

16.15 Documentation

-  The following document types are available:
- On the CD-ROM supplied with the device
 - In the Download Area of the Endress+Hauser Internet site: www.endress.com → Download

Standard documentation

Communication	Document type	Documentation code
----	Brief Operating Instructions	KA01112D
----	Technical Information	TI01044D

Supplementary device-
dependent documentation

Document type	Approval	Documentation code
Special Documentation	Heartbeat Technology	SD01183D
Installation Instructions		Specified for each individual accessory (→  127)  Overview of accessories available for order (→  127)

17 Appendix

17.1 Overview of the operating menu

The following table provides an overview of the entire operating menu structure with menus and parameters. The direct access code to the parameter is given in brackets. The page reference indicates where a description of the parameter can be found in the manual.

* = The submenu only appears if it has been additionally ordered ("Technical Information", Section "Application packages").

Display language		(→ 68)
Operation	→	(→ 79)
Display language		(→ 68)
Websserver language		(→ 58)
Access status display		(→ 57)
Access status tooling		(→ 57)
Locking status		(→ 96)
Display	→	(→ 79)
Format display		
Contrast display		
Backlight		
Display interval		
Operation	→	(→ 101)
Control totalizer 1 to 3		
Preset value 1 to 3		
Reset all totalizers		
Setup	→	(→ 68)
Device tag		(→ 69)
Status input	→	(→ 70)
Assign status input		
Active level		
Response time status input		
Current output	→	(→ 71)
Assign current output		

Mass flow unit		
Volume flow unit		
Density unit		
Conductivity unit		
Current span		
0/4 mA value		
20 mA value		
Failure mode		
Failure current		
PFS output1 to 2	→	(→  72)
Pulse output	→	(→  72)
Operation mode		
Assign pulse output		
Mass flow unit		
Mass unit		
Volume flow unit		
Conductivity unit		
Volume unit		
Density unit		
Unit totalizer 1 to 3		
Pulse value		
Pulse width		
Failure mode		
Invert output signal		
Frequency output	→	(→  74)
Operation mode		
Assign frequency output		
Mass flow unit		
Mass unit		
Volume flow unit		
Conductivity unit		

Volume unit	
Density unit	
Unit totalizer 1 to 3	
Minimum frequency value	
Maximum frequency value	
Measuring value at minimum frequency	
Measuring value at maximum frequency	
Failure mode	
Failure frequency	
Invert output signal	
Switch output	→ (→  76)
Operation mode	
Switch output function	
Assign diagnostic behavior	
Assign limit	
Assign flow direction check	
Assign status	
Mass flow unit	
Mass unit	
Volume flow unit	
Conductivity unit	
Volume unit	
Density unit	
Unit totalizer 1 to 3	
On value	
Off value	
Switch-on delay	
Switch-off delay	
Failure mode	

Invert output signal		
Display	→	(→ 79)
Format display		
Value 1 display		
0% bargraph value 1		
100% bargraph value 1		
Value 2 display		
Value 3 display		
0% bargraph value 3		
100% bargraph value 3		
Value 4 display		
Output cond.	→	(→ 82)
Display damping		
Assign current output		
Output damping 1 to 2		
Mode output 1 to 2		
Assign pulse output		
Assign frequency output		
Low flow cut off	→	(→ 84)
Assign process variable		
On value low flow cut off		
Off value low flow cutoff		
Pressure shock suppression		
Empty pipe detection	→	(→ 86)
Empty pipe detection		
New adjustment		
Progress		
Switch point empty pipe detection		
Response time		
HART input	→	(→ 81)
Capture mode		

Device ID		
Device type		
Manufacturer ID		
Burst command		
Slot number		
Timeout		
Failure mode		
Failure value		
Advanced setup	→	(→  88)
Enter access code		(→  57)
System units	→	(→  89)
Volume flow unit		
Volume unit		
Conductivity unit		
Temperature unit		
Mass flow unit		
Mass unit		
Density unit		
Sensor adjustment	→	(→  90)
Installation direction		
Totalizer1 to 3	→	(→  90)
Assign process variable		
Unit totalizer		
Totalizer operation mode		
Failure mode		
Display	→	(→  91)
Format display		
Value 1 display		
0% bargraph value 1		
100% bargraph value 1		
Decimal places 1		

	Value 2 display	
	Decimal places 2	
	Value 3 display	
	0% bargraph value 3	
	100% bargraph value 3	
	Decimal places 3	
	Value 4 display	
	Decimal places 4	
	Display language	
	Display interval	
	Display damping	
	Header	
	Header text	
	Separator	
	Backlight	
	Electrode cleaning circuit* (not Promag D 400)	→
	Electrode cleaning circuit	
	ECC duration	
	ECC recovery time	
	ECC cleaning cycle	
	ECC polarity	
	Administration	→
	Define access code	
	Confirm access code	
	Device reset	
		(→ 95)
Diagnostics	→	(→ 104)
Actual diagnostics		(→ 119)
Previous diagnostics		(→ 119)
Operating time from restart		-
Operating time		(→ 119)

Diagnostic list	→	(→  119)
Diagnostics 1 to 5		
Event logbook	→	(→  119)
Filter options		(→  120)
Device information	→	(→  121)
Device tag		
Serial number		
Firmware version		
Device name		
Order code		
Extended order code 1 to 3		
ENP version		
Device revision		
Device ID		
Device type		
Manufacturer ID		
IP address		
Subnet mask		
Default gateway		
Measured values	→	(→  98)
Process variables	→	(→  98)
Volume flow		
Mass flow		
Conductivity		
Totalizer	→	(→  99)
Totalizer value 1 to 3		
Totalizer overflow 1 to 3		
Input values	→	(→  99)
Value status input		
Output values	→	(→  100)
Output current 1		

	Measured current 1	
	Pulse output1 to 2	
	Output frequency1 to 2	
	Switch status1 to 2	
Data logging	→	(→  102)
Assign channel 1-4		
Logging interval		
Clear logging data		
Simulation	→	(→  93)
Assign simulation process variable		
Value process variable		
Simulation status input		
Value status input		
Simulation current output 1		
Value current output 1		
Frequency simulation1 to 2		
Frequency value1 to 2		
Pulse simulation1 to 2		
Pulse value1 to 2		
Switch output simulation1 to 2		
Switch status1 to 2		
Simulation device alarm		
Heartbeat*	→	(→ SD01183D)
	Performing verification	→
	Year	
	Month	
	Day	
	Hour	
	AM/PM	
	Minute	

	Verification mode	
	Information external device	
	External reference voltage 1 to 2	
	Start verification	
	Progress	
	Measured values	
	Output values	
	Status	
	Overall result	
	Verification result →	
	Date/time	
	Verification ID	
	Operating time	
	Overall result	
	Sensor	
	Sensor electronic module	
	I/O module	
	Monitoring result →	
	Noise	
	Coil current shot time	
	Reference electrode potential against PE	
Expert →		(→ ⓘ 45)
Direct access (0106)		(→ ⓘ 54)
Locking status (0122)		(→ ⓘ 57)
Access status display (0091)		(→ ⓘ 57)
Access status tooling (0005)		(→ ⓘ 57)
Enter access code (0003)		
System →		
	Display →	(→ ⓘ 91)

Display language (0104)	(→  68)
Format display (0098)	
Value 1 display (0107)	
0% bargraph value 1 (0123)	
100% bargraph value 1 (0125)	
Decimal places 1 (0095)	
Value 2 display (0108)	
Decimal places 2 (0117)	
Value 3 display (0110)	
0% bargraph value 3 (0124)	
100% bargraph value 3 (0126)	
Decimal places 3 (0118)	
Value 4 display (0109)	
Decimal places 4 (0119)	
Display interval (0096)	
Display damping (0094)	
Header (0097)	
Header text (0112)	
Separator (0101)	
Contrast display (0105)	(→  51)
Backlight (0111)	
Access status display (0091)	(→  57)
Diagnostic behavior	(→  104)
Alarm delay (0651)	(→  108)
Assign behavior of diagnostic no. 252 (0661)	(→  115)
Assign behavior of diagnostic no. 441 (0657)	(→  115)
Assign behavior of diagnostic no. 442 (0658)	(→  115)

	Assign behavior of diagnostic no. 443 (0659)		(→ 115)
	Assign behavior of diagnostic no. 531 (0741)		(→ 115)
	Assign behavior of diagnostic no. 832 (0681)		(→ 115)
	Assign behavior of diagnostic no. 833 (0682)		(→ 115)
	Assign behavior of diagnostic no. 834 (0700)		(→ 115)
	Assign behavior of diagnostic no. 835 (0702)		(→ 115)
	Assign behavior of diagnostic no. 862 (0745)		(→ 115)
	Assign behavior of diagnostic no. 937 (0743)		(→ 115)
	Assign behavior of diagnostic no. 302 (0739)		(→ 115)
	Administration	→	(→ 95)
	Define access code		
	Confirm access code		
	Device reset		
	Activate SW option (0029)		
	SW option active overview (0015)		
Sensor	→		
	Measured values	→	(→ 98)
	Process variables	→	(→ 98)
	Volume flow (1838)		
	Mass flow (1847)		
	Conductivity (1850)		
	Totalizer	→	(→ 99)

	Totalizer value 1 to 3 (0911)	
	Totalizer overflow 1 to 3 (0910)	
	Input values	→ (→ ⓘ 99)
	Value status input (1353)	
	Output values	→ (→ ⓘ 100)
	Output current 1 (0361)	
	Measured current output 1 (0366)	
	Pulse output 1 to 2 (0456)	
	Output frequency 1 to 2 (0471)	
	Switch status 1 to 2 (0461)	
	System units	→ (→ ⓘ 89)
	Volume flow unit (0553)	
	Volume unit (0563)	
	Conductivity unit (0582)	
	Temperature unit (0557)	
	Mass flow unit (0554)	
	Mass unit (0574)	
	Density unit (0555)	
	Date/time format (2812)	
	User-specific units	→ (→ ⓘ 89)
	User volume text (0567)	
	User volume offset (0569)	
	User volume factor (0568)	
	User mass text (0560)	
	User mass offset (0562)	
	User mass factor (0561)	
	Process param.	→ (→ ⓘ 68)
	Filter options (6710)	

Flow damping (6661)	
Flow override (1839)	
Conductivity damping (1803)	
Conductivity measurement (6514)	
	Low flow cut off → (→ ⓘ 84)
	Assign process variable (1837)
	On value low flow cutoff (1805)
	Off value low flow cutoff (1804)
	Pressure shock suppression (1806)
	Empty pipe detection → (→ ⓘ 86)
	Empty pipe detection (1860)
	Switch point (6562)
	Response time (1859)
	Empty pipe adj. value (6527)
	Full pipe value (6548)
	Current measured value (6559)
	New adjustment (6560)
	Progress (6571)
	Electrode cleaning circuit* → (not Promag D 400)
	Electrode cleaning circuit (6528)
	ECC duration (6555)
	ECC recovery time (6556)
	ECC cleaning cycle (6557)
	ECC polarity (6631)
	External compensation →


Output	→	
Current output 1	→	(→ ⓘ 71)
Assign current output (0359)		
Current span (0353)		
Fixed current (0365)		
0/4 mA value (0367)		
20 mA value (0372)		
Measuring mode (0351)		
Damping (0363)		
Response time (0378)		
Failure mode (0364)		
Failure current (0352)		
Output current 1 (0361)		
Measured current output 1 (0366)		
PFS output1 to 2	→	(→ ⓘ 72)
Pulse output	→	(→ ⓘ 72)
Operating mode (0469)		
Assign pulse output (0460)		
Value per pulse (0455)		
Pulse width (0452)		
Measuring mode (0457)		
Failure mode (0480)		
Pulse output 1 to 2 (0456)		
Invert output signal (0470)		
Frequency output	→	(→ ⓘ 74)
Operating mode (0469)		
Assign frequency output (0478)		
Minimum frequency value (0453)		

	Maximum frequency value (0454)	
	Measuring value at minimum frequency (0476)	
	Measuring value at maximum frequency (0475)	
	Measuring mode (0479)	
	Damping output (0477)	
	Response time (0491)	
	Failure mode (0451)	
	Failure frequency (0474)	
	Output frequency 1 to 2 (0471)	
	Invert output signal (0470)	
	Switch output →	(→  76)
	Operating mode (0469)	
	Switch output function (0481)	
	Assign diagnostic behavior (0482)	
	Assign limit (0483)	
	Switch-on value (0466)	
	Switch-off value (0464)	
	Assign flow direction check (0484)	
	Assign status (0485)	
	Switch-on delay (0467)	
	Switch-off delay (0465)	
	Failure mode (0486)	
	Switch status 1 to 2 (0461)	
	Invert output signal (0470)	
Communication →		
	HART input →	(→  81)

	Configuration	→	(→ 📄 81)
	Capture mode (7001)		
	Assign external process variable (7002)		
	Device ID (7007)		
	Device type (7008)		
	Manufacturer ID (7009)		
	Burst command (7006)		
	Slot number (7010)		
	Timeout (7005)		
	Failure mode (7011)		
	Failsafe value (7012)		
	Input	→	(→ 📄 81)
	Value (7003)		
	Status (7004)		
HART output		→	(→ 📄 66)
	Configuration	→	(→ 📄 67)
	Burst mode (0208)		
	Burst command (0207)		
	HART address (0219)		
	No. of preambles (0217)		
	HART short tag (0220)		
	Device tag (0215)		
	Information	→	(→ 📄 121)
	Device revision (0204)		
	Device ID (0221)		
	Device type (0222)		
	Manufacturer ID (0223)		
	HART revision (0205)		
	HART descriptor (0212)		
	HART message (0216)		
	HART date code (0202)		

	Hardware revision (0206)	
	Software revision (0224)	
	Output	→ (→ ⓘ 66)
	Assign PV (0234)	
	Primary variable (PV) (0201)	
	Assign SV (0235)	
	Secondary variable (SV) (0226)	
	Assign TV (0236)	
	Tertiary variable (TV) (0228)	
	Assign QV (0237)	
	Quaternary variable (QV) (0203)	
	Web server	→ (→ ⓘ 58)
	Web server language (7221)	
	MAC address (7214)	
	IP address (7209)	
	Subnet mask (7211)	
	Default gateway (7210)	
	Web server functionality (7222)	
	Application	→
	Reset all totalizers (2806)	→ (→ ⓘ 101)
	Totalizer1 to 3	→ (→ ⓘ 90)
	Assign process variable (0914)	
	Unit (0915)	
	Totalizer operation mode (0908)	
	Control totalizer 1 (0912)	
	Preset value 1 (0913)	
	Failure mode (0901)	

Diagnostics	→	(→ 📄 104)
Actual diagnostics (0691)		(→ 📄 119)
Previous diagnostics (0690)		
Operating time from restart (0653)		
Operating time (0652)		
Diagnostic list	→	
Diagnostics 1 to 5 (692 to 696)		
Event logbook	→	(→ 📄 119)
Filter options (0705)		(→ 📄 120)
Device information	→	(→ 📄 121)
Device tag (0011)		
Serial number (0009)		
Firmware version (0010)		
Device name (0013)		
Order code (0008)		
Extended order code 1 to 3 (0023, 0021, 0022)		
Configuration counter (0233)		
ENP version (0012)		
IP address (7209)		
Subnet mask (7211)		
Default gateway (7210)		
Data logging	→	(→ 📄 102)
Assign channel 1-4 (851 to 854)		
Logging interval (0856)		
Clear logging data (0855)		
Min/max values	→	
Reset min/max values (6541)		

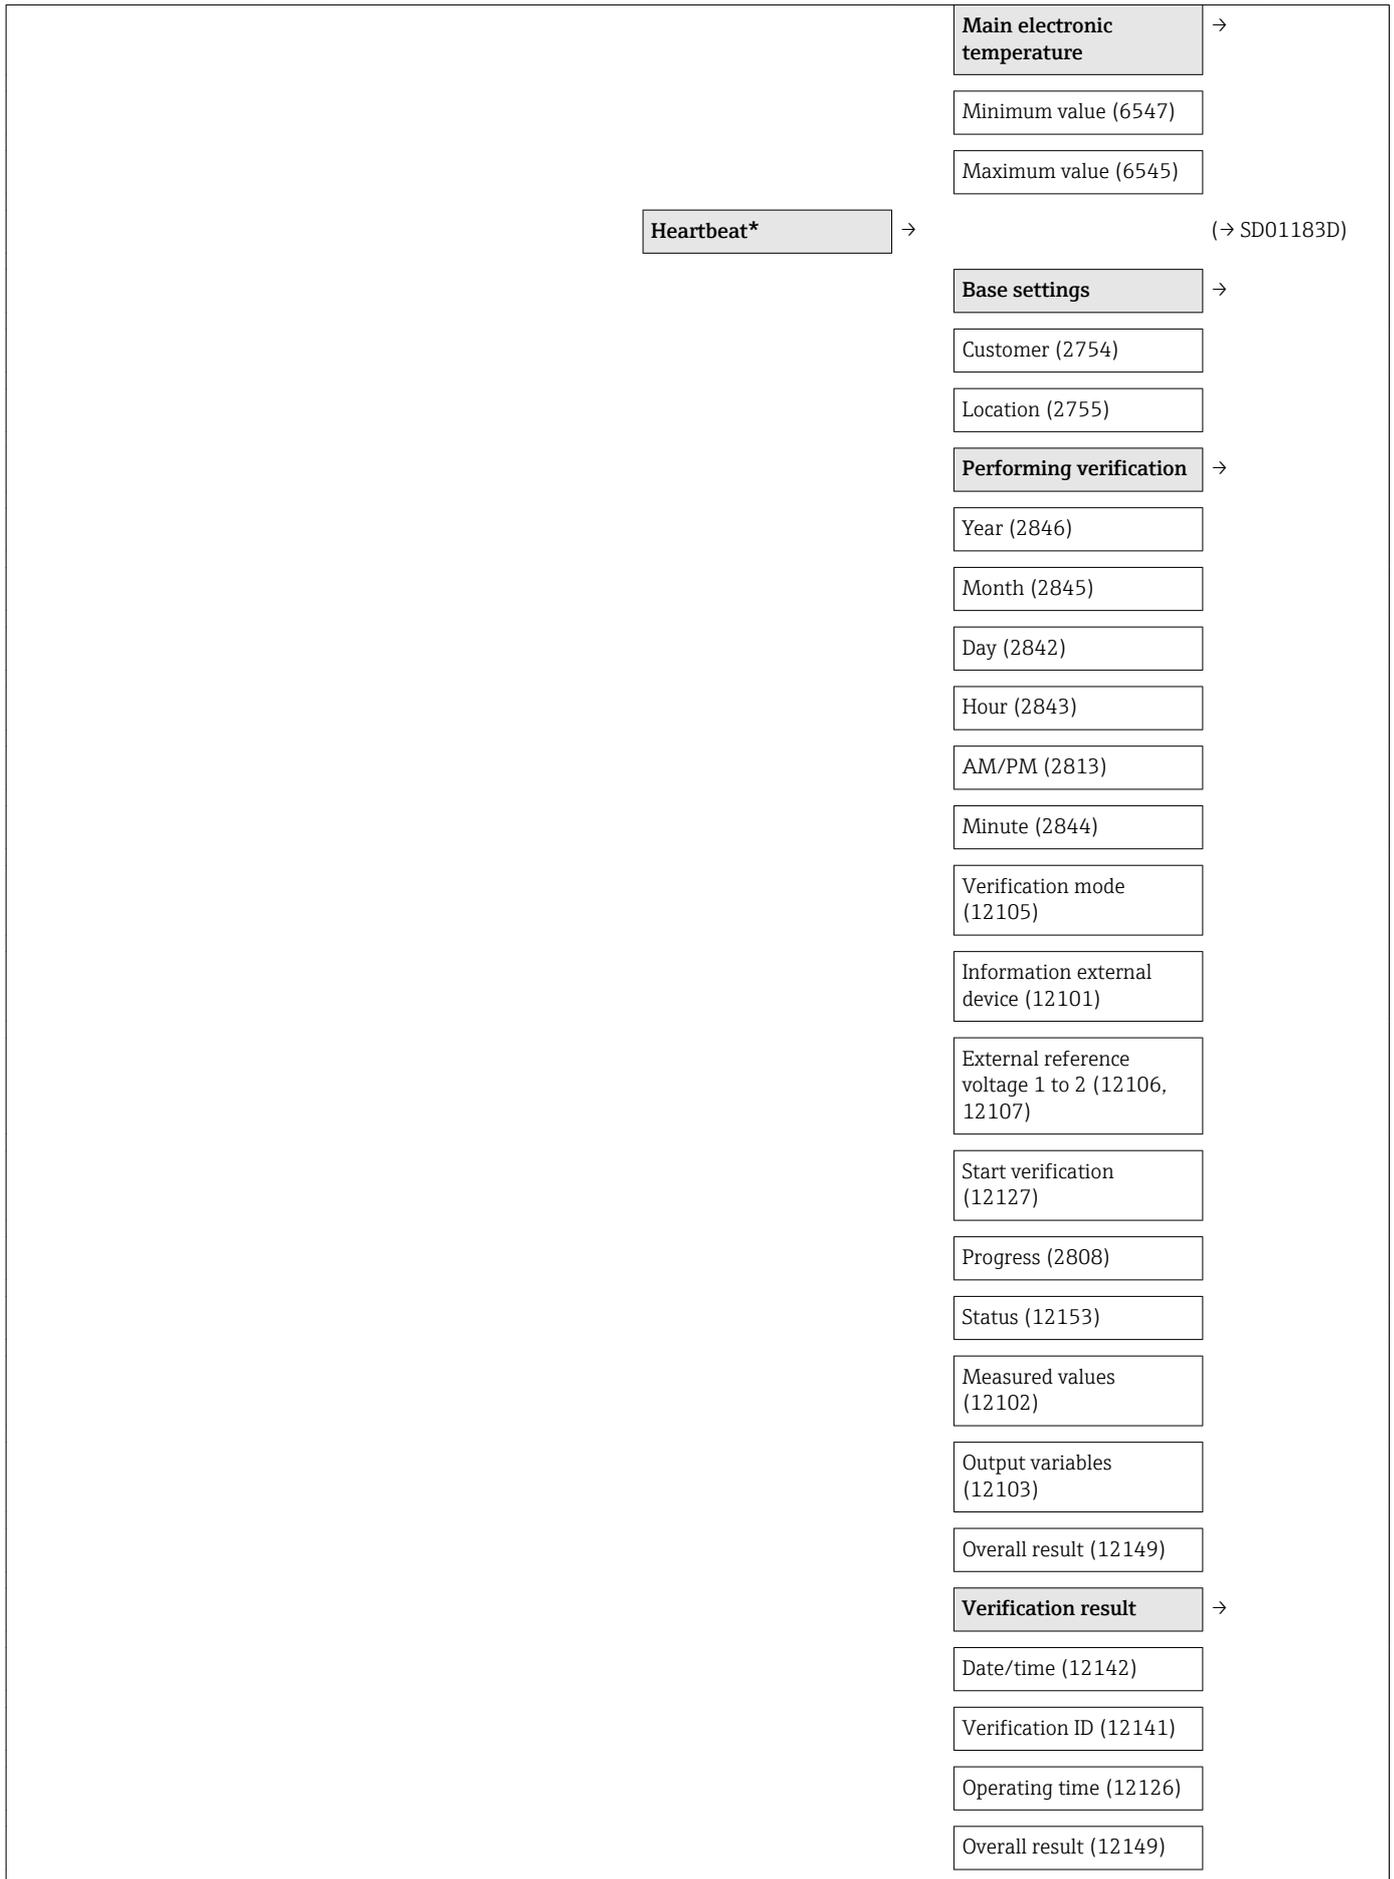

	Sensor (12152)	
	Sensor electronics module (12151)	
	I/O module (12145)	
	Monitoring result	→
	Noise (12158)	
	Coil current shot time (12150)	
	Reference electrode potential against PE (12155)	
	Simulation	→
	Assign simulation process variable (1810)	
	Value process variable (1811)	
	Simulation status input (1355)	
	Value status input (1356)	
	Simulation current output 1 (0354)	
	Value current output 1 (0355)	
	Frequency simulation 1 to 2 (0472)	
	Frequency value 1 to 2 (0473)	
	Pulse simulation 1 to 2 (0458)	
	Pulse value 1 to 2 (0459)	
	Switch output simulation 1 to 2 (0462)	
	Switch status 1 to 2 (0463)	
	Simulation device alarm (0654)	
		(→ 93)

Index

A

- Access authorization to parameters
 - Read access 57
 - Write access 57
- Access code 57
 - Incorrect input 57
- Adapters 21
- Adapting the diagnostic behavior 113
- Ambient temperature
 - Influence 135
- Ambient temperature range 20
- AMS Device Manager 64
 - Function 64
- Application 9, 129
- Applicator 129
- Approvals 143

C

- C-Tick symbol 143
- Cable entries
 - Technical data 134
- Cable entry
 - Degree of protection 41
- CE mark 10, 143
- Certificates 143
- Check
 - Installation 30
 - Post-connection 41
- Checklist
 - Post-connection check 41
 - Post-installation check 30
- Cleaning
 - Exterior cleaning 124
 - Interior cleaning 124
- Commissioning 68
 - Advanced settings 88
 - Configuring the measuring device 68
- Communication-specific data 66
- Connecting cable 31
- Connecting the measuring device 36
- Connection
 - see Electrical connection
- Connection examples, potential equalization 39
- Connection preparations 34
- Connection tools 31
- Context menu
 - Closing 52
 - Explanation 52
 - Opening 52
- Current consumption 133

D

- Declaration of Conformity 10
- Define access code 95, 96
- Degree of protection 41, 135
- Design

- Measuring device 12
- Designated use 9
- Device components 12
- Device description files 66, 66
- Device documentation
 - Supplementary documentation 8
- Device locking, status 98
- Device name
 - Sensor 15
 - Transmitter 14
- Device repair 125
- Device revision 66
- Device type ID 66
- Diagnostic behavior
 - Explanation 108
 - Symbols 108
- Diagnostic information
 - Design, description 108, 111, 113
 - FieldCare 111, 112
 - Light emitting diodes 105
 - Local display 107
 - Overview 115
 - Remedial measures 115
 - Web browser 110
- Diagnostic list 119
- Diagnostic message 107
- Diagnostics
 - Symbols 107
- DIP switch
 - see Write protection switch
- Direct access 54
- Direct access code 48
- Disabling write protection 95
- Display
 - Current diagnostic event 118
 - Previous diagnostic event 118
 - see Local display
- Display area
 - For operational display 47
 - In the navigation view 49
- Display values
 - For locking status 98
- Disposal 125
- Document
 - Function 6
 - Symbols used 6
- Document function 6
- Documentation 144
- Down pipe 18
- Drinking water approval 143

E

- Electrical connection
 - Commubox FXA195 62
 - Degree of protection 41
 - Field Communicator 62

- Handheld terminals 62
 - Measuring device 31
 - Operating tools 62
 - Via HART protocol 62
 - Via service interface (CDI-RJ45) 62
 - Web server 62
 - Electromagnetic compatibility 136
 - Enabling write protection 95
 - Endress+Hauser services
 - Maintenance 124
 - Repair 125
 - Environment
 - Ambient temperature range 20
 - Mechanical load 136
 - Shock resistance 135
 - Storage temperature 135
 - Vibration resistance 136
 - Error messages
 - see Diagnostic messages
 - Event history 119
 - Events list 119
 - Ex approval 143
 - Extended order code
 - Sensor 15
 - Transmitter 14
 - Exterior cleaning 124
- F**
- Field Communicator
 - Function 65
 - Field Communicator 475 65
 - Field of application
 - Residual risks 10
 - Field Xpert 63
 - Function 63
 - FieldCare 63
 - Device description file 66
 - Establishing a connection 63
 - Function 63
 - User interface 64
 - Filtering the event logbook 120
 - Firmware
 - Release date 66
 - Version 66
 - Firmware history 123
 - Fitted electrodes 141
 - Flow direction 19
 - Flow limit 136
 - Function check 68
 - Function scope
 - AMS Device Manager 64
 - Field Communicator 65
 - Field Communicator 475 65
 - Field Xpert 63
 - SIMATIC PDM 64
 - Functions
 - see Parameter
- G**
- Galvanic isolation 132
- H**
- Hardware write protection 96
 - HART input
 - Connection 41
 - Settings 81
 - HART protocol 142
 - Device variables 66
 - Measured variables 66
 - Help text
 - Calling up 55
 - Close 55
 - Explanation 55
- I**
- I/O electronics module 12, 36
 - Identifying the measuring device 14
 - Incoming acceptance 13
 - Influence
 - Ambient temperature 135
 - Information on the document 6
 - Inlet runs 19
 - Input 129
 - Input mask 50
 - Inspection check
 - Received goods 13
 - Installation 18
 - Installation conditions
 - Adapters 21
 - Down pipe 18
 - Inlet and outlet runs 19
 - Mounting kit 23
 - Mounting location 18
 - Orientation 19
 - Partially filled pipe 19
 - System pressure 20
 - Vibrations 21
 - Installation dimensions 20
 - Interior cleaning 124
- K**
- Keypad lock
 - Disabling 57
 - Enabling 57
- L**
- Languages, operation options 142
 - Line recorder 102
 - Local display 142
 - Editing view 50
 - Navigation view 48
 - see Diagnostic message
 - see In alarm condition
 - see Operational display
 - Low flow cut off 132

M

Main electronics module	12
Maintenance tasks	124
Replacing seals	124
Manufacturer ID	66
Manufacturing date	14, 15
Materials	139
Maximum measured error	134
Measured variables	
Calculated	129
Measured	129
see Process variables	
Measuring and test equipment	124
Measuring device	
Configuration	68
Conversion	125
Design	12
Disposal	126
Integrating via HART protocol	66
Mounting the sensor	23
Arranging the mounting bolts and centering sleeves	23
Mounting the ground cable/ground disks	24
Mounting the seals	24
Screw tightening torques	24
Preparing for electrical connection	34
Preparing for mounting	22
Removing	125
Repair	125
Switching on	68
Measuring principle	129
Measuring range	129
Measuring system	129
Measuring tube specification	138
Mechanical load	136
Media	9
Medium temperature range	136
menu	
Diagnostics	118
Setup	69
Menus	
For measuring device configuration	68
For specific settings	88
Mounting bolts	141
Mounting dimensions	
see Installation dimensions	
Mounting kit	23
Mounting location	18
Mounting preparations	22
Mounting requirements	
Installation dimensions	20
Mounting tools	22

N

Nameplate	
Sensor	15
Transmitter	14
Navigation path (navigation view)	48
Navigation view	

In the submenu	48
In the wizard	48
Numeric editor	50

O

Operable flow range	130
Operating elements	51, 108
Operating keys	
see Operating elements	
Operating menu	
Menus, submenus	44
Overview of menus with parameters	146
Structure	44
Submenus and user roles	45
Operating philosophy	45
Operation	98
Operation options	43, 43
Operational display	46
Operational safety	10
Order code	14, 15
Orientation (vertical, horizontal)	19
Outlet runs	19
Output	130
Output signal	130
Overview	
Operating menu	146

P

Packaging disposal	17	
Parameter		
Changing	56	
Enter a value	56	
Parameter settings		
Configuration (submenu)	67, 81	
Current output 1 to 2 (wizard)	71	
Data logging (submenu)	102	
Device information (submenu)	121	
Diagnostics (menu)	118	
Display (submenu)	91	
Display (wizard)	79	
Empty pipe detection (wizard)	86	
For the status input	70	
Input values (submenu)	99	
Low flow cut off (wizard)	84	
Operation (submenu)	101	
Output conditioning (wizard)	82	
Output values (submenu)	100	
Process variables (submenu)	98	
Pulse-Frequency-Switch output 1 to 2 (wizard)		
72,	74,	76
Sensor adjustment (submenu)	90	
Setup (menu)	69	
Simulation (submenu)	93	
Status input (submenu)	70	
System units (submenu)	89	
Totalizer (submenu)	99	
Totalizer 1 to 3 (submenu)	90	
Web server (submenu)	61	
Partially filled pipe	19	

- Performance characteristics 134
- Post-connection check (checklist) 41
- Post-installation check 68
- Post-installation check (checklist) 30
- Potential equalization 39, 133
- Power consumption 133
- Power supply failure 133
- Pressure loss 136
- Pressure tightness 136
- Pressure-temperature ratings 136
- Process
 - Flow limit 136
 - Medium temperature 136
 - Pressure loss 136
 - Pressure tightness 136
- Process connections 141
- Product safety 10
- Protecting parameter settings 95
- R**
- Read access 57
- Reading measured values 98
- Recalibration 124
- Reference operating conditions 134
- Registered trademarks 8
- Remedial measures
 - Calling up 109
 - Closing 109
- Remote operation 142
- Remote version
 - Connecting the signal cables 37
- Repair 125
 - Notes 125
- Repair of a device 125
- Repeatability 135
- Replacement
 - Device components 125
- Replacing seals 124
- Requirements for personnel 9
- Returning devices 125
- S**
- Safety 9
- Screw tightening torques 24
- Sensor
 - Mounting 23
- Serial number 14, 15
- Service interface (CDI-RJ45) 142
- Setting the operating language 68
- Settings
 - Adapting the measuring device to the process conditions 101
 - Advanced display configurations 91
 - Current output 71
 - Device reset 121
 - Device tag 69
 - Empty pipe detection (EPD) 86
 - HART input 81
 - Local display 79
 - Low flow cut off 84
 - Operating language 68
 - Output conditioning 82
 - Pulse/frequency/switch output 72
 - Resetting the totalizer 101
 - Sensor adjustment 90
 - Simulation 93
 - Status input 70
 - System units 89
 - Totalizer 90
 - Totalizer reset 101
- Shock resistance 135
- Showing data logging 102
- Signal on alarm 131
- SIMATIC PDM 64
 - Function 64
- Software release 66
- Spare part 125
- Spare parts 125
- Standards and guidelines 143
- Status area
 - For operational display 46
 - In the navigation view 48
- Status signals 107, 110
- Storage conditions 16
- Storage temperature 16
- Storage temperature range 135
- Structure
 - Operating menu 44
- submenu
 - Configuration 67, 81
 - Data logging 102
 - Device information 121
 - Display 91
 - Input values 99
 - Operation 101
 - Output values 100
 - Process variables 98
 - Sensor adjustment 90
 - Simulation 93
 - Status input 70
 - System units 89
 - Totalizer 99
 - Totalizer 1 to 3 90
 - Web server 61
- Submenu
 - Define access code 95
 - Events list 119
 - Overview 45
 - Process variables 98
- Supply voltage 133
- Symbols
 - For communication 46
 - For correction 50
 - For diagnostic behavior 46
 - For locking 46
 - For measured variable 47
 - For measurement channel number 47
 - For menus 49

- For parameters 49
- For status signal 46
- For submenu 49
- For wizard 49
- In the status area of the local display 46
- In the text and numeric editor 50
- System design
 - Measuring system 129
 - see Measuring device design
- System integration 66
- System pressure 20
- T**
- Technical data, overview 129
- Temperature range
 - Ambient temperature range for display 142
 - Storage temperature 16
- Terminal assignment 33, 36, 37
- Terminals 133
- Text editor 50
- Tool tip
 - see Help text
- Tools
 - Electrical connection 31
 - For mounting 22
 - Transport 16
- Transmitter
 - Connecting the signal cables 36
 - Turning the display module 29
 - Turning the housing 27
- Transporting the measuring device 16
- Troubleshooting
 - General 104
- Turning the display module 29
- Turning the electronics housing
 - see Turning the transmitter housing
- Turning the transmitter housing 27
- U**
- Use of the measuring device
 - Borderline cases 9
 - Incorrect use 9
 - see Designated use
- User roles 45
- V**
- Version data for the device 66
- Vibration resistance 136
- Vibrations 21
- W**
- W@M 124, 125
- W@M Device Viewer 14, 125
- Weight
 - Compact version 137
 - Sensor remote version 137
 - Transport (notes) 16
- wizard
 - Current output 1 to 2 71
 - Define access code 95
- Display 79
- Empty pipe detection 86
- Low flow cut off 84
- Output conditioning 82
- Pulse-Frequency-Switch output 1 to 2 72, 74, 76
- Wizard
 - Empty pipe detection (EPD) 87
- Workplace safety 10
- Write access 57
- Write protection
 - Via access code 95
 - Via write protection switch 96
- Write protection switch 96

www.addresses.endress.com
