Valid as of version V 2.03.XX (Device firmware, HART 5) V 2.07.XX (Device firmware, HART 7)

Description of Device Functions Proline Promag 53

Electromagnetic flowmeter



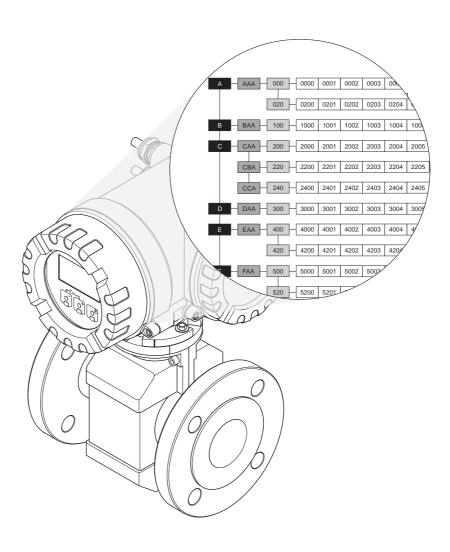


Table of contents

1	Notes on using this Manual	. 7
1.1	Using the table of contents to locate a function description	7
1.2	Using the graphic of the function matrix to locate a function description	
1.3	Using the index of the function matrix to locate a function description	
2	Function Matrix	o
2.1	General layout of the function matrix	
	2.1.1 Blocks (A, B, C, etc.)	
	2.1.2 Groups (AAA, AEA, CAA, etc.)	
	2.1.4 Functions (0000, 0001, 0002, etc.)	
	2.1.5 Codes identifying cells	
	2.1.6 Designation of device software	
2.2	Function matrix Promag 53	. 10
3	Block MEASURED VARIABLES	11
3.1	Group MEASURING VALUES	
3.2	Group SYSTEM UNITS	
J.Z	3.2.1 Function group CONFIGURATION	
	3.2.2 Function group ADDITIONAL CONFIGURATION	
3.3	Group SPECIAL UNITS	. 17
	3.3.1 Function group ARBITRARY UNIT	
	3.3.2 Function group DENSITY PARAMETER	18
4	Block QUICK SETUP	20
4.1	Setup Commissioning	22
4.2	Pulsating flow Setup menu	
4.3	Batching Setup menu	
5	Block USER INTERFACE	20
5.1	Group CONTROL	
	5.1.1 Function group BASIC CONFIGURATION	
	5.1.3 Function group OPERATION	
5.2	Group MAIN LINE	. 35
	5.2.1 Function group CONFIGURATION	
	5.2.2 Function group MULTIPLEX	
5.3	Group ADDITIONAL LINE	
	5.3.1 Function group CONFIGURATION	
5.4	Group INFORMATION LINE	
	5.4.1 Function group CONFIGURATION	
	5.4.2 Function group MULTIPLEX	47
6	Block TOTALIZER	49
6.1	Group TOTALIZER (1 to 3)	50
J.1	6.1.1 Function group CONFIGURATION	
	6.1.2 Function group OPERATION	52
6.2	Group HANDLING TOTALIZER	. 53
7	Block OUTPUTS	5/
,	DIOCK COTT OTO	J-1

 $Endress\!+\!Hauser$

7.1	Group CURRENT OUTPUT (1 to 2)	. 55
	7.1.1 Function group CONFIGURATION	. 55
	7.1.2 Function group OPERATION	
	7.1.3 Function group INFORMATION	
7.2	Group PULSE/FREQUENCY OUTPUT (1 to 2)	
	7.2.1 Function group CONFIGURATION	
	7.2.2 Function group OPERATION	
7.0	7.2.3 Function group INFORMATION	
7.3	Group RELAY OUTPUT (1 to 2)	
	7.3.2 Function group OPERATION	
	7.3.3 Function group INFORMATION	
	7.3.4 Information on the response of the relay output	
7.4	Switching response of the relay output	
	o microssis of the rotal output	100
8	Block INPUTS	102
0 1		
8.1	Group STATUS INPUT	
	8.1.1 Function group CONFIGURATION	
	8.1.3 Function group INFORMATION	
8.2	Group CURRENT INPUT	
0.2	8.2.1 Function group CONFIGURATION	
	8.2.2 Function group OPERATION	
	8.2.3 Function group INFORMATION	
	J r	
9	Block BASIC FUNCTION	110
9.1	Group HART	111
7.1	9.1.1 Function group CONFIGURATION	
	9.1.2 Function group INFORMATION	
9.2	Group PROCESS PARAMETER	
	9.2.1 Function group CONFIGURATION	
	9.2.2 Function group EPD PARAMETER	
	9.2.3 Function group ECC PARAMETER	119
	9.2.4 Function group ADJUSTMENT	
9.3	Group SYSTEM PARAMETER	
	9.3.1 Function group CONFIGURATION	
9.4	Group SENSOR DATA	124
	9.4.1 Function group CONFIGURATION	
	9.4.2 Function group OPERATION	125
10	Block SPECIAL FUNCTION	127
10 1	Group BATCHING FUNCTION	120
10.1	10.1.1 Function group CONFIGURATION	
	10.1.1 Function group CONFIGURATION	
	10.1.2 Function group VALVE FARMETER	133
	10.1.4 Function group SUPERVISION	136
	10.1.5 Function group OPERATION	141
	10.1.6 Function group INFORMATION	
11	Plack SUDEDVISION	145
	Block SUPERVISION	
11.1	Group SYSTEM	
	11.1.1 Function group CONFIGURATION	146
11.0	11.1.2 Function group OPERATION	149
11.2	Group VERSION INFO	
	11.2.1 Function group DEVICE	
	11.2.2 1 anchor group our would be the contract of the contrac	エノエ

4 Endress+Hauser

	SI units (not for USA and Canada)	
13	Index function matrix	157

Endress+Hauser 5

Registered trademarks ${\rm HART}^{\rm @}$

Registered trademark of HART Communication Foundation, Austin, USA $\,$

 $HistoROM^{TM},\,S\text{-}DAT^{\circledR},\,T\text{-}DAT^{\circledR},\,F\text{-}CHIP^{\circledR}$

Registered trademarks of Endress+Hauser Flowtec AG, Reinach, CH

6 Endress+Hauser

1 Notes on using this Manual

There are various ways of locating the description of a function of your choice in the manual:

1.1 Using the table of contents to locate a function description

1.2 Using the graphic of the function matrix to locate a function description

This step-by-step, top-down approach starts with the blocks, the highest level, and works down through the matrix to the description of the function you need:


- 1. All available blocks and their corresponding groups, are illustrated on $\rightarrow \boxminus 10$. Select the block (or the group within the block) which you need for your application and use the page reference to locate the information corresponding to the next level.
- 2. The page in question contains a graphic showing of the block with all its subordinate groups, function groups and functions. Select the function which you need for your application and use the page reference to locate the detailed function description.

1.3 Using the index of the function matrix to locate a function description

Each "cell" in the function matrix (blocks, groups, function groups, functions) has a unique identifier in the form of a code consisting of one or three letters or a three- or four-digit number. The code identifying a selected "cell" appears at the top right on the local display.

Example:



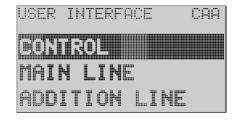

A0001653-EN


The function matrix index lists the codes for all the available "cells" in alphabetic and consecutive order, complete with the page references for the corresponding functions. The index to the function matrix is on $\Rightarrow \triangleq 157$.

2 Function Matrix

2.1 General layout of the function matrix

The function matrix consists of four levels:

Blocks -> Groups -> Function groups -> Functions

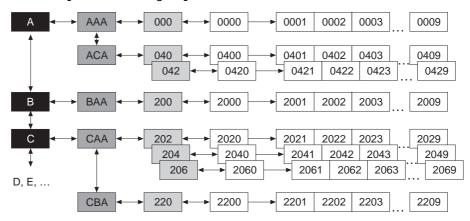

A0000961

2.1.1 Blocks (A, B, C, etc.)

The blocks are the highest-level grouping of the operation options for the device. The blocks include, for example: MEASURED VARIABLES, QUICK SETUP, USER INTERFACE, TOTALIZER, etc.

2.1.2 Groups (AAA, AEA, CAA, etc.)

A block consists of one or more groups. Each group represents a more detailed selection of the operation options in the higher-order block. The groups in the "USER INTERFACE" block, for example, include: CONTROL, MAIN LINE, ADDITIONAL LINE, etc.

2.1.3 Function groups (000, 020, 060, etc.)

A group consists of one or more function groups. Each function group represents a more detailed selection of the operation options in the higher-order group. Function groups available of group "CONTROL" are for example: BASIC CONFIGURATION, UNLOCKING/LOk-KING, OPERATION, etc.

2.1.4 Functions (0000, 0001, 0002, etc.)

Each function group consists of one or more functions. The functions are used to operate and parameterize the device. Numerical values can be entered or. parameters selected and saved. The functions in the "BASIC CONFIGURATION" function group include LANGUAGE, DISPLAY DAMPING, CONTRAST LCD, etc. The procedure for changing the language of the user interface, for example, is as follows:

- 1. Select the block "USER INTERFACE".
- 2. Select the group "CONTROL".
- 3. Select the function group "BASIC CONFIGURATION".
- 4. Select the function "LANGUAGE" (here you can set the language required).

2.1.5 Codes identifying cells

Each cell (block, group, function group and function) in the function matrix has an individual, unique code.

Blocks:

The code is a letter (A, B, C, etc.)

Groups:

The code consists of three letters (AAA, ABA, BAA, etc.).

The first letter matches the block code (i.e. each group in block A has a code starting with an A $_$; the codes of the groups in block B start with a B $_$, etc.).

The other two letters are for identifying the group within the respective block.

Function groups:


The code consists of three digits (000, 001, 100, etc.).

Functions:

The code consists of four digits (0000, 0001, 0201, etc.).

The first three digits are the same as the code for the function group.

The last digit in the code is a counter for the functions in the function group, incrementing from 0 to 9 (e.g. function 0005 is the sixth function in group 000).

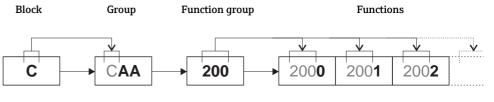

A0001251

2.1.6 Designation of device software


HART 5

- Valid until software version: 2.03.XX
- Order code "Power Supply; Display", option A, B, C, D, E, F, G, H, X, 7, 8


HART 7

- Valid as of software version: 2.07.XX
- \bullet Order code "Power Supply; Display", option P, Q, R, S, T, U, 4, 5

2.2 Function matrix Promag 53

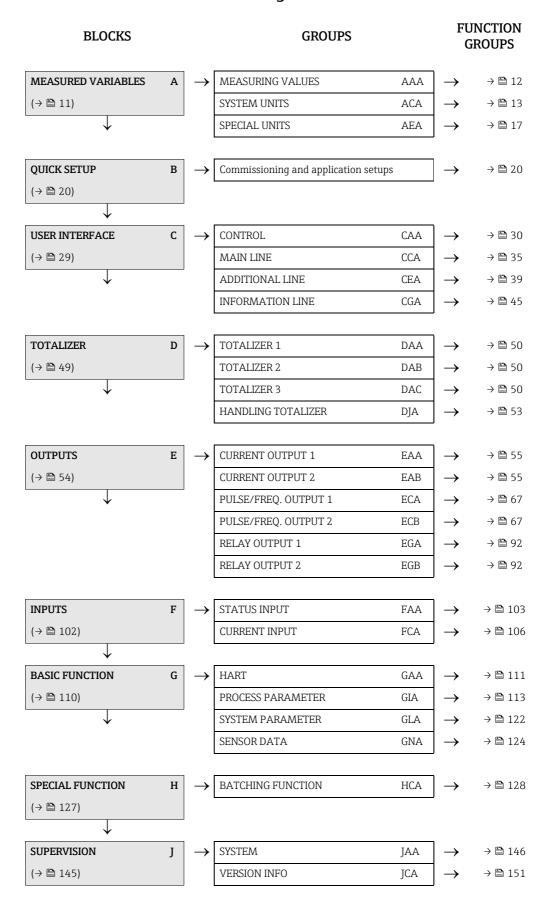

3 Block MEASURED VARIABLES

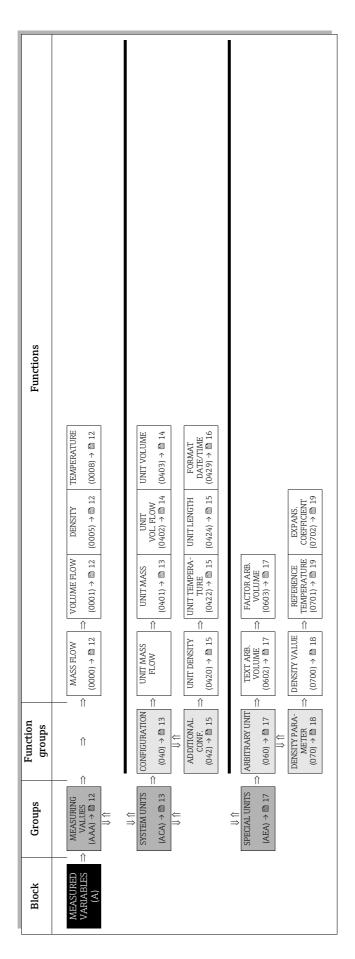


3.1 Group MEASURING VALUES

Function description MEASURED VARIABLES → MEASURING VALUES → Measuring value functions						
 Note! The engineering units of all the measured variables shown here can be set in the "SYSTEM UNITS" group. If the fluid in the pipe flows backwards, a negative sign prefixes the flow reading on the display. 						
The calculated mass flow appears on the display. The mass flow is derived from the measured volume flow and the fixed (or temperature-compensated) density.						
User interface: 5-digit floating-point number, including unit and sign (e.g. 462.87 kg/h; -731.63 lb/min; etc.)						
The volume flow currently measured appears on the display.						
User interface: 5-digit floating-point number, including unit and sign (e.g. 5.5445 dm ³ /min; 1.4359 m ³ /h; -731.63 gal/d; etc.)						
The fixed density, temperature-compensated density or density fed in via the current input appears on the display.						
User interface: 5-digit floating-point number, including unit (corresponding to 0.10000 to 6.0000 kg/dm³) e.g. 1.2345 kg/dm³; 993.5 kg/m³; 1.0015 SG_20 °C; etc.						
Display of the actual temperature, if the current input is set to "TEMPERATURE". User interface: max. 4-digit fixed-point number, including unit and sign (e.g23.4 °C; 160.0 °F; 295.4 K, etc.)						

3.2 Group SYSTEM UNITS

3.2.1 Function group CONFIGURATION

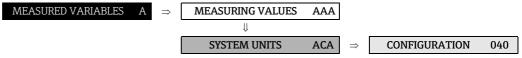

		SYSTEM UNITS	ACA	\Rightarrow	CONFIGURATION	040		
,	AE A CLIDED TA	Function descrip		NICIO	ID A TION			
	MEASURED VARIABLES → SYSTEM UNITS → CONFIGURATION							
You can select the units for measured variables in this function group.								
UNIT MASS FLOW	UNIT MASS FLOW Use this function to select the unit for displaying the calculated mass flow							
(0400)	(mass/ti	me). The mass flow is deri and the measured volume	ved from			fic fluid		
	Currer	you select here is also vali nt outputs	d for:					
		ency outputs switch points (limit value ow	for mass t	flow, flo	ow direction)			
	Options :							
	Kilogram	g/s; g/min; g/h; g/day \rightarrow kg/s; kg/min; kg/h; k on \rightarrow t/s; t/min; t/h; t/da						
	US:							
	pound -	> oz/s; oz/min; oz/h; oz/d → lb/s; lb/min; lb/h; lb/da on/s; ton/min; ton/h; ton/	y					
	Factory :	setting: on nominal diameter and	country	(→ 🖺 1	54).			
UNIT MASS (0401)	Use this The mas	function to select the unit s is derived from the prese d volume.	for displa	ying th	ne calculated mass.	ıd the		
		you select here is also vali value (e.g. kg/p)	d for:					
	Options: Metric − US → oz	→ g; kg; t						
	Factory :	setting: on nominal diameter and	country	(→ 🖺 1	54).			
	The unit	ote! for the totalizers is indepo is selected separately for t				each		

Function description

MEASURED VARIABLES → SYSTEM UNITS → CONFIGURATION

UNIT VOLUME FLOW (0402)

Use this function to select the unit for displaying the volume flow (volume/time).

The unit you select here is also valid for:

- Current outputs
- Frequency outputs
- Relay switch points (limit value for volume flow, flow direction)
- Low flow

Options:

Metric:

Cubic centimeter \rightarrow cm³/s; cm³/min; cm³/h; cm³/day Cubic decimeter \rightarrow dm³/s; dm³/min; dm³/h; dm³/day Cubic meter \rightarrow m³/s; m³/min; m³/h; m³/day

Milliliter \rightarrow ml/s; ml/min; Ml/h; ml/day

Liter \rightarrow l/s; l/min; l/h; l/day

Hectoliter \rightarrow hl/s; hl/min; hl/h; hl/day

Megaliter \rightarrow Ml/s; ml/min; Ml/h; ml/day

US:

Cubic centimeter \rightarrow cc/s; cc/min; cc/h; cc/day

Acre foot \rightarrow af/s; af/min; af/h; af/day

Cubic foot \rightarrow ft³/s; ft³/min; ft³/h; ft³/day

Fluid ounce \rightarrow oz f/s; oz f/min; oz f/h; oz f/day

 $Gallon \rightarrow gal/s; gal/min; gal/h; gal/day$

Kilo gallon → Kgal/s; Kgal/min; Kgal/h; Kgal/day

Million gallon → Mgal/s; Mgal/min; Mgal/h; Mgal/day

Barrel (normal fluids: 31.5 gal/bbl) \rightarrow bbl/s; bbl/min; bbl/h; bbl/day

Barrel (beer: 31.0 gal/bbl) \rightarrow bbl/s; bbl/min; bbl/h; bbl/day

Barrel (petrochemicals: 42.0 gal/bbl) \rightarrow bbl/s; bbl/min; bbl/h; bbl/day Barrel (filling tanks: 55.0 gal/bbl) \rightarrow bbl/s; bbl/min; bbl/h; bbl/day

Imperial:

 $Gallon \rightarrow gal/s; gal/min; gal/h; gal/day$

 $Mega~gallon \longrightarrow Mgal/s;~Mgal/min;~Mgal/h;~Mgal/day$

Barrel (beer: 36.0 gal/bbl) \rightarrow bbl/s; bbl/min; bbl/h; bbl/day

Barrel (petrochemicals: 34.97 gal/bbl) \rightarrow bbl/s; bbl/min; bbl/h; bbl/day

Arbitrary unit (see function group ARBITRARY UNIT on \rightarrow \cong 17) ____ \rightarrow ____/s; ____/min; ____/h; ____/day

Factory setting:

Depends on nominal diameter and country ($\Rightarrow \triangleq 154$).

Note

If you defined a unit of volume in the ARBITRARY UNIT 060 function group (see \rightarrow \cong 17) the unit in question is shown here.

UNIT VOLUME (0403)

Use this function to select the unit for displaying the volume.

The unit you select here is also valid for:

Pulse weighting (e.g. m³/p)

Options:

Metric \rightarrow cm³; dm³; m³; ml; l; hl; Ml Mega

 $US \rightarrow cc$; af; ft³; oz f; gal; Kgal; Mgal; bbl (normal fluids); bbl (beer); bbl (petrochemicals); bbl (filling tanks)

Imperial \rightarrow gal; Mgal; bbl (beer); bbl (petrochemicals)

Arbitrary unit \rightarrow _ _ _ _ (see function group ARBITRARY UNIT on \Rightarrow $\stackrel{\triangle}{=}$ 17)

Factory setting:


Depends on nominal diameter and country ($\rightarrow \square$ 154).

Note!

• If you defined a unit of volume in the ARBITRARY UNIT 060 function group (see \rightarrow \cong 17) the unit in question is shown here.

The unit of the totalizers is independent of your choice here. The unit for each totalizer is selected separately for the totalizer in question.

3.2.2 Function group ADDITIONAL CONFIGURATION

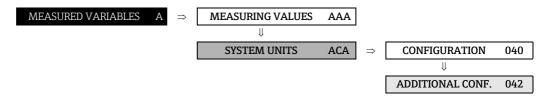


Function description MEASURED VARIABLES \rightarrow SYSTEM UNITS \rightarrow ADDITIONAL CONFIGURATION						
UNIT DENSITY (0420)	Use this function to select the unit for displaying the fluid density.					
(0120)	The unit you select here is also valid for: • Fluid density entry					
	Options: Metric \rightarrow g/cm ³ ; g/l; g/cc; kg/dm ³ ; kg/l kg/m ³ ; SD 4 °C, SD 15 °C, SD 20 °C; SG 4 °C, SG 15 °C, SG 20 °C					
	$ US \longrightarrow lb/ft^3; lb/gal; lb/bbl (normal fluids); lb/bbl (beer); lb/bbl (petrochemicals); lb/bbl (filling tanks) $					
	$Imperial \longrightarrow lb/gal; lb/bbl (beer); lb/bbl (petrochemicals)$					
	Factory setting: kg/1 (SI units: not for USA and Canada) g/cc (US units: only for USA and Canada)					
	SD = Specific Density, SG = Specific Gravity The specific density is the ratio of fluid density to water density (at water temperature = 4 , 15 , 20 °C).					
UNIT TEMPERATURE (0422)	Use this function to select the unit for the temperature. The unit selected here is also valid for the current input.					
	Options: °C (Celsius) K (Kelvin) °F (Fahrenheit) °R (Rankine)					
	Factory setting: °C © Note! This function is only displayed if the current input is set to "TEMPERATURE" (→ □ 106).					
UNIT LENGTH (0424)	Use this function to select the unit for displaying the length of the nominal diameter.					
	The unit you select here is also valid for: Nominal diameter of sensor (function NOMINAL DIAMETER (6804) on \rightarrow $\ \ \ \ \ \ \ \ \ \ \ \ \ $					
	Options: MILLIMETER INCH					
	Factory setting: MILLIMETER (SI units: not for USA and Canada) INCH (US units: only for USA and Canada)					

Function description MEASURED VARIABLES → SYSTEM UNITS → ADDITIONAL CONFIGURATION FORMAT DATE/TIME Use this function to select the format for the date and the time. (0429)The unit you select here is also valid for: Displaying the current calibration date (function CALIBRATION DATE (6808) on \rightarrow 124) Options: DD.MM.YY 24H MM/DD/YY 12H A/P DD.MM.YY 12H A/P MM/DD/YY 24H Factory setting: DD.MM.YY 24H (SI units) MM/DD/YY 12H A/P (US units)


3.3 Group Special Units

3.3.1 Function group ARBITRARY UNIT

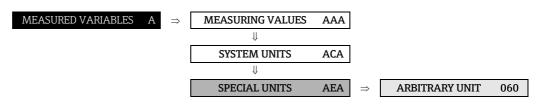

ME.	Function description ASURED VARIABLES → SPECIAL UNITS → ARBITRARY UNIT				
Use this function group to define an arbitrary unit for the flow rate variable.					
TEXT ARBITRARY VOLUME (0602)	Use this function to enter a text for the selectable volume unit / volume flow unit. You define only the text, the unit of time is provided from a choice of options (s, min, h, day). User input: xxxxxxx (max. 4 characters) Valid characters are A–Z, 0–9, +, -, decimal point, white space or underscore Factory setting: "" (No text) Example: If your text entry is "GLAS", this text string appears on the display complete with the unit of time, e.g. "GLAS/min": GLAS = Volume (text input)				
	GLAS / min = Volume flow as shown (on the display)				
FACTOR ARBITRARY VOLUME (0603)	Use this function to define a quantity factor (without time) for the selectable unit. The volume unit on which this factor is based is one liter. User input: 7-digit floating-point number Factory setting: 1 Reference quantity: Liter Example: The volume of a glass is 0.5 l → 2 glasses = 1 liter User input: 2				

3.3.2 Function group DENSITY PARAMETER

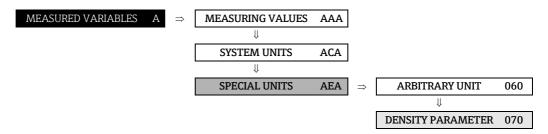

Function description

MEASURED VARIABLES → SPECIAL UNITS → DENSITY PARAMETER

Use this function group to calculate a mass flow from a volume flow. The thermal expansion of the fluid can be compensated if the measuring device is provided with the fluid process temperature by means of a current input.

Note

It is advisable to enter the density factor at process temperature for calculating the mass flow without compensating for thermal expansion.

Example of calculated mass flow without compensation for thermal expansion of the fluid:

 $\dot{\mathbf{m}} = \dot{\mathbf{V}} \cdot \rho = 1 \, [dm^3/h] \cdot 0.900 \, [kg/l] = 0.900 \, [kg/h] \, (mass flow at 20 °C)$

 $\dot{\mathbf{m}} = \dot{\mathbf{V}} \cdot \rho = 1 \, [dm^3/h] \cdot 0.783 \, [kg/l] = 0.783 \, [kg/h] \, (mass flow at 150 \, ^{\circ}\text{C})$

 $\dot{\mathbf{m}} = \text{Mass flow [kg/h]}$

 $\dot{\mathbf{V}}$ = Volume flow = 1 [dm³/h]

 ρ = Density value = 0.9 [kg/1], see function DENSITY (0700)

 T_{Ref} = Reference temperature = 20 [°C], see function REFERENCE TEMPERATURE (0701)

 T_{Pro} = Process temperature of the fluid = 150 [°C] via current input

 $\epsilon\,$ = Vol. expansion coefficient = $1\cdot 10^{-3}$ [1/K], see function EXPANSION COEFFICIENT (0702)

$$\dot{\mathbf{m}} = \dot{\mathbf{V}} \cdot \frac{\rho}{1 + \epsilon \cdot (\mathbf{T}_{Pro} - \mathbf{T}_{Ref})} \rightarrow \dot{\mathbf{m}} = 0.783 \text{ [kg/h]}$$

DENSITY VALUE (0700)

Use this function to enter a density value preferably at process temperature (or at reference temperature). This density value is used to convert the volume flow to a mass flow.

User input:

5-digit floating-point number

Factory setting:

1 [unit]

Note!

The appropriate unit is taken from the function UNIT DENSITY (0420), ($\rightarrow \stackrel{\triangle}{=} 15$).

Function description						
MEASURED VARIABLES → SPECIAL UNITS → DENSITY PARAMETER						
REFERENCE TEMPERATURE (0701)	Use this function to enter the reference temperature for the programmed density value. User input: 5-digit floating-point number					
	Factory setting: 20 °C Note!					
	The appropriate unit is taken from the UNIT TEMPERATURE function (0422) (\Rightarrow 15).					
EXPANSION COEFFI- CIENT (0702)	Use this function to enter a volume expansion coefficient $\lceil 1/K \rceil$ for temperature-dependent density changes.					
(0702)	User input: 5-digit floating-point number					
	Factory setting: 0					
	Note! This function is only displayed if the current input is set to TEMPERATURE" (\rightarrow 106).					

4 Block QUICK SETUP

Block	Group	Function groups	Functions				
QUICK SETUP (B)	⇒	⇒	QUICK SETUP COMMISSION (1002) → 🗎 20	⇒	QUICK SETUP PULS. FLOW (1003) → 🗎 20	QUICK SETUP BATCHING (1005) → 🗎 20	T-DAT SAVE/LOAD (1009) → 🖺 21

Function description						
QUICK SETUP						
QUICK SETUP COMMISSION (1002)	Use this function to start the Setup menu for commissioning. Options: YES NO Factory setting: NO Note! You will find a flowchart of the COMMISSIONING Setup menu on → 22. For more information on Setup menus, please refer to the Operating Instructions Promag 53, BA00047D.					
QUICK SETUP PULSATING FLOW (1003)	Use this function to start the application-specific Setup menu for pulsating flow. Options: YES NO Factory setting: NO Note! You will find a flowchart of the PULSATING FLOW Setup menu on → 24. For more information on Setup menus, please refer to the Operating Instructions Promag 53, BA00047D.					
QUICK SETUP BATCHING/DOSING (1005)	Note! This function is not available unless the optional software package BATCHING is installed and at least one relay output is available. Use this function to start the (optional) application-specific Setup menu for batching. Options: YES NO Factory setting: NO Note! You will find a flowchart of the BATCHING Setup menu on → 26. For more information on Setup menus, please refer to the Operating Instructions Promag 53, BA00047D.					

Function description

QUICK SETUP

T-DAT SAVE/LOAD (1009)

Use this function to save the parameter settings / configuration of the transmitter in a transmitter DAT (T-DAT), or to load the parameter settings from the T-DAT into the EEPROM (manual security function).

Application examples:

- After commissioning, the current measuring point parameters can be saved to the T-DAT as a backup.
- If the transmitter is replaced for some reason, the data from the T-DAT can be loaded into the new transmitter (EEPROM).

Options:

CANCEL

SAVE (from EEPROM to T-DAT) LOAD (from the T-DAT into EEPROM)

Factory setting:

CANCEL




- If the target device has an older software version, the message "TRANSM. SW-DAT" is displayed during start-up. Then only the "SAVE" function is available.
- IOAD

This function is only possible if the target device has the same software version as, or a more recent software version than, the source device.

■ SAVE

This function is always available.

4.1 Setup Commissioning

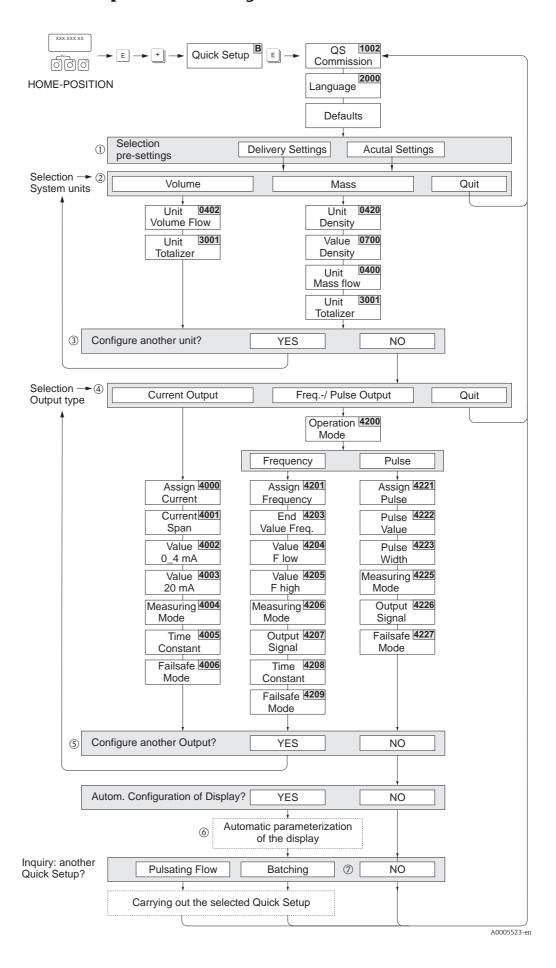


In the case of measuring devices without a local display, the individual parameters and functions must be configured by means of a configuration program, such as FieldCare from Endress+Hauser. During initial commissioning, the "Commissioning" Quick Setup must always be run through first, i.e. before other Quick Setups ($\rightarrow \cong 24, 26$).

Note!

- The display returns to the cell SETUP COMMISSIONING (1002) if you press the ESC key combination during parameter interrogation. The stored parameters remain valid.
- The "Commissioning" Quick Setup must be carried out before one of the Quick Setups explained below is run.
- ① The DELIVERY SETTINGS option sets every selected unit to the factory setting. The ACTUAL SETTINGS option accepts the units you previously configured.
- ② Only units not yet configured in the current Setup are offered for selection in each cycle. The unit for mass, volume and corrected volume is derived from the corresponding flow unit.
- The "YES" option remains visible until all the units have been configured. "NO" is the only option displayed when no further units are available.
- ④ Only the outputs not yet configured in the current Setup are offered for selection in each cycle.
- ⑤ The "YES" option remains visible until all the outputs have been parameterized. "NO" is the only option displayed when no further outputs are available.
- The "automatic parameterization of the display" option contains the following basic settings/factory settings:
 - YES: Main line = Mass flow; Additional line = Totalizer 1; Information line = Operating/system conditions
 - **NO:** The existing (selected) settings remain
- The QUICK SETUP BATCHING is only available when the optional software package BATCHING is installed.

4.2 Pulsating flow Setup menu

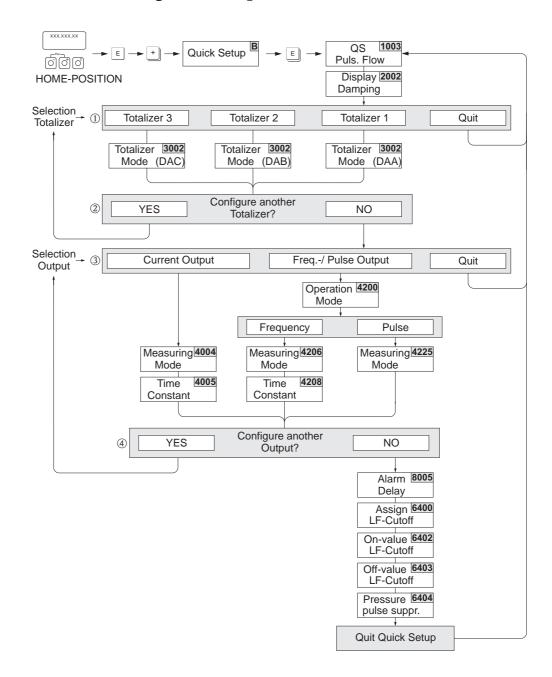

A0005524-en

Note!

- The display returns to the cell QUICK SETUP PULSATING FLOW (1003) if you press the ESC key combination during parameter interrogation.
- You can call up this Setup menu either directly from the "COMMISSIONING" Setup menu or manually by means of the function QUICK SETUP PULSATING FLOW (1003).
- ① Only totalizers not yet configured in the current Setup are offered for selection in each cycle.
- ② The "YES" option remains visible until all the totalizers have been configured. "NO" is the only option displayed when no further totalizers are available.
- ③ Only the outputs not yet configured in the current Setup are offered for selection in each cycle.
- ④ The "YES" option remains visible until all the outputs have been configured. "NO" is the only option displayed when no further outputs are available.

ct. code	Function name	Suggested settings	Description				
Call up through the function matrix:							
В	QUICK SETUP	QUICK SETUP PULSATING FLOW	→ 🖺 20				
1003	QUICK SETUP PULSATING FLOW	YES	→ 🖺 20				
asic conf	guration:						
2002	DISPLAY DAMPING	3 s	→ 🖺 31				
3002	TOTALIZER MODE (DAA)	BALANCE	→ 🖺 51				
3002	TOTALIZER MODE (DAB)	BALANCE	→ 🖺 51				
3002	TOTALIZER MODE (DAC)	BALANCE	→ 🖺 51				
	MEASURING MODE	PULSATING FLOW					
4005	TIME CONSTANT	3 s	→ 🖺 63				
			→ 🖺 63				
	signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE		→				
elect the	signal type: FREQ./PULSE OUTPUT (1	to 2) / operating mode: FREQUENCY					
elect the 4206 4208 elect the	signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE TIME CONSTANT signal type: FREQ./PULSE OUTPUT (1	to 2) / operating mode: FREQUENCY PULSATING FLOW 0 s to 2) / operating mode: PULSE	→ 🖺 71 → 🖺 76				
elect the 4206 4208	signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE TIME CONSTANT	to 2) / operating mode: FREQUENCY PULSATING FLOW 0 s	→ 🗎 71				
elect the 4206 4208 elect the	signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE TIME CONSTANT signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE	to 2) / operating mode: FREQUENCY PULSATING FLOW 0 s to 2) / operating mode: PULSE	→ 🖺 71 → 🖺 76				
elect the 4206 4208 elect the 4225	signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE TIME CONSTANT signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE	to 2) / operating mode: FREQUENCY PULSATING FLOW 0 s to 2) / operating mode: PULSE	→ 🖺 71 → 🖺 76				
elect the 4206 4208 elect the 4225	signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE TIME CONSTANT signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE ings:	to 2) / operating mode: FREQUENCY PULSATING FLOW 0 s to 2) / operating mode: PULSE PULSATING FLOW	→ 🖺 71 → 🖺 76 → 🖺 79				
elect the 4206 4208 elect the 4225 ther setti	signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE TIME CONSTANT signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE ings: ALARM DELAY	to 2) / operating mode: FREQUENCY PULSATING FLOW 0 s to 2) / operating mode: PULSE PULSATING FLOW 0 s	 → □ 71 → □ 76 → □ 79 → □ 147 				
elect the 4206 4208 elect the 4225 ther setting 8005 6400	signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE TIME CONSTANT signal type: FREQ./PULSE OUTPUT (1 MEASURING MODE ings: ALARM DELAY ASSIGN LOW FLOW CUT OFF	to 2) / operating mode: FREQUENCY PULSATING FLOW 0 s to 2) / operating mode: PULSE PULSATING FLOW 0 s VOLUME FLOW	→ 🖺 71 → 🖺 76 → 🖺 79 → 🖺 147 → 🖺 113				

Recommended settings for the function ASSIGN LOW FLOW CUT OFF (6400):

DN [mm]	dm ³ /min		US-gal/min
2	0.002	or	0.001
4	0.007	or	0.002
8	0.03	or	0.008
15	0.1	or	0.03
25	0.3	or	0.08
32	0.5	or	0.15
40	0.7	or	0.2
50	1.1	or	0.3
65	2.0	or	0.5
80	3.0	or	0.8
100	4.7	or	1.3


The recommended values correspond to the max. full scale value per DN divided by 1000 (see Operating Instructions Promag 53, BA00047D, Chapter "Installation" \rightarrow nominal diameters and flow rates).

4.3 Batching Setup menu

This Setup menu guides the user systematically through all the device functions that have to be adjusted and configured for batching operation.

The Setup menu settings result in a (simple) one-stage batching process.

The parameters for any additional settings, e.g. for automatic compensation of after-runs or multi-stage batching, must be manually set in the function matrix.

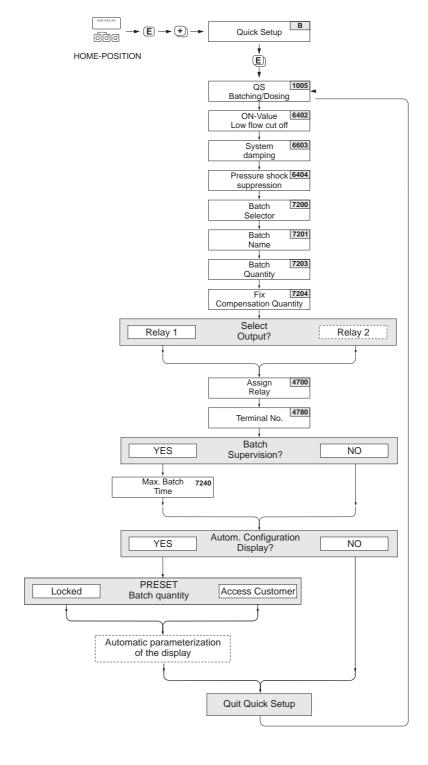

A0004433-EN



Note!

- This Setup menu is only available if the optional software package BATCHING is installed in the measuring device. By means of the order option, the software package can already be installed in the measuring device when delivered from the factory or it can be ordered at a later date from Endress + Hauser and installed as an optional software package.
- The display returns to the function QUICK SETUP BATCHING/DOSING (1005), if you press the ESC key combination during parameter interrogation.
- At the start of the Setup, general device parameters are optimally configured for measuring signal processing and output response.
- Then you can enter the specific batching parameters, starting with the options list "Batching 1 to 6". In this way, by running through the Setup menu a number of times, up to six different batching parameter sets (incl. special naming) can be created and called up as necessary.
- In order to enjoy full functionality, it is advisable to let the display parameters be set automatically. This means that the lowest display line is parameterised as the batching menu. Softkeys are displayed which can be used to start or stop the batching process in the HOME position. In this way, the measuring device can be fully deployed as a "batch controller". The user can also use the "PRESET Batch quantity" interrogation to decide whether changing the batch quantity is possible via the local display with or without first entering a code:
 - ACCESS CUSTOMER: batch quantity can be changed without first entering a code.
 - LOCKED: batch quantity cannot be changed without first entering a code (read-only).



Caution!


Settings for the Batching Setup menu:

By running the Setup, certain device parameters are optimally set for discontinuous operation. Should the measuring device be used for continuous flow measurement at a later time, we recommend you to rerun the "COMMISSIONING" or the "PULSATING FLOW" Setup.

Fct. code	Function name	Suggested settings	Description	
Call up through the function matrix:				
В	QUICK SETUP	QUICK SETUP BATCHING	→ 🖺 20	
1005	QUICK SETUP BATCHING	YES	→ 🖺 20	
Settings (fu	nctions with a grey background are set	automatically):	1	
6400	ASSIGN LOW FLOW CUT OFF	Volume	→ 🖺 113	
6402	ON-VALUE LOW FLOW CUT OFF	Table value	→ 🖺 114	
6403	OFF-VALUE LOW FLOW CUT OFF	50%	→ 🖺 114	
6603	SYSTEM DAMPING	9	→ 🖺 122	
6404	PRESSURE SHOCK SUPPRESSION	0 seconds	→ 🖺 115	
7200	BATCH SELECTOR	BATCH #1	→ 🖺 128	
7202	BATCH NAME	BATCH #1	→ 🖺 128	
7201	ASSIGN BATCH VARIABLE	Volume	→ 🖺 129	
7203	BATCH QUANTITY	0	→ 🖺 129	
7204	FIX COMPENSATION QUANTITY	0	→ 🖺 129	
7208	BATCH STAGES	1	→ 🖺 130	
7209	INPUT FORMAT	Value input	→ 🖺 130	
4700	ASSIGN RELAY	BATCHING VALVE 1	→ 🖺 92	
4780	TERMINAL NUMBER	Output (display only)	→ 🖺 98	
7220	OPEN VALVE 1	0% or 0 [unit]	→ 🖺 131	
7240	MAXIMUM BATCHING TIME	0 seconds (Off)	→ 🖺 136	
7241	MINIMUM BATCHING QUANTITY	0% or 0 [unit]	→ 🖺 137	
7242	MAXIMUM BATCHING QUANTITY	0% or 0 [unit]	→ 🖺 138	


2200	ASSIGN (Main line)	BATCH NAME	→ 🖺 35
2220	ASSIGN (Multiplex main line)	Off	→ 🖺 37
2400	ASSIGN (Additional line)	BATCH DOWNWARDS	→ 🖺 39
2420	ASSIGN (Multiplex additional line)	Off	→ 🖺 42
2600	ASSIGN (Info line)	BATCHING KEYS	→ 🖺 45
2620	ASSIGN (Multiplex info line)	Off	→ 🖺 47

5 Block USER INTERFACE

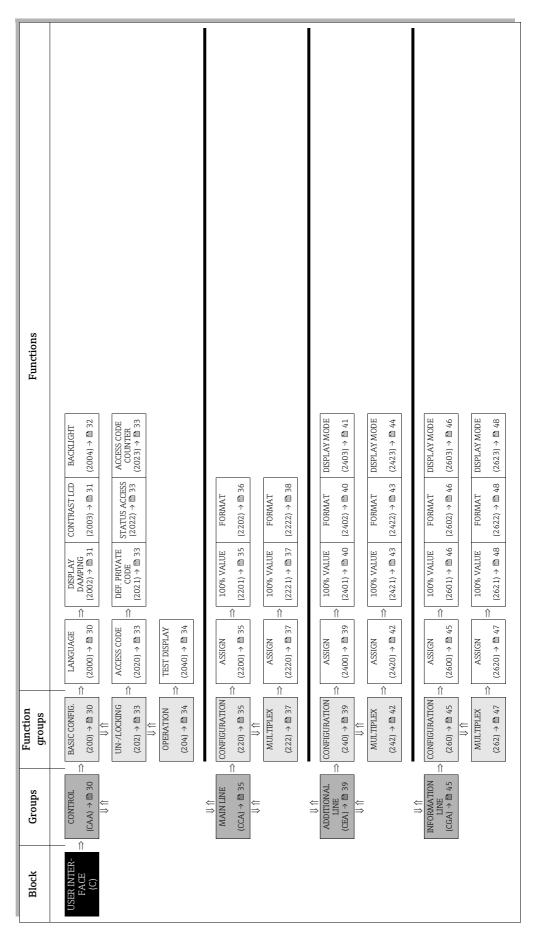

5.1 Group CONTROL


5.1.1 Function group BASIC CONFIGURATION

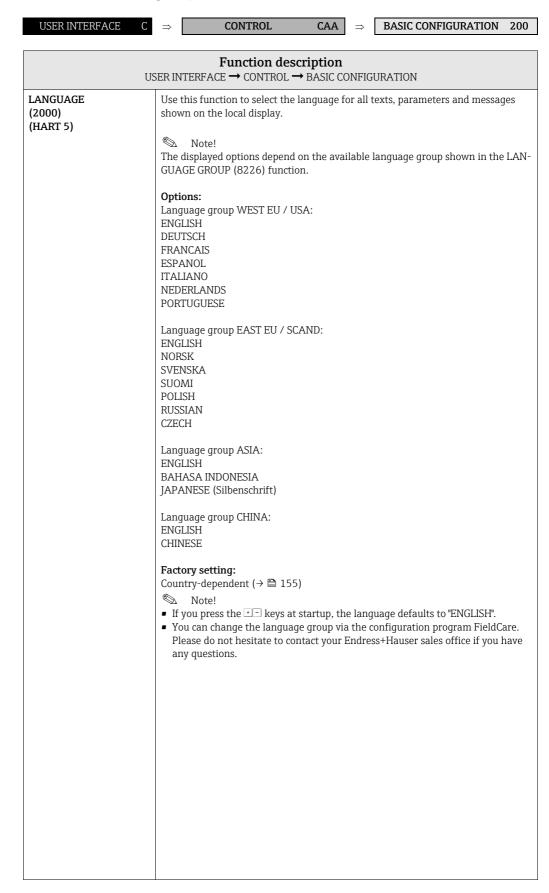

Function description USER INTERFACE → CONTROL → BASIC CONFIGURATION LANGUAGE Use this function to select the language for all texts, parameters and messages (2000)shown on the local display. (HART 7) Note! The displayed options depend on the available language group shown in the LAN-GUAGE GROUP (8226) function. Options: Option P, Q: ENGLISH **DEUTSCH FRANCAIS ESPANOL** ITALIANO **NEDERLANDS** Option R, S: **ENGLISH NEDERLANDS** PORTUGUESE RUSSIAN **CZECH** Option T, U: **ENGLISH** BAHASA INDONESIA **POLISH CHINA** Option 4, 5: ENGLISH NORSK SVENSKA SUOMI **JAPANESE** Factory setting: Country-dependent (→ 🖺 155) Note! ■ If you press the 🗀 keys at startup, the language defaults to "ENGLISH". • You can change the language group via the configuration program FieldCare. Please do not hesitate to contact your Endress+Hauser sales office if you have any questions. **DISPLAY DAMPING** Use this function to enter a time constant defining how the display reacts to (2002)severely fluctuating flow variables, either very quickly (enter a low time constant) or with damping (enter a high time constant). User input: 0 to 100 seconds Factory setting: 3 s Note! Setting the time constant to zero seconds switches off damping. CONTRAST LCD Use this function to optimize display contrast to suit local operating conditions. (2003)User input: 10 to 100% Factory setting: 50%


Function description USER INTERFACE \rightarrow CONTROL \rightarrow BASIC CONFIGURATION BACKLIGHT Use this function to optimize the backlight to suit local operating conditions. (2004)User input: 0 to 100% Note! Entering the value "O" means that the backlight is "switched off". The display then no longer emits any light, i.e. the display texts can no longer be read in the dark. Factory setting: 50%

5.1.2 Function group UNLOCKING/LOCKING

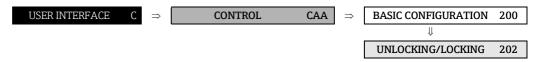

Į	Function description USER INTERFACE → CONTROL → UNLOCKING/LOCKING		
ACCESS CODE (2020)	All data of the measuring system are protected against inadvertent change. Programming is disabled and the settings cannot be changed until a code is entered in this function. If you press the		
DEFINE PRIVATE CODE (2021)	Use this function to specify a personal code for enabling programming in the function ACCESS CODE. User input: 0 to 9999 (max. 4-digit number)		
	Factory setting: 53 Note! Programming is always enabled with the code "0". Programming has to be enabled before this code can be changed. When programming is disabled this function is not available, thus preventing others from accessing your personal code.		
STATUS ACCESS (2022)	Use this function to check the access status for the function matrix. User Interface: ACCESS CUSTOMER (parameterization possible) LOCKED (parameterization disabled)		
ACCESS CODE COUNTER (2023)	Displays how often the customer code, service code or the digit "O" (code-free) has been entered to gain access to the function matrix. Display: max. 7-digit number: 0 to 9999999 Factory setting: 0		


5.1.3 Function group OPERATION

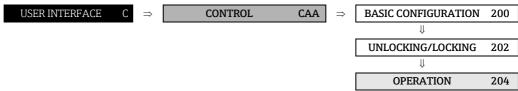


	OPERATION 204
	Function description
	USER INTERFACE \rightarrow CONTROL \rightarrow OPERATION
TEST DISPLAY (2040)	Use this function to test the operability of the local display and its pixels. Options:
	OFF ON
	Factory setting:
	OFF
	Test sequence: 1. Start the test by selecting ON.
	All pixels of the main line, additional line and information line are darkened for minimum 0.75 seconds.
	3. Main line, additional line and information line show an "8" in each field for minimum 0.75 seconds.
	4. Main line, additional line and information line show a "0" in each field for minimum 0.75 seconds.
	5. Main line, additional line and information line show nothing (blank display) for minimum 0.75 seconds.
	When the test completes the local display returns to its initial state and the setting changes to OFF.

5.2 Group MAIN LINE


5.2.1 Function group CONFIGURATION

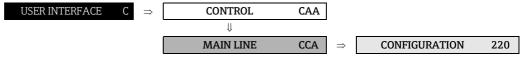

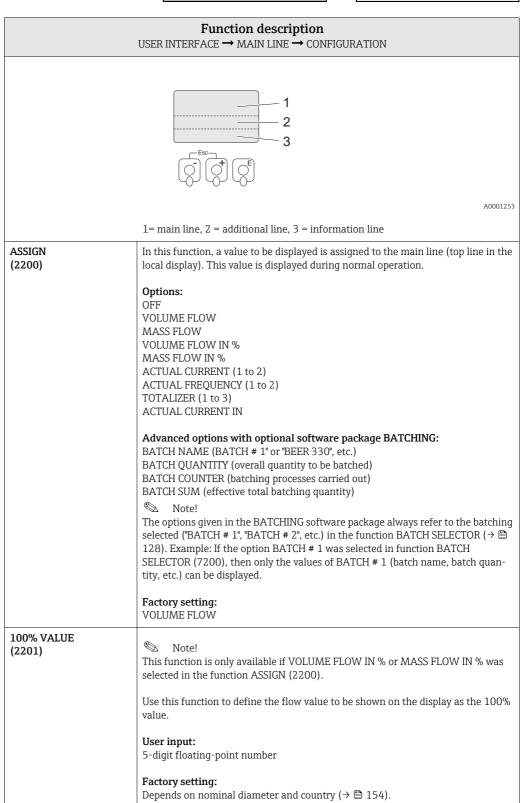

Function description USER INTERFACE → MAIN LINE → CONFIGURATION **FORMAT** Use this function to define the maximum number of places after the decimal point $\[$ (2202)displayed for the reading in the main line. Options: \overline{XXXXX} . – XXXX.X – XXX.XX – XX.XXX – X.XXXXFactory setting: X.XXXX Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. $1.2 \rightarrow \text{kg/h}$), indicating that the measuring system is computing with more decimal places than can be shown on the display.

5.2.2 Function group MULTIPLEX

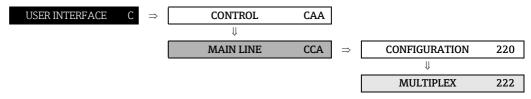


Function description USER INTERFACE → MAIN LINE → MULTIPLEX				
ASSIGN (2220)	Use this function to define the second reading to be displayed in the main line alternately (every 10 seconds) with the value defined in the ASSIGN function (2200). Options: OFF VOLUME FLOW MASS FLOW VOLUME FLOW IN % MASS FLOW IN % ACTUAL CURRENT (1 to 2) ACTUAL FREQUENCY (1 to 2) TOTALIZER (1 to 3) ACTUAL CURRENT IN Advanced options with optional software package BATCHING: BATCH NAME ("BATCH # 1" or "BEER 330", etc.) BATCH QUANTITY (overall quantity to be batched) BATCH SUM (effective total batching quantity) Note! The options given in the BATCHING software package always refer to the batching selected ("BATCH # 1", "BATCH # 2", etc.) in the function BATCH SELECTOR (→ 128). Example: If the option BATCH # 1 was selected in the function BATCH SELECTOR (7200), then only the values of BATCH # 1 (batch name, batch quantity, etc.) can be displayed.			
100% VALUE (2221)	Note! This function is only available if VOLUME FLOW IN % or MASS FLOW IN % was selected in the function ASSIGN (2220). Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country (→ 🖺 154).			

Function description USER INTERFACE → MAIN LINE → MULTIPLEX **FORMAT** Use this function to define the maximum number of places after the decimal point $\[$ (2222)for the second value displayed in the main line. Options: XXXXX. - XXXX.X - XXX.XX - XX.XXX - X.XXXX Factory setting: X.XXXX Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. $1.2 \rightarrow \text{kg/h}$), indicating that the measuring system is computing with more decimal places than can be shown on the display.

5.3 Group ADDITIONAL LINE

5.3.1 Function group CONFIGURATION

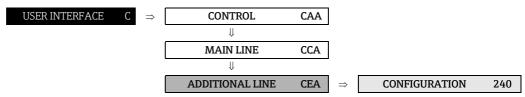



Function description USER INTERFACE \rightarrow ADDITIONAL LINE \rightarrow CONFIGURATION ASSIGN Advanced options with optional software package BATCHING: (continued) BATCH NAME ("BATCH # 1" or "BEER 330", etc.) BATCH QUANTITY (overall quantity to be batched) BATCH COUNTER (batching processes carried out) BATCH SUM (effective total batching quantity) BATCH UPWARDS (batching progress upwards) BATCH DOWNWARDS (batching progress downwards) Note! The options given in the BATCHING software package always refer to the batching selected ("BATCH # 1", "BATCH # 2", etc.) in the function BATCH SELECTOR (→ 🖺 Example: If the option BATCH # 1 was selected in the function BATCH SELECTOR (7200), only the values of BATCH # 1 (batch name, batch quantity, etc.) can be displayed. Factory setting: TOTALIZER 1 **100% VALUE** \otimes (2401)This function is not available unless one of the following was selected in the function ASSIGN (2400): VOLUME FLOW IN % MASS FLOW IN % VOLUME FLOW BARGRAPH IN % MASS FLOW BARGRAPH IN % Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country ($\rightarrow \triangleq 154$). FORMAT (2402)This function is not available unless a number was selected in the function ASSIGN (2400).Use this function to define the maximum number of places after the decimal point displayed for the reading in the additional line. Options: \bar{XXXXX} . – XXX.X – XXX.XX – XX.XXX – X.XXXXFactory setting: X.XXXX Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the $\,$ engineering unit (e.g. $1.2 \rightarrow \text{kg/h}$), indicating that the measuring system is computing with more decimal places than can be shown on the display.

USER INTERFACE → ADDITIONAL LINE → CONFIGURATION

DISPLAY MODE (2403)




Note!

This function is only available if VOLUME FLOW BARGRAPH IN % or MASS FLOW BARGRAPH IN % was selected in the function ASSIGN (2400).

Use this function to define the format of the bar graph.

Options:

STANDARD (Simple bar graph with 25 / 50 / 75% gradations and integrated sign).

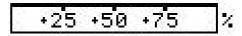

A0001258

SYMMETRY (Symmetrical bar graph for positive and negative directions of flow, with -50 / 0 / +50% gradations and integrated sign).




A0001259

Factory setting:

STANDARD

5.3.2 Function group MULTIPLEX

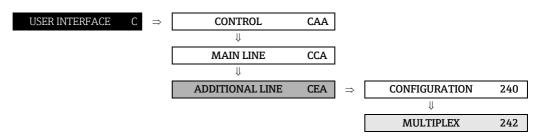


Function description USER INTERFACE → ADDITIONAL LINE → MULTIPLEX ASSIGN Use this function to define the second reading to be displayed in the additional line (2420)alternately (every 10 seconds) with the value defined in the function ASSIGN (2400).Options: OFF **VOLUME FLOW** MASS FLOW VOLUME FLOW IN % MASS FLOW IN % VOLUME FLOW BARGRAPH IN % MASS FLOW BARGRAPH IN % FLOW VELOCITY ACTUAL CURRENT (1 to 2) ACTUAL FREQUENCY (1 to 2) TOTALIZER (1 to 3) TAG NAME **DENSITY** * TEMPERATURE * **ACTUAL CURRENT IN *** LONG TAG 1...16 (only HART 7)** LONG TAG 17...32 (only HART 7)** * only available with present or correspondingly configured current input. ** Byte 29 to 32 only selectable in INFORMATION LINE. \rightarrow $\stackrel{\triangle}{=}$ 45 Advanced options with optional software package BATCHING: BATCH NAME ("BATCH # 1" or "BEER 330", etc.) BATCH QUANTITY (overall quantity to be batched) BATCH COUNTER (batching processes carried out) BATCH SUM (effective total batching quantity) BATCH UPWARDS (batching progress upwards) BATCH DOWNWARDS (batching progress downwards) The options given in the BATCHING software package always refer to the batching selected ("BATCH # 1", "BATCH # 2", etc.) in the function BATCH SELECTOR (\Rightarrow $\stackrel{ riangle}{ riangle}$ 128). Example: If option BATCH # 1 was selected in the function BATCH SELECTOR (7200), then only the values of BATCH $\#\ 1$ (batch name, batch quantity, etc.) can be displayed. Factory setting: (continued on next page)


	Function description			
USER INTERFACE → ADDITIONAL LINE → MULTIPLEX				
ASSIGN (continued)	 Note! Multiplex mode is suspended as soon as a fault/notice message is generated. The message in question appears on the display. Fault message (identified by a lightning icon): If ON was selected in the function ACKNOWLEDGE FAULTS (8004), multiplex mode is continued as soon as the fault has been acknowledged and is no longer active. If OFF was selected in the function ACKNOWLEDGE FAULTS (8004), multiplex mode is continued as soon as the fault is no longer active. Notice message (identified by an exclamation mark): Multiplex mode is continued as soon as the notice message is no longer active. 			
100% VALUE (2421)	 Note! This function is not available unless one of the following was selected in the function ASSIGN (2420): VOLUME FLOW IN % MASS FLOW IN % VOLUME FLOW BARGRAPH IN % MASS FLOW BARGRAPH IN % 			
	Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country (→ 🖺 154).			
FORMAT (2422)	This function is not available unless a number was selected in the function ASSIGI (2420). Use this function to define the maximum number of places after the decimal point for the second value displayed in the additional line. Options: XXXXX. − XXXX.X − XXX.XX − XX.XXX Factory setting: X.XXXX Note! Note that this setting only affects the reading as it appears on the display, it had no influence on the accuracy of the system's calculations. The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In succeinstances an arrow appears on the display between the measuring value and the engineering unit (e.g. 1.2 → kg/h), indicating that the measuring system is computing with more decimal places than can be shown on the display.			

Function description USER INTERFACE → ADDITIONAL LINE → MULTIPLEX DISPLAY MODE Note! (2423)This function is only available if VOLUME FLOW BARGRAPH IN % or MASS FLOW BARGRAPH IN % was selected in the function ASSIGN (2420). Use this function to define the format of the bar graph. Options: STANDARD (Simple bar graph with 25 / 50 / 75% gradations and integrated sign). +50 A0001258 $SYMMETRY \ (Symmetrical \ bar \ graph \ for \ positive \ and \ negative \ directions \ of \ flow,$ with -50 / 0 / +50% gradations and integrated sign). -50 A0001258 Factory setting: STANDARD

5.4 **Group INFORMATION LINE**

5.4.1 **Function group CONFIGURATION**

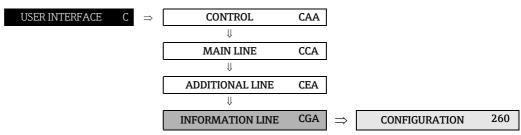

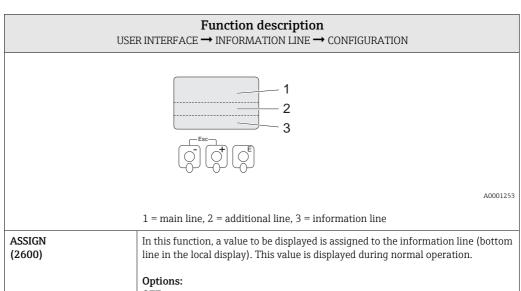

OFF

VOLUME FLOW IN %

MASS FLOW IN %

VOLUME FLOW BARGRAPH IN %

MASS FLOW BARGRAPH IN %

FLOW VELOCITY

ACTUAL CURRENT (1 to 2)

ACTUAL FREQUENCY (1 to 2)

TOTALIZER (1 to 3)

TAG NAME

OPERATING/SYSTEM CONDITIONS

DISPLAY FLOW DIRECTION

DENSITY *

TEMPERATURE *

ACTUAL CURRENT IN *

LONG TAG 1-14 (only HART 7)

LONG TAG 15-28 (only HART 7) LONG TAG 29-32 (only HART 7)

 $\ensuremath{^\star}$ only available with present or correspondingly configured current input.

Advanced options with optional software package BATCHING:

BATCHING KEYS (softkeys on the local display)

Note!


- If you select the BATCHING OPERATING KEYS, the multiplex display functionality (function ASSIGN (2620), etc.) is not available in the information
- For information on the functional concept of the batching menu, see chapter "Operation" in the Operating Instructions Promag 53, BA00047D.

Factory setting:

OPERATING/SYSTEM CONDITIONS

Function description USER INTERFACE → INFORMATION LINE → CONFIGURATION **100% VALUE** Notel (2601)This function is not available unless one of the following was selected in the function ASSIGN (2600): ■ VOLUME FLOW IN % MASS FLOW IN % • VOLUME FLOW BARGRAPH IN % MASS FLOW BARGRAPH IN % Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country ($\rightarrow \square$ 154). **FORMAT** (2602)This function is not available unless a number was selected in the function ASSIGN (2600).Use this function to define the maximum number of places after the decimal point displayed for the reading in the information line. Options: XXXXX. -XXXXXX. -XXXXXX. -XXXXXX. -XXXXXX. Factory setting: X.XXXX Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. $1.2 \rightarrow \text{kg/h}$), indicating that the measuring system is computing with more decimal places than can be shown on the display. DISPLAY MODE Notel (2603)This function is only available if VOLUME FLOW BARGRAPH IN % or MASS FLOW BARGRAPH IN % was selected in the function ASSIGN (2600). Use this function to define the format of the bar graph. Options: STANDARD (Simple bar graph with 25 / 50 / 75% gradations and integrated sign). +50 A0001258 SYMMETRY (Symmetrical bar graph for positive and negative directions of flow, with -50 / 0 / +50% gradations and integrated sign). A0001259 Factory setting: STANDARD

5.4.2 Function group MULTIPLEX

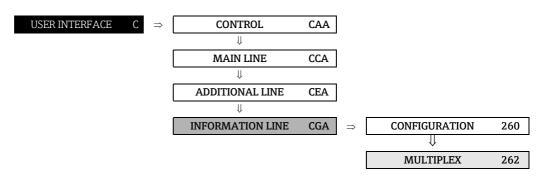

Function description

USER INTERFACE → INFORMATION LINE → MULTIPLEX

Note!

If you select the BATCHING KEYS in the function ASSIGN (2600), the multiplex display functionality is not available in the information line.

ASSIGN (2620)

Use this function to define the second reading to be displayed in the information line alternately (every 10 seconds) with the value defined in the function ASSIGN (2600).

Options:

OFF

VOLUME FLOW IN %

MASS FLOW IN %

VOLUME FLOW BARGRAPH IN %

MASS FLOW BARGRAPH IN %

FLOW VELOCITY

ACTUAL CURRENT (1 to 2)

ACTUAL FREQUENCY (1 to 2)

TOTALIZER (1 to 3)

TAG NAME

OPERATING/SYSTEM CONDITIONS

DISPLAY FLOW DIRECTION

DENSITY *

TEMPERATURE *

ACTUAL CURRENT IN *

LONG TAG 1-14 (only HART 7)

LONG TAG 15-28 (only HART 7)

LONG TAG 29-32 (only HART 7)

Factory setting:

OFF




Multiplex mode is suspended as soon as a fault / notice message is generated. The message in question appears on the display.

- Fault message (identified by a lightning icon):
 - If ON was selected in the function ACKNOWLEDGE FAULTS (8004), multiplex mode is continued as soon as the fault has been acknowledged and is no longer active.
 - If OFF was selected in the function ACKNOWLEDGE FAULTS (8004), multiplex mode is continued as soon as the fault is no longer active.
- Notice message (identified by an exclamation mark):
 - Multiplex mode is continued as soon as the notice message is no longer active.

 $[\]ensuremath{^{\star}}$ only available with present or correspondingly configured current input.


Function description USER INTERFACE → INFORMATION LINE → MULTIPLEX **100% VALUE** Note (2621)This function is not available unless one of the following was selected in the function ASSIGN (2620): ■ VOLUME FLOW IN % MASS FLOW IN % • VOLUME FLOW BARGRAPH IN % MASS FLOW BARGRAPH IN % Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country ($\rightarrow \square$ 154). **FORMAT** (2622)This function is not available unless a number was selected in the ASSIGN function (2600).Use this function to define the maximum number of places after the decimal point for the second value displayed in the information line. Options: XXXXX. -XXXXXX. -XXXXXX. -XXXXXX. -XXXXXX. Factory setting: X.XXXX Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. $1.2 \rightarrow \text{kg/h}$), indicating that the measuring system is computing with more decimal places than can be shown on the display. **DISPLAY MODE** \otimes Notel (2623)This function is only available if VOLUME FLOW BARGRAPH IN % or MASS FLOW BARGRAPH IN % was selected in the function ASSIGN (2620). Use this function to define the format of the bar graph. Options: STANDARD (Simple bar graph with 25 / 50 / 75% gradations and integrated sign). +50 A0001258 SYMMETRY (Symmetrical bar graph for positive and negative directions of flow, with -50 / 0 / +50% gradations and integrated sign). A0001258 Factory setting: STANDARD

6 Block TOTALIZER

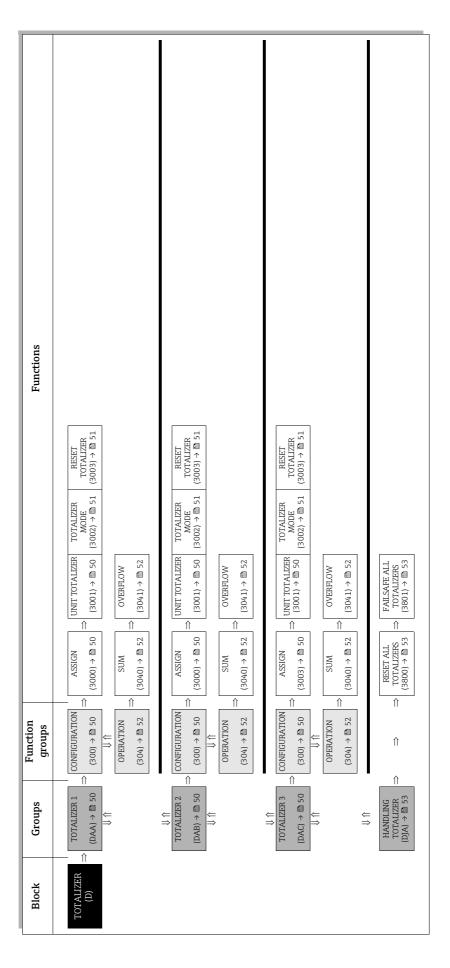

6.1 Group TOTALIZER (1 to 3)


6.1.1 Function group CONFIGURATION

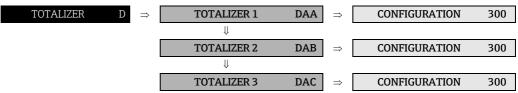

		TOTALIZER 3	DAC	\Rightarrow	CONFIGURATION	300
Function description TOTALIZER \rightarrow TOTALIZER (1 to 3) \rightarrow CONFIGURATION						
The function descriptions b	The function descriptions below apply to totalizers 1 to 3; the totalizers are independently configurable.					
ASSIGN (3000)	Options: OFF MASS FLOW VOLUME FLO Factory setti VOLUME FLO Note! The totaliz If you select	DW ing: DW ter is reset to "0" as	soon as th	ne sele CONF.	IGURATION of the totalizer in o	ques-
UNIT TOTALIZER (3001)	beforehand. Options: (for Metric o g; US o oz; lb; Factory setti Depends on n Options (for Metric o cm US o cc; af; bbl (petroche) Imperial o co Arbitrary uni (see function) Factory setti	r MASS FLOW asskg; t ton ing: nominal diameter a VOLUME FLOW a 1 ³ ; dm ³ ; m ³ ; ml; l; ft ³ ; oz f; gal; Kgal; emicals); bbl (filling gal; Mgal; bbl (bees group ARBITRAR	and countingsignment) assignmenth; MI Mee Mgal; bbl g tanks) r); bbl (pee	: nt): ga (norm croche	nal fluids); bbl (beer); micals) 17)	ected

	Function description TOTALIZER → TOTALIZER (1 to 3) → CONFIGURATION
TOTALIZER MODE	Use this function to define how the flow components are to be totalised.
(3002)	Options: BALANCE Positive and negative flow components. The positive and negative flow components are balanced. In other words, net flow in the flow direction is registered.
	FORWARD Positive flow components only
	REVERSE Negative flow components only
	Factory setting: Totalizer 1 = BALANCE Totalizer 2 = FORWARD Totalizer 3 = REVERSE
RESET TOTALIZER	Use this function to reset the sum and the overflow of the totalizer to zero.
(3003)	Options: NO YES
	Factory setting: NO
	Note! If the device is equipped with a status input, with the appropriate configuration a reset for each individual totalizer can also be triggered by a pulse (siehe Funktion ASSIGN STATUS INPUT (5000) auf Seite 103).

6.1.2 Function group OPERATION

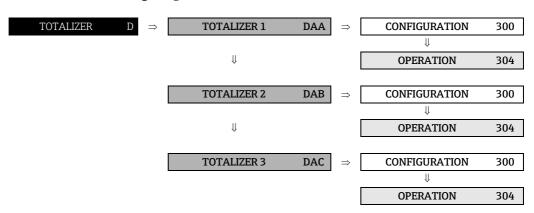

Function description

TOTALIZER → TOTALIZER (1 to 3) → OPERATION

The function descriptions below apply to totalizers 1 to 3; the totalizers are independently configurable.

SUM (3040)

Use this function to view the total for the totalizer's measured variable aggregated since measuring commenced. The value can be positive or negative, depending on the setting selected in the "TOTALIZER MODE" function (3002), and the direction of flow.

User interface:

max. 7-digit floating-point number, including sign and unit (e.g. $15467.04~\text{m}^3$; -4925.631~kg)



- The effect of the setting in the "TOTALIZER MODE" function (see \rightarrow 🖺 51) is as follows:
 - If the setting is "BALANCE", the totalizer balances flow in the positive and negative directions.
 - If the setting is "FORWARD", the totalizer registers only flow in the positive direction.
 - If the setting is "REVERSE", the totalizer registers only flow in the negative
- The totalizer's response to faults is defined in the "FAILSAFE ALL TOTALIZERS" function (3801), (see →

 53).

OVERFLOW (3041)

Use this function to view the overflow for the totalizer aggregated since measuring commenced.

Total flow quantity is represented by a floating-point number consisting of max. 7 digits. You can use this function to view higher numerical values (> 9,999,999) as overflows. The effective quantity is thus the total of OVERFLOW plus the value returned by the SUM function.


Example

Reading for 2 overflows: $2 \cdot 10^7 \, dm^3$ (= 20,000.000 dm³) The value displayed in the function SUM = 196,845.7 dm³ Effective total quantity = 20,196,845.7 dm³

User interface:

integer with exponent, including sign and unit, e.g. $2 \cdot 10^7$ dm³

6.2 Group HANDLING TOTALIZER

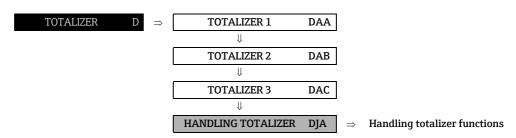


Function description TOTALIZER \rightarrow HANDLING TOTALIZER \rightarrow Handling totalizer functions		
RESET ALL TOTALIZERS (3800)	Use this function to reset the totals (including all overflows) of the totalizers (1 to 3) tozero (= RESET).	
	Options: NO YES	
	Factory setting: NO	
	Note! If the device is equipped with a status input and if it is appropriately configured, a reset for the totalizer (1 to 3) can also be triggered by a pulse (siehe Funktion ASSIGN STATUS INPUT (5000) auf Seite 103).	
FAILSAFE ALL TOTALIZERS (3801)	Use this function to define the common response of all totalizers (1 to 3) in case of error.	
	Options: STOP The totalizer is paused until the fault is rectified.	
	ACTUAL VALUE The totalizer continues to count is based on the current flow measuring value. The fault is ignored.	
	HOLD VALUE The totalizer continues to count the flow that is based on the last valid flow measuring value (before the fault occurred).	
	Factory setting: STOP	


7 Block OUTPUTS

	FAIL:SAFE MODE (4006) → 64 64	MEASURING MODE OUTPUT SIGNAL TIME CONSTANT FAILSAFE MODE (4206) → □ 71 (4207) → □ 73 (4208) → □ 76 (4209) → □ 76 FAILSAFE MODE FAILSAFE MODE (4207) → □ 73 (4208) → □ 76				(4706) → 🖺 95
ions	TIME CONSTANT (4005) → 🖺 63	VALUE-f HIGH (4205) → 🖺 69 OUTPUT SIGNAL	(4226) → 🖺 80 SWITCH-OFF DELAY (4245) → 🖺 85			MEASURING MODE (4705) → 🖺 94
Functions	VALUE 20 mA MEASURING MODE (4003) → ■ 59 (4004) → ■ 60	END VALUE VALUE-f LOW FREQ. (4203) \Rightarrow	$(4223) \rightarrow \mathbb{B} 78$ $(4225) \rightarrow \mathbb{B} 79$ SWITCH-ON OFF-VALUE DELAY $(4244) \rightarrow \mathbb{B} 84$	VALUE SIMUL. FREQ. (4303) → B 88	VAL. SIM. SWITCH PNT. (4343) → 🖺 90	OFF-VALUE SWITCH-OFF (4703) \Rightarrow \Rightarrow 99 (4704) \Rightarrow 99
	VALUE 0_4 mA VALUE (4002) → № 57 (4003) VALUE SIM. CURRENT (4042) → № 65	START VALUE FREG. (4202) → B 68	(4222) → B 77 (4223) ON-VALUE SWITT (4242) → B 84 (4243)	SIMULATION FREO. (4302) → ₿ 87 VALUE SIM. PULSE (4323) → ₿ 89	SIM. SWITCH POINT (4342) → ≜ 90	SWITCH-ON DELAY (4702) → B 93 (4703) VAL. SIM. SWITCH PNT. (4742) → B 97
	$CURRENT SPAN (4001) \Rightarrow 56(4001) \Rightarrow 56CURRENT (4041) \Rightarrow 65(4041) \Rightarrow 65(4041) \Rightarrow 66666$	$\begin{pmatrix} N \\ 67 \\ \end{pmatrix} \Rightarrow \begin{pmatrix} ASSIGN \\ (4201) \Rightarrow @ 67 \\ (4201) \Rightarrow @ 76 \\ (4211) \Rightarrow @ 76 \\ \end{pmatrix}$ $ASSIGN PULSE$	$(4221) \Rightarrow \mathbb{B} 77$ ASSIGN STATUS $(4241) \Rightarrow \mathbb{B} 83$	$\Rightarrow \begin{array}{c} ACTUAL FREQ. \\ (4301) \Rightarrow \blacksquare 87 \\ \hline SIMULATION \\ PULSE \\ (4322) \Rightarrow \blacksquare 89 \end{array}$	ACTUAL STATUS (4341) → ■ 90 UM- 91	$AY \Rightarrow ON-VALUE$ $92 \Rightarrow (4701) \Rightarrow B 93$ $TUS \Rightarrow SIM. SWITCH POINT POINT (4741) \Rightarrow B 96$ $1M-$
	ACTUAL CURRENT ACTUAL CURRENT (4040) > 26 TERMINAL NUM- BER (4080) > 26	$\Rightarrow \begin{array}{c} \text{OPERATION} \\ \text{MODE} \\ \text{(4200)} \Rightarrow \blacksquare 67 \end{array}$		î î	$\Rightarrow \begin{array}{c} \text{TERMINAL NUM-} \\ \Rightarrow \\ (4380) \Rightarrow \blacksquare 91 \end{array}$	$\Rightarrow \begin{array}{c} ASSIGN RELAY \\ (4700) \Rightarrow \textcircled{2} \ 92 \\ \Rightarrow \begin{array}{c} ACTUAL STATUS \\ RELAY \\ (4740) \Rightarrow \textcircled{2} \ 96 \\ \Rightarrow \end{array}$ $\Rightarrow \begin{array}{c} ACTUAL STATUS \\ (4740) \Rightarrow \textcircled{2} \ 96 \\ \Rightarrow \\ (4780) \Rightarrow \textcircled{2} \ 98 \\ \Rightarrow \end{array}$
Function groups	CONFIGURATION (4001) → № 55 U ↑ OPERATION (404) → № 65 U ↑ INFORMATION (408) → № 66	$\Rightarrow \begin{array}{c} \text{CONFIGURATION} \\ \Rightarrow \\ (420) \Rightarrow \mathbb{B} 67 \\ \downarrow \downarrow \uparrow \uparrow$	← =	ION 87	TION	$\Rightarrow \begin{array}{c} \text{CONFIGURATION} \\ (470) \Rightarrow \mathbb{B} 92 \\ \downarrow \downarrow \uparrow \\ \text{OPERATION} \\ (474) \Rightarrow \mathbb{B} 96 \\ \downarrow \downarrow \uparrow \\ \text{INFORMATION} \\ (478) \Rightarrow \mathbb{B} 98 \\ \end{array}$
Groups	CURRENT CLORRENT + B 55 U	REQ.			¢ =	□ ←
Block	OUTPUTS (E)					

7.1 Group CURRENT OUTPUT (1 to 2)

7.1.1 Function group CONFIGURATION

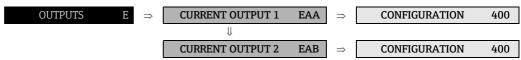

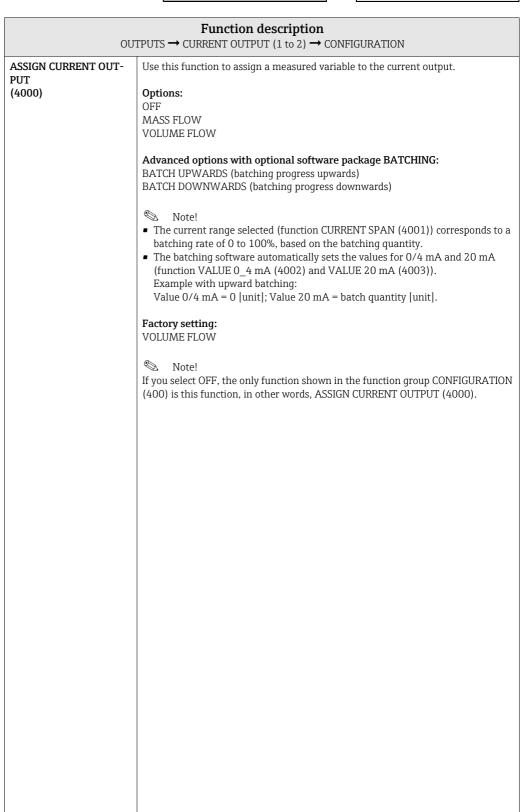

OUTPUTS \rightarrow CURRENT OUTPUT (1 to 2) \rightarrow CONFIGURATION

CURRENT SPAN (4001)

Use this function to define the current span. The selection specifies the operational range and the lower and upper signal on alarm. For the current output 1 the option HART can be defined additionally.

Options:

- 0-20 mA
- 4-20 mA
- 4-20 mA HART (only current output1)
- 4-20 mA NAMUR
- $4-20\ \text{mA}\ \text{HART}\ \text{NAMUR}$ (only current output1)
- 4-20 mA US
- 4–20 mA HART US (only current output1)
- 0-20 mA (25 mA)
- 4-20 mA (25 mA)
- 4-20 mA (25 mA) HART (only current output1)

Factory setting:

- 4-20 mA HART NAMUR (für current output 1)
- 4-20 mA NAMUR (für current output 2)
- 🖎 Note
- When switching the hardware from an active (factory setting) to a passive output signal select a current span of 4–20 mA (see Operating Instructions Promag 53, BA047D/06/en)

Current span, operational range and signal on alarm level

 1	2	3
0 - 20.5 mA	0	22
4 - 20.5 mA	2	22
3.8 - 20.5 mA	3.5	22.6
3.9 - 20.8 mA	3.75	22.6
0 - 24 mA	0	25
4 - 24 mA	2	25

A0001222

- a = Current span
- 1 = Operational range (measuring information)
- 2 = Lower signal on alarm level
- 3 = Upper signal on alarm level
 - Note
- If the measured value exceeds the measuring range (as defined in the functions VALUE 0_4 mA (4002) and VALUE 20 mA (4003)) a notice message is generated (#351 to 354, current span).
- In case of a fault the behaviour of the current output is according to the selected option in the function FAILSAFE MODE (4006). Change the error category in the function ASSIGN SYSTEM ERROR (8000) to generate a fault message instead of a notice message.

OUTPUTS \rightarrow CURRENT OUTPUT (1 to 2) \rightarrow CONFIGURATION

VALUE 0_4 mA (4002)

Use this function to assign the 0/4 mA current a value.

The value can be higher or lower than the value assigned to 20 mA (function VALUE 20 mA (4003)). Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow).

Example:


4 mA assigned value = -250 l/h

20 mA assigned value = +750 l/h

Calculated current value = 8 mA (at zero flow)

Note that values with different signs cannot be entered for 0/4~mA and 20~mA (function 4003) if SYMMETRY is the setting selected for the MEASURING MODE function (4004). In this case, the message "INPUT RANGE EXCEEDED" appears on the display.

Example for STANDARD measuring mode:

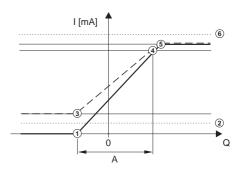

A0001223

- 1 = Initial value (0 to 20 mA)
- ② = Lower signal on alarm level:: depends on the setting in the function CURRENT SPAN
- ③ = Initial value (4 to 20 mA): depends on the setting in the function CURRENT SPAN
- 4 = Full scale value (0/4 to 20 mA): depends on the setting in the function CURRENT SPAN
- \bigcirc = Maximum current value: depends on the setting in the function CURRENT SPAN
- ⑥ = Failsafe mode (upper signal on alarm level): depends on the setting in the functions CURRENT SPAN (\rightarrow 🖺 56) and FAILSAFE MODE, (\rightarrow 🖺 64)
- A = Measuring range (the minimum measuring range has to exceed the value that correlates with a flow velocity of 0.3 m/s)

User input:

5-digit floating-point number, with sign

Factory setting:

0 [unit]



- The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400), (see → 14 or → 13).
- If the option BATCH UPWARDS or BATCH DOWNWARDS (only possible with the optional software package BATCHING) is selected in the function ASSIGN CURRENT OUTPUT (4000), the value 0/4 mA is automatically specified in this function and cannot be edited.



Caution!

The current output responds differently, depending on the parameters set in the various functions. Some examples of parameter settings and their effect on the current output are given in the following section.

OUTPUTS → CURRENT OUTPUT (1 to 2) → CONFIGURATION


VALUE 0_4 mA (continued)


Parameter setting example A:

- 1. VALUE 0_4 mA (4002) = not equal to zero flow (e.g. -5 m³/h) VALUE 20 mA (4003) = not equal to zero flow (e.g. 10 m³/h) or
- 2. VALUE 0_4 mA (4002) = not equal to zero flow (e.g. $100 \text{ m}^3/\text{h}$) VALUE 20 mA (4003) = not equal to zero flow (e.g. $-40 \text{ m}^3/\text{h}$) and

MEASURING MODE (4004) = STANDARD

When you enter the values for 0/4 mA and 20 mA, the working range of the measuring device is defined. If the effective flow drops below or exceeds this working range (see ①), a fault/notice message is generated (#351-354, current range) and the current output responds in accordance with the parameter settings in the function FAILSAFE MODE (4006).

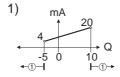

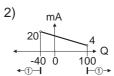


A0001262


Parameter setting example B:

- 1. VALUE 0_4 mA (4002) = equal to zero flow (e.g. $0 \text{ m}^3/h$) VALUE 20 mA (4003) = not equal to zero flow (e.g. $10 \text{ m}^3/h$) or
- 2. VALUE 0_4 mA (4002) = not equal to zero flow (e.g. $100 \text{ m}^3\text{/h}$) VALUE 20 mA (4003) = equal to zero flow (e.g. $0 \text{ m}^3\text{/h}$) and MEASURING MODE (4004) = STANDARD

When you enter the values for 0/4 mA and 20 mA, the working range of the measuring device is defined. In doing so, one of the two values is parameterised as zero flow (e.g. $0~\text{m}^3/\text{h}$).

If the effective flow drops below or exceeds the value parameterised as the zero flow, no fault/notice message is generated and the current output retains its value. If the effective flow drops below or exceeds the other value, a fault/notice message is generated (#351-354, current range) and the current output responds in accordance with the parameter settings in the function FAILSAFE MODE (4006).

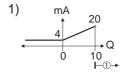

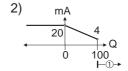


A0001264

Deliberately only one flow direction is output with this setting and flow values in the other flow direction are suppressed.

Parameter setting example C:

MEASURING MODE (4004) = SYMMETRY

The current output signal is independent of the direction of flow (absolute amount of the measured variable). The 0_4 mA value ① and the 20 mA value ② must have the same sign (+ or –). The "20 mA VALUE" ③ (e.g. backflow) corresponds to the mirrored 20 mA VALUE ② (e.g. flow).

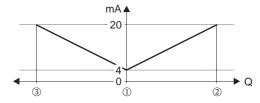

A0001249

ASSIGN RELAY (4700) = FLOW DIRECTION

With this setting e.g. the flow direction output via a switching contact can be made

Parameter setting example D:

MEASURING MODE (4004) = PULSATING FLOW

OUTPUTS → CURRENT OUTPUT (1 to 2) → CONFIGURATION

VALUE 20 mA (4003)

Use this function to assign the 20 mA current a value. The value can be higher or lower than the value assigned to 0/4 mA (function VALUE 0_4 mA (4002), see \Rightarrow 57). Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow).

Example:

4 mA assigned value = -250 l/h20 mA assigned value = +750 l/hCalculated current value = 8 mA (at zero flow)

Note that values with different signs cannot be entered for 0/4 mA (function 4002) and 20 mA, if SYMMETRY is the setting selected in the function MEASURING MODE (4004). In this case, the message "INPUT RANGE EXCEEDED" appears.

Example for STANDARD measuring mode → 🗎 57

User input:

5-digit floating-point number, with sign

Factory setting:

Depends on nominal diameter and country ($\rightarrow \triangleq 154$).

Note

- The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400).
- If the option BATCH UPWARDS or BATCH DOWNWARDS, (only possible with the optional software package BATCHING), is selected in the function ASSIGN CURRENT OUTPUT (4000), the value 20 mA is automatically specified in this function and cannot be edited.



Caution!

It is very important to read and comply with the information in the function VALUE 0_4 mA (under " $\$ Caution"; Examples of parameter settings) on \rightarrow $\$ 57.

OUTPUTS \rightarrow CURRENT OUTPUT (1 to 2) \rightarrow CONFIGURATION

MEASURING MODE (4004)

Use this function to define the measuring mode for the current output. $\ensuremath{\mathsf{U}}$

Options:

STANDARD SYMMETRY PULSATING FLOW

Factory setting:


STANDARD

Description of the individual options:

STANDARD

(4006).


- The current output signal is proportional to the measured variable. The flow components outside the scaled measuring range (defined by the 0_4 mA VALUE ① and the 20 mA VALUE ②) are taken into account as follows for signal output.
 - $^-$ If one of the values is defined as equal to the zero flow (e.g. VALUE 0_4 mA = 0 m³/h), no message is given if this value is exceeded or not achieved and the current output retains its value (4 mA in the example). If the other value is exceeded or not achieved, the message "CURRENT OUTPUT AT FULL SCALE VALUE" appears and the current output responds in accordance with the parameter setting in the function FAILSAFE MODE
 - If both values defined are not equal to the zero flow (for example VALUE 0_4 mA= -5 m 3 /h; VALUE 20 mA = 10m 3 /h), the message "CURRENT OUTPUT AT FULL SCALE VALUE" appears if the measuring range is exceeded or not achieved and the current output responds in accordance with the parameter setting in the function FAILSAFE MODE (4006).

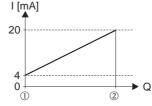

A0001248

SYMMETRY

The current output signal is independent of the direction of flow (absolute amount of the measured variable). The 0_4 mA value ① and the 20 mA value ② must have the same sign (+ or –). The "20 mA value" ③ (e.g. backflow) corresponds to the mirrored 20 mA value ② (e.g. flow)

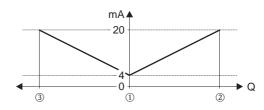

A0001249

Note!

- $\, \bullet \,$ The direction of flow can be output via the configurable relay or status outputs.
- SYMMETRY cannot be selected unless the values in the VALUE 0_4 mA (4002) and VALUE 20 mA (4003) functions have the same sign or one of the values is zero. If the values have different signs, SYMMETRY cannot be selected and an "ASSIGNMENT NOT POSSIBLE" message is displayed.

(continued on next page)

OUTPUTS → CURRENT OUTPUT (1 to 2) → CONFIGURATION

MEASURING MODE

(continued)

PULSATING FLOW

If flow is characterized by severe fluctuations as is the case, for example, with reciprocating pumps, flow components outside the measuring range are buffered, balanced and output after a maximum delay of 60 seconds.

If the buffered data cannot be processed within approx. 60 seconds, a fault/notice message appears.

Under certain plant conditions, flow values can aggregate in the buffer, for example in the case of prolonged and unwanted fluid backflow. However, this buffer is reset in all relevant programming adjustments which affect the current output.



Caution!


If the option BATCHING QUANTITY UPWARDS or BATCH QUANTITY DOWNWARDS is selected in the function ASSIGN CURRENT OUTPUT (4000), the option is automatically specified and cannot be edited.

OUTPUTS \rightarrow CURRENT OUTPUT (1 to 2) \rightarrow CONFIGURATION

Detailed explanations and information


How the current output responds under the following postulated conditions:

1. Defined measuring range (①–②): ① and ② have the same sign

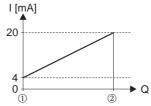

A0001248


and the following flow behaviour:

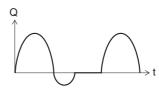

A0001265

STANDARD


The current output signal is proportional to the measured variable. The flow components outside the scaled measuring range are not taken into account for signal output.

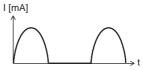

A0001267

SYMMETRY


The current output signal is independent of the direction of flow.

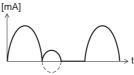

A0001268

PULSATING FLOW

Flow components outside the measuring range are buffered, balanced and output after a maximum delay of 60 seconds.

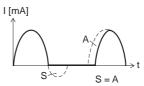


A0001269

(Continued on next page)

OUTPUTS \rightarrow CURRENT OUTPUT (1 to 2) \rightarrow CONFIGURATION


Detailed explanations and information (continued)

2. Defined measuring range $(\mathbb{O}-\mathbb{O})$: \mathbb{O} and \mathbb{O} do not have the same sign.

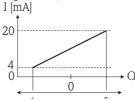

A0001272

3. Flow a (–) outside, b (- -) within the measuring range.

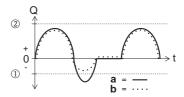


A0001273

STANDARD

a (—): The flow components outside the scaled measuring range cannot be taken into account for signal output.

A fault message is generated (# 351 to 354, current range) and the current output responds in accordance with the parameter settings in the function FAIL-SAFE MODE (4006).

b (- -): The current output signal is proportional to the measured variable assigned.

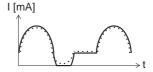


A0001274

SYMMETRY

This option is not available under these circumstances, because the 0_4 mA value and the 20 mA value have different signs.

PULSATING FLOW

Flow components outside the measuring range are buffered, balanced and output after a maximum delay of 60 seconds.

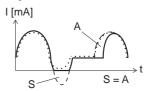

A0001275

TIME CONSTANT (4005)

Use this function to enter a time constant defining how the current output signal reacts to severely fluctuating measured variables, either very quickly (enter a low time constant) or with damping (enter a high time constant).

User input:

fixed-point number 0.01 to 100.00 s

Factory setting:

3.00 s

OUTPUTS → CURRENT OUTPUT (1 to 2) → CONFIGURATION

FAILSAFE MODE (4006)

For safety reasons it is advisable to ensure that the current output assumes a predefined state in the event of a fault. The setting you select here affects only the current output.

It has no effect on other outputs and the display (e.g. totalizers).

Options:

MIN. CURRENT

The current output adopts the value of the lower signal on alarm level (as defined in the function CURRENT SPAN (4001)

MAX. CURRENT

The current output adopts the value of the upper signal on alarm level (as defined in the function CURRENT SPAN (4001)

HOLD VALUE (not recommended)

Measuring value output is based on the last measuring value saved before the error occurred .


ACTUAL VALUE

Measured value output is based on the current flow measurement. The fault is ignored .

Factory setting:


MIN. CURRENT

7.1.2 Function group OPERATION

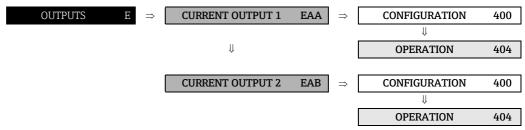

	Function description OUTPUTS \rightarrow CURRENT OUTPUT (1 to 2) \rightarrow OPERATION
ACTUAL CURRENT (4040)	Use this function to view the computed actual value of the output current.
	User interface: 0.00 to 25.00 mA
SIMULATION CURRENT (4041)	Use this function to activate simulation of the current output.
	Options: OFF ON
	Factory setting: OFF
	 Note! The "SIMULATION CURRENT OUTPUT" message indicates that simulation is active. The measuring device continues to measure while simulation is in progress, i.e.
	the current measuring values are output correctly via the other outputs. Caution! The setting is not saved if the power supply fails.
VALUE SIMULATION CURRENT (4042)	Note! The function is not visible unless the SIMULATION CURRENT function (4041) is active (= ON).
	Use this function to define a freely selectable value (e.g. 12 mA) to be output at the current output. This value is used to test downstream devices and the measuring device itself.
	User input: 0.00 to 25.00 mA
	Factory setting: 0.00 mA
	Caution! The setting is not saved if the power supply fails.


7.1.3 Function group INFORMATION

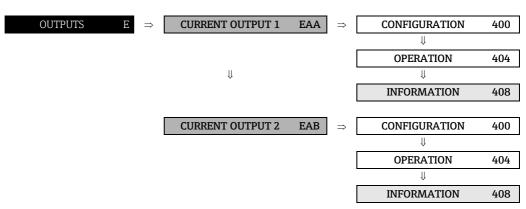

	From the description			
Function description OUTPUTS \rightarrow CURRENT OUTPUT (1 to 2) \rightarrow INFORMATION				
TERMINAL NUMBER (4080)	Function description OUTPUTS → CURRENT OUTPUT (1 to 2) → INFORMATION Use this function to display the numbers of the terminals (in the connection compartment) which are used by the current output.			

7.2 Group PULSE/FREQUENCY OUTPUT (1 to 2)

7.2.1 Function group CONFIGURATION

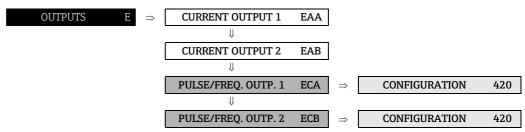

	PULSE/FREQ. OUTP. 2 ECB \Rightarrow CONFIGURATION 420			
Function description OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (GENERAL / FREQUENCY)				
OPERATION MODE (4200)	Use this function to configure the output as a pulse output, frequency output or status output. The functions available in this function group vary, depending on which option you select here. Options: PULSE FREQUENCY STATUS Factory setting: PULSE			
ASSIGN FREQUENCY (4201)	This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to assign a measured variable to the frequency output. Options: OFF MASS FLOW VOLUME FLOW Factory setting: VOLUME FLOW Note! If you select OFF, the only function shown in the CONFIGURATION function group is this function, in other words ASSIGN FREQUENCY (4201).			

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (FREQUENCY)

START VALUE **FREQUENCY** (4202)



This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200).

Use this function to define an initial frequency for the frequency output. You define the associated measuring value of the measuring range in the VALUE-f LOW function (4204) described on $\rightarrow \triangleq$ 68.

User input:

5-digit fixed-point number: 0 to 10000 Hz

Factory setting:

0 Hz

Example:

- VALUE-f LOW. = 0 l/h, initial frequency = 0 Hz: i.e. a frequency of 0 Hz is output at a flow of 0 l/h.
- VALUE-f LOW. = 1 l/h, initial frequency = 10 Hz: i.e. a frequency of 10 Hz is output at a flow of 1 l/h.

END VALUE FREQUENCY (4203)



This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200).

Use this function to define a full scale frequency for the frequency output. You define the associated measuring value of the measuring range in the VALUE-f HIGH function (4205) described on $\rightarrow \blacksquare$ 69.

User input:

5-digit fixed-point number 2 to 10000 Hz

Factory setting:

10000 Hz

Example:

- VALUE-f HIGH = 1000 l/h, full scale value frequency = 1000 Hz: i.e. a frequency of 1000 Hz is output at a flow of 1000 l/h.
- VALUE-f HIGH = 3600 l/h, full scale value frequency = 1000 Hz: i.e. a frequency of 1000 Hz is output at a flow of 3600 l/h.



Note!

In the FREQUENCY operating mode the output signal is symmetrical (on/off ratio = 1:1). At low frequencies the pulse duration is limited to a maximum of 2 seconds, i.e. the on/off ratio is no longer symmetrical.

VALUE-f LOW (4204)



Note!

This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200).

Use this function to assign a variable to the start value frequency (4202). The value can be higher or lower than the value assigned to the VALUE-f HIGH. Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow). You define a measuring range by defining the VALUE-f LOW and VALUE-f HIGH values.

User input:

5-digit floating-point number

Factory setting:

0 [unit]



- For graphic illustration of VALUE-f LOW see function VALUE-f HIGH (4205).
- The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400), (see $\rightarrow \blacksquare$ 14 or $\rightarrow \blacksquare$ 13).

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (FREQUENCY)

VALUE-f HIGH (4205)



Note!

This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200).

Use this function to assign a variable to the end value frequency (4203). The value can be higher or lower than the value assigned to the VALUE-f LOW. Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow). You define a measuring range by defining the VALUE-f LOW and VALUE-f HIGH values.

User input:


5-digit floating-point number

Factory setting:

Depends on nominal diameter and country ($\Rightarrow \triangleq 154$).



Note that values with different signs cannot be entered for VALUE F LOW $\,$ and VALUE F HIGH, if SYMMETRY is the setting selected for the MEASURING MODE function (4206). In this case the message "INPUT RANGE EXCEEDED" appears on the display.rresponds to the factory setting for the final value.

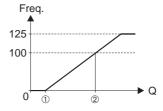

A0001279

- ① = Value-f min.
- ② = Value-f high

(continued on next page)

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (FREQUENCY)

VALUE-f HIGH


(continued)

Parameter setting example A:

1. VALUE-f LOW (4204) = not equal to zero flow (e.g. -5 m^3/h) VALUE-f HIGH (4205) = not equal to zero flow (e.g. 10 m^3/h) or

2. VALUE-f LOW (4204) = not equal to zero flow (e.g. $100 \text{ m}^3/\text{h}$) VALUE-f HIGH (4205) = not equal to zero flow s (e.g. -40 m $^3/\text{h}$) and MEASURING MODE (4206) = STANDARD

When you enter the values for VALUE-f LOW and VALUE-f HIGH the working range of the measuring device is defined. If the effective flow drops below or exceeds this working range (see ①), a fault or notice message is generated (#355-358, frequency area) and the frequency output responds in accordance with the parameter settings in the function FAILSAFE MODE (4209).

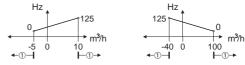

a0001276


Parameter setting example B:

- 1. VALUE-f LOW (4204) = equal to zero flow (e.g. $0 \text{ m}^3/\text{h}$) VALUE-f HIGH (4205) = not equal to zero flow (e.g. $10 \text{ m}^3/\text{h}$) or 2. VALUE-f LOW (4204) = not equal to zero flow (e.g. $100 \text{ m}^3/\text{h}$)
- 2. VALUE-f LOW (4204) = not equal to zero flow (e.g. $100 \text{ m}^3/\text{h}$) VALUE-f HIGH (4205) = equal to zero flow s (e.g. $0 \text{ m}^3/\text{h}$) and MEASURING MODE (4206) = STANDARD

When you enter the values for VALUE-f LOW and VALUE-f HIGH the working range of the measuring device is defined. In doing so, one of the two values is parameterised as zero flow (e.g. $0 \text{ m}^3/\text{h}$).

If the effective flow drops below or exceeds the value parameterised as the zero flow, no fault/notice message is generated and the frequency output retains its value.

If the effective flow drops below or exceeds the other value, a fault/notice message is generated (#355-358, frequency area) and the frequency output responds in accordance with the parameters set in the function FAILSAFE MODE (4209).

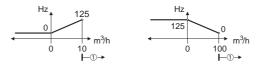


A0001277

Deliberately only one flow direction is output with this setting and flow values in the other flow direction are suppressed.

Parameter setting example C:

MEASURING MODE (4206) = SYMMETRY

The frequency output signal is independent of the direction of flow (absolute amount of the measured variable). The VALUE-f LOW 1 and VALUE-f HIGH 2 must have the same sign (+ or –). The "VALUE-f HIGH" 3 (e.g. backflow) corresponds to the mirrored VALUE-f HIGH 2 (e.g. flow).

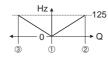

A0001278

ASSIGN RELAY (4700) = FLOW DIRECTION Flow direction output via a switching contact.

Parameter setting example D:

MEASURING MODE (4206) = PULSATING FLOW

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (FREQUENCY)

MEASURING MODE (4206)



This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200).

Use this function to define the measuring mode for the frequency output.

Options:

STANDARD SYMMETRY PULSATING FLOW

Factory setting:


STANDARD

Description of the individual options:

STANDARD

The frequency output signal is proportional to the measured variable. The flow components outside the scaled measuring range (defined by the VALUE-f LOW. ① and VALUE-f HIGH. ②) are not taken into account for signal output.


- $^-$ If one of the values is defined as equal to the zero flow (e.g. VALUE-f LOW = 0 m 3 /h), no message is given if this value is exceeded or not achieved and the frequency output retains its value (0 Hz in the example). If the other value is exceeded or not achieved, the message "FREQUENCY OUTPUT AT FULL SCALE VALUE" appears and the frequency output responds in accordance with the parameter setting in the function FAILSAFE MODE (4209).
- If both values defined are not equal to the zero flow (for example VALUE-f LOW= $-5~\text{m}^3/\text{h}$; VALUE-f HIGH = $10\text{m}^3/\text{h}$) the message "FREQUENCY OUTPUT AT FULL SCALE VALUE" appears if the measuring range is exceeded or not achieved and the frequency output responds in accordance with the parameter settings in the function FAILSAFE MODE (4209).

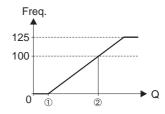

A0001279

SYMMETRY

The frequency output signal is independent of the direction of flow (absolute amount of the measured variable). The VALUE-f LOW 1 and VALUE-f HIGH 2 must have the same sign (+ or –). The VALUE-f HIGH 3 (e.g. backflow) corresponds to the mirrored VALUE-f HIGH 2 (e.g. forward flow).

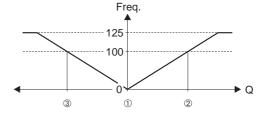

A0001280

Note!

- The direction of flow can be output via the configurable relay or status outputs.
- SYMMETRY cannot be selected unless the values in the VALUE-f LOW (4204) and VALUE-f HIGH (4205) functions have the same sign or one of the values is zero. If the values have different signs, SYMMETRY cannot be selected and an "ASSIGNMENT NOT POSSIBLE" message is displayed.

(continued on next page)

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (FREQUENCY)

MEASURING MODE (continued)

PULSATING FLOW

If flow is characterized by severe fluctuations as is the case, for example, with reciprocating pumps, flow components outside the measuring range are buffered, balanced and output after a maximum delay of 60 seconds. If the buffered data cannot be processed within approx. 60 seconds, a fault/notice message appears.

Under certain plant conditions, flow values can aggregate in the buffer, for example in the case of prolonged and unwanted fluid backflow. However, this buffer is reset in all relevant programming adjustments which affect the frequency output.

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (FREQUENCY)

OUTPUT SIGNAL (4207)



Function is not available unless the FREQUENCY setting was selected in the OPERATING MODE (4200) function.

For selecting the output configuration of the frequency output.

Options:

0 = PASSIVE - POSITIVE

1 = PASSIVE - NEGATIVE

2 = ACTIVE - POSITIVE

3 = ACTIVE - NEGATIVE

Factory setting: PASSIVE - POSITIVE

Explanation

- PASSIVE = power is supplied to the frequency output by means of an external power supply.
- ACTIVE = power is supplied to the frequency output by means of the deviceinternal power supply.

Configuring the output signal level (POSITIVE or NEGATIVE) determines the quiescent behaviour (at zero flow) of the frequency output.

The internal transistor is activated as follows:

- If POSITIVE is selected, the internal transistor is activated with a positive signal level.
- If NEGATIVE is selected, the internal transistor is activated with a negative signal level (0 V).



With the passive output configuration, the output signal levels of the frequency output depend on the external circuit (see examples).

Example for passive output circuit (PASSIVE)

If PASSIVE is selected, the frequency output is configured as an open collector.



A0001225

① = Open Collector, ② = External power supply


Note!

For continuous currents up to 25 mA (I_{max} = 250 mA / 20 ms).

Example for output configuration PASSIVE-POSITIVE:

Output configuration with an external pull-up resistance.

In the quiescent state (at zero flow), the output signal level at the terminals is 0 V. $+ U_{\tiny max} = 30 \ \lor \ DC$

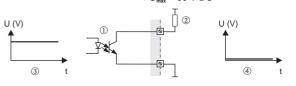


A0004687

① = Open Collector, ② = Pull-Up-Resistance

③ = Transistor activation in "POSITIVE" quiescent state (at zero flow)

④ = Output signal level in quiescent state (at zero flow)

In the operating status (flow present), the output signal level changes from 0 V to a positive voltage level.

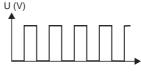

A000197


OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (FREQUENCY)

OUTPUT SIGNAL

(continued)

Example for output configuration PASSIVE-POSITIVE:


Output configuration with an external pull-down resistance. In the quiescent state (at zero flow), a positive voltage level is measured via the pull-down resistance.

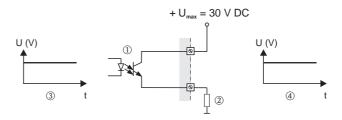

A0004689

- ① = Open Collector
- ② = Pull-Down-Resistance
- ③ = Transistor activation in "POSITIVE" quiescent state (at zero flow)
- ④ = Output signal level in quiescent state (at zero flow)


In the operating status (flow present), the output signal level changes from a positive voltage level to 0 $\mbox{\rm V}.$

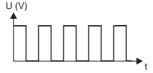

A0001981

Example for output configuration PASSIVE-NEGATIVE:


Output configuration with an external pull-up resistance. In the quiescent state (at zero flow), the output signal level at the terminals is at a positive voltage level.

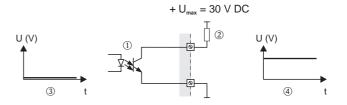

A0004690

- ① = Open Collector
- ② = Pull-Up-Resistance
- ③ = Transistor activation in "NEGATIVE" quiescent state (at zero flow)
- ④ = Output signal level in quiescent state (at zero flow)

In the operating status (flow present), the output signal level changes from a positive voltage level to 0 $\mbox{V}.$

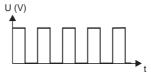

A0001981

(continued on next page)


OUTPUTS \rightarrow PULSE/FREQUENCY OUTPUT (1 to 2) \rightarrow CONFIGURATION (FREQUENCY)

OUTPUT SIGNAL

(continued)

Example for active output circuit (ACTIVE):

With an active circuit, the internal power supply is 24 V. The frequency output is short-circuit proof.

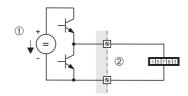

A0004691

① = 24 V DC internal power supply

② = Short-circuit proof output

The signal levels are to be seen as analogous to the passive circuit.

The following applies for the output configuration **ACTIVE-POSITIVE**: In the quiescent state (at zero flow), the output signal level at the terminals is 0 V.




A0004694

In the operating status (flow present), the output signal level changes from 0 V to a positive voltage level.



a000469

The following applies for the output configuration **ACTIVE-NEGATIVE**: In the quiescent state (at zero flow), the output signal level at the terminals is at a positive voltage level.

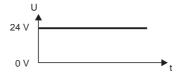

a0004693

In the operating status (flow present), the output signal level changes from a positive voltage level to 0 $\rm V$.



A0004710

Function description OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (FREQUENCY) TIME CONSTANT (4208)This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to enter a time constant defining how the frequency output signal reacts to severely fluctuating measured variables, either very quickly (enter a low time constant) or with damping (enter a high time constant). User input: fixed-point number 0.00 to 100.00 s Factory setting: $0.00 \, s$ FAILSAFE MODE Note! (4209)This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). For safety reasons it is advisable to ensure that the frequency output assumes a predefined state in the event of a fault. The setting you select here affects only the frequency output. It has no effect on other outputs and the display (e.g. totalizers). Options: FALLBACK VALUE Output is 0 Hz. FAILSAFE VALUE Output is the frequency specified in the FAILSAFE VALUE function (4211). Measuring value output is based on the last measuring value saved before the error occurred. ACTUAL VALUE Measuring value output is based on the current flow measurement. The fault is ignored. Factory setting: FALLBACK VALUE **FAILSAFE VALUE** Note! (4211)This function is not available unless FREQUENCY was selected in the OPERATION MODE function (4200) and FAILSAFE VALUE was selected in the FAILSAFE MODE function (4209). Use this function to define the frequency that the measuring device outputs in the event of an error. User input: max. 5-digit number: 0 to 12500 Hz Factory setting: 12500 Hz

Function description OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (PULSE) ASSIGN PULSE (4221)This function is not available unless the PULSE setting was selected in the OPERA-TION MODE function (4200). Use this function to assign a measured variable to the pulse output. Options: OFF MASS FLOW **VOLUME FLOW** Factory setting: **VOLUME FLOW** Note! If you select OFF, the only function shown in the CONFIGURATION function group is this function, in other words ASSIGN PULSE (4221). PULSE VALUE (4222)Note! This function is not available unless the PULSE setting was selected in the OPERA-TION MODE function (4200). Use this function to define the flow at which a pulse is triggered. These pulses can be totaled by an external totalizer, and the total flow quantity since measuring started can be registered in this way. User input: 5-digit floating-point number [unit] Factory setting: Depends on nominal diameter and country ($\rightarrow \stackrel{\triangle}{=} 154$). Note! The appropriate unit is taken from the function UNIT VOLUME (0403) or UNIT MASS (0401), (see $\rightarrow \blacksquare$ 14 or $\rightarrow \blacksquare$ 13).

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (PULSE)

PULSE WIDTH (4223)



This function is not available unless the PULSE setting was selected in the OPERA-TION MODE function (4200).

Use this function to enter the pulse width of the output pulse.


User input:


0.05 to 2000 ms

Factory setting:

100 ms

Pulse output is **always** with the pulse width (B) entered in this function. The pauses (P) between the individual pulses are automatically configured. However, they must at least correspond to the pulse width (B = P).

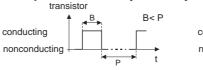

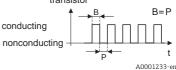

B = Pulse width entered (the illustration applies to positive pulses) P= Intervals between the individual pulses



Note!

When entering the pulse width, select a value that can still be processed by an external totalizer (e.g. mechanical totalizer, PLC, etc.).



Caution!

If the pulse number or frequency resulting from the pulse value entered, (see function PULSE VALUE (4222) on \rightarrow $\ \ \,$ $\ \,$ $\ \ \,$ $\ \ \,$ $\ \ \,$ $\ \,$ $\ \ \,$ $\ \ \,$ maintain the pulse width selected (the interval P is smaller than the pulse width \ensuremath{B} entered), a system error message (# 359 to 362, pulse memory) is generated after buffering/balancing has occurred.

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (PULSE)

MEASURING MODE (4225)



This function is not available unless the PULSE setting was selected in the OPERA-TION MODE function (4200).

Use this function to define the measuring mode for the pulse output.

Options:

STANDARD

Only positive flow components are totaled. Negative components are not taken into account.

SYMMETRY

Positive and negative flow components are taken into account.

Note!

The direction of flow can be output via the relay output.

PULSATING FLOW

If flow is characterized by severe fluctuations as is the case, for example, with reciprocating pumps, the positive and negative flow components are totalled, with the signs taken into account (e.g. -10 l and +25 l = 15 l).

Flow components outside the maximum pulse number per second (value/width) are buffered, balanced and output after a maximum delay of 60 seconds. If the buffered data cannot be processed within approx. 60 seconds, a fault/notice message appears. Under certain plant conditions, flow values can aggregate in the buffer, for example in the case of prolonged and unwanted fluid backflow. However, this buffer is reset in all relevant programming adjustments which affect the pulse output.

STANDARD REVERSE

Only negative flow components are totaled. Positive components are not taken into account.

Factory setting:

STANDARD

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (PULSE)

OUTPUT SIGNAL (4226)



Function is not available unless the PULSE setting was selected in the OPERATION MODE (4200) function.

For selecting the output configuration of the pulse output.

Options:

0 = PASSIVE - POSITIVE1 = PASSIVE - NEGATIVE 2 = ACTIVE - POSITIVE 3 = ACTIVE - NEGATIVE

Factory setting: PASSIVE - POSITIVE

Explanation

- PASSIVE = power is supplied to the pulse output by means of an external power
- ACTIVE = power is supplied to the pulse output by means of the device-internal power supply.

Configuring the output signal level (POSITIVE or NEGATIVE) determines the quiescent behaviour (at zero flow) of the pulse output.

The internal transistor is activated as follows:


- If POSITIVE is selected, the internal transistor is activated with a **positive** signal
- If NEGATIVE is selected, the internal transistor is activated with a **negative** signal level (0 V).



With the passive output configuration, the output signal levels of the pulse output depend on the external circuit (see examples).

Example for passive output circuit (PASSIVE)

If PASSIVE is selected, the pulse output is configured as an open collector.

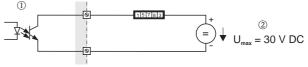

① = Open Collector, ② = External power supply




For continuous currents up to 25 mA (I_{max} = 250 mA / 20 ms).

Example for output configuration PASSIVE-POSITIVE:

Output configuration with an external pull-up resistance.


In the quiescent state (at zero flow), the output signal level at the terminals is 0 $\rm V$. $+ U_{max} = 30 \text{ V DC}$

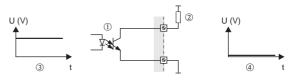

A0004687

- ① = Open Collector, ② = Pull-Up-Resistance
- ③ = Transistor activation in "POSITIVE" quiescent state (at zero flow)
- ④ = Output signal level in quiescent state (at zero flow)

In the operating status (flow present), the output signal level changes from 0 V to a positive voltage level.

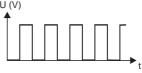


A0001975

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (PULSE)

OUTPUT SIGNAL (continued)

Example for output configuration PASSIVE-POSITIVE:


Output configuration with an external pull-down resistance. In the quiescent state (at zero flow), a positive voltage level is measured via the pull-down resistance.

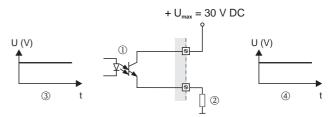

A0004689

- ① = Open Collector
- ② = Pull-Down-Resistance
- $\ensuremath{ \ensuremath{ \en$
- ④ = Output signal level in quiescent state (at zero flow)


In the operating status (flow present), the output signal level changes from a positive voltage level to 0 V.

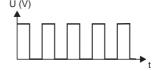

A0001981

Example for output configuration PASSIVE-NEGATIVE:


Output configuration with an external pull-up resistance. In the quiescent state (at zero flow), the output signal level at the terminals is at a positive voltage level.

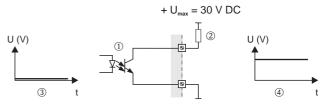

A0004690

- ① = Open Collector
- ② = Pull-Up-Resistance
- ③ = Transistor activation in "NEGATIVE" quiescent state (at zero flow)
- ④ = Output signal level in quiescent state (at zero flow)

In the operating status (flow present), the output signal level changes from a positive voltage level to 0 $\mbox{V}.$

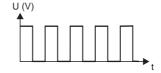

A0001981

(continued on next page)


OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (PULSE)

OUTPUT SIGNAL

(continued)

Example for active output circuit (ACTIVE):

With an active circuit, the internal power supply is 24 V. The pulse output is short-circuit proof.

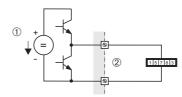


A0004691

① = 24 V DC internal power supply

② = Short-circuit proof output


The signal levels are to be seen as analogous to the passive circuit.

The following applies for the output configuration **ACTIVE-POSITIVE**: In the quiescent state (at zero flow), the output signal level at the terminals is 0 V.

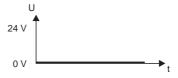


A0004694

In the operating status (flow present), the output signal level changes from 0 V to a positive voltage level.

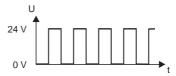


A0004692

The following applies for the output configuration **ACTIVE-NEGATIVE**: In the quiescent state (at zero flow), the output signal level at the terminals is at a positive voltage level.

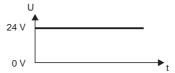

A0004693

In the operating status (flow present), the output signal level changes from a positive voltage level to 0 V.

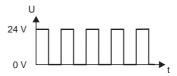

A0004710

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (PULSE)

FAILSAFE MODE (4227)



This function is not available unless the PULSE setting was selected in the OPERA-TION MODE function (4200).

For safety reasons it is advisable to ensure that the pulse output assumes a predefined state in the event of a fault. The setting you select here affects only the pulse output. It has no effect on other outputs and the display (e.g. totalizers).

Options:

FALLBACK VALUE Output is 0 pulse.

ACTUAL VALUE

Measuring value output is based on the current flow measurement.

The fault is ignored.

Factory setting:

FALL BACK VALUE

Function description

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (STATUS)

ASSIGN STATUS (4241)



Note!

This function is not available unless the STATUS setting was selected in the OPE-RATION MODE function (4200).

Use this function to assign a switching function to the status output.

Options:

OFF

ON (operation)

FAULT MESSAGE NOTICE MESSAGE

FAULT MESSAGE or NOTICE MESSAGE

EPD or OED (Empty Pipe Detection/ Open Electrode Detection, only if active)

FLOW DIRECTION

MASS FLOW LIMIT VALUE

VOLUME FLOW LIMIT VALUE

TOTALIZER (1 to 3) LIMIT VALUE

Advanced options with optional software package BATCHING:

BATCH RUNNING

> BATCH TIME

>< BATCH QUANTITIES (< min. / > max. batching quantity)

PROGRESS NOTE (batching end approaching)



Note!

The only options available are the monitoring functions (7240 to 7243) which have a value not equal to zero (max. 3).

Factory setting:

FAULT MESSAGE



- The behaviour of the status output is a normally closed behaviour, in other words the output is closed (transistor conductive) when normal, error-free measuring is in progress.
 - The following apply as "normal, error-free" measurements: Flow direction = forward; limit values = not exceeded; no empty or partiallly filled measuring tube (EPD/OED); no fault or notice message present.
- If you select OFF, the only function shown in the CONFIGURATION function group is this function, in other words ASSIGN STATUS (4241).

Function description OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (STATUS) **ON-VALUE** Notel (4242)This function is not available unless STATUS was selected in the OPERATION MODE function (4200) and LIMIT VALUE or FLOW DIRECTION was selected in the ASSIGN STATUS function (4241). Use this function to assign a value to the switch-on point (activation of the status output). The value can be equal to, higher than or lower than the switch-off point. Positive or negative values are permissible, depending on the measured variable in question (e.g. volume flow, totalizer reading). User input: 5-digit floating-point number [unit] Factory setting: 0 [unit] Note! • The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400). • Only the switch-on point is available for flow direction output (no switch-off point). If you enter a value not equal to the zero flow (e.g. 5), the difference between the zero flow and the value entered corresponds to half the switchover hysteresis. SWITCH-ON DELAY \otimes Note! (4243)This function is not available unless STATUS was selected in the OPERATION MODE function (4200) and LIMIT VALUE or FLOW DIRECTION was selected in the ASSIGN STATUS function (4241). Use this function to specify a delay (0 to 100 seconds) for switching on the status output (i.e. signal changes from 0 to 1). The delay starts when the limit value is reached. The status output does switch when the delay has timed out and the switch-on condition has been valid over the delay time. User input: fixed-point number: 0.0 to 100.0 s Factory setting: 0.0 s **OFF-VALUE** Note! (4244)This function is not available unless STATUS was selected in the OPERATION MODE function (4200) and LIMIT VALUE was selected in the ASSIGN STATUS function (4241). Use this function to assign a value to the switch-off point (deactivation of the status output). The value can be equal to, higher than or lower than the switch-on point. Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow, totalizer reading). User input: 5-digit floating-point number [unit] Factory setting: 0 [unit] • The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400). • If SYMMETRY is selected in the function MEASURING MODE (4246) and values with different signs are entered for the switch-on and switch-off points, the

notice message "INPUT RANGE EXCEEDED" appears.

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → CONFIGURATION (STATUS)

SWITCH-OFF DELAY (4245)



This function is not available unless the STATUS setting was selected in the OPE-RATION MODE function (4200).

Use this function to define a delay (0 to 100 seconds) for switching off the status output (i.e. signal changes from 1 to 0). The delay starts when the limit value is reached. The status output does switch when the delay has timed out and the switch condition has been valid over the delay time.

User input:

fixed-point number 0.0 to 100.0 s

Factory setting:

0.0 s

MEASURING MODE (4246)



This function is not available unless STATUS was selected in the function OPERATION MODE (4200) and the status output was assigned a limit value.

Use this function to define the measuring mode for the status output.

Options:

STANDARD

The status output signal switches at the defined switch points.

SYMMETRY

The status output signal switches at the defined switch points, irrespective of the sign. If you define a switch point with a positive sign, the status output signal switches as soon as the value is reached in the negative direction (negative sign), see illustration.


Factory setting:

STANDARD

Example for the SYMMETRY measuring mode:

Switch-on point Q = 4, switch-off point: Q = 10

- ① = Status output switched on (conductive)
- ② = Status output switched off (non-conductive)

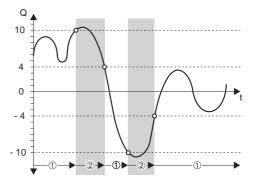

A0001247



- SYMMETRY cannot be selected unless the values in the ON-VALUE (4242) and OFF-VALUE (4244) functions have the same sign or one of the values is zero.
- If the values have different signs, SYMMETRY cannot be selected and an "ASSIGNMENT NOT POSSIBLE" message is displayed.

OUTPUTS \rightarrow PULSE/FREQUENCY OUTPUT (1 to 2) \rightarrow CONFIGURATION (STATUS)

TIME CONSTANT (4247)



Note!

This function is not available unless the STATUS setting was selected in the OPE-RATION MODE function (4200).

Use this function to enter a time constant defining how the measuring signal reacts to severely fluctuating measured variables, either very quickly (enter a low time constant) or with damping (enter a high time constant). Damping acts on the measuring signal before the switch status changes, and consequently before switch-on or switch-off delay is activated. The purpose of damping, therefore, is to prevent the status output changing state continuously in response to fluctuations in flow.


User input:


fixed-point number 0.00 to 100.00 s

Factory setting:

0.00 s

7.2.2 Function group OPERATION

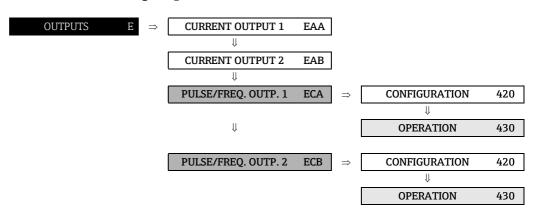

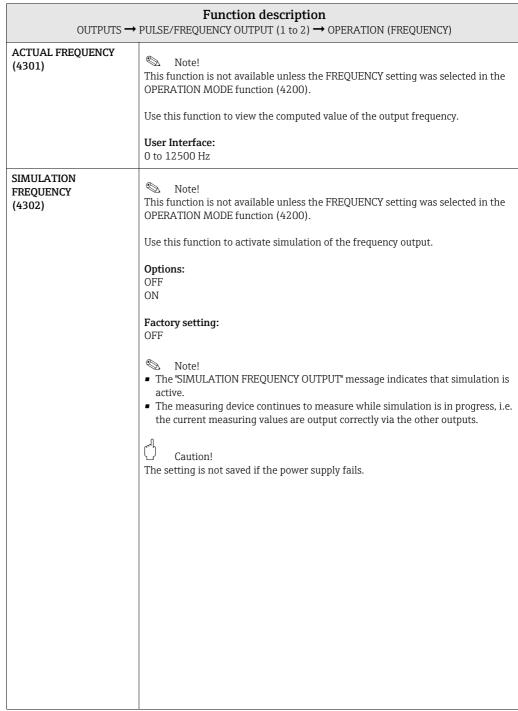

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → OPERATION (FREQUENCY)

VALUE SIMULATION FREQUENCY (4303)



Note!

This function is not available unless FREQUENCY was selected in the OPERATION MODE function (4200) and the SIMULATION FREQUENCY function (4302) is

(= ON).

Use this function to define a selectable frequency value (e.g. 500 Hz) to be output at the frequency output. This value is used to test downstream devices and the flowmeter itself.

User input:

0 to 12500 Hz

Factory setting:

0 Hz



Caution!

The setting is not saved if the power supply fails.

OUTPUTS → PULSE/FREQUENCY OUTPUT (1 to 2) → OPERATION (PULSE)

SIMULATION PULSE (4322)



Note!

This function is not available unless the PULSE option was selected in the OPERA-TING MODE function.

Use this function to activate simulation of the pulse output.

Options:

OFF

COUNTDOWN

The pulses specified in the VALUE SIMULATION PULSE function are output.

CONTINUOUSLY

Pulses are continuously output with the pulse width specified in the PULSE WIDTH function. Simulation is started once the CONTINUOUSLY option is confirmed with the 🗉 key.



Note!

Simulation is started by confirming the CONTINUOUSLY option with the **E** key. The simulation can be switched off again via the SIMULATION PULSE function.

Factory setting:

OFF



Note!

- The notice message #631 "SIM. PULSE" indicates that simulation is active.
- The on/off ratio is 1:1 for both types of simulation.
- The measuring device continues to measure while simulation is in progress, i.e. the current measured values are output correctly via the other outputs.



Caution!

The setting is not saved if the power supply fails.

VALUE SIMULATION PULSE (4323)



This function is not available unless the COUNTDOWN option was selected in the SIMULATION PULSE function.

Use this function to specify the number of pulses (e.g. 50) which are output during the simulation. This value is used to test downstream devices and the measuring device itself. The pulses are output with the pulse width specified in the $\mbox{\it PULSE}$ WIDTH function. The on/off ratio is 1:1.

Simulation is started once the specified value is confirmed with the E key. The display remains at 0 if the specified pulses have been output.

User input:

0 to 10000

Factory setting:



Note!

Simulation is started by confirming the simulation value with the $\[\[\] \]$ key. The simulation can be switched off again via the SIMULATION PULSE function.




Caution!

The setting is not saved if the power supply fails.

Trunskian Japaninkian				
Function description OUTPUTS \rightarrow PULSE/FREQUENCY OUTPUT (1 to 2) \rightarrow OPERATION (STATUS)				
ACTUAL STATUS (4341)	Note! This function is not available unless the STATUS setting was selected in the OPE-RATION MODE function (4200). Use this function to check the current status of the status output. User Interface: NOT CONDUCTIVE			
	CONDUCTIVE			
SIMULATION SWITCH POINT (4342)	Note! This function is not available unless the STATUS setting was selected in the OPE-RATION MODE function (4200).			
	Use this function to activate simulation of the status output. Options: OFF ON			
	Factory setting: OFF			
	 Note! The "SIMULATION STATUS OUTPUT" message indicates that simulation is active. The measuring device continues to measure while simulation is in progress, i.e. the current measuring values are output correctly via the other outputs. 			
	Caution! The setting is not saved if the power supply fails.			
VALUE SIMULATION SWITCH POINT (4343)	Note! This function is not available unless STATUS was selected in the OPERATION MODE function (4200) and the SIMULATION SWITCH POINT function (4342) is active (= ON).			
	Use this function to define the switching response of the status output during the simulation. This value is used to test downstream devices and the flowmeter itself. Options:			
	NOT CONDUCTIVE CONDUCTIVE			
	Factory setting: NOT CONDUCTIVE			
	Caution! The setting is not saved if the power supply fails.			


7.2.3 Function group INFORMATION

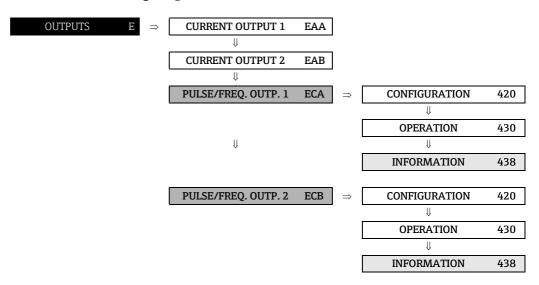

Function description OUTPUTS \rightarrow PULSE/FREQUENCY OUTPUT (1 to 2) \rightarrow INFORMATION			
TERMINAL NUMBER (4380)	Function description ITS → PULSE/FREQUENCY OUTPUT (1 to 2) → INFORMATION Use this function to display the numbers of the terminals (in the connection compartment) which are used by the pulse/frequency output.		

7.3 Group RELAY OUTPUT (1 to 2)

7.3.1 Function group CONFIGURATION

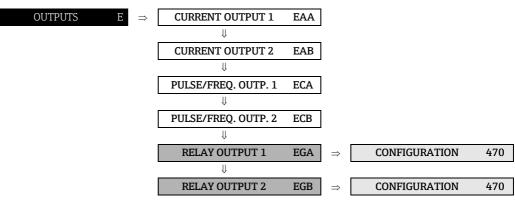

Function description OUTPUTS → RELAY OUTPUT (1 to 2) → CONFIGURATION ASSIGN RELAY Use this function to assign a switching function to the relay output. (4700)Options: OFF ON (operation) **FAULT MESSAGE** NOTICE MESSAGE FAULT MESSAGE or NOTICE MESSAGE EPD or OED (Empty Pipe Detection / Open Electrode Detection, only if active) FLOW DIRECTION MASS FLOW LIMIT VALUE VOLUME FLOW LIMIT VALUE TOTALIZER (1 to 3) LIMIT VALUE Advanced options with optional software package BATCHING: BATCH VALVE 1 (e.g. to control valve 1) BATCH VALVE 2 (e.g. to control valve 2) **BATCH RUNNING** > BATCH TIME >< BATCH QUANTITIES (< min. / > max. batching quantity) PROGRESS NOTE (batching end approaching) Note! • The batching valves defined in the function BATCH STAGES (7208) are the only available selection (max. 3). • Only the monitoring functions (7240 to 7243) which have a value not equal to zero (max. 3) are available as selection. Factory setting: FAULT MESSAGE Note! • It is very important to read and comply with the information on the switching characteristics of the relay output (see $\rightarrow \triangle$ 99). • It is advisable to configure at least one relay output as a fault output and define the outputs' response to error. • The relay output is configured as a normally open (NO or make) contact by default. It can be reconfigured as a normally closed (NC or break) contact by means of a jumper on the relay module (see Operating Instructions Promag 53, BA00047D). • If you select OFF, the only function shown in the CONFIGURATION function

group is this function ASSIGN RELAY (4700).

Function description OUTPUTS → RELAY OUTPUT (1 to 2) → CONFIGURATION **ON-VALUE** Note! (4701)This function is not available unless LIMIT VALUE or FLOW DIRECTION was selected in the function ASSIGN RELAY (4700). Use this function to assign a value to the switch-on point (relay output pulls up). The value can be equal to, higher than or lower than the switch-off point. Positive or negative values are permissible, depending on the measured variable in question (e.g. volume flow, totalizer reading). **User input:** 5-digit floating-point number [unit] Factory setting: 0 [unit] Note! • The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400). • Only the switch-on point is available for flow direction output (no switch-off point). If you enter a value not equal to the zero flow (e.g. 5), the difference between the zero flow and the value entered corresponds to half the switching hysteresis. SWITCH-ON DELAY Note! (4702)This function is not available unless LIMIT VALUE or FLOW DIRECTION was selected in the function ASSIGN RELAY (4700). Use this function to define a delay (0 to 100 seconds) for pull-up (i.e. signal changes from 0 to 1) of the relay output. The delay starts when the limit value is reached. The relay output does switch when the delay has timed out and the switch condition has been valid throughout the delay time. User input: fixed-point number 0.0 to 100.0 s Factory setting: 0.0 s **OFF-VALUE** Notel (4703)This function is not available unless LIMIT VALUE was selected in the ASSIGN RELAY function (4700). Use this function to assign a value to the switch-off point (relay drops out). The value can be equal to, higher than or lower than the switch-on point. Positive or negative values are permissible, depending on the measured variable in question (e.g. volume flow, totalizer reading). User input: 5-digit floating-point number [unit] Factory setting: 0 [unit] • The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400). • If SYMMETRY is selected in the function MEASURING MODE (4705) and values with different signs are entered for the switch-on and switch-off points, the notice message "INPUT RANGE EXCEEDED" appears.

OUTPUTS \rightarrow RELAY OUTPUT (1 to 2) \rightarrow CONFIGURATION

SWITCH-OFF DELAY (4704)



This function is not available unless LIMIT was selected in the ASSIGN RELAY function (4700).

Use this function to define a delay (0 to 100 seconds) for drop-out (i.e. signal changes from 1 to 0) of the relay output. The delay starts when the limit value is reached. The relay output does switch when the delay has timed out and the switch condition has been valid throughout the delay time.

User input:

fixed-point number 0.0 to 100.0 s

Factory setting:

0.0 s

MEASURING MODE (4705)



Note!

This function is not visible unless a limit value was assigned to the relay output.

Use this function to define the measuring mode for the relay output.

Options:

STANDARD

The relay output signal switches at the defined switch points.

SYMMETRY

The relay output signal switches at the defined switching points, irrespective of the sign. If you define a switch point with a positive sign, the relay output switches as soon as the value is reached in the negative direction (negative sign), (see illustration).

Factory setting:

STANDARD


Example for the SYMMETRY measuring mode:

Switch-on point Q = 4

Switch-off point Q = 10

1 = Relay energized

2 = Relay de-energized

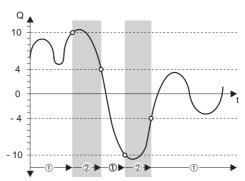

A0001247





Note!

- SYMMETRY cannot be selected unless the values in the ON-VALUE (4701) and OFF-VALUE (4703) functions have the same sign or one of the values is zero.
- If the values have different signs, SYMMETRY cannot be selected and an "ASSIGNMENT NOT POSSIBLE" message is displayed.

Function description OUTPUTS \rightarrow RELAY OUTPUT (1 to 2) \rightarrow CONFIGURATION TIME CONSTANT Use this function to enter a time constant defining how the measuring signal $% \left(1\right) =\left(1\right) \left(1$ reacts to severely fluctuating measured variables, either very quickly (enter a low (4706)time constant) or with damping (enter a high time constant). Damping acts on the measuring signal before the switch status changes, and consequently before switch-on or switch-off delay is activated. The purpose of damping, therefore, is to prevent the relay output changing state continuously in response to fluctuations in flow. User input: fixed-point number 0.00 to 100.00 s Factory setting: $0.00\,\mathrm{s}$

7.3.2 Function group OPERATION

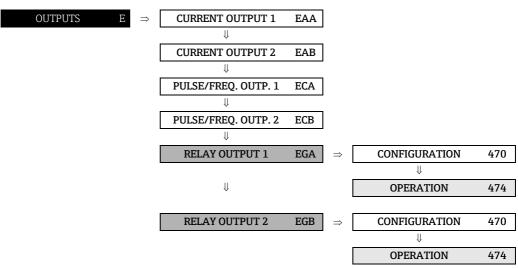

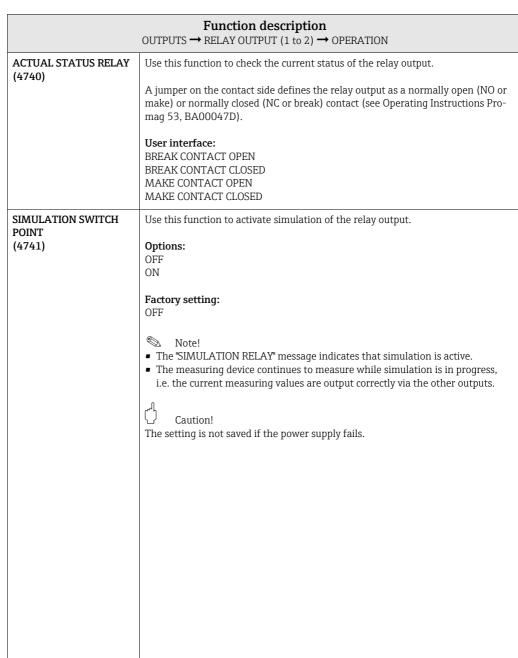

OUTPUTS \rightarrow RELAY OUTPUT (1 to 2) \rightarrow OPERATION

VALUE SIMULATION SWITCH POINT (4742)



Note!

The function is not visible unless the SIMULATION SWITCH POINT function (4741) is active (= ON).

Use this function to define the status of the relay output during the simulation. This value is used to test downstream devices and the flowmeter itself. Depending on the relay configuration (as make or break contact) the following selections are available.

Options:

Relay output configured as normally open (make) contact: MAKE CONTACT OPEN MAKE CONTACT CLOSED


Relay output configured as normally closed (break) contact: BREAK CONTACT OPEN BREAK CONTACT CLOSED



Caution!

The setting is not saved if the power supply fails.

7.3.3 Function group INFORMATION

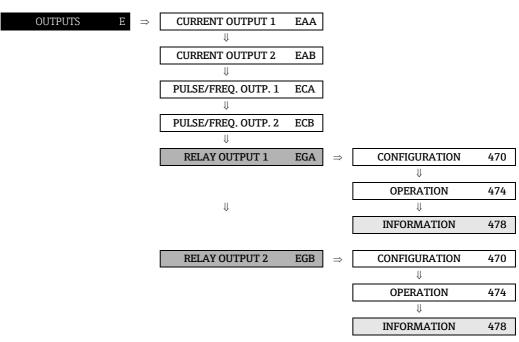

Function description OUTPUTS \rightarrow RELAY OUTPUT (1 to 2) \rightarrow INFORMATION		
TERMINAL NUMBER (4780)	Use this function to display the numbers of the terminals (in the connection compartment) which are used by the relay output.	


7.3.4 Information on the response of the relay output

General

If you have configured the relay output signal for "LIMIT VALUE" or "FLOW DIRECTION", you can define the requisite switch points in the ON-VALUE and OFF-VALUE functions. When the measured variable in question reaches one of these predefined values, the relay output switches as shown in the illustrations below.

Relay output configured for "limit value"

The relay output signal switches as soon as the measured variable undershoots or overshoots a defined switch point. Application: Monitoring flow or process-related boundary conditions.

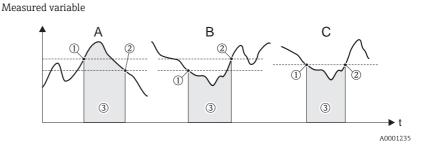

A = Maximum safety \rightarrow ① SWITCH-OFF POINT > ② SWITCH-ON POINT

B = Minimum safety \rightarrow ① SWITCH-OFF POINT < ② SWITCH-ON POINT

C = Minimum safety → ① SWITCH-OFF POINT = ② SWITCH-ON POINT (this configuration is to avoid)


③ = Relay de-energised

Relay output configured for "flow direction"

The value you entered in the function ON-VALUE defines the switch point for the positive and negative directions of flow.

If, for example, the switch point you define is $= 1 \text{ m}^3/\text{h}$, the relay drops out at $-1 \text{ m}^3/\text{h}$ and pulls up at $+1 \text{ m}^3/\text{h}$. Set the switch point to 0 if your process calls for direct switchover (no switching hysteresis). If low flow cut off is used, it is advisable to set hysteresis to a value higher than or equal to the low flow rate.

Switch-off point / Switch-on point

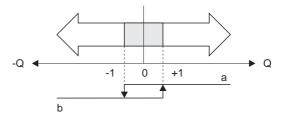

A0001236

a = Relay energised

b = Relay de-energised

7.4 Switching response of the relay output

Function	State		Relay coil	Conta	nct*
ON (operation)	System in measuring mode			NC	140
Oiv (operation)	System in measuring mode	XXX.XXX			
		Esc————————————————————————————————————	energized	/_	
		A0001052		A0001239	A0001237
	System not in measuring mode (power supply failed)	XXX.XX			
		_Essfa	de-		
			energized	1	′ L _®
		A0001291		A0001240	A0001238
Fault message	System OK				
		xxx.xxx.xx			
			energized	/ _{L®}	
		A0001052		A0001239	A0001237
	(System or process error)				
	Fault → Response to error, outputs /Inputs and totalizers	XXX.XXXXX			
	outpute / mpute and totalisers		de- energized	1	
N-4:	Contain OV	A0001291		A0001240	A0001238
Notice message	System OK	XXX.XXX			
		Esc	energized	/_].
			_	′ L	'L
		A0001052		A0001239	A0001237
	(System or process error) Fault → Continuation of				a
	measuring	××××××××	de-		
			energized		/ L
		A0001291		A0001240	A0001238
Fault message	System OK				
or Notice message		xxx.xxx.xx			
		Esc.	energized		
				_	_
	(System or process error)	A0001052		A0001239	A0001237
	Fault \rightarrow Response to error	xxxxxxx			
	or Note \rightarrow Continuation of		de- energized	1	/
	measuring		circigized		
		A0001291		A0001240	A0001238

F	State		Delen "	Contact*	
Function			Relay coil	NC	NO
Empty pipe detection (EPD) / Open electrode detection (OED)	Measuring tube full	A0001292	energized	A0001239	A0001237
	Measuring tube partially filled /empty measuring tube	A0001293	de- energized	A0001240	A0001238
Flow direction	forward				
		A0001241	energized		
		7,0001241		A0001239	A0001237
	reverse	A0001242	de- energized	A0001240	A0001238
Limit value - Volume flow - Totalizer	Limit value not overshot or undershot	A0001243	energized	A0001239	A0001237
	Limit value overshot or undershot		de- energized	A0001239	A0001297
		A0001244		A0001240	A0001238




If the measuring device has two relays, the factory setting is:

- Relay 1 → normally open contact (NO)
 Relay 2 → normally closed contact (NC)

Caution!


When using the optional software package BATCHING, it is advisable for the contacts (either normally open or normally closed contacts) to have the same switching response for all relay outputs used.

8 Block INPUTS

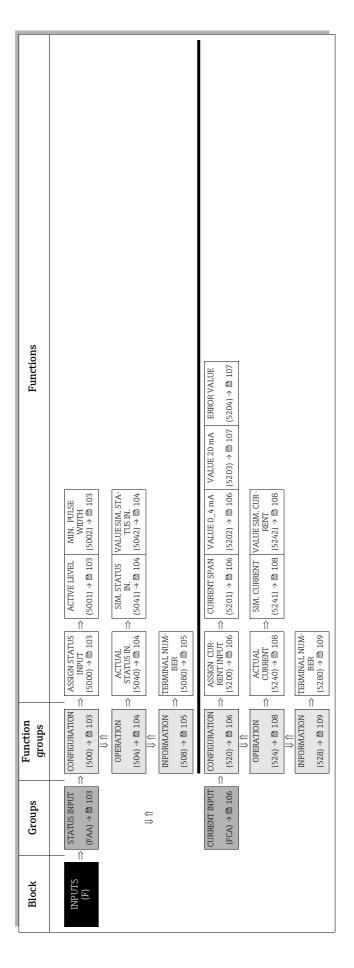


8.1 Group STATUS INPUT

8.1.1 Function group CONFIGURATION

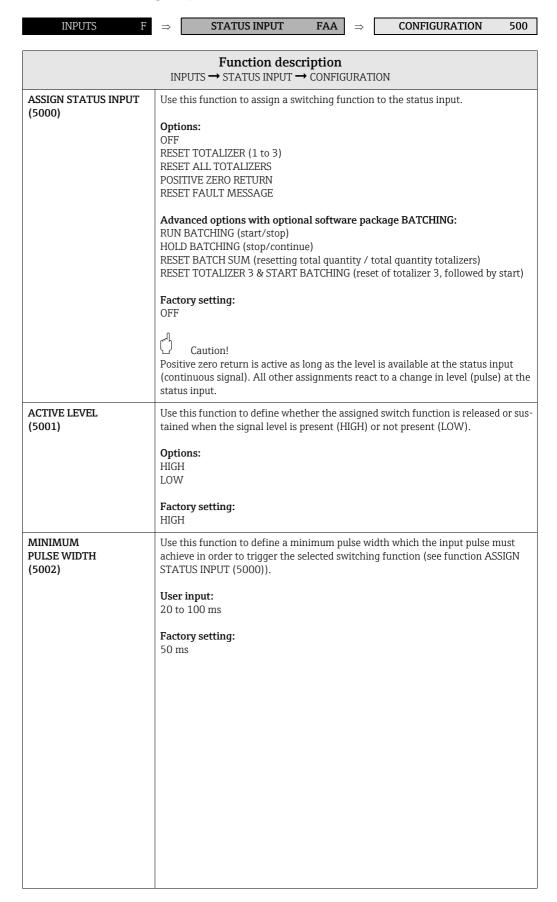


8.1.2 Function group OPERATION

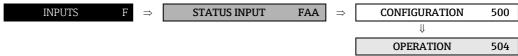

	OPERATION 504			
Function description INPUTS → STATUS INPUT → OPERATION				
ACTUAL STATUS INPUT (5040)	Use this function to view the current level of the status input. User Interface: HIGH LOW			
SIMULATION STATUS INPUT (5041)	Use this function to simulate the status input, i.e. to trigger the function (siehe Funktion ASSIGN STATUS INPUT (5000) auf Seite 103) assigned to the status input. Options: OFF ON Factory setting: OFF Note! • The "SIMULATION STATUS INPUT" message indicates that simulation is active. • The measuring device continues to measure while simulation is in progress, i.e. the current measuring values are output correctly via the other outputs.			
	Caution! The setting is not saved if the power supply fails.			
VALUE SIMULATION STATUS INPUT (5042)	Note! The function is not visible unless the SIMULATION STATUS INPUT function (5041) is active (= ON). Use this function to define the level to be assumed at the status output during the simulation. This value is used to test downstream devices and the measuring device itself. Options: HIGH LOW Factory setting: LOW Caution! The setting is not saved if the power supply fails.			


8.1.3 Function group INFORMATION

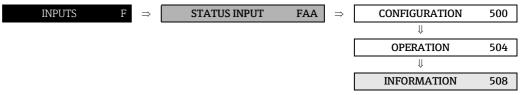

	<u> </u>		
Function description inputs \rightarrow status input \rightarrow information			
TERMINAL NUMBER (5080)	Use this function to display the numbers of the terminals (in the connection compartment) which are used by the status input.		

8.2 Group CURRENT INPUT


8.2.1 Function group CONFIGURATION

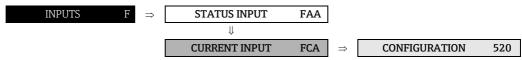

	Function description INPUTS \rightarrow CURRENT INPUT \rightarrow CONFIGURATION
ASSIGN CURRENT (5200)	Use this function to assign a process variable to the current input. Options: OFF TEMPERATURE DENSITY Factory setting: OFF
CURRENT SPAN (5201)	Use this function to select the current range. This selection defines the operational range and the upper and lower signal on alarm. Options: 0-20 mA 4-20 mA 4-20 mA 4-20 mA NAMUR 4-20 mA (25 mA) 4-20 mA (25 mA) Factory setting: 4-20 mA NAMUR Note! When switching the hardware from an active (factory setting) to a passive output signal, select a current range of 4-20 mA (see Operating Instructions Promag 53, BAO47D/06/en). Current span / operational range (measuring information): 0-20 mA / 0 to 20.5 mA 4-20 mA / 4 to 20.5 mA 4-20 mA NAMUR / 3.8 to 20.5 mA 4-20 mA NAMUR / 3.8 to 20.5 mA 4-20 mA (25 mA) / 0 to 24 ma 4-20 mA (25 mA) / 0 to 24 ma 4-20 mA (25 mA) / 4 to 24 mA
VALUE 0_4 mA (5202)	Use this function to assign a value to the 0/4 mA current. User input: 5-digit floating-point number Factory setting: Dependent on the process variable assigned to the current input (see function ASSIGN CURRENT, 5200). Density: 0.5 kg/l Temperature: −50 °C Note! The appropriate unit is taken from the functions UNIT DENSITY (0420) or UNIT TEMPERATURE (0422).


Function description INPUTS → CURRENT INPUT → CONFIGURATION		
VALUE 20 mA (5203)	Use this function to assign a value to the 20 mA current. User input: 5-digit floating-point number Factory setting: Dependent on the process variable assigned to the current input (see function ASSIGN CURRENT, 5200). Density: 2.0 kg/l Temperature: 200 °C Note! The appropriate unit is taken from the functions UNIT DENSITY (0420) or UNIT TEMPERATURE (0422).	
ERROR VALUE (5204)	Use this function to enter a defined error value for the process variable concerned. If the current value lies outside of the selected range (see function CURRENT SPAN, 5201), then the process variable is set to the 'error value' defined here and a corresponding notice message CURRENT INPUT RANGE (* 363) is generated. User input: 5-digit floating-point number Factory setting: Dependent on the process variable assigned to the current input (see function ASSIGN CURRENT INPUT, 5200). Density: 1.25 kg/l Temperature: 75 °C Note! 1 Triggered amplifier faults or the error behaviour of the outputs do not have any influence on the current input. 1 The appropriate unit is taken from the functions UNIT DENSITY (0420) or UNIT TEMPERATURE (0422).	

8.2.2 Function group OPERATION

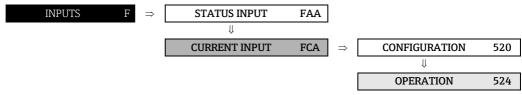


	OPERATION 524				
	Function description				
	Function description INPUTS → CURRENT INPUT → OPERATION				
ACTUAL CURRENT (5240)	The actual value of the input current appears on the display.				
,	User interface: 0.0 to 25 mA				
SIMULATION CURRENT (5241)	Use this function to activate the simulation of the current input.				
	Options: OFF ON				
	Factory setting: OFF				
	 Note! An active simulation is displayed by the notice message "SIM. CURR. IN" (# 661). The value output for the simulation at the current input is defined in the function VALUE SIMULATION CURRENT (5242). The measuring device remains fully operational during the simulation and the current measured values are output correctly via the other outputs and the display. 				
	Caution! The setting is not saved in the event of a power failure.				
VALUE SIMULATION CURRENT (5242)	Note! This function is only available if the function SIMULATION CURRENT (5241) is switched on.				
	Use this function to specify a freely selectable value, e.g. 12 mA, which is to be simulated at the current input. This value is used to test downstream devices and the measuring device itself.				
	User input: 0.00 to 25.00 mA				
	Factory setting: 0.00 mA or 4 mA (depending on the setting in function 5201).				
	Caution! The setting is not saved in the event of a power failure.				

8.2.3 Function group INFORMATION

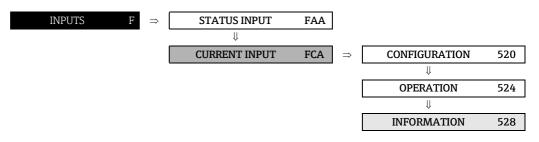

Function description INPUTS → CURRENT INPUT → INFORMATION	
TERMINAL NUMBER (5280)	This function is used to display the polarity and numbers of the terminals (in the terminal compartment) occupied by the current input.
(5280)	terminal compartment) occupied by the current input.

9 Block BASIC FUNCTION

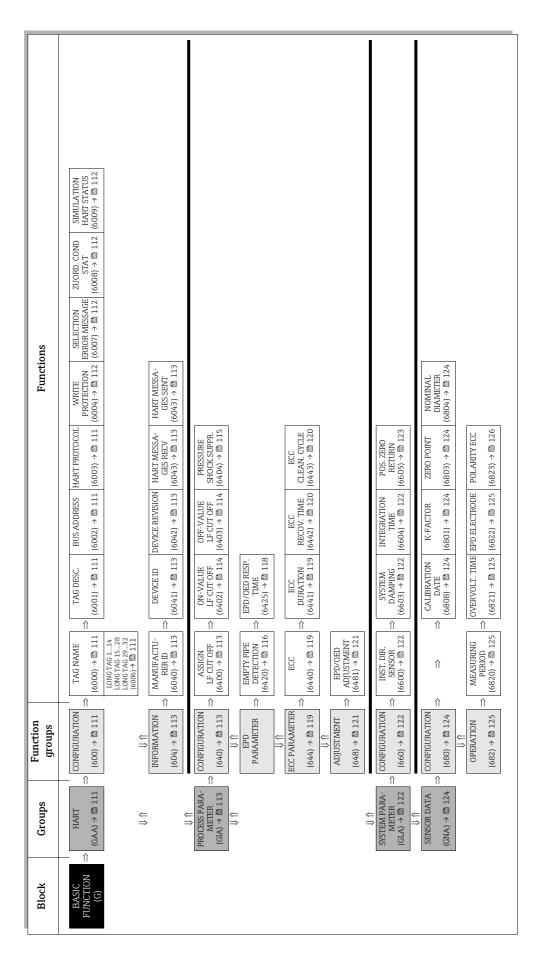

9.1 Group HART


9.1.1 Function group CONFIGURATION

BASIC FUNCTION G \Rightarrow HART GAA \Rightarrow CONFIGURATION 600

Function description		
BASIC FUNCTION → HART → CONFIGURATION		
LONG TAG 114 (6006) (HART 7)	Use this function to enter a tag name for the measuring device. You can edit and read this tag name at the local display or via the HART protocol.	
LONG TAG 1528 (6006) (HART 7)	Max. 14-character text: LONG TAG 114, LONG TAG 1528 max. 4-character text: LONG TAG 2932 permissible: A–Z, 0–9, +, –, punctuation marks	
LONG TAG 2932 (6006) (HART 7)	Factory setting: LONG TAG 114 :"" (no text) LONG TAG 1528: "" (no text) LONG TAG 2932: "" (no text)	
TAG NAME (6000) (HART 5)	Use this function to enter a tag name for the measuring device. You can edit and read this tag name at the local display or via the HART protocol. User input: max. 8-character text, permissible: A–Z, 0–9, +, –, punctuation marks	
	Factory setting: "" (no text)	
TAG DESCRIPTION (6001)	Use this function to enter a tag description for the measuring device. You can edit and read this tag description at the local display or via the HART protocol.	
	User input: max. 16-character text, permissible: A–Z, 0–9, +, –, punctuation marks	
	Factory setting: "" (No text)	
BUS ADDRESS (6002)	Use this function to define the address for the exchange of data with the HART protocol.	
	User input: 0 to 15 (HART 5) 0 to 63 (HART 7)	
	Factory setting: 0	
	Note! HART 5: With the Addresses 1 to 15 a constant 4 mA current is applied. HART 7: With the Addresses 1 to 63 a constant 4 mA current is applied.	
HART PROTOCOL	Use this function to display if the HART protocol is active.	
(6003)	User Interface: OFF = HART protocol not active ON = HART protocol active	
	Note! The HART protocol can be activated with the selection 4–20 mA HART or 4–20 mA (25 mA) HART in the CURRENT SPAN function (see \rightarrow $\stackrel{\triangle}{=}$ 56).	

Function description		
BASIC FUNCTION \rightarrow HART \rightarrow CONFIGURATION		
WRITE PROTECTION (6004)	Use this function to check whether the measuring device can be write-accessed.	
(0004)	User interface OFF (Data exchange is possible) ON (Data exchange is disabled) Factory setting:	
	OFF Note! Write protection is activated and deactivated by means of a jumper on the I/O module (see Operating Instructions Promag 53, BA00047D).	
SELECTION ERROR MES- SAGE (6007)	In this function, the error to be categorized is selected. Options:	
(HART 7)	CANCEL #401 EMPTY PIPE #601 POS.ZERO-RET	
	Note! List of error messages: Operating Instructions Promag 53, BA00047D, chapter "Trouble shooting"	
	Factory setting: CANCEL	
ASSIGN NE107 CON- DENSED STATUS	In this function, an NE107 category is assigned to the function previously selected.	
(6008) (HART 7)	Auswahl: CANCEL FUNCTION CHECK (C) OUT OF SPECIFICATIONS (S) MAINTENANCE REQ. (M) NO EFFECT (N)	
	Factory setting: CANCEL	
SIMULATION HART STATUS	In this function, the error to be simulated is selected.	
(6009) (HART 7)	Options: CANCEL #401 EMPTY PIPE #601 POS.ZERO-RET	
	Note! List of error messages: Operating Instructions Promag 53, BA00047D, chapter "Trouble shooting"	
	Factory setting: CANCEL	


9.1.2 Function group INFORMATION

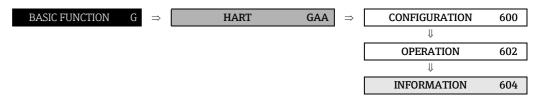

Function description BASIC FUNCTION → HART → OPERATION	
MANUFACTURER ID (6040)	Use this function to view the manufacturer ID. User Interface: - Endress+Hauser - $17 \cong 11 \text{ hex}$ for Endress+Hauser
DEVICE ID (6041)	Use this function to view the device ID in hexadecimal numerical format. User Interface: 42 hex (≅ 66 dez) for ProdType
DEVICE REVISION (6042)	Use this function to view the device-specific revision of the HART command interface. User interface: E.g.: 5
HART MESSAGES RECV (6043) (HART 7)	Returns the number of HART messages that are received without error and destined for the device in question (including broadcast messages). This does not include messages that contain a communication error but still demand a response on the part of the device (e.g. checksum error type of errors). User interface: 0 to 65535
HART MESSAGES SENT (6043) (HART 7)	Returns the number of all the messages sent by the device. Also contains the messages that are sent as a response to an incorrect request, e.g. to a request with a checksum error type of error or to a command that is not supported. User interface: 0 to 65535

9.2 Group PROCESS PARAMETER

9.2.1 Function group CONFIGURATION

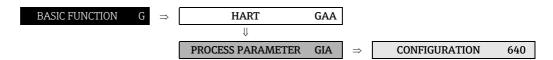

Function description \rightarrow PROCESS PARAMETER \rightarrow CONFIGURATION	
ASSIGN LOW FLOW CUT OFF (6400)	Use this function to assign the switch point for the low flow cut off. Options: OFF MASS FLOW VOLUME FLOW Factory setting: VOLUME FLOW

Function description BASIC FUNCTION → PROCESS PARAMETER → CONFIGURATION ON-VALUE LOW FLOW Use this function to enter the switch-on point for low flow cut off. **CUT OFF** (6402)Low flow cut off is active if the value entered is not equal to 0. The sign of the flow $% \left(1\right) =\left(1\right) \left(1\right)$ value is highlighted on the display to indicate that low flow cut off is active. User input: 5-digit floating-point number [unit] Factory setting: Depends on nominal diameter and country ($\rightarrow \stackrel{\triangle}{=} 154$). The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400) (see $\rightarrow \blacksquare$ 14 or $\rightarrow \blacksquare$ 13). OFF-VALUE LOW FLOW Use this function to enter the switch-off (b) point for low flow cut off. **CUT OFF** Enter the switch-off point as a positive hysteresis (H) from the switch-on point (a). (6403)User input: Integer 0 to 100% Factory setting: Example: A0003882 ① = switch-on point, ② = switch-off point Low flow cut off is switched on $b = Low flow cut off is switched off (a + a \cdot H)$ H Hysteresis: 0 to 100% Low flow cut off is active Q Flow

BASIC FUNCTION → PROCESS PARAMETER → CONFIGURATION

PRESSURE SHOCK SUP-PRESSION (6404)

The closure of a valve can cause brief but severe movements of the fluid in the piping system, movements which the measuring system registers. The pulses totalled in this way result in a totalizer reading error, particularly in the case of batching processes. For this reason, the measuring device is equipped with pressure shock suppression (= short-term signal suppression) which can eliminate system-related "disruptions".

Note!

Use this function to define the time span for active pressure shock suppression.

Activation of the pressure shock suppression

Pressure shock suppression is activated one the flow falls below the switch-on point of the low flow (see point a in graphic).

While pressure shock suppression is active, the following conditions apply:


- Current output → outputs the current corresponding to zero flow.
- Pulse/frequency output → outputs the frequency corresponding to zero flow.
- lacksquare Flow reading on display ightarrow 0
- Totalizer reading → the totalizers are pegged at the last correct value.

Deactivation of the pressure shock suppression

The pressure shock suppression is deactivated after the time interval, set in this function, has passed (see point b in graphic).

Note!

The current flow value is displayed and output, when the time interval for the pressure shock suppression has passed and the flow exceeds the switch-off point of the low flow (see point c in graphic).

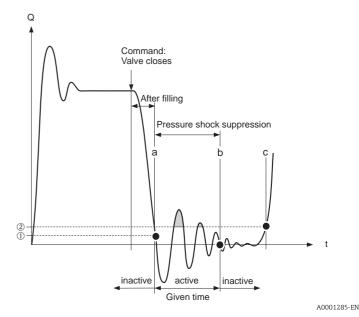

① = switch-on point (for low flow), ② = switch-off point (for low flow)

- a Activated if on-value of low flow is not reached
- Deactivated once the predefined time period has elapsed
- c Flow values are taken into account when calculating the pulses Suppressed values

Q Flow


User input:

max. 4-digit number, incl. unit: 0.00 to 100.0 s

Factory setting:

0.00 s

9.2.2 Function group EPD PARAMETER

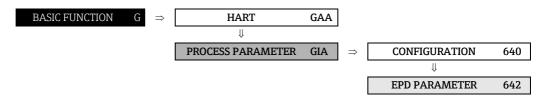

Function description

BASIC FUNCTION → PROCESS PARAMETER → EPD PARAMETER

EMPTY PIPE DETECTION (6420)

Flow cannot be measured correctly unless the measuring tube is full. This status can be monitored at all times with the Empty Pipe Detection function. Use this function to activate Empty Pipe Detection (EPD) or Open Electrode Detection (OED).

- EPD = Empty Pipe Detection (with the help of an EPD electrode)
- OED = Open Electrode Detection (empty pipe detection with the help of the measuring electrodes, if the sensor is not equipped with an EPD electrode or the orientation is not suitable for using EPD).

Options:

OFF - ON SPECIAL - OED - ON STANDARD

OFF (neither EPD nor OED are active)

ON SPECIAL (for DN < 400 only):

Switching on the Empty Pipe Detection (EPD) for devices in remote version (transmitter and sensor are installed separately).

OFD.

Switching on the Open Electrode Detection (OED).

ON STANDARD:

Switching on the Empty Pipe Detection (EPD) for:

- Devices in compact version (transmitter and sensor form a single mechanical unit).
- Applications where a facing and coating of the fluid on the measuring tube line and measuring electrode accrues.

Factory setting:

Note!

OFF



- The options ON STANDARD and ON SPECIAL are not available unless the sensor is equipped with an EPD electrode.
- The default setting for the EPD/OED functions when the device is delivered is OFF. The functions must be activated as required.
- The devices are calibrated at the factory with water (approx. $500 \,\mu\text{S/cm}$). If the conductivity of certain fluids deviates from this reference, empty pipe/full pipe adjustment must be performed again on site (siehe Funktion EPD/OED ADJUSTMENT (6481) auf Seite 121).
- If there are problems with the adjustment, the following error messages appear on the screen:
 - ADJUSTMENT FULL = EMPTY:
 - The adjustment values for empty pipe and full pipe are identical. In such instances, empty pipe adjustment/full pipe adjustment must be carried out again.
 - ADJUSTMENT NOT OK:

Adjustment is not possible as the fluid conductivity values are outside the permitted range.

(continued on next page)

BASIC FUNCTION → PROCESS PARAMETER → EPD PARAMETER

EMPTY PIPE DETECTION (continued)

Notes on empty pipe detection (EPD and OED)

- Flow cannot be measured correctly unless the measuring pipe is completely full.
 This status can be monitored at all times by means of the EPD/OED.
- An empty or partially filled pipe is a process error. A default factory setting defines that a fault message is issued and that this process error has an effect on the outputs.
- The EPD/OED process error can be output via the configurable relay or status outputs.
- A plausibility check of the adjustment values will only be executed by activating
 the empty pipe detection. If an empty or full pipe adjustment is performed
 during the empty pipe detection is active, the empty pipe detection has to be deand again activated, after finishing the adjustment, to start the plausibility
 check.

Response to partially filled pipes

If the EPD/OED is switched on and responds to a partially filled or empty pipe, the fault message "EMPTY PIPE" appears on the display. If the pipe is partially empty and the EPD/OED is not switched on, the response can vary in identically configured systems:

- Flow reading fluctuates
- Zero flow
- Excessively high flow values

Notes on open electrode detection (OED)

Open Electrode Detection (OED) functions like the Empty Pipe Detection (EPD). In contrast to the EPD where the measuring device must be equipped with a separate (optional) electrode, the OED detects partial filling by means of the two measuring electrodes which are present as standard (fluid no longer covers the measuring electrodes).

Open electrode detection can also be used if:

- the sensor is not installed in the optimal position for using EPD (optimal = installed horizontally).
- the sensor is not equipped with an additional (optional) EPD electrode.



Cable connection length:

When mounting a remote version, please observe the maximum permissible cable length of 15 metres in order to keep the OED function.

• OED empty pipe adjustment:

To achieve the best results for the open electrode detection, it is important to have the electrodes surface as dry as possible (no liquid film) while the emptypipe adjustment is being made.

Even during normal operation, the OED function is only secured if there is no longer any liquid film present on the electrodes when the measuring pipe is empty.

BASIC FUNCTION → PROCESS PARAMETER → EPD PARAMETER

EPD/OED RESPONSE TIME (6425)



Note!

This function is not available unless ON STANDARD, ON SPECIAL or OED was selected in the EMPTY PIPE DETECTION function (6420).

Use this function to enter the time span for which the criteria for an "empty" pipe have to be satisfied without interruption before a notice message or fault message is generated. The setting defined here is used by the active empty pipe etection (EPD) or open electrode detection (OED).

User input:

fixed-point number: 1.0 to 100 s

Factory setting:

1.0 s




Note!


OED detection time:

The recognition of open electrodes is, in contrast to the empty pipe detection (EPD), very slow reacting (delay at least 25 seconds) and is only activated after an aditional delay from the programmed response time!

We recommend in most applications to use the empty pipe detection (EPD) which is an optimal solution for detecting partly filled measuring tubes.

9.2.3 Function group ECC PARAMETER

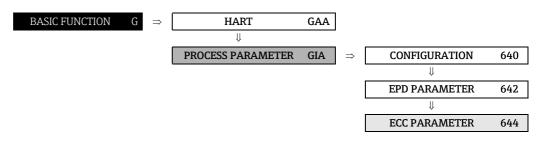

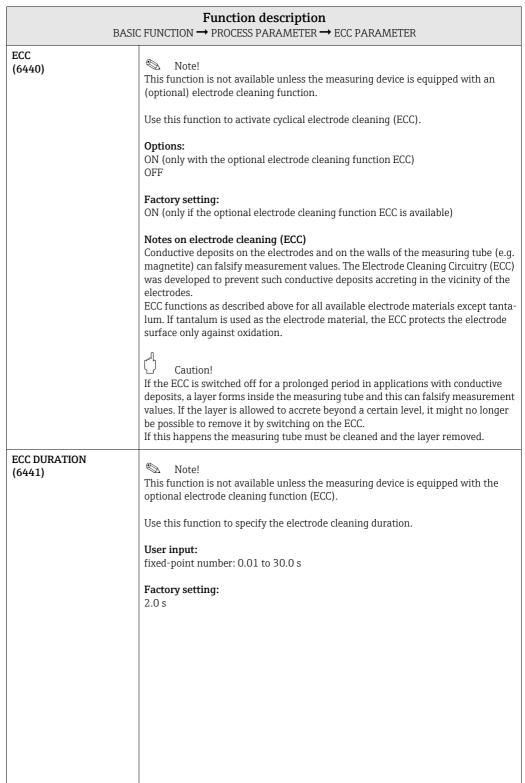

BASIC FUNCTION → PROCESS PARAMETER → ECC PARAMETER

ECC RECOVERY TIME (6442)



Note!

This function is not available unless the measuring device is equipped with the optional electrode cleaning function (ECC).

Use this function to specify the recovery time for which the last flow value measured prior to cleaning is retained. A recovery time is necessary as the signal outputs can fluctuate after electrode cleaning on account of electrochemical interference voltages.

User input:

max. 3-digit number: 1 to 600 s

Factory setting:

5 s



Caution!

The last value measured prior to cleaning is output for the duration of the recovery time (max. 600 s). This in turn means that the measuring system does not register changes in flow, e.g. stoppage, during this time span.

ECC CLEANING CYCLE (6443)



Note!

This function is not available unless the measuring device is equipped with the optional electrode cleaning function (ECC).

Use this function to specify the cleaning cycle for electrode cleaning.


User input:

Integer: 30 to 10080 min

Factory setting:

40 min

9.2.4 Function group ADJUSTMENT

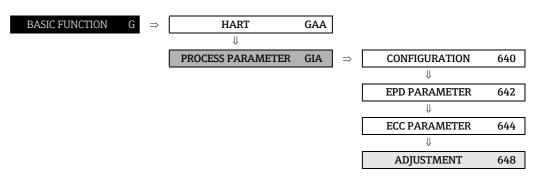

Function description

BASIC FUNCTION \rightarrow PROCESS PARAMETER \rightarrow ADJUSTMENT

EPD/OED ADJUSTMENT (6481)

Use this function to activate the EPD/OED adjustment for an empty or full measuring tube.

Note!

A detailed description and other helpful hints for the empty-pipe/full-pipe adjustment procedure can be found on \rightarrow \cong 116.

Options:

OFF FULL PIPE ADJUST EMPTY PIPE ADJUST OED FULL ADJUST OED EMPTY ADJUST

Factory setting:

OFF

Procedure for EPD or OED empty-pipe / full-pipe adjustment

- 1. Empty the piping. In case of an EPD adjustment, the wall of the measuring tube should be wetted with fluid for the adjustment procedure but this is not the case with an OED adjustment!
- 2. Start empty-pipe adjustment: Select "EMPTY PIPE ADJUST" or "OED EMPTY ADJUST" and press 🗉 to confirm.
- 3. After empty-pipe adjustment, fill the piping with fluid.
- 4. Start full-pipe adjustment: Select "FULL PIPE ADJUST" or "OED FULL ADJUST" and press © to confirm.
- 5. Having completed the adjustment, select the setting "OFF" and exit the function by pressing $\[\]$.
- 6. Now select the "EMPTY PIPE DETECTION" function (6420). Switch on Empty Pipe Detection by selecting the following settings:
 - EPD \rightarrow Select ON STANDARD or ON SPECIAL and press ${}^{\blacksquare}$ to confirm.
 - OED \rightarrow Select OED and confirm with \blacksquare .

Cautio

The adjustment coefficients must be valid before you can activate the EPD/OED function. If adjustment is incorrect the following messages might appear on the display:

- FULL = EMPTY


The adjustment values for empty pipe and full pipe are identical. In cases of this nature you **must** repeat empty-pipe or full-pipe adjustment **again**!

- ADJUSTMENT NOT OK

Adjustment is not possible because the fluid's conductivity is out of range.

9.3 Group SYSTEM PARAMETER

9.3.1 Function group CONFIGURATION

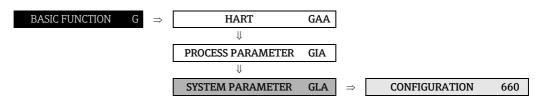


BAS	Function description BASIC FUNCTION → SYSTEM PARAMETER → CONFIGURATION	
INSTALLATION DIRECTION SENSOR (6600)	Use this function to reverse the sign of the flow quantity, if necessary. Options: NORMAL (flow as indicated by the arrow) INVERSE (flow opposite to direction indicated by the arrow) Factory setting: NORMAL Note! Ascertain the actual direction of fluid flow with reference to the direction indicated by the arrow on the sensor (nameplate).	
SYSTEM DAMPING (6603)	Use this function to set the filter depth of the digital filter. This reduces the sensitivity of the measuring signal to interference peaks (e.g. high solids content, gas bubbles in the fluid, etc.). The system reaction time decreases with an increasing filter setting. User input: 0 to 15 Factory setting: 9 Note! The system damping acts on all functions and outputs of the measuring device.	
INTEGRATION TIME (6604)	Use this function to set the integration time. Under normal circumstances it is not necessary to change the factory settings. User input: 3.3 to 65 ms Factory setting: 20 ms at 50 Hz → mains frequency (e.g. Europe) 16.7 ms at 60 Hz → mains frequency (e.g. USA) Caution! The integration time must not be selected with a greater value than the measuring period (6820). Note! The integration time defines the duration of internal totalling of the induced voltage in the fluid (measured by the measuring electrode), i.e. the time in which the measuring device records the true flow (afterwards the magnetic field for the next integration is created from the opposite pole).	

Function description BASIC FUNCTION → SYSTEM PARAMETER → CONFIGURATION POSITIVE ZERO RETURN Use this function to interrupt evaluation of measured variables. (6605)This is necessary when a piping system is being cleaned, for example. This setting acts on all function and outputs of the measuring device. OFF $ON \longrightarrow Signal$ output is set to the "ZERO FLOW" value. Factory setting: OFF Note! Positive zero return may **not** be activated for batching processes with the optional software package BATCHING.

9.4 Group SENSOR DATA

9.4.1 Function group CONFIGURATION

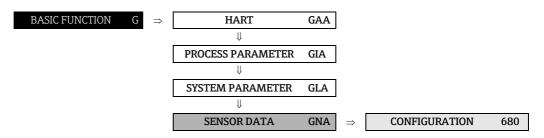

Function description

BASIC FUNCTION \rightarrow SENSOR DATA \rightarrow CONFIGURATION

All sensor data (calibration factors, zero (point) and nominal diameter) are set at the factory and saved on the S-DAT sensor memory chip.

Caution!

Under normal circumstances you should not change the following parameter settings, because changes affect numerous functions of the entire measuring facility in general and the accuracy of the measuring system in particular. For this reason, the functions described below cannot be changed even when you enter your personal code


Contact the Endress+Hauser service organization if you have any questions about these functions.

Note 🌯

The individual values of the functions are also provided on the sensor nameplate.

CALIBRATION DATE (6808)	Use this function to view the current calibration date and time for the sensor.
, ,	User interface:
	Calibration date and time
	Factory setting:
	Calibration date and time of the current calibration.
	Note!
	The calibration date and time format is defined in the FORMAT DATE/TIME
	(0429) function, $\rightarrow \stackrel{\triangle}{=} 16$.
K-FACTOR (6801)	Use this function to display the actual calibration factor (positive flow direction) for the sensor. The calibration factor is determined and set at the factory.
	User interface:
	5-digit fixed-point number: 0.5000 to 2.0000
	g
	Factory setting:
	Depends on nominal diameter and calibration
	Note!
	This value is also provided on the sensor nameplate.
ZERO POINT	This function shows the current zero-point correction value for the sensor. Zero-
(6803)	point correction is determined and set at the factory.
	User interface
	max. 4-digit number: -1000 to +1000
	The state of the s
	Factory setting:
	Depends on nominal diameter and calibration
NOMINAL DIAMETER (6804)	This function shows the nominal diameter for the sensor. The nominal diameter depends on the size of the sensor and is set at the factory.
	User interface
	2 to 2000 mm or 1/12 to 78"
	Factory setting:
	Depends on the size of the sensor

9.4.2 Function group OPERATION

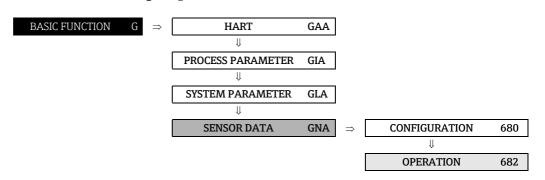

Function description Basic function \rightarrow sensor data \rightarrow operation

All sensor data (measuring period, overvoltage time etc.) are set at the factory and saved on the S-DAT sensor memory chip.

MEASURING PERIOD (6820)

Use this function to set the time for a full measuring period. The duration of the measuring period is calculated from the rise time of the magnetic field, the brief recovery time, the integration time (which can be set) and the empty pipe detection time.

User input:

0.0 to 1000 ms

Factory setting:

Depends on nominal diameter

Note!

The system checks the time entered and sets the measuring period which is actually used internally to a plausible value. If you enter 0 ms, the system automatically computes the shortest time.



Caution!

Under normal circumstances you should not change the following parameter settings, because changes affect numerous functions of the entire measuring facility in general and the accuracy of the measuring system in particular. For this reason, the functions described below cannot be changed even when you enter your personal code

Contact the Endress+Hauser service organization if you have any questions about these functions.

OVERVOLTAGE TIME (6821)	Use this function to specify the time in which overvoltage is applied to the coil circuit in order to build up the magnetic field as fast as possible. The overvoltage time is adjusted automatically while measuring is in progress. The overvoltage time depends on the sensor type and the nominal diameter and is set at the factory. User interface 4-digit floating-point number 0.0 to 100.0 ms
	4 digit floating point number 0.0 to 100.0 ms
	Factory setting: Depends on nominal diameter
EPD ELECTRODE (6822)	Use this function to check whether the sensor is equipped with an EPD electrode.
(0022)	User interface
	YES
	NO
	Factory setting: YES → Electrode fitted as standard

Function description BASIC FUNCTION → SENSOR DATA → OPERATION POLARITY ECC Use this function to display the actual current polarity for optional electrode cleaning (ECC). Electrode cleaning uses either a positive or negative current, (6823)depending on the electrode material. The measuring device automatically selects the correct polarity on the basis of the electrode-material data stored in the S-DAT. User interface $POSITIVE \rightarrow$ for electrodes made of: 1.4435, Hastelloy C, platinum, titanium NEGATIVE \rightarrow for electrodes made of: tantalum Caution! If the incorrect current is applied to the electrodes, the electrode material is destroyed.

10 Block SPECIAL FUNCTION

Functions	BATCH BATCH NAME SELECTOR SE
n s	
Function groups	CONFIGURATION (720) → B 128 U ↑ VALVE PARAMETER (722) → B 131 U ↑ SUPERVISION (724) → B 136 U ↑ OPERATION (726) → B 141 U ↑ OPERATION (728) → B 143 U ↑ OPERATION (728) → B 141
Groups	BATCHING FUNCTION (HCA) → ₾ 128 ↓ ↑
Block	SPECIAL HUNCTION (H)

10.1 **Group BATCHING FUNCTION**

10.1.1 **Function group CONFIGURATION**

BATCHING FUNCTION CONFIGURATION 720 SPECIAL FUNCTION Η **HCA**

Function description

SPECIAL FUNCTION \rightarrow BATCHING FUNCTION \rightarrow CONFIGURATION

BATCH SELECTOR (7200)

Use this function to select a batching specification. There are six different batching specifications available by means of which different batchings can be defined.

BATCH # 1 (or the name which was defined for batching specification 1 in the function BATCH NAME (7201).

BATCH # 2 (or the name which was defined for batching specification 2 in the function BATCH NAME (7201).

BATCH # 3 (or the name which was defined for batching specification 3 in the function BATCH NAME (7201).

BATCH # 4 (or the name which was defined for batching specification 4 in the function BATCH NAME (7201).

BATCH # 5 (or the name which was defined for batching specification 5 in the function BATCH NAME (7201).

BATCH # 6 (or the name which was defined for batching specification 6 in the function BATCH NAME (7201).

Factory setting:

BATCH #1



- By selecting a batching specification and its related settings (explained below), up to 6 different batchings can be preconfigured and selected as necessary.
- All the following functions in this function group, as well as the functions in the function groups VALVE PARAMETER (722) and SUPERVISION (724) are assigned to the batching specification selected here.
- All the settings in the following functions of this function group are valid only for the batching specification selected in the function BATCH SELECTOR (7200). In other words, the entry or option is assigned to the batching specification currently selected (e.g. in the factory setting BATCH # 1).

BATCH NAME (7201)

Use this function to assign a specific name to the batching specification .

User input:

max. 8-character text, permissible: A-Z, 0-9

Factory setting:

Name of batching specification (depends on selection in the function BATCH SELECTOR (7200), e.g. "BATCH # 1").



Once an entry has been made (e.g. "BEER 33"), the batch name (BEER 33) appears in the home position when selecting the quantity and the name of the batching specification ("e.g. BATCH # 1") no longer appears.

SPECIAL FUNCTION → BATCHING FUNCTION → CONFIGURATION

ASSIGN BATCH **VARIABLE** (7202)

Use this function to assign a batching variable to the batching specification.

Options:

OFF

VOLUME FLOW MASS FLOW

Factory setting:

OFF



• The possible assignments of the display functions are automatically extended. Once a batching variable has been selected (MASS or VOLUME), you can locally define the application-specific function of the minus key (start-stop-continue) and the plus key (stop-batching name/quantity) in the information line by means of the "batching menu" assignment.

In this way, a direct batching control station is made available locally at the measuring device by means of the user interface and the controls.

• Select OFF if the BATCHING functionality is no longer to be used. All settings related to the function (e.g. switching contact assigned to the relay output) must be assigned to another functionality.

BATCH QUANTITY (7203)

Use this function to define the quantity to be batched.

User input:

5-digit floating-point number: 0 to max. value (depends on nominal diameter) [unit]

Factory setting:

0 [unit]



- Note! • The appropriate unit is taken from the function group SYSTEM UNITS (ACA).
- (see $\rightarrow \blacksquare$ 13).
- When the batching quantity entered here is achieved, valve 1 closes (see function CLOSE VALVE 1 (7221) on $\rightarrow \blacksquare$ 131).

FIX COMPENSATION **QUANTITY** (7204)

Use this function to specify a positive or negative compensation quantity. The compensation quantity balances out a **constant**, system-related incorrect quantity. This can be caused, for example, by a pump over-running or by the closing time of a valve. The compensation quantity is determined by the system operator. A negative compensation quantity must be specified for overbatching and a positive compensation quantity for underbatching.



The compensation quantity affects batching quantity only and does not affect the after run compensation.

User input:

Floating-point number with sign (depends on nominal diameter)

Factory setting:

0 [unit]



- If the entry range is not sufficient for the compensation quantity, the batching quantity may have to be adjusted.
- The appropriate unit is taken from the function group SYSTEM UNITS (ACA), (see $\rightarrow \blacksquare$ 13).

SPECIAL FUNCTION \rightarrow BATCHING FUNCTION \rightarrow CONFIGURATION

BATCH STAGES (7208)

Use this function to define the number of batching stages. Batching can be carried out in several stages, e.g. 2-stage batching with fast and precise batching.

Options:

1-stage (1 valve or 1-stage batching) 2-stage (2 valves or 2-stage batching)

Factory setting:

1-stage (1 valve or 1-stage batching)



Note!

- The batching stage selection (number of valves) is directly dependent on the configuration of the outputs. For 2-stage batching two relay outputs must be available in the measuring device.
- The functions available in the function group VALVE PARAMETER (\rightarrow 🖺 131) are dependent on the number of batching stages (number of valves) selected in this function.

INPUT FORMAT (7209)

Use this function to define the entry format of the quantities for the switch points of the valves.

Options:

VALUE-INPUT (e.g. 10 [unit]) %-INPUT (e.g. 80 [%])

Factory setting:


VALUE-INPUT



Note!

The entry format selected in this function is also used in the function groups VALVE PARAMETER (\rightarrow 🗎 131) and SUPERVISION (\rightarrow 🗎 136).

10.1.2 Function group VALVE PARAMETER

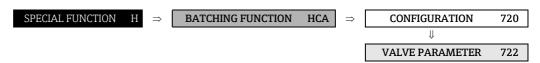

Function description

SPECIAL FUNCTION \rightarrow BATCHING FUNCTION \rightarrow VALVE PARAMETER

The parameters for the switching contacts of up to 2 valves can be set in the following functions. The number of switching contacts (valves) available, and thus their settings in this group, is defined in the function BATCH STAGES (7208).

Note

The following functions are only available if at least one batch stage has been selected in the function BATCH SELECTOR (7200).

OPEN VALVE 1 (7220)

Use this function to specify the quantity value at which contact 1 opens. This is used as a switch point for valve 1 to output via an assigned output . The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209).

User input:

0 to max. value or 0 to 100% (related to the batching quantity)

Factory setting:

0 [unit] or 0 [%]



Dynamic tracking for %-data:

If the value is entered as a %, this %-value always refers to the batching quantity (e.g. 70% of a batching quantity of 10 liters = 7 liters).

If the BATCH QUANTITY (7203) is adjusted (reduced/increased), the effective quantity switch point is automatically and dynamically adjusted (e.g. taking 70% and changing the batching quantity from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters).

Dynamic tracking for value-data:

If you enter value-input, this value is "absolute" for batching quantities that do not change (e.g. always 7 liters for a batching quantity of 10 liters). If the batching quantity (7203) is adjusted (reduced/increased), the quantity switch point is automatically and dynamically adjusted/tracked (e.g. with a new batching quantity changing from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters). In other words, the existing value data is tracked as a percentage of the altered batching quantity.

CLOSE VALVE 1 (7221)

Use this function to display the quantity value at which contact 1 (value 1) closes. The quantity value is displayed either as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209).

User Interface:

Value or 100% (corresponds to the batching quantity)

Factory setting:

0 [unit] or 0 [%]



SPECIAL FUNCTION \rightarrow BATCHING FUNCTION \rightarrow VALVE PARAMETER

OPEN VALVE 2 (7222)

Use this function to specify the quantity value at which contact 2 opens. This is used as a switch point for valve 2 to output via an assigned output . The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209).

User input:

0 to max. value or 0 to 100% (related to the batching quantity)

Factory setting:

0 [unit] or 0 [%]



Note!

Dynamic tracking for %-data:

If the value is entered as a %, this %-value always refers to the batching quantity (e.g. 70% of a batching quantity of 10 liters = 7 liters).

If the BATCH QUANTITY (7203) is adjusted (reduced/increased), the effective quantity switch point is automatically and dynamically adjusted (e.g. taking 70% and changing the batching quantity from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters).

• Dynamic tracking for value-data:

If you enter value-input, this value is "absolute" for batching quantities that do not change (e.g. always 7 liters for a batching quantity of 10 liters). If the batching quantity (7203) is adjusted (reduced/increased), the quantity switch point is automatically and dynamically adjusted/tracked (e.g. with a new batching quantity changing from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters). In other words, the existing value data is tracked as a percentage of the altered batching quantity.

CLOSE VALVE 2 (7223)

Use this function to specify the quantity value at which contact 2 closes. This is used as a switch point for valve 2 to output via an assigned output . The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209).

User input:

0 to max. value or 0 to 100% (related to the batching quantity)

Factory setting:

0 [unit] or 0 [%]



Note!

Dynamic tracking for %-data:

If the value is entered as a %, this %-value always refers to the batching quantity (e.g. 70% of a batching quantity of 10 liters = 7 liters). If the BATCH QUANTITY (7203) is adjusted (reduced/increased), the effective quantity switch point is automatically and dynamically adjusted (e.g. taking 70% and changing the batching quantity from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters).

• Dynamic tracking for value-data:

If you enter value-input, this value is "absolute" for batching quantities that do not change (e.g. always 7 liters for a batching quantity of 10 liters). If the batching quantity (7203) is adjusted (reduced/increased), the quantity switch point is automatically and dynamically adjusted/tracked (e.g. with a new batching quantity changing from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters). In other words, the existing value data is tracked as a percentage of the altered batching quantity.

10.1.3 Examples of setting parameters for batching processes


The two examples in the next section clearly show the effect of different entries and options in the function group BATCHING FUNCTION.

Example 1

The first example explains the parameter setting of various functions for carrying out batching and illustrates how functions are affected when the batching quantity is changed.

The following batching is to take place:

- 2-stage batching with a batching quantity of 10 liters in total.
- Coarse batching quantity of 8 liters. Valve 2 opens at the start of the batching and closes when
 - 8 liters is achieved.
- Fine batching of 2 liters. Valve 1 opens at the start of the batching and closes (automatically)
 - when the batching quantity (10 liters) is achieved.
- Once 9 liters have been batched a batching progress message should be generated.
- Value-input should be entered.

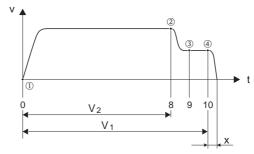

A0004670

- v = Flow velocity [m/s]
- t = Time
- V_1 = Valve 1 open
- V_2 = Valve 2 open
- ① = Start batching/coarse batching, valves 1 (7220) and 2 (7222) open
- ② = Valve 2 (7223) closes, coarse batching quantity achieved
- ③ = Batching progress message (7243)
- @ = Valve 1 closes (7221), batching ends
- x = After run quantity

The following parameter settings must be made:

- Select the unit for batching: Function UNIT VOLUME (0403) → \blacksquare 14 = 1 (liter)
- Enter the batching quantity: Function BATCH QUANTITY (7203) \rightarrow $\stackrel{\triangle}{=}$ 129 = 10 [liters]
- Select the entry format:
 Function BATCH STAGES (7208) →

 130 = 2-stage
- Quantity data for when the first valve should open:
 Function OPEN VALVE 1 (7220) → 131 = 0 [liters]
 (valve 1 closes automatically when the batching quantity is achieved = 10 [liters], display in function CLOSE VALVE 1 (7221) → 131

- Quantity data for when the second valve should open: Function OPEN VALVE 2 (7224) \rightarrow $\stackrel{\triangle}{=}$ 132 = 0 [liters]
- Quantity data for when the second valve should close:
 Function CLOSE VALVE 2 (7223) →

 132 = 8 [liters]
- Quantity data for when the message should be generated:
 Function PROGRESS NOTE (7243) →

 139 = 9 [liters]

Example 1 a

Batching specifications identical to those in example 1, however the new batching quantity is 20 liters and the message should be generated once 18 liters are batched.

The following parameters must be set **manually**:

- Enter the new batching quantity:
 Function BATCH QUANTITY (7203) →

 129 = 20 [liters]
- New quantity data for when the message should be generated:
 Function PROGRESS NOTE (7243) →

 139 = 18 [liters]

The following functions are **automatically** adjusted to suit the new batching quantity:


- Function OPEN VALVE 1 = 0 [liters]
- Function OPEN VALVE 2 = 0 [liters]
- Function CLOSE VALVE 2 = 16 [liters]

Example 2

The second example explains the parameter settings of the various functions for batching with the entry format in % for the switch points of the valves.

The following batching is to take place:

- 2-stage batching with a batching quantity of 15 liters in total.
- Coarse batching quantity from 3 to 12 liters. Valve 2 opens when 20% (3 liters) of the batching quantity is achieved and closes once 80% (12 liters) is achieved.
- Valve 1 opens at the start of the batching and closes (automatically) when the batching quantity (15 liters) is achieved.
- %-data should be entered.

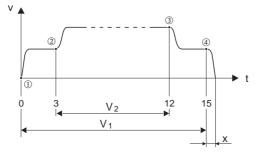

A0004684

v = Flow velocity [m/s]

t = Time

 V_1 = Valve 1 open

 V_2 = Valve 2 open

- ① = Start batching, valve 1 (7220) opens
- ② = Valve 2 (7222) opens, coarse batching quantity starts
- ③ = Valve 2 (7223) closes, coarse batching quantity achieved
- 4 = Valve 1 (7221) closes, end of batching
- x = After run quantity

The following parameter settings must be made:

- Select the unit for batching:
 Function UNIT VOLUME (0403) →

 14 = 1 (liter)
- Select the measured variable for batching:
 Function ASSIGN BATCH VARIABLE (7202) →

 129 = VOLUME FLOW

- Select the entry format: Function INPUT FORMAT (7209) → \blacksquare 130 = %-DATA
- Percentage data for when the first valve should open:
 Function OPEN VALVE 1 (7220) → 131 = 0 [%]
 (valve 1 closes automatically when the batching quantity is achieved = 15 [liters], display in function CLOSE VALVE 1 (7221) → 131
- Percentage data for when the second valve should open: Function OPEN VALVE 2 (7224) \rightarrow \bigsim 132 = 20 [%], corresponds to 3 liters
- Percentage data for when the second valve should close:
 Function CLOSE VALVE 2 (7223) →

 132 = 80 [%], corresponds to 12 liters

Example 2 a

Batching specifications identical to those in example 1, however the new batching quantity is 45 liters.


The following parameters must be set **manually**:

Enter the new batching quantity: Function BATCH QUANTITY (7203) $\Rightarrow \triangleq 129 = 45$ [liters]

The following functions are **automatically** adjusted to suit the new batching quantity:

- Function OPEN VALVE 1 = 0 [%]
- Function OPEN VALVE 2 = 20 [%] corresponds to 9 liters
- Function CLOSE VALVE 2 = 80 [%] corresponds to 36 liters

10.1.4 Function group SUPERVISION

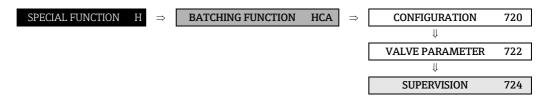

Function description

SPECIAL FUNCTION → BATCHING FUNCTION → SUPERVISION

MAXIMUM BATCHING TIME (7240)

Use this function to specify a maximum batching time.

All valves close once the specified batching time elapses (see functions CLOSE VALVE 1 to 2, see $\rightarrow \blacksquare$ 131 ff.).

This function can be used for safety reasons, for example, to ensure all batching valves close in the event of a system fault.

User input:

0 to 30000 s

Factory setting:

0 s (= deactivated)



Caution!

- When the batching quantity is adjusted (reduced/increased), (see function place i.e. this value must be determined again and re-entered (see also fault message # 471 in the Operating Instructions Promag 53, BA00047D, Troubleshooting Chapter).
- Batching (START) is not possible when the fault message is active!



Note!

- The function is not active if you enter 0 s (factory setting). This means that the batching valves are not closed by means of this function.
- As a factory setting, this function is assigned to a fault message. These messages are no longer automatically removed after 60 s but are now continuously displayed.

The fault message can be acknowledged by following actions:

- General reset:
 - A reset is possible, if any batch parameter is configured or by pressing the "+" key together with the 🗉 key.
- Reset via the status input:
 - The error message is reset with an initial input pulse, with the continuation of the batch procedure is resumed with an additional input pulse.
- Reset via the batch control keys (soft keys):
 - The error message is reset by pressing the START key, while the continuation $% \left(1\right) =\left(1\right) \left(1$ of the batch procedure is resumed by pressing the START button.
- Reset via the BATCH PROCEDURE (7260) parameter: The error message is reset via a STOP, START, HOLD or GO ON selection, while the continuation of the batch procedure is resumed by pressing the START button.
- If this function is intended more for general monitoring purposes or if there is a short time lapse between two batching processes, it is advisable to assign this function to a notice message (see function ERROR CATEGORY on $\rightarrow \blacksquare$ 146). However, while the notice message is active (60 seconds) the next batching can be started and the notice message is thereby acknowledged.
- This function can be output via the switch output.

SPECIAL FUNCTION → BATCHING FUNCTION → SUPERVISION

MINIMUM BATCHING QUANTITY (7241)

Use this function to specify a minimum batching quantity. A message is generated if the minimum batching quantity was not achieved by the time batching ends (e.g. if after run mode is active). The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209).

Application:

Message stating that underbatching is present (e.g. the contents of the containers does not correspond to the quantity declared).

User input:

0 to max. value or 0 to 100% (related to the batching quantity)

Factory setting:

0 [unit] (= deactivated)



Caution!

- When the batching quantity is adjusted (reduced/increased), (see function BATCH QUANTITY (7203) on →

 129) automatic adjustment does not take place, i.e. this value must be determined again and re-entered (see also fault message # 472 in the Operating Instructions Promag 53, BA00047D, Trouble-shooting Chapter).
- Batching (START) is not possible when the fault message is active!

Note!

- The function is not active if you enter 0 s (factory setting).
- As a factory setting, this function is assigned to a fault message. These messages are no longer automatically removed after 60 s but are now continuously displayed.

The fault message can be acknowledged by following actions:

- General reset:
- A reset is possible, if any batch parameter is configured or by pressing the "+" key together with the $\[\]$ key.
- Reset via the status input:
 - The error message is reset with an initial input pulse, with the continuation of the batch procedure is resumed with an additional input pulse.
- Reset via the batch control keys (soft keys):
 The error message is reset by pressing the START key, while the continuation of the batch procedure is resumed by pressing the START button.
- Reset via the BATCH PROCEDURE (7260) parameter:
 The error message is reset via a STOP, START, HOLD or GO ON selection, while the continuation of the batch procedure is resumed by pressing the START button.
- If this function is intended more for general monitoring purposes or if there is a short time lapse between two batching processes, it is advisable to assign this function to a notice message (see function ERROR CATEGORY on → ≦ 146). However, while the notice message is active (60 seconds) the next batching can be started and the notice message is acknowledged.
- This function can be output via the switch output.

SPECIAL FUNCTION → BATCHING FUNCTION → SUPERVISION

MAXIMUM BATCHING QUANTITY (7242)

Use this function to specify a maximum batching quantity. If the maximum batching quantity is exceeded during batching, all valves are closed, batching is stopped and a message is generated. The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209).

Application:

To avoid overbatching and thus prevent critical situations caused by fluid overflow arising in the plant (e.g. plant standstill caused by safety level switches being triggered, contamination, product loss, etc.).

User input:

0 to $2 \cdot max$. value or 0 to 200% (related to the batching quantity)

Factory setting:

0 [unit] (= deactivated)



Caution!

- When the batching quantity is adjusted (reduced/increased), (see function BATCH QUANTITY (7203) on →
 129) automatic adjustment does not take place, i.e. this value must be determined again and re-entered (see also fault message # 472 in the Operating Instructions Promag 53, BA00047D, Trouble-shooting Chapter).
- Batching (START) is not possible when the fault message is active!



Note!

- The function is not active if you enter 0 s (factory setting).
- As a factory setting, this function is assigned to a fault message. These messages are no longer automatically removed after 60 s but are now continuously displayed.

The fault message can be acknowledged by following actions:

- General reset:
 - A reset is possible, if any batch parameter is configured or by pressing the "+" key together with the $\ \ \ \ \ \$ key.
- Reset via the status input:
 - The error message is reset with an initial input pulse, with the continuation of the batch procedure is resumed with an additional input pulse.
- Reset via the batch control keys (soft keys):
 The error message is reset by pressing the START key, while the continuation of the batch procedure is resumed by pressing the START button.
- Reset via the BATCH PROCEDURE (7260) parameter:
 The error message is reset via a STOP, START, HOLD or GO ON selection, while the continuation of the batch procedure is resumed by pressing the START button.
- This function can be output via the switch output.

SPECIAL FUNCTION → BATCHING FUNCTION → SUPERVISION

PROGRESS NOTE (7243)

Use this function to define a batching quantity at which a message should be generated. When the specified batching quantity is achieved, the message is generated and signaled via an output.

The quantity value is entered as a % or as an absolute value, depending on the selection in function INPUT FORMAT (7209).

Application:

For longer batching processes when preparing or taking measures related to production (e.g. preparing to replace container, etc.).

User input:

0 to max. value or 0 to 100% (related to the batching quantity)

Factory setting:

0 [unit] (= deactivated)



Caution!

Note!

- The function is not active if you enter 0 (factory setting).
- This function can be output via the switch output.
- The batching progress message remains active until batching ends.

SPECIAL FUNCTION → BATCHING FUNCTION → SUPERVISION

MAX. FLOW VALUE (7244)

A maximum flow value can be specified in this function. The batching process is aborted and all the valves are closed if the specified flow value is overshot.

Application:

This function can be used for safety reasons, for example, to ensure all batching valves close in the event of a system fault.

User input:

5-digit floating-point number

Factory setting:

0 [Unit] (= deactivated)



- The appropriate unit is taken depending on the process variable selected in the ASSIGN BATCH VARIABLE parameter and the unit configured in the SYSTEM UNITS function group.
- The function is not active if you enter 0 s (factory setting).
- If the batching process is aborted because the specified flow value is overshot, the parameter BATCH COUNTER is not incremented.
- New error message > MAX. FLOW with the error number #474.
- As a factory setting, this function is assigned to a fault message. These messages are no longer automatically removed after 60 s but are now continuously displayed.


The fault message can be acknowledged by following actions:

- General reset:
 - A reset is possible, if any batch parameter is configured or by pressing the "+" key together with the $\ \ \ \$ key.
- Reset via the status input:
 - The error message is reset with an initial input pulse, with the continuation of the batch procedure is resumed with an additional input pulse.
- Reset via the batch control keys (soft keys):
 - The error message is reset by pressing the START key, while the continuation of the batch procedure is resumed by pressing the START button.
- Reset via the BATCH PROCEDURE (7260) parameter:
 The error message is reset via a STOP, START, HOLD or GO ON selection, while the continuation of the batch procedure is resumed by pressing the START button.

In the function ASSIGN PROCESS ERROR (8002), you can use the ERROR CATEGORY (8003) to define whether this should be treated as a fault or notice message.

Factory setting = FAULT MESSAGE


10.1.5 Function group OPERATION

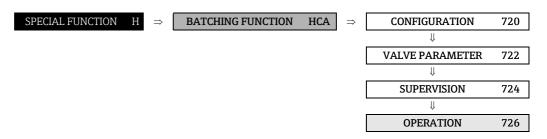

Function description SPECIAL FUNCTION → BATCHING FUNCTION → OPERATION	
BATCH PROCEDURE (7260)	Use this function to control a batching process. The batching can be started manually or a batching already running can be interrupted or stopped at any time.
	Options: STOP (Stop batching) START (Start batching) HOLD (Interrupt batching) GO ON (Continue batching)
	Factory setting: STOP
	 Note! This function can also be controlled via the status input (see function ASSIGN STATUS INPUT (5000) on →
	 during the batching process, the batching is cancelled (STOP) and the local display alternates between displaying the batching menu and the fault message. If the positive zero return is activated (see →
BATCH UPWARDS (7261)	In this function the batching progress can be read upwards, i.e. starting at 0 the quantity displayed increases until the batching process is complete.
	User interface: Floating-point number incl. unit Note!
D. HOLL DOLLDWIN DDG	The value of this function can be output via the current output.
BATCH DOWNWARDS (7262)	In this function the batching progress can be read downwards, i.e. starting from the batching quantity, the quantity displayed decreases until the batching process is complete.
	User interface: Floating-point number incl. unit
	Note! The value of this function can be output via the current output.

SPI	Function description \rightarrow Operation \rightarrow Batching function \rightarrow Operation
BATCH COUNTER (7263)	Use this function to display the number of batchings carried out. User interface: max. 7-digit floating-point number
	Factory setting: Note! The batching quantity totalizer can be reset to 0 via the function RESET SUM/COUNTER (7265). This function is reset to 0 (zero) if a different batching specification is selected
BATCH SUM (7264)	in the function BATCH SELECTOR (7200). Use this function to display the effective overall total of all the batchings carried out.
(7204)	User Interface: max. 7-digit floating-point number [unit]
	Factory setting: 0 [unit]
	 Note! E.g. in 2-stage batching the effective overall total is calculated from the coarse batching quantity, fine batching quantity and after run quantity. The total batching quantity can be reset to 0 via the function RESET SUM/COUNTER (7265). This function is reset to 0 (zero) if a different batching specification is selected in the function BATCH SELECTOR (7200).
RESET SUM/COUNTER (7265)	Use this function to reset the batch counter and the batch sum to zero. User input: NO YES
	Factory setting: NO Note! The batch counter and the batch sum can also be reset via the batching menu (information line on the local display).

10.1.6 Function group INFORMATION

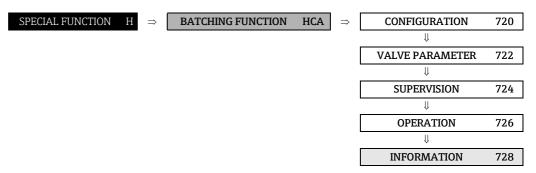

Function description \rightarrow SPECIAL FUNCTION \rightarrow BATCHING FUNCTION \rightarrow INFORMATION	
INTERNAL SWITCH POINT VALVE 1 (7280)	Use this function to display the internal switch point of valve 1 (siehe Funktion CLOSE VALVE 1 (7221) auf Seite 131). The value displayed takes the fixed correction quantity and / or the calculated after run quantity into account.
	User Interface: max. 7-digit floating-point number [unit]
	Note! The appropriate unit is taken from the function group SYSTEM UNITS (ACA), (see $\rightarrow \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ $
VALVE 1 CLOSING TIME (7282)	Use this function to display the valve closing time calculated internally .
	User Interface: max. 7-digit floating-point number [ms]
	Note! The valve closing time is the period between the switch point of valve 1 and the first undershooting of the low flow. The data can only be taken as a general trend as the accuracy of the time value is directly dependent on the measuring period.


SPECIAL FUNCTION \rightarrow BATCHING FUNCTION \rightarrow INFORMATION

BATCHING TIME (7283)

In this function, you can read the batching time for the current or completed batching process, i.e. starting at 0 seconds, the time displayed increases until the batching process is complete.

Application:

This BATCHING TIME refers to the batch quantity determined in the BATCH SUM function for the current or last batching process.

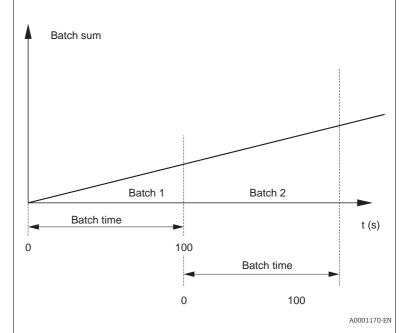

User Interface:


max. 7-digit floating-point number



Note!


- Behaviour when controlling batching process via function BATCH PROCEDURE:
 - STOP ⇒ BATCHING TIME is not reset and stays at the current value.
 - START \Rightarrow BATCHING TIME is reset and starts with the value 0
 - HOLD \Rightarrow BATCHING TIME is not reset and stays at the current value.
 - ${
 m GO~ON} \Rightarrow {
 m BATCHING~TIME}$ is not reset and continues updating on the basis of the last time value
- The BATCHING TIME is also updated during the batching process

11 Block SUPERVISION

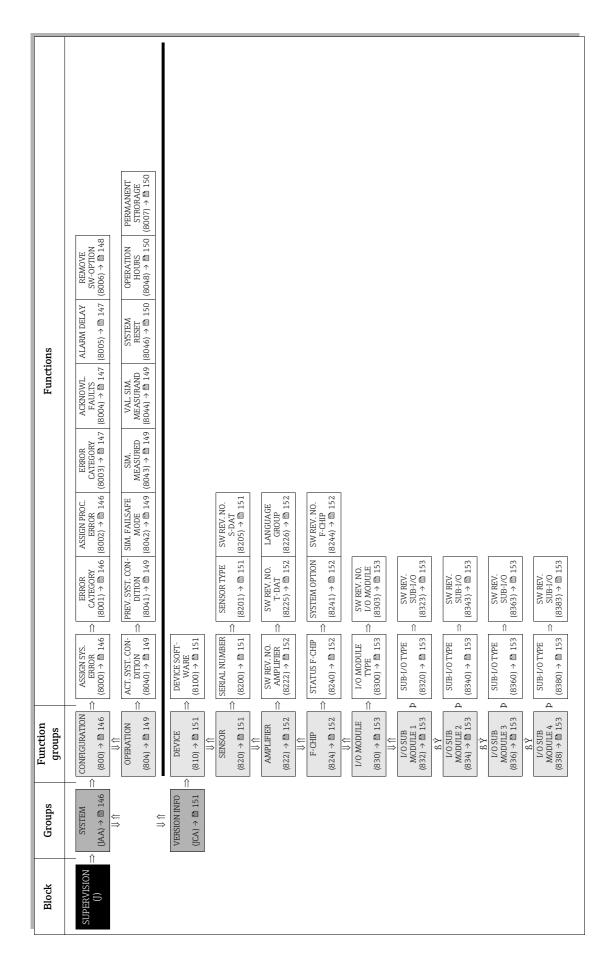

11.1 Group SYSTEM


11.1.1 Function group CONFIGURATION

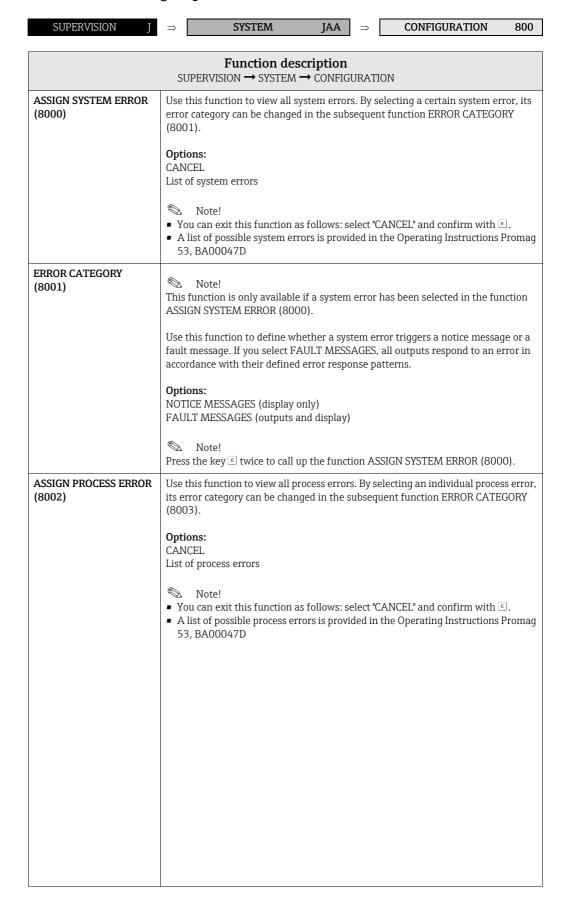

Function description SUPERVISION → SYSTEM → CONFIGURATION **ERROR CATEGORY** \otimes Note! (8003)This function is only available if a process error has been selected in the function ASSIGN PROCESS ERROR (8002). Use this function to define whether a process error triggers a notice message or a fault message. If you select FAULT MESSAGES, all outputs respond to an error in accordance with their defined error response patterns. Options: NOTICE MESSAGES (display only) FAULT MESSAGES (outputs and display) \otimes Note! Press the key E twice to call up the function ASSIGN PROCESS ERROR (8002). ACKNOWLEDGE FAULTS Use this function to define the measuring device's response to fault messages. (8004)Options: OFF The measuring device resumes normal operation when the fault is rectified. The fault message disappears automatically. ON The measuring device resumes normal operation when the fault is rectified. The fault message is shown on the local display until the message is acknowledged by pressing the E key. Factory setting: OFF ALARM DELAY Use this function to define a time span in which the criteria for a fault have to be (8005)satisfied without interruption before a fault or notice message is generated. Depending on the setting and the type of fault, this suppression acts on: Display Relay output Current output • Frequency output User input: 0 to 100 s (in steps of one second) Factory setting: 0 s Caution! If this function is activated fault and notice messages are delayed by the time corresponding to the setting before being transmitted to the higher-order controller (process controller, etc.). It is therefore imperative to check in advance in order to make sure whether a delay of this nature could affect the safety requirements of the process. If fault and notice messages may not be suppressed, a value of 0 seconds must be entered here.

Function description SUPERVISION → SYSTEM → CONFIGURATION REMOVE Note! **SW-OPTION** This function is only available if: (8006) The F-CHIP software options were saved beforehand The F-CHIP is not located on the I/O board of the measuring device Deletes all F-CHIP software options, such as batching, etc. The measuring device is restarted after the software options have been deleted. Options: 0 = NO1 = YESFactory setting: NO Caution! If process variables which are only available via the F-CHIP software options are assigned to the local display or the outputs, these have to be reconfigured.

11.1.2 Function group OPERATION

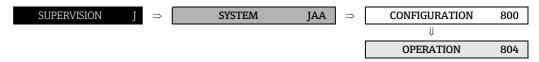


	Function description SUPERVISION \rightarrow SYSTEM \rightarrow OPERATION
ACTUAL SYSTEM CONDITION (8040)	Use this function to check the present system condition. User Interface: "SYSTEM OK" or the fault / notice message with the highest priority.
PREVIOUS SYSTEM CONDITIONS (8041)	Use this function to view the fifteen most recent fault and notice messages since measuring last started. User Interface: The 15 most recent fault or notice messages.
SIMULATION FAILSAFE MODE (8042)	Use this function to set all inputs, outputs and totalizers to their defined failsafe modes, in order to check whether they respond correctly. During this time, the words "SIMULATION FAILSAFE MODE" appear on the display. Options: ON OFF Factory setting: OFF
SIMULATION MEASURAND (8043)	Use this function to set all inputs, outputs and totalizers to their defined flow-response modes, in order to check whether they respond correctly. During this time, the words "SIMULATION MEASURAND" appear on the display. Options: OFF MASS FLOW VOLUME FLOW Factory setting: OFF Caution! The measuring device cannot be used for measuring while this simulation is in progress. The setting is not saved if the power supply fails.
VALUE SIMULATION MEASURAND (8044)	Note! The function is not visible unless the SIMULATION MEASURAND function (8043) is active. Use this function to specify a selectable value (e.g. 12 m³/s). This is used to test the associated functions in the device itself and downstream signal loops. User input: 5-digit floating-point number [unit] Factory setting: 0 [unit] Caution! The setting is not saved if the power supply fails. The appropriate unit is taken from the function group SYSTEM UNITS (ACA), (see → 13).


	Function description
	SUPERVISION → SYSTEM → OPERATION
SYSTEM RESET (8046)	Use this function to perform a reset of the measuring system. Options: NO
	RESTART SYSTEM (restart without interrupting power supply)
	Factory setting: NO
OPERATION HOURS (8048)	The hours of operation of the device appear on the display.
	Display: Depends on the number of hours of operation elapsed: Hours of operation < 10 hours → display format = 0:00:00 (hr:min:sec) Hours of operation 10 to 10,000 hours → display format = 0000:00 (hr:min) Hours of operation > 10,000 hours → display format = 000000 (hr)
PERMANENT STRORAGE (8007)	This function indicates whether permanent storage of all parameters in the EEPROM has been switched on or off.
	Display: 0 = OFF 1 = ON
	Factory setting: ON

11.2 Group VERSION INFO

11.2.1 Function group DEVICE

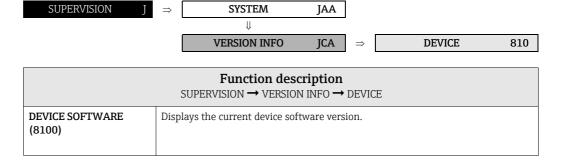


11.2.2 Function group SENSOR

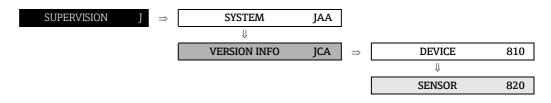


Function description SUPERVISION \rightarrow VERSION INFO \rightarrow SENSOR							
SERIAL NUMBER (8200)	Use this function to view the serial number of the sensor.						
SENSOR TYPE (8201)	Use this function to view the sensor type.						
SOFTWARE REVISION NUMBER S-DAT (8205)	Use this function to view the software revision number of the software used to create the content of the S-DAT.						

11.2.3 Function group AMPLIFIER

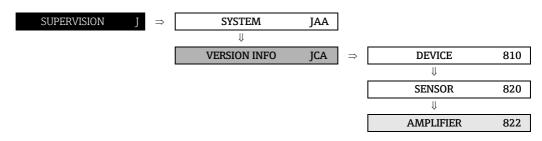


	Function description SUPERVISION \rightarrow VERSION INFO \rightarrow AMPLIFIER
SOFTWARE REVISION NUMBER AMPLIFIER (8222)	Use this function to view the software revision number of the amplifier.
SOFTWARE REVISION NUMBER T-DAT (8225)	Use this function to view the software revision number of the software used to create the content of the T-DAT.
LANGUAGE GROUP (8226)	Use this function to view the language group. The following language groups can be ordered: WEST EU / USA, EAST EU / SCAND., ASIA, CHINA. Display: available language group Note! The language options of the available language group are displayed in the LAN-GUAGE (2000) function. You can change the language group via the configuration software FieldCare. Please do not hesitate to contact your Endress+Hauser sales office if you have any questions.

11.2.4 Function group F-CHIP

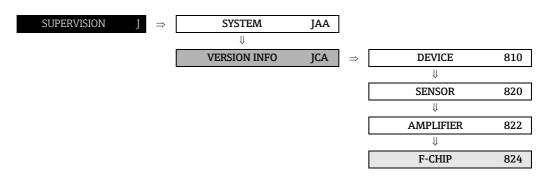


	Function description SUPERVISION \rightarrow VERSION INFO \rightarrow F-CHIP
STATUS F-CHIP (8240)	Use this function to check whether an F-CHIP is installed and which software options are available.
SYSTEM OPTION (8241)	Note! This function is not available unless the measuring device is equipped an F-CHIP. The software options available in the measuring device appear on the display.
SOFTWARE REVISION NUMBER F-CHIP (8244)	Note! This function is not available unless the measuring device is equipped an F-CHIP. Use this function to view the software revision number of the F-CHIP.

11.2.5 Function group I/O MODULE

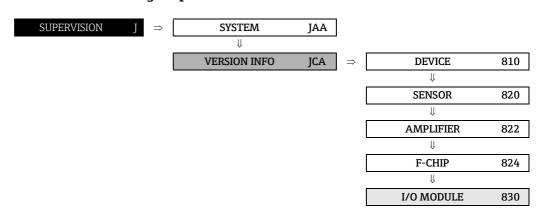

Function description SUPERVISION → VERSION INFO → I/O MODULE						
I/O MODULE TYPE (8300)	Use this function to view the configuration of the I/O module complete with terminal numbers.					
SOFTWARE REVISION NUMBER I/O MODULE (8303)	Use this function to view the software revision number of the I/O module.					

11.2.6 Function groups INPUT /OUTPUT 1 to 4

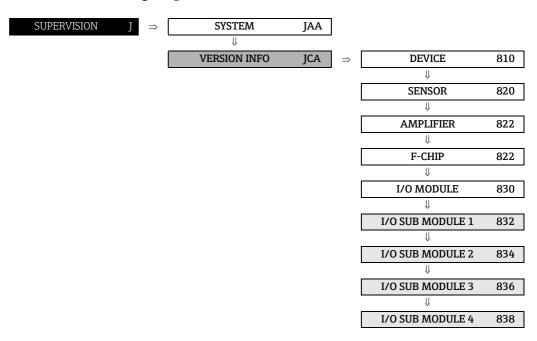

Function description							
	SUPERVISION \rightarrow VERSION INFO \rightarrow I/O SUB MODULE 1 to 4						
SUB I/O TYPE	Use this function to view the configuration complete with terminal numbers.						
1 = (8320)							
2 = (8340)							
3 = (8360)							
4 = (8380)							
SOFTWARE REVNO.	Use this function to view the software revision number of the corresponding						
SUBMODULE I/O	submodule.						
1 = (8322)							
2 = (8343)							
3 = (8363)							
4 = (8383)							

12 Factory settings

12.1 SI units (not for USA and Canada)

Low flow, full scale value, pulse value, totalizer

	Nominal dia- meter Low flow		Full scale value		Pulse value			Totalizer				
		(app	rox. v = 0.0)4 m/s)	(approx. v = 2.5 m/s) (a		(approx. 2 pulse/s at 2.5 m/s)					
[mm]	[inch]		Volume	Mass		Volume	Mass		Vol.	Mass	Vol.	Mass
2	1/12"	0.01	dm ³ /min	kg/min	0.5	dm ³ /min	kg/min	0.005	dm ³	kg	dm ³	kg
4	1/8"	0.05	dm ³ /min	kg/min	2	dm ³ /min	kg/min	0.025	dm ³	kg	dm ³	kg
8	3/8"	0.1	dm ³ /min	kg/min	8	dm ³ /min	kg/min	0.10	dm ³	kg	dm^3	kg
15	1/2"	0.5	dm ³ /min	kg/min	25	dm ³ /min	kg/min	0.20	dm ³	kg	dm^3	kg
25	1"	1	dm ³ /min	kg/min	75	dm ³ /min	kg/min	0.50	dm ³	kg	dm ³	kg
32	1 1/4"	2	dm ³ /min	kg/min	125	dm ³ /min	kg/min	1.00	dm ³	kg	dm ³	kg
40	1 1/2"	3	dm ³ /min	kg/min	200	dm ³ /min	kg/min	1.50	dm^3	kg	dm ³	kg
50	2"	5	dm ³ /min	kg/min	300	dm ³ /min	kg/min	2.50	dm ³	kg	dm ³	kg
65	2 1/2"	8	dm ³ /min	kg/min	500	dm ³ /min	kg/min	5.00	dm ³	kg	dm ³	kg
80	3"	12	dm ³ /min	kg/min	750	dm ³ /min	kg/min	5.00	dm^3	kg	dm ³	kg
100	4"	20	dm ³ /min	kg/min	1200	dm ³ /min	kg/min	10.00	dm^3	kg	dm ³	kg
125	5"	30	dm ³ /min	kg/min	1850	dm ³ /min	kg/min	15.00	dm^3	kg	dm ³	kg
150	6"	2.5	m ³ /h	t/h	150	m ³ /h	t/h	0.025	m ³	t	m ³	t
200	8"	5.0	m ³ /h	t/h	300	m ³ /h	t/h	0.05	m ³	t	m ³	t
250	10"	7.5	m ³ /h	t/h	500	m ³ /h	t/h	0.05	m ³	t	m ³	t
300	12"	10	m ³ /h	t/h	750	m ³ /h	t/h	0.10	m ³	t	m ³	t
350	14"	15	m ³ /h	t/h	1000	m ³ /h	t/h	0.10	m ³	t	m ³	t
375	15"	20	m ³ /h	t/h	1200	m ³ /h	t/h	0.15	m ³	t	m ³	t
400	16"	20	m ³ /h	t/h	1200	m ³ /h	t/h	0.15	m ³	t	m ³	t
450	18"	25	m ³ /h	t/h	1500	m ³ /h	t/h	0.25	m ³	t	m ³	t
500	20"	30	m ³ /h	t/h	2000	m ³ /h	t/h	0.25	m ³	t	m ³	t
600	24"	40	m ³ /h	t/h	2500	m ³ /h	t/h	0.30	m ³	t	m ³	t
700	28"	50	m ³ /h	t/h	3500	m ³ /h	t/h	0.50	m ³	t	m ³	t
_	30"	60	m ³ /h	t/h	4000	m ³ /h	t/h	0.50	m ³	t	m ³	t
800	32"	75	m ³ /h	t/h	4500	m ³ /h	t/h	0.75	m ³	t	m ³	t
900	36"	100	m ³ /h	t/h	6000	m ³ /h	t/h	0.75	m ³	t	m ³	t
1000	40"	125	m ³ /h	t/h	7000	m ³ /h	t/h	1.00	m ³	t	m ³	t
-	42"	125	m ³ /h	t/h	8000	m ³ /h	t/h	1.00	m ³	t	m ³	t
1200	48"	150	m ³ /h	t/h	10000	m ³ /h	t/h	1.50	m ³	t	m ³	t
-	54"	200	m ³ /h	t/h	13000	m ³ /h	t/h	1.50	m ³	t	m ³	t
1400	-	225	m ³ /h	t/h	14000	m ³ /h	t/h	2.00	m ³	t	m^3	t
-	60"	250	m ³ /h	t/h	16000	m ³ /h	t/h	2.00	m ³	t	m^3	t
1600	-	300	m ³ /h	t/h	18000	m ³ /h	t/h	2.50	m ³	t	m ³	t
-	66"	325	m ³ /h	t/h	20500	m ³ /h	t/h	2.50	m ³	t	m ³	t
1800	72"	350	m ³ /h	t/h	23000	m ³ /h	t/h	3.00	m ³	t	m ³	t
-	78"	450	m ³ /h	t/h	28500	m ³ /h	t/h	3.50	m ³	t	m^3	t
2000	-	450	m ³ /h	t/h	28500	m ³ /h	t/h	3.50	m ³	t	m ³	t

Language

Country	Language
Australia	English
Austria	Deutsch
Belgium	English
China	Chinese
Czech Republic	Czech
Denmark	English
England	English
Finland	Suomi
France	Francais
Germany	Deutsch
Hong Kong	English
Hungary	English
India	English
Indonesia	Bahasa Indonesia
Instruments International	English
Italy	Italiano
Japan	Japanese
Malaysia	English
Netherlands	Nederlands
Norway	Norsk
Poland	Polish
Portugal	Portuguese
Russia	Russian
Singapore	English
South Africa	English
Spain	Espanol
Sweden	Svenska
Switzerland	Deutsch
Thailand	English

Density, length, temperature

	Unit
Density	kg/l
Length	mm
Temperature	℃

12.2 US units (only for USA and Canada)

Low flow, full scale value, pulse value, totalizer

	Nominal dia- meter Low flow		Fu	Full scale value		Pulse value			Totalizer			
		(appı	rox. $v = 0.0$	4 m/s)	(app	rox. v = 2.5	m/s)	(approx. 2 pulse/s at 2.5 m/s)				
[inch]	[mm]		Volume	Mass		Volume	Mass		Vol.	Mass	Vol.	Mass
1/12"	2	0.002	gal/min	lb/min	0.1	gal/min	lb/min	0.001	gal	lb	gal	lb
1/8"	4	0.008	gal/min	lb/min	0.5	gal/min	lb/min	0.005	gal	lb	gal	lb
3/8"	8	0.025	gal/min	lb/min	2	gal/min	lb/min	0.02	gal	lb	gal	lb
1/2"	15	0.10	gal/min	lb/min	6	gal/min	lb/min	0.05	gal	lb	gal	lb
1"	25	0.25	gal/min	lb/min	18	gal/min	lb/min	0.20	gal	lb	gal	lb
1 1/4"	32	0.50	gal/min	lb/min	30	gal/min	lb/min	0.20	gal	lb	gal	lb
1 1/2"	40	0.75	gal/min	lb/min	50	gal/min	lb/min	0.50	gal	lb	gal	lb
2"	50	1.25	gal/min	lb/min	75	gal/min	lb/min	0.50	gal	lb	gal	lb
2 1/2"	65	2.0	gal/min	lb/min	130	gal/min	lb/min	1	gal	lb	gal	lb
3"	80	2.5	gal/min	lb/min	200	gal/min	lb/min	2	gal	lb	gal	lb
4"	100	4.0	gal/min	lb/min	300	gal/min	lb/min	2	gal	lb	gal	lb
5"	125	7.0	gal/min	lb/min	450	gal/min	lb/min	5	gal	lb	gal	lb
6"	150	12	gal/min	lb/min	600	gal/min	lb/min	5	gal	lb	gal	lb
8"	200	15	gal/min	lb/min	1200	gal/min	lb/min	10	gal	lb	gal	lb
10"	250	30	gal/min	lb/min	1500	gal/min	lb/min	15	gal	lb	gal	lb
12"	300	45	gal/min	lb/min	2400	gal/min	lb/min	25	gal	lb	gal	lb
14"	350	60	gal/min	lb/min	3600	gal/min	lb/min	30	gal	lb	gal	lb
15"	375	60	gal/min	lb/min	4800	gal/min	lb/min	50	gal	lb	gal	lb
16"	400	60	gal/min	lb/min	4800	gal/min	lb/min	50	gal	lb	gal	lb
18"	450	90	gal/min	lb/min	6000	gal/min	lb/min	50	gal	lb	gal	lb
20"	500	120	gal/min	lb/min	7500	gal/min	lb/min	75	gal	lb	gal	lb
24"	600	180	gal/min	lb/min	10500	gal/min	lb/min	100	gal	lb	gal	lb
28"	700	210	gal/min	lb/min	13500	gal/min	lb/min	125	gal	lb	gal	lb
30"	ī	270	gal/min	lb/min	16500	gal/min	lb/min	150	gal	lb	gal	lb
32"	800	300	gal/min	lb/min	19500	gal/min	lb/min	200	gal	lb	gal	lb
36"	900	360	gal/min	lb/min	24000	gal/min	lb/min	225	gal	lb	gal	lb
40"	1000	480	gal/min	lb/min	30000	gal/min	lb/min	250	gal	lb	gal	lb
42"	-	600	gal/min	lb/min	33000	gal/min	lb/min	250	gal	lb	gal	lb
48"	1200	600	gal/min	lb/min	42000	gal/min	lb/min	400	gal	lb	gal	lb
54"	ı	1.3	Mgal/d	ton/h	75	Mgal/d	ton/h	0.0005	Mgal	ton	Mgal	ton
_	1400	1.3	Mgal/d	ton/h	85	Mgal/d	ton/h	0.0005	Mgal	ton	Mgal	ton
60"	-	1.3	Mgal/d	ton/h	95	Mgal/d	ton/h	0.0005	Mgal	ton	Mgal	ton
-	1600	1.7	Mgal/d	ton/h	110	Mgal/d	ton/h	0.0008	Mgal	ton	Mgal	ton
66"	ı	2.2	Mgal/d	ton/h	120	Mgal/d	ton/h	0.0008	Mgal	ton	Mgal	ton
72"	1800	2.6	Mgal/d	ton/h	140	Mgal/d	ton/h	0.0008	Mgal	ton	Mgal	ton
78"	-	3.0	Mgal/d	ton/h	175	Mgal/d	ton/h	0.001	Mgal	ton	Mgal	ton
-	2000	3.0	Mgal/d	ton/h	175	Mgal/d	ton/h	0.001	Mgal	ton	Mgal	ton

Language, density, length, temperature

	Unit
Language	English
Density	g/cc
Length	inch
Temperature	F

157

13 Ir	ndex function matrix	400 = CONFIGURATION	
	iden function matrix	404 = OPERATION	65
		408 = INFORMATION	
Blöcke		420 = CONFIGURATION	67
A = MEASURI	ED VARIABLES11	430 = OPERATION	87
B = QUICK SE	ГUР 20	438 = INFORMATION	
	ERFACE	470 = CONFIGURATION	
	CR49	474 = OPERATION	
	54	478 = INFORMATION	98
		500 = CONFIGURATION	0:
	NCTION	504 = OPERATION 10	J۷
	FUNCTION	508 = INFORMATION	0:
	ON	520 = CONFIGURATION)(
,		524 = OPERATION 10	
Gruppen		528 = INFORMATION	ე:
	URING VALUES12	600 = CONFIGURATION	1:
	M UNITS	604 = INFORMATION	13
	AL UNITS	640 = CONFIGURATION	13
	ROL30	642 = EPD PARAMETER 1:	16
	LINE	644 = ECC PARAMETER	19
	ONAL LINE	648 = ADJUSTMENT	2:
	MATION LINE	660 = CONFIGURATION	22
	JZER 1 50	680 = CONFIGURATION	24
	IZER 2	682 = OPERATION	2:
	IZER 3	720 = CONFIGURATION	28
	ING TOTALIZER53	722 = VALVE PARAMETER	3:
	INT OUTPUT 155	724 = SUPERVISION	36
	NT OUTPUT 2	726 = OPERATION	4:
	FREQUENCY OUTPUT 1	728 = INFORMATION	43
	FREQUENCY OUTPUT 2	800 = CONFIGURATION	46
	OUTPUT 192	804 = OPERATION	49
	OUTPUT 2	820 = SENSOR	
	S INPUT	822 = AMPLIFIER	
	NT INPUT	824 = F-CHIP	
		830 = I/O MODULE	
	SS PARAMETER113	832 = INPUT/OUTPUT 1 1	
	M PARAMETER	834 = INPUT/OUTPUT 2 1	53
	PR DATA	836 = INPUT/OUTPUT 3	53
	HING FUNCTION	838 = INPUT/OUTPUT 4	
	M146		
	N INFO	Funktionen 0	
JCA - VEIGIO	IN IINFO	0000= CALCULATED MASS FLOW	15
Funktions	rgunnon	0001 = VOLUME FLOW	
		0005 = DENSITY	
	GURATION	0008 = TEMPERATURE	
	ONAL CONFIGURATION	0400 = UNIT MASS FLOW.	
	RARY UNIT	0401 = UNIT MASS.	
	Y PARAMETER	0402 = UNIT VOLUME FLOW	
	CONFIGURATION30	0403 = UNIT VOLUME.	
	KING/LOCKING33	0420 = UNIT DENSITY	
	TION34	0422 = UNIT TEMPERATURE	
	GURATION35	0424 = UNIT LENGTH	
	PLEX	0429 = FORMAT DATE/TIME.	
	GURATION	0602 = TEXT ARBITRARY VOLUME.	
	PLEX	0603 = FACTOR ARBITRARY VOLUME	
	GURATION45	0700 = DENSITY VALUE	
	PLEX	0701 = REFERENCE TEMPERATURE	
	GURATION50	0702 = EXPANSION COEFFICIENT	
304 = OPERA	TION52	O. OL LENGTH TOTAL	٠.

1	4042 = VALUE SIMULATION CURRENT	
1002 = QUICK SETUP COMMISSION20	4080 = TERMINAL NUMBER	
1003 = QUICK SETUP PULSATING FLOW	4200 = OPERATION MODE	
1005 = QUICK SETUP BATCHING/DOSING	4201 = ASSIGN FREQUENCY	
1009 = T DAT SAVE/LOAD	4202 = START VALUE FREQUENCY	.68
	4203 = END VALUE FREQUENCY	.68
2	4204 = VALUE F LOW	
2000 = LANGUAGE	4205 = VALUE-F HIGH	
	4206 = MEASURING MODE	
2002 = DISPLAY DAMPING	4207 = OUTPUT SIGNAL	
2003 = CONTRAST LCD	4208 = TIME CONSTANT.	
2004 = BACKLIGHT32	4209 = FAILSAFE MODE.	
2020 = ACCESS CODE	4211 = FAILSAFE VALUE	
2021 = DEFINE PRIVATE CODE33	4211 = PAILSAPE VALUE 4221 = ASSIGN PULSE	
2022 = STATUS ACCESS	4221 – ASSIGN PULSE	
2023 = ACCESS CODE COUNTER		
2040 = TEST DISPLAY	4223 = PULSE WIDTH	
2200 = ASSIGN	4225 = MEASURING MODE	
2201 = 100% VALUE	4226 = OUTPUT SIGNAL	
2202 = FORMAT	4227 = FAILSAFE MODE	
2220 = ASSIGN	4241 = ASSIGN STATUS	
2221 = 100% VALUE	4242 = ON VALUE	
2222 = FORMAT	4243 = SWITCH-ON DELAY	
2400 = ASSIGN	4244 = OFF-VALUE	
2401 = 100% VALUE	4245 = SWITCH-OFF DELAY	.85
2402 = FORMAT	4246 = MEASURING MODE	.85
2402 = PORWIAT	4247 = TIME CONSTANT	.86
2420 = ASSIGN	4301 = ACTUAL FREQUENCY	
	4302 = SIMULATION FREQUENCY	
2421 = 100% VALUE	4303 = VALUE SIMULATION FREQUENCY	
2422 = FORMAT	4322 = SIMULATION PULSE.	
2423 = DISPLAY MODE	4323 = VALUE SIMULATION PULSE	
2600 = ASSIGN	4341 = ACTUAL STATUS.	
2601 = 100% VALUE	4342 = SIMULATION SWITCH POINT	
2602 = FORMAT	4343 = VALUE SIMULATION SWITCH POINT	
2603 = DISPLAY MODE	4380 = TERMINAL NUMBER	
2620 = ASSIGN		
2621 = 100% VALUE	4700 = ASSIGN RELAY	
2622 = FORMAT	4701 = ON-VALUE	
2623 = DISPLAY MODE	4702 = SWITCH-ON DELAY	
	4703 = OFF-VALUE	
3	4704 = SWITCH-OFF DELAY	
3000 = ASSIGN	4705 = MEASURING MODE	
3001 = UNIT TOTALIZER	4706 = TIME CONSTANT	
3002 = TOTALIZER MODE	4740 = ACTUAL STATUS RELAY	
3003 = RESET TOTALIZER	4741 = SIMULATION SWITCH POINT	
3040 = SUM	4742 = VALUE SIMULATION SWITCH POINT	
3041 = OVERFLOW	4780 = TERMINAL NUMBER	.98
3800 = RESET ALL TOTALIZERS	5	
3801 = FAILSAFE ALL TOTALIZERS53	5000 = ASSIGN STATUS INPUT	กร
_	5001 = ACTIVE LEVEL	
4	5002 = MINIMUM PULSE WIDTH	
4000 = ASSIGN CURRENT OUTPUT55	5040 = ACTUAL STATUS INPUT	
4001 = CURRENT SPAN	5040 = ACTUAL STATUS INPUT	
4002 = VALUE 0_4 mA 57,58		
4003 = VALUE 20 mA	5042 = VALUE SIMULATION STATUS INPUT 1	
4004 = MEASURING MODE	5080 = TERMINAL NUMBER	
4005 = TIME CONSTANT	5200 = ASSIGN CURRENT INPUT	
4006 = FAILSAFE MODE	5201 = CURRENT SPAN	
4040 = ACTUAL CURRENT	5202 = VALUE 0_4 mA	
4040 - ACTOAL CONTENT	5203 = VALUE 20 mA	٠07

158

5204 = FAILSAFE MODE107	7220 = OPEN VALVE 1	
5240 = ACTUAL CURRENT INPUT108	7221 = CLOSE VALVE 1	. 131
5241 = SIMULATION CURRENT INPUT108	7222 = OPEN VALVE 2	. 132
5242 = VALUE SIMULATION CURRENT INPUT108	7223 = CLOSE VALVE 2	. 132
5245 = TERMINAL NUMBER109	7240 = MAXIMUM BATCHING TIME	. 136
	7241 = MINIMUM BATCHING QUANTITY	. 137
6	7242 = MAXIMUM BATCHING QUANTITY	. 138
6000 = TAG NAME	7243 = PROGRESS NOTE	. 139
6001 = TAG DESCRIPTION	7244 = MAX. FLOW VALUE	. 140
6002 = BUS ADDRESS	7260 = BATCH PROCEDURE	. 141
6003 = HART PROTOCOL	7261 = BATCH UPWARDS	. 141
6004 = WRITE PROTECTION	7262 = BATCH DOWNWARDS	. 141
6006 = LONG TAG 114	7263 = BATCH COUNTER	. 142
6006 = LONG TAG 1528	7264 = BATCH SUM	. 142
6006 = LONG TAG 2932	7265= RESET TOTAL SUM/COUNTER	. 142
6007 = SELECTION ERROR MESSAGE	7280 = INTERNAL SWITCH POINT VALVE 1	. 143
6008 = ASSIGN NE107 COND. STAT	7282 = CLOSING TIME VALVE 1	. 143
6009 = SIMULATION HART STATUS	7283 = BATCHING TIME	. 144
6040 = MANUFACTURER ID		
6041 = DEVICE ID	8	
6042 = DEVICE REVISION	8000 = ASSIGN SYSTEM ERROR	146
6043 = HART MESSAGES RECV	8001 = ERROR CATEGORY.	
6043 = HART MESSAGES SENT	8002 = ASSIGN PROCESS ERROR	
6400 = ASSIGN LOW FLOW CUT OFF	8003 = ERROR CATEGORY	
6402 = ON-VALUE LOW FLOW CUT OFF	8004 = ACKNOWLEDGE FAULTS	
6403 = OFF-VALUE LOW FLOW CUT OFF	8005 = ALARM DELAY	
6404 = PRESSURE SHOCK SUPPRESSION	8006 = REMOVE SW-OPTION	
6420 = EMPTY PIPE DETECTION (EPD)	8007 = PERMANENT STRORAGE	
6425 = EPD/OED RESPONSE TIME	8040 = ACTUAL SYSTEM CONDITION	
6440 = ECC	8041 = PREVIOUS SYSTEM CONDITIONS	
6441 = ECC DURATION	8042 = SIMULATION FAILSAFE MODE	
6442 = ECC RECOVERY TIME	8043 = SIMULATION MEASURAND	
6443 = ECC CLEANING CYCLE	8044 = VALUE SIMULATION MEASURAND	
6481 = EPD/OED ADJUSTMENT	8046 = OPERATION HOURS	
6600 = INSTALLATION DIRECTION SENSOR	8046 = SYSTEM RESET.	
6603 = SYSTEM DAMPING	8200 = SERIAL NUMBER	
6604 = INTEGRATION TIME	8201 = SENSOR TYPE	
6605 = POSITIVE ZERO RETURN	8205 = SOFTWARE REV. NO. S-DAT	
6801 = K-FACTOR	8222 = SOFTWARE REV. NO. AMPLIFIER	
6803 = ZERO POINT	8225 = SOFTWARE REV. NO. T-DAT	
6804 = NOMINAL DIAMETER	8226 = LANGUAGE GROUP	
6808 = CALIBRATION DATE	8240 = STATUS F-CHIP	
6820 = MEASURING PERIOD	8241 = SYSTEM OPTION	
6821 = OVERVOLTAGE TIME	8244 = SOFTWARE REV. NO. F-CHIP.	
6822 = EPD ELECTRODE	8300 = I/O MODULE TYPE	
6823 = POLARITY ECC	8303 = SOFTWARE REV. NO. I/O MODULE	
0029 TOMMATT 200	8320 = SUBMODULE I/O TYPE 1	
7	8323 = SOFTWARE REV. NO. SUBMODULE I/O 1	
7200 = BATCH SELECTOR	8340 = SUBMODULE I/O TYPE 2	
7200 = BATCH SELECTOR	8343 = SOFTWARE REV. NO. SUBMODULE I/O 2	
7201 = BATCH NAME	8360 = SUBMODULE I/O TYPE 3	
7202 = ASSIGN BATCH VARIABLE	8363 = SOFTWARE REV. NO. SUBMODULE I/O 3	
7204 = FIX COMPENSATION QUANTITY	8380 = SUBMODULE I/O TYPE 4	
7208 = BATCH STAGES	8383 = SOFTWARE REV. NO. SUBMODULE I/O 4	
7208 = BATCH STAGES		. 1))
$1209 - \text{INFUL FURIVIAL} \dots 130$		

14 Index key words

A
Access Code
Acknowledge faults147
Active level103
Actual
Current (current input)108
Current (current output)65
Frequency87
Actual status
Relay output
Status input104
Status (pulse/frequency output)
Actual system condition149
Additional configuration (system units)15
Additional line
Configuration39
Multiplex42
Adjustment
EPD/EED123
Alarm delay147
Amplifier (version info)
Arbitrary unit
Assign
Additional line
Additional line (Multiplex) 42, 43
Batch variable129
Current input106
Current output
Frequency (Pulse/freq. output)
Information line45
Information line (Multiplex)47
Low flow cut off
Main line
Main line (Multiplex)37
Process error146
Pulse output
Relay (relay output)
Status input
Status (pulse/frequency output)83
System error146
Totalizer50
В
Backlight
Basic configuration (user interface)
Basic function
Batch
Counter
Downwards
Name
Procedure
Quantity
Selector
Stages
Sum
Upwards

Batching function
Basic function
Inputs
Measured variables
Outputs54
Quick Setup
Special function127
Supervision145
Totalizer
User interface
Bus address
C
Calculated mass flow
Calibration date124
Close
Valve 1
Valve 2
Closing time Valve 1143
Commission
Compensation
Quantity (fixed)129
Configuration
Additional line
Batching function
Current input
Current output55
HART111
Information line
Main line
Process parameter
Pulse/Frequency output67
Relay output92
Sensor data
Status input
System
System parameter122
System units
Totalizer
Contrast LCD
Control
Basic configuration
Operation
Unlocking/locking
Current input
Configuration
Information
Operation
Current output
Configuration
Information
Operation
Current span
Guirent span
D
Define private code
Density

Density parameter (introduction)	Additional line	
Density value (display)	Additional line (Multiplex)	43
Density value (input)18	Date and Time	
Expansion coefficient (volume)	Information line	
Reference temperature	Information line (Multiplex)	
Device ID	Main line	
Device Revision	Main line (Multiplex)	38
Diagram Red Miss Code and a second s	Function group	1 5
Batching Setup menu	Additional configuration (system units)	
Pulsating flow Setup menu	Adjustment	
Setup Commissioning	Amplifier	
Display Backlight32	Basic configuration (user interface)	
Damping	Configuration	
Test	Additional line	39
Display mode	Batching function	
Additional line	Current input	
Additional line (Multiplex)	Current output	
Information line	HART	
Information line (Multiplex)	Information line	
mormación me (mateipren) 111111111111111111111111111111111111	Main line	
E	Process parameter	
ECC	Pulse/Frequency output	
Cleaning cycle120	Relay output	
Duration	Sensor data	
Parameter119	Status input	103
Polarity	System	146
Recovery time120	System parameter	122
Electrode cleaning (ECC)119	System units	
Empty pipe detection (EPD/OED)	Totalizer	
Empty/Full pipe adjustment121	Density parameter	
EPD electrode	ECC parameter	
General information	EPD parameter	
Response time	F-CHIP	152
Switching on/off EPD/OED116	Information	
End value frequency	Batching function	
EPD (Empty Pipe Detection)	Current input	
Error category Process error147	Current output	
System error	HART	
Error message112	Pulse/frequency output	
Expansion coefficient for volume (density)	Relay output	
Expansion coefficient for volume (density)	Input/output (14)	
F	I/O Module	
Factor arbitrary volume	Multiplex	
Factory settings	Additional line	
Failsafe mode	Information line	
All totalizers53	Main line	
Current input107	Operation	
Current output	Batching function	141
Frequency output76	Current input	
Pulse output83	Current output	
Failsafe value	Pulse/Frequency output	
F-CHIP (version info)	Relay output	
Fix compensation quantity	Sensor data	
Flow damping122	Status input	
Flow value	System	
Maximum	Totalizer	
Format	User interface	34

162

Concor	77
Sensor	K
Unlocking/locking (user interface)	K-Factor
Valve parameter	L
Function matrix	Language
General layout	Factory settings
Identification code9	Language group (display)
Overview10	Selection
	Low flow cut off
G	
Group	M
Additional line	Main line
Batching function	Configuration
Control (User interface)	Multiplex
Current input	Manufacturer number
Handling Totalizer53	Maximum
HART111	Batching quantity138
Information line45	Batching time
Main line35	Max. flow value
Measuring values12	Measured variables (block A)
Process parameter113	Measuring mode
Pulse/Frequency output	Current output
Relay output	Frequency (pulse/frequency output)71, 72
Sensor data124	Pulse output
Special units	Relay output94
Status input	Status (pulse/frequency output)
System	Measuring period
System parameter	Measuring values
Totalizer	Batching quantity
Version info	Pulse width
1 0.25.01. 1	Multiplex
H	Additional line
Handling Totalizer53	Information line
Hardware ID number	Main line
Input/output 14	NT.
HART	N
Configuration	NE107 category
Information	Nominal diameter124
TIANT messages	0
I	OED (Open Electrode Detection)
Information	see Empty Pipe Detection (EPD/OED)
Batching function143	Off value
Current input	Low flow cut off114
Current output	Relay output93
Pulse/frequency output91	Status (pulse/frequency output) 84
Relay output	On value
Status input	Low flow cut off
Information line	Relay output
Configuration	Status (pulse/frequency output)
Multiplex	Open Valve 1
Inputs	Valve 2
Input/output 14 (version info)	Open electrode detection (OED)
Installation direction sensor	Operation
Integration time	Batching function141
Internal switch point Valve 1143	Current input
I/O Module	Current output65

Pulse/frequency output87	S
Relay output96	Sensor data
Sensor data125	Configuration124
Status input104	Operation
System149	Sensor type
Totalizer	Sensor (version info)
User interface34	Serial number sensor
Operation hours150	Simulation
Operation mode (Pulse/frequency output)67	Current input
Output signal	Current (current output)65
Frequency output73	Failsafe mode149
Pulse output	Frequency87
Outputs54	HART status112
Overflow	Measurand149
Overvoltage time	Pulse
n.	Relay output switch point96
P	Status input
Permanent storage	Status (pulse/frequency output)
Polarity ECC	Software revision number
Positive zero return	Amplifier
Pressure shock suppression	F-CHIP
Previous system conditions149	I/O Module153
Process parameter	S-DAT
Adjustment121	T-DAT152
Configuration113	Special units
ECC parameter119	Arbitrary unit
EPD parameter116	Density parameter
Progress note	Start value frequency
Pulsating flow20	Status
Pulse	Access
Value	F-CHIP
Width78	Status input
Pulse/frequency output	Configuration103
Configuration67	Information105
Information91	Operation
Operation	Sum (Totalizer)
Q	Supervision
Quick Setup	Batching function
Batching/Dosing20	Block Supervision
Commission	Switching response of the relay output 100
Pulsating flow	Switch-off delay
1 disading now20	Relay output94
R	Status (pulse/frequency output)
Reference temperature19	Switch-on delay
Relay output	Relay output93
Configuration92	Status (pulse/frequency output)
Flow direction	System
General	Configuration146
Information	Operation
Limit value	Operation hours
Operation	Parameter
Switching response	Permanent storage
Remove SW-option	Reset
Reset	System condition
All totalizers53	Actual
Total sum/counter	Previous
Totalizer51	System option (additional software)
	System units
	Additional configuration

164

Configuration13	User interface
T	V
Tag	Value
Description	F High69
Name111	F Low
Tag name	Simulation Pulse
T-DAT Save/Load	0_4 mA
	0_4 mA (current input)
Temperature Display (current input)	20 mA59
Display (current input)	20 mA (current input)
Reference temperature	
Units	Value Simulation
Terminal number	Frequency
Current input	Relay output switch point
Current output	Switch point status (pulse/frequency output) 90
Pulse/frequency output91	Value simulation
Relay output	Current (current input)
Status input	Current (current output)65
Text arbitrary volume	Measurand149
Time constant	Status input104
Current output	Valve parameter
Frequency output	Batching function
Relay output95	Version info
Status (pulse/frequency output)	Amplifier
Totalizer	F-CHIP
Configuration50	Input/output 14
Mode51	I/O Module153
Operation	Sensor
Reset	Volume flow
Type	TAT
Input/output 14	W
I/O Module153	Write protection
U	Z
	Zero point
Unit	Zero point124
Density	Zahlen
Length	100% value flow
Mass	Additional line40
Mass flow	Additional line (Multiplex)
Temperature	Information line
Totalizer	Information line (Multiplex)
Volume	Main line
Volume flow	Main line (Multiplex)
Unlocking/locking (user interface)33	iviani mie (ivianipien)

www.endress.com/worldwide

