



Level



Pressure



Flow



Temperature



Liquid  
Analysis



Registration



Systems  
Components



Services




Solutions

## Brief Operating Instructions

# Levelflex M FMP41C

## Guided Level-Radar

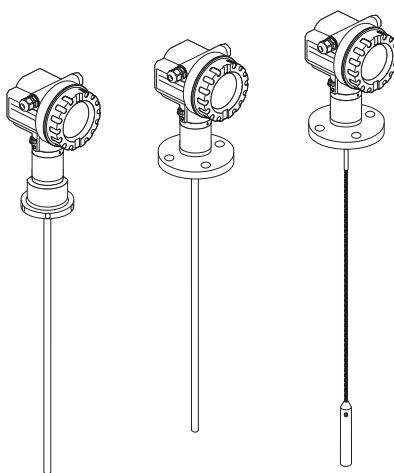

These are Brief Operating Instructions.

For more detailed information, please refer to the Operating Instructions and the additional documentation on the CD-ROM provided.

These Brief Operating Instructions are not intended to replace the Operating Instructions provided in the scope of supply.

The complete device documentation consists of:

- these Brief Operating Instructions
- Approvals and safety certificates
- a CD-ROM with:
  - the Operating Instructions
  - Technical Information

KA01043F/00/EN/13.10  
71120297

# Table of contents

- 1 Safety instructions . . . . . 3
  - 1.1 Designated use . . . . . 3
  - 1.2 Installation, commissioning and operation . . . . . 3
  - 1.3 Operational safety and process safety . . . . . 3
  - 1.4 Return . . . . . 3
  - 1.5 Safety icons . . . . . 4
- 2 Mounting . . . . . 5
  - 2.1 Incoming acceptance, transport, storage . . . . . 5
  - 2.2 Installation . . . . . 6
  - 2.3 Post-installation check . . . . . 13
- 3 Wiring . . . . . 14
  - 3.1 Wiring in F12/F23 housing . . . . . 14
  - 3.2 Wiring in T12 housing . . . . . 15
  - 3.3 Wiring with FOUNDATION Fieldbus connector . . . . . 15
  - 3.4 Terminal assignment . . . . . 16
  - 3.5 Cable specification FOUNDATION Fieldbus . . . . . 16
  - 3.6 Connecting the measuring unit . . . . . 16
  - 3.7 Screening/potential matching . . . . . 18
  - 3.8 Degree of protection . . . . . 18
  - 3.9 Post-connection check . . . . . 18
- 4 Operation . . . . . 19
  - 4.1 General structure of the operating menu . . . . . 19
  - 4.2 Display and operating elements . . . . . 20
- 5 Commissioning . . . . . 23
  - 5.1 Function check . . . . . 23
  - 5.2 Switching on the measuring device . . . . . 23
  - 5.3 Overview Basic Setup . . . . . 24
  - 5.4 Basic Setup with the device display . . . . . 26
  - 5.5 Blocking distance . . . . . 36
  - 5.6 Envelope curve with device display . . . . . 38

# 1 Safety instructions

## 1.1 Designated use

The Levellflex M is a compact level transmitter for the continuous measurement of solids and liquids, measuring principle: Guided Level Radar / TDR: **T**ime **D**omain **R**eflectometry.

## 1.2 Installation, commissioning and operation

- The device must only be installed, connected, commissioned and maintained by qualified and authorized specialists (e.g. electrical technicians) in full compliance with the instructions in this manual, the applicable norms, legal regulations and certificates (depending on the application).
- The specialist must have read and understood this manual and must follow the instructions it contains. If you are unclear on anything in these Brief Operating Instructions, you must read the Operating Instructions (on the CD-ROM). The Operating Instructions provide detailed information on the device/measuring system.
- The device may only be modified or repaired if such work is expressly permitted in the Operating Instructions (→ see CD-ROM).
- If faults cannot be rectified, the device must be taken out of service and secured against unintentional commissioning.
- Do not operate damaged devices. Mark them as defective.




## 1.3 Operational safety and process safety

- Alternative monitoring measures must be taken to ensure operational safety and process safety during configuration, testing and maintenance work on the device.
- The device is safely built and tested according to state-of-the-art technology and has left the factory in perfect condition as regards technical safety. The applicable regulations and European standards have been taken into account.
- Pay particular attention to the technical data on the nameplate.
- If the device is to be installed in an explosion hazardous area, then the specifications in the certificate as well as all national and local regulations must be observed. The device is accompanied by separate "Ex documentation", which is an integral part of this Operating Instructions. The installation regulations, connection values and Safety Instructions listed in this Ex document must be observed. The documentation number of the related Safety Instructions is also indicated.
- If using devices for applications with safety integrity level, the separate manual on functional safety must be observed thoroughly (→ see CD-ROM).

## 1.4 Return

Follow the instructions on returning the device as outlined in the Operating Instructions on the CD-ROM provided.

# 1.5 Safety icons

| Symbol  | Meaning  |
|---|--|
|  | <b>Warning!</b><br>A warning highlights actions or procedures which, if not performed correctly, will lead to personal injury, a safety hazard or destruction of the device.       |
|  | <b>Caution!</b><br>Caution highlights actions or procedures which, if not performed correctly, may lead to personal injury or incorrect functioning of the device.                 |
|  | <b>Note!</b><br>A note highlights actions or procedures which, if not performed correctly, may indirectly affect operation or may lead to an device response which is not planned. |

## 2 Mounting

### 2.1 Incoming acceptance, transport, storage

#### 2.1.1 Incoming acceptance

Check the packing and contents for any signs of damage. Check the shipment, make sure nothing is missing and that the scope of supply matches your order.

#### 2.1.2 Transport



Caution!

Follow the safety instructions and transport conditions for device of more than 18 kg. Do not lift the measuring device by its probe rod in order to transport it.

#### 2.1.3 Storage

Pack the measuring device so that is protected against impacts for storage and transport. The original packing material provides the optimum protection for this. The permissible storage temperature is -40 °C to +80 °C.

## 2.2 Installation

### 2.2.1 Mounting kit

For the mounting, you will require the following tool:

- The tool for flange mounting
- 4 mm (0.1") Allen wrench for turning the housing

### 2.2.2 Mounting rope probes




#### Caution!

If there is a risk of electrostatic discharge from the product, then both process connection and rope must be earthed before the probe is lowered into the silo.

#### Insert probe

- Uncoil rope and lower it slowly and carefully into the silo.
- Do not kink the rope.
- Avoid any backlash, since this might damage the probe or the silo fittings.
- If possible, make a visual check to see that the rope has not tangled or is lysing such that it can knot when the level falls. This is particularly important if a flange was not used. Re-insert the probe is necessary.

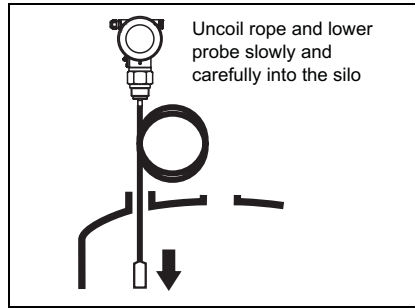

L00-FMP4xxxx-17-00-00-en-056



#### Note!


Be sure to use unpainted metal bolts to ensure good electrical contact between probe flange and process flange.

### 2.2.3 General instructions

Normally use rod or coax probes for liquids. Rope probes are used in liquids for measuring ranges > 4 m and with restricted ceiling clearance which does not allow the installation of rigid probes.

#### Mounting location

- Do not mount rod or rope probes in the filling curtain (2).
- Mount rod and rope probes away from the wall (B) at such a distance that, in the event of build-up on the wall, there is still a minimum distance of 100 mm between the probe and the build-up.
- Mount rod and rope probes as far away as possible from installed fittings. "Mapping" must be carried out during commissioning in the event of distances < 300 mm.
- Minimum distance of probe end to the container floor (C):
  - Rope probe: 150 mm
  - Rod probe: 50 mm
- When installing outdoors, it is recommended that you use a protective cover (1), see Operating Instruction on the CD-ROM.

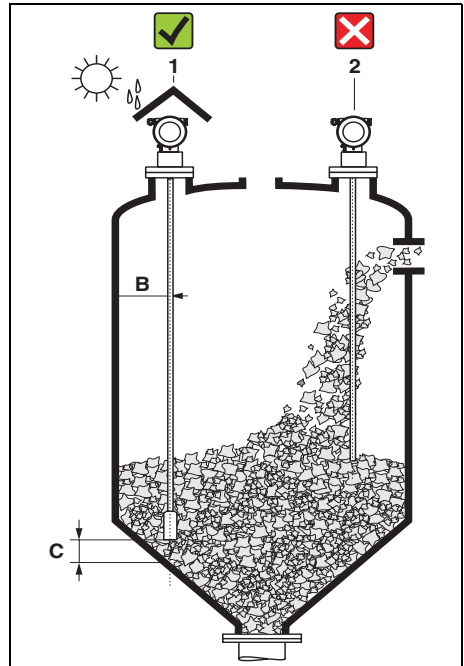


L00-FMP4xxxx-17-00-00-xx-003

### Other installations

- Select the mounting location such that the distance to internals (5) (e.g. limit switch, struts) is > 300 mm over the entire length of the probe, also during operation.
- Probe must within the measuring span not touch any internals during operation.  
If necessary: when using rope probes the probe end (4) may be fixed to ensure that (see Operating Instruction on the CD-ROM)!

### Optimization options

- Interference echo suppression:  
Measurement can be optimised by electronically tuning out interference echoes.

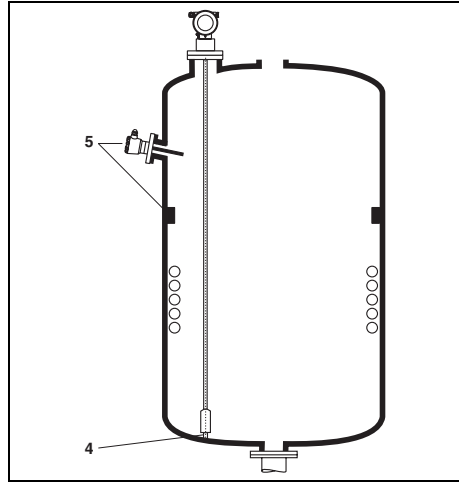

L00-FMP4xxxx-17-00-00-xx-037

### Minimum distance B of the probe to the container wall:

The wall clearance can be chosen as desired as long as the probe does not touch the tank wall.



#### Note!

- There should be no metallic parts or persons moving when installation is made in plastic tanks, also on the outside of the tank at a distance of 300 mm to the probe.
- There should no bridges to the wall created by build up or highly viscous media.



## Type of probe installation


- When installing in plastic tanks, the nozzle must have at least DN50 (2"). The appropriate flange must be used as the process connection.
- For nozzles up to 450 mm high, select the length of the centering rod appropriate for the nozzle height when using rope probes.
- Use spring washers (1) (see Figure below)



### Note!

It is recommended to retighten the flange bolts periodically, depending on process temperature and pressure. Recommended torque: 60 to 100 Nm.

- After mounting, the housing can be turned 350° in order to simplify access to the display and the terminal compartment.

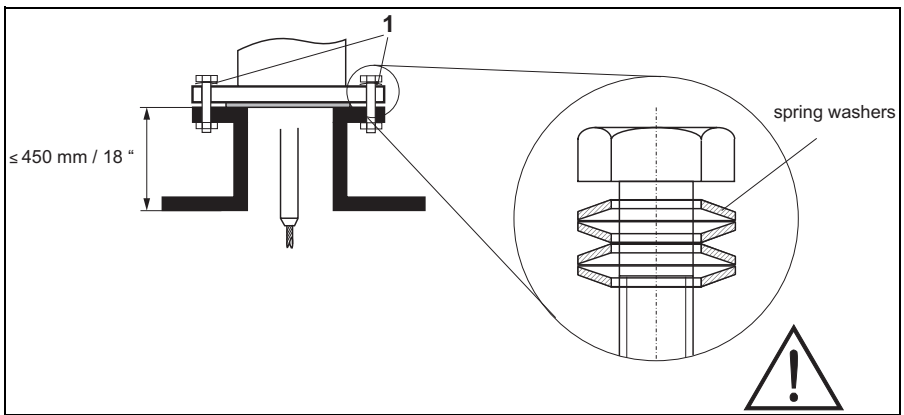

L00-FMP41 Cxx-17-00-00-en-005




### Note!

The PTFE plating of the FMP41C is used for sealing to the process. Usually no other sealing is necessary.

The coupling nut must be tightened using a torque of 5 up to a maximum of 10 Nm when installing the FMP41C in the universal adapter ("Welding boss for adapter 43 mm", see Operating Instruction on the CD-ROM).

## Supporting probes against warping


- For WHG approval:  
For probe lengths  $\geq 3$  m a support is required (see figure).

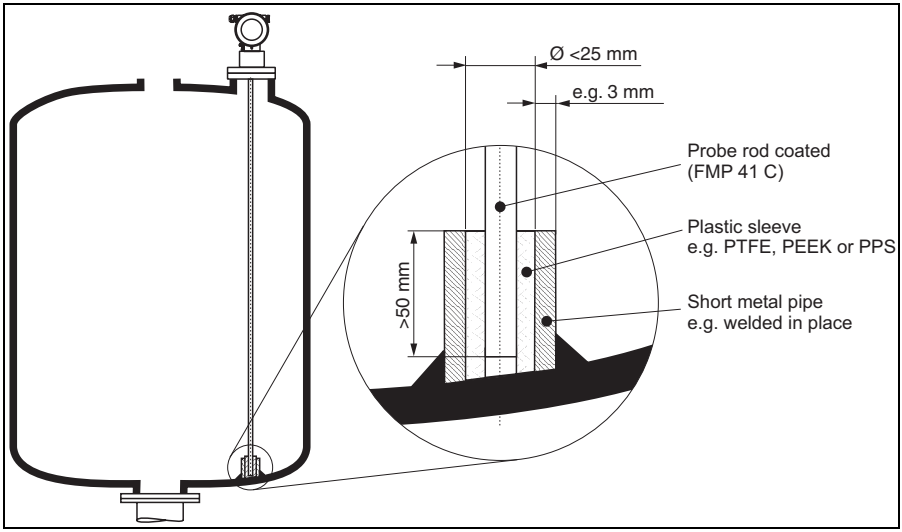

L00-FMP4xxxx-17-00-00-en-065

## 2.2.4 Notes on special installation situations


- For mechanical reasons, the probe should be installed as vertically as possible.
- With inclined installations the probe length has to be adjusted in dependence to the installation angle.
  - up to 1 m = 30°
  - up to 2 m = 10°
  - up to 4 m = 5°

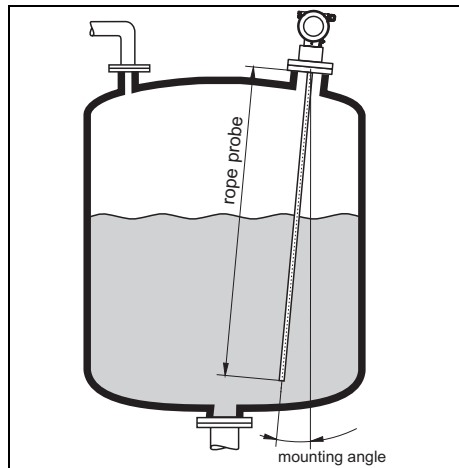

L00-FMP4xxxx-17-00-00-en-048

## Installation in plastic containers

Please note that the "guided lever radar" measurement principle requires a metallic surface at the process connection! When installing rod or robe probes in plastic silos, whose silo cover is also made of plastic or silos with wood cover, the probes must either be mounted in a  $\geq \text{DN50}$  (2") metallic flange, or a metal sheet with diameter of  $\geq 200$  mm must be mounted under the screw-in piece

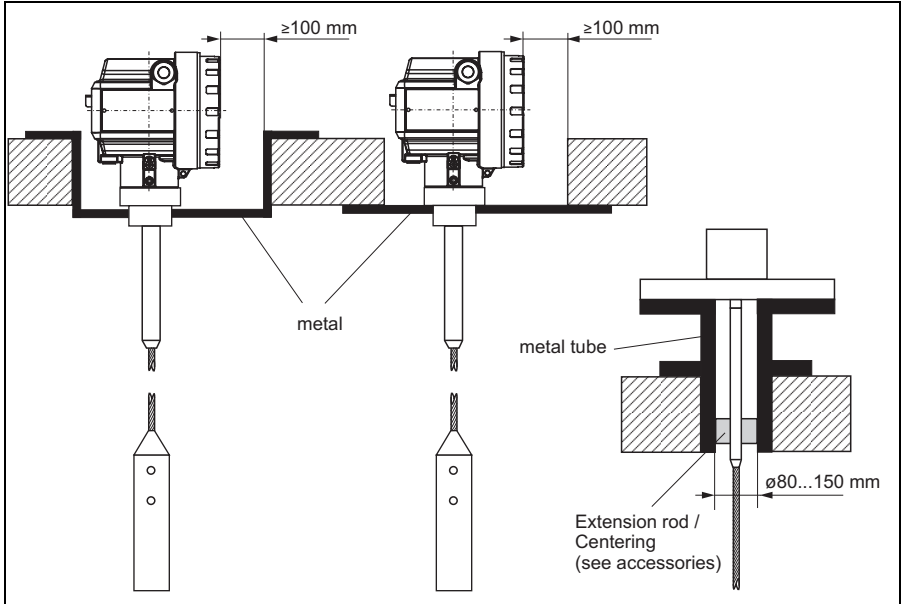


L00-FMP4xxxx-17-00-00-en-008

### 2.2.5 Special instructions

When installing in stirring tanks, observe lateral load of probes. Possibly check whether a non-contact process, ultrasound or radar would not be better suited, above all if the stirrer generates large mechanical loads on the probe

#### Installation in horizontal cylindrical and standing tanks


- Use a rod probe for measuring ranges up to 4 m. For anything over this or if there is too free cover space use a rope probe
- Any distance from wall, as long as occasional contact is prevented.

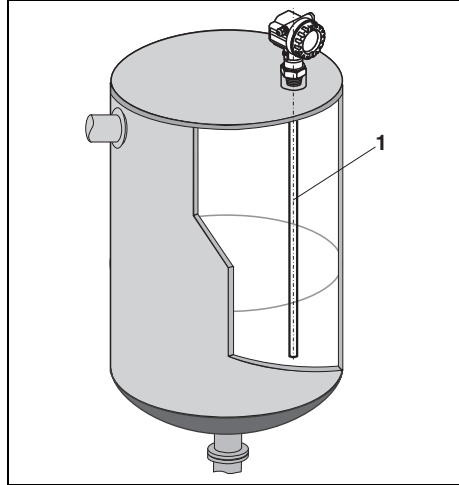

L00-FMP4xxxx-17-00-00-yy-049

#### Installation in stilling well or bypass

- Rod and rope probes can also be installed in pipes (stilling well, bypass).
- When installing in metal pipes up to DN150 (6"), the measuring sensitivity of the device increases such that liquids as of DC 1.4 can be measured.
- If a rod probe is used the probe length must be 100 mm longer than the lower disposal.
- Welded joints that protrude up to approx. 5 mm (0.2") inwards do not influence measurement.

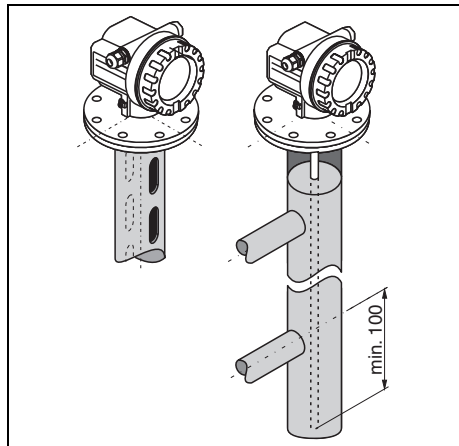


L00-FMP4xxxx-17-00-00-yy-023

### 2.2.6 Turn housing

After mounting, the housing can be turned 350° in order to simplify access to the display and the terminal compartment. Proceed as follows to turn the housing to the required position:

- Undo the fixing screws (1)
- Turn the housing (2) in the required direction
- Tighten up the fixing screws (1)

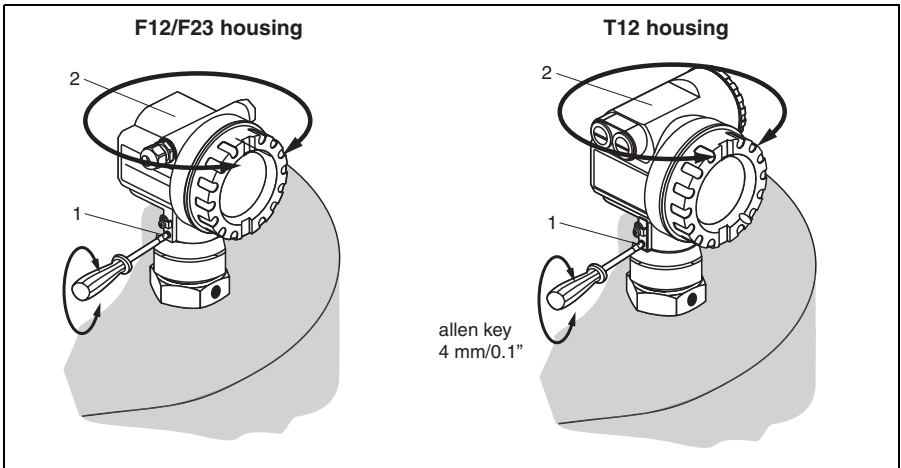


100-FMP4xxxx-17-00-00-en-028


## 2.3 Post-installation check

After the measuring device has been installed, perform the following checks:

- Is the measuring device damaged (visual check) ?
- Does the measuring device correspond to the measuring point specifications such as process temperature/pressure, ambient temperature, measuring range, etc.?
- Are the measuring point number and labeling correct (visual check) ?
- Is the measuring device adequately protected against rain and direct sunlight (see Chapter "Accessories" in the Operating Instructions on the CD-ROM) ?

### 3 Wiring


 **Warning!**  
When using the measuring device in hazardous areas, installation must comply with the corresponding national standards and regulations and the Safety Instructions or Installation or Control Drawings.

 **Caution!**  
Before connection please note the following:

- The power supply must be identical to the data on the nameplate.
- Switch off power supply before connecting up the device.
- Use screened, twisted wire pair (see Operating Instructions on the enclosed CD-ROM).

#### 3.1 Wiring in F12/F23 housing


1. Unscrew housing cover (1).
2. Remove any display (2) if fitted.
3. Remove cover plate from terminal compartment (3).
4. Pull out terminal module (4) slightly using "pulling loop" (only 2-wire).
5. Insert cable (5) through gland (6).
6. Make connection (see terminal assignment).
7. Re-insert terminal module (4).
8. Tighten cable gland (6).  
Max. torque 10 to 12 Nm!
9. Tighten screws on cover plate (3).
10. Insert display (2) if fitted.
11. Screw on housing cover (1).
12. Switch on power supply.

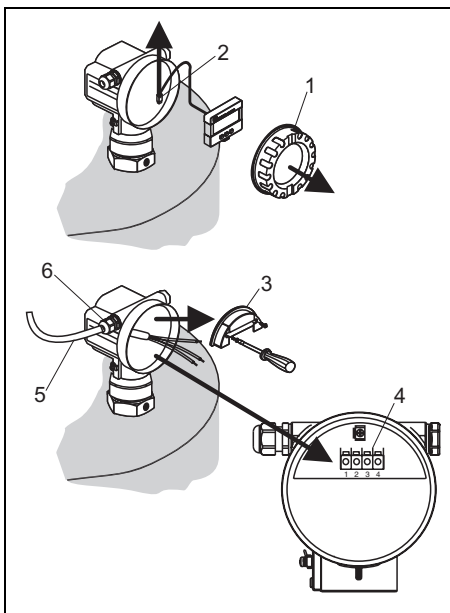

L00-FMP40xxx-04-00-00-xx-001

### 3.2 Wiring in T12 housing


1. Unscrew housing cover (1).
2. Insert cable (2) through gland (3).
3. Connect cable screen to the grounding terminal (4) within the terminal compartment.
4. Make connection (see terminal assignment).
5. Tighten cable gland (6).
6. Max. torque 10 to 12 Nm!
7. Screw on housing cover (1).
8. Switch on power supply.

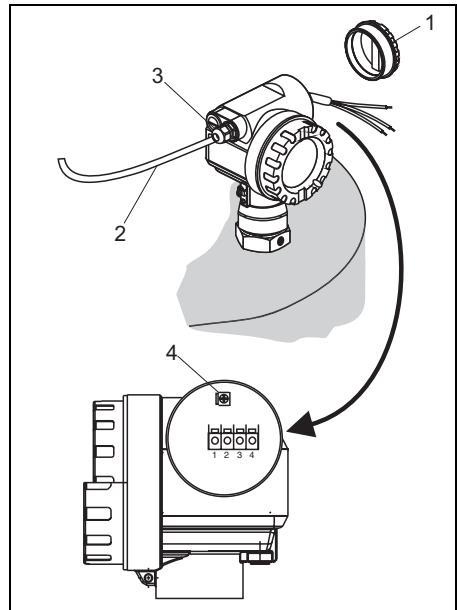

L00-FMP40xxx-04-00-00-xx-002


### 3.3 Wiring with FOUNDATION Fieldbus connector

1. Insert plug (2) into bushing (3).
2. Screw firmly.
3. Ground the device according to the desired safety concept.

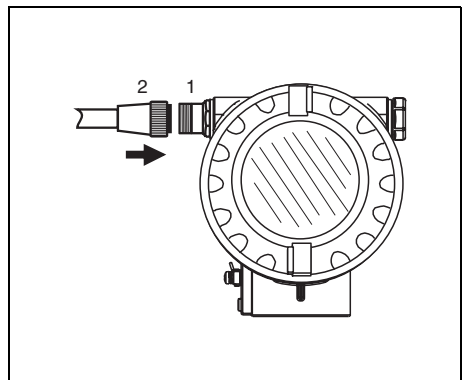

L00-FMP40xxx-04-00-00-xx-004

### 3.4 Terminal assignment

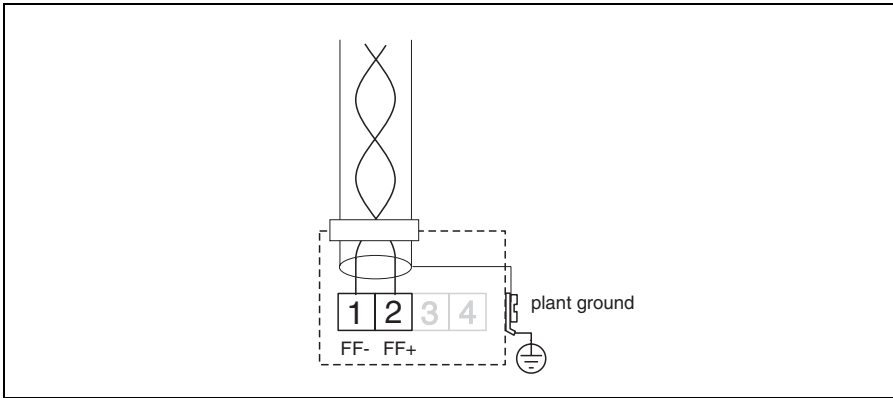

L00-FMP4xxxx-04-00-00-en-004

### 3.5 Cable specification FOUNDATION Fieldbus

Twisted, shielded pairs must be used. The cable specifications can be taken from the FF specification or IEC 61158-2. The following have been found suitable:

- Siemens 6XV1 830-5BH10
- Kerpen CEL-PE/OSCR/PVC/FRLA FB-02YS(ST)YFL
- Belden 3076F

### 3.6 Connecting the measuring unit

#### Ground connection

It is necessary to make a good ground connection to the ground terminal on the outside of the housing, in order to achieve EMC security.

#### Terminals

For wire cross-sections of 0.5 to 2.5 mm<sup>2</sup>

#### Cable entry

- Cable gland: M20x1.5
- Cable entry: G½ or ½NPT
- FOUNDATION Fieldbus 7/8" plug



## Supply voltage

The following values are the voltages across the terminals directly at the device:

| Type     | Terminal voltage |
|----------|------------------|
| Standard | 9 V to 32 V      |

|                  |                           |
|------------------|---------------------------|
| Supply voltage   | 9 V to 32 V <sup>1)</sup> |
| Lift-off voltage | 9 V                       |

- 1) There may be additional restrictions for devices with an explosion protection certificate. Refer to the notes in the appropriate Safety Instructions (XA).

## Current consumption

|                       |           |
|-----------------------|-----------|
| Nominal current       | 15 mA     |
| Starting current      | ≤ 15 mA   |
| Error current         | 0 mA      |
| FISCO/FNICO conformal | Compliant |
| Polarity sensitive    | No        |

## Overvoltage protection

If the measuring device is used for the level measurement in flammable liquids which requires the use of an overvoltage protection according to EN/IEC 60079-14 or EN/IEC 60060-1 (10 kA, Puls 8/20 µs) it has to be ensured that

- the measuring device with integrated overvoltage protection with gas discharge tubes within the T12-enclosure is used, refer to "Ordering structure" in the Operating Instructions on CD-ROM
- or**
- this protection is achieved by the use of other appropriate measures (external protection devices e.g. HAW562Z).

### 3.7 Screening/potential matching


- You achieve optimum screening against disturbances if the screening is connected on both sides (in the cabinet and on the device). If you have to reckon with potential equalisation currents in the plant, only earth screening on one side, preferably at the transmitter.
- When using in hazardous areas, you must observe the applicable regulations and the separate Ex documentation.

### 3.8 Degree of protection

- with closed housing tested according to:
  - IP68, NEMA6P (24 h at 1.83 m under water surface)
  - IP66, NEMA4X
- with open housing: IP20, NEMA1 (also ingress protection of the display)

### 3.9 Post-connection check

After wiring the measuring device, perform the following checks:

- Is the terminal allocation correct (→  16)?
- Is the cable gland tight?
- Is the Foundation Fieldbus connector screwed tight?
- Is the housing cover screwed tight?
- If auxiliary power is available:
  - Is the device ready for operation and is the liquid crystal display visible?

## 4 Operation

### 4.1 General structure of the operating menu

The operating menu is made up of two levels:

- **Function groups (00, 01, 03, ..., 0C, 0D):**

The individual operating options of the device are split up roughly into different function groups. The function groups that are available include, e.g.: **"basic setup"**, **"safety settings"**, **"output"**, **"display"**, etc.

- **Functions (001, 002, 003, ..., 0D8, 0D9):**


Each function group consists of one or more functions. The functions perform the actual operation or parameterisation of the device. Numerical values can be entered here and parameters can be selected and saved. The available functions of the **"basic setup" (00)** function group include, e.g.: **"tank properties" (002)**, **"medium property" (003)**, **"process cond." (004)**, **"empty calibr." (005)**, etc.

If, for example, the application of the device is to be changed, carry out the following procedure:

1. Select the **"basic setup" (00)** function group
2. Select the **"tank properties" (002)** function (where the existing tank shape is selected).

#### 4.1.1 Identifying the functions

For simple orientation within the function menus, for each function a position is shown on the display.

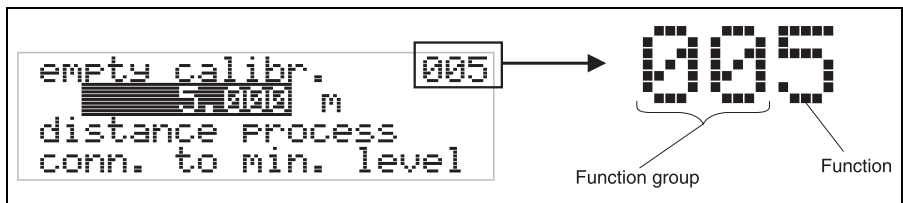

L00-FMRxxxxx-07-00-00-de-005

The first two digits identify the function group:

- **basic setup**                      00
- **safety settings**                01
- **linearisation**                  04

...

The third digit numbers the individual functions within the function group:


|                      |           |   |                            |            |
|----------------------|-----------|---|----------------------------|------------|
| ■ <b>basic setup</b> | <b>00</b> | → | ■ <b>tank properties</b>   | <b>002</b> |
|                      |           |   | ■ <b>medium properties</b> | <b>003</b> |
|                      |           |   | ■ <b>process cond.</b>     | <b>004</b> |
|                      |           |   | ...                        |            |

Here after the position is always given in brackets (e.g. "**tank properties**" (002)) after the described function.

## 4.2 Display and operating elements

### 4.2.1 Liquid crystal display (LCD)


Four lines with 20 characters each. Display contrast adjustable through key combination.

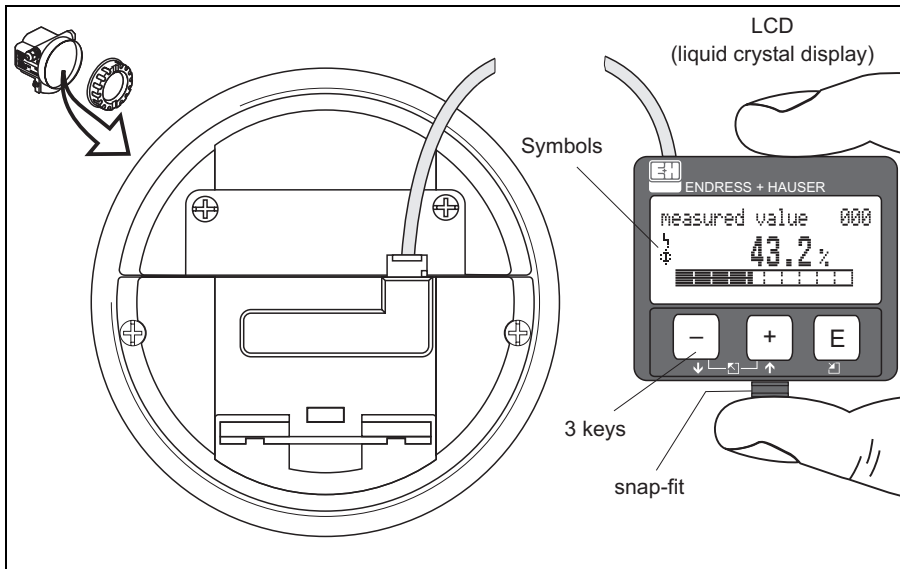

L00-FMxxxxxx-07-00-00-en-001

The VU331 LCD display can be removed to ease operation by simply pressing the snap-fit (see graphic above). It is connected to the device by means of a 500 mm cable.

4.2.2 Display

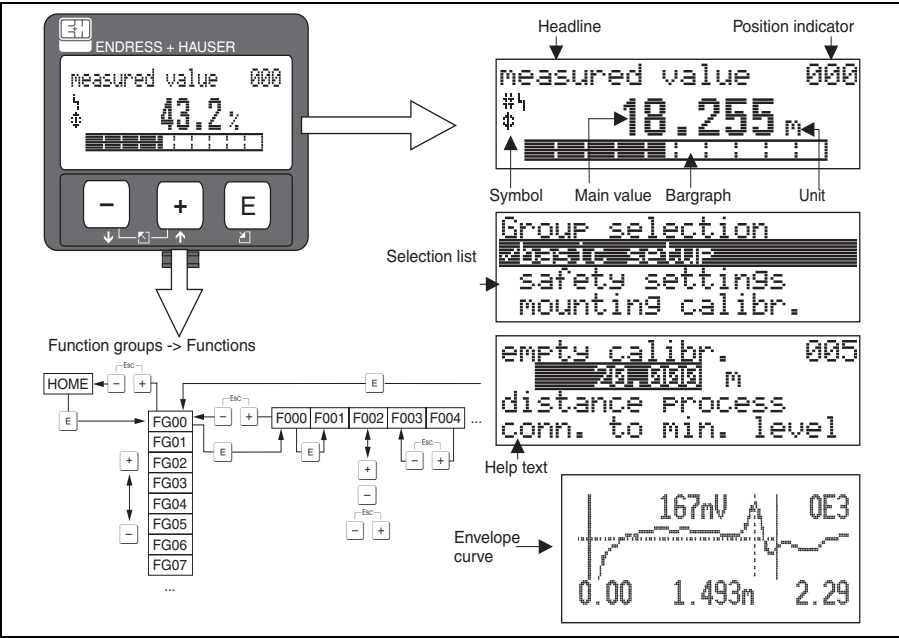

100-FMRxxxx-07-00-00-en-007

4.2.3 Display symbols








 

 

 


The following table describes the symbols that appear on the liquid crystal display:

| Symbol | Meaning   |
|--------|---|
|        | <b>ALARM_SYMBOL</b><br>This alarm symbol appears when the device is in an alarm state. If the symbol flashes, this indicates a warning.           |
|        | <b>LOCK_SYMBOL</b><br>This lock symbol appears when the device is locked, i.e. if no input is possible.   |
|        | <b>COM_SYMBOL</b><br>This communication symbol appears when a data transmission via e.g. HART, PROFIBUS PA or FOUNDATION Fieldbus is in progress. |
|        | <b>SIMULATION_SWITCH_ENABLE</b><br>This communication symbol appears when simulation in FOUNDATION Fieldbus is enabled via the DIP switch.        |

4.2.4 Key assignment

The operating elements are located inside the housing and are accessible for operation by opening the lid of the housing.

Function of the keys

| Key(s)   | Meaning  |
|--|--|
|  or    | Navigate upwards in the selection list.<br>Edit numeric value within a function.   |
|  or    | Navigate downwards in the selection list.<br>Edit numeric value within a function.   |
|  or    | Navigate to the left within a function group.  |
|   | Navigate to the right within a function group, confirmation.   |
|  and <br>or<br> and  | Contrast settings of the LCD.  |
|  and  and   | Hardware lock / unlock<br>After a hardware lock, an operation of the device via display or communication is not possible! The hardware can only be unlocked via the display. An unlock parameter must be entered to do so. |

## 5 Commissioning


### 5.1 Function check

Make sure that all final checks have been completed before you start up your measuring point:


- Checklist "Post-installation check", → 13.
- Checklist "Post-connection check", → 18.

### 5.2 Switching on the measuring device

When the device is switched on for the first time, the following messages appear in a sequence of 5 s on the display: software version, communication protocol and language selection.

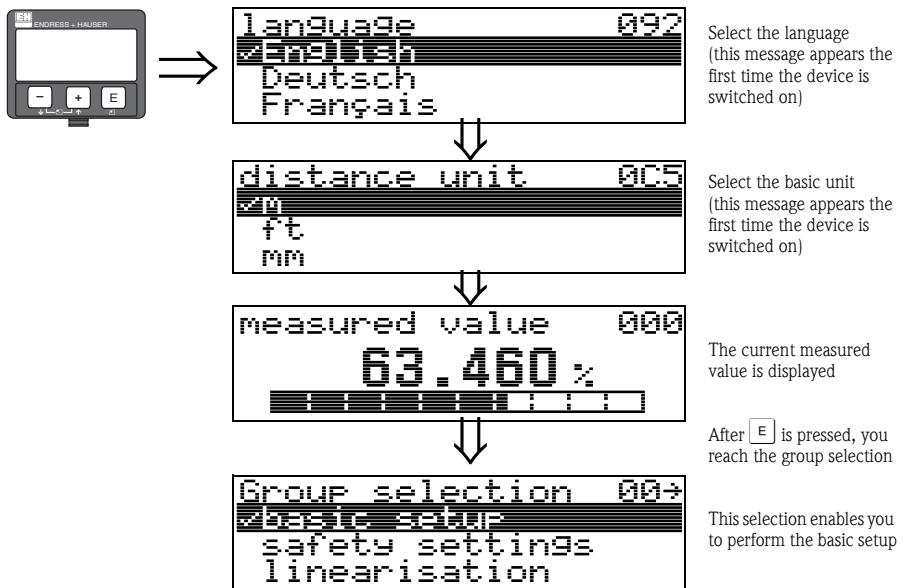

### 5.3 Overview Basic Setup

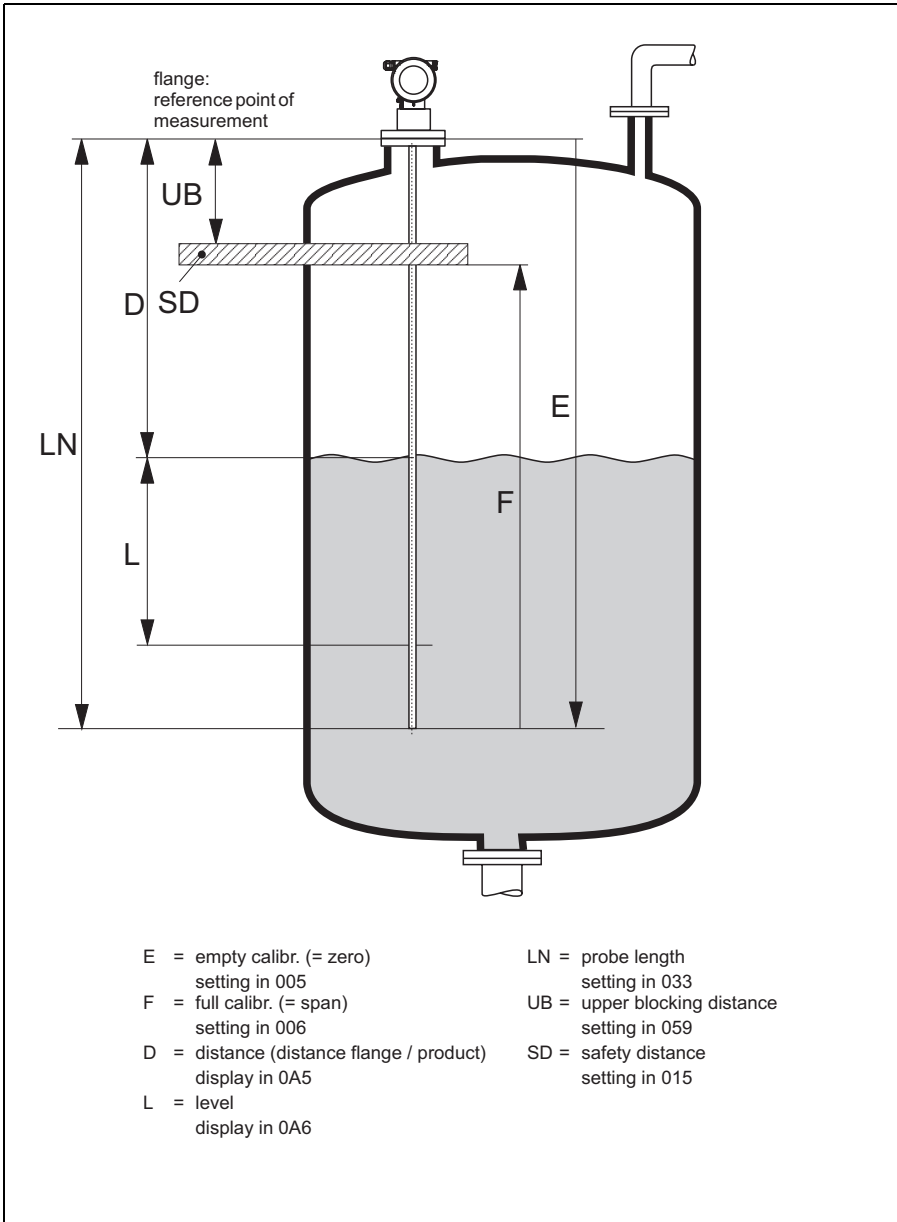

100-FMP4xxxx-19-00-00-en-039





### Caution!

The basic setup is sufficient for successful commissioning in most applications.

The Levelflex is initially adjusted at the factory to the probe length ordered, so that in most cases only the application parameters, that automatically adapt the device to the measuring conditions, need to be entered. For digital outputs and the display module, the factory adjustment for zero point "E" and span "F" is 0 % and 100 %.

A linearization function with max. 32 points, that is based on a manually or semi-automatically input table, can be activated on-site or via remote operation. This function enables, for example, the conversion of the level into units of volume or weight



### Note!

The Levelflex M allows to check for broken probe. On delivery, this function is switched off, because otherwise shortening of the probe would be mistaken for a broken probe. In order to activate this function, perform the following steps:

1. With the probe uncovered, perform a mapping ("**range of mapping**" (052) and "**start mapping**" (053)).
2. Activate the "**broken probe det**" (019) function in the "**safety settings**" (01) function group.

Complex measuring operations necessitate additional functions that the user can use to customise the Levelflex as necessary to suit his specific requirements. The functions available to do this are described in detail in the BA00245F/00/EN.

Comply with the following instructions when configuring the functions in the "**basic setup**" (00):

- Select the functions as described, → 19 .
- Certain functions (e.g. starting an interference echo mapping (053)) prompt you to confirm your data entries. Press  or  to select "**YES**" and press  to confirm. The function is now started.
- If you do not press a key during a configurable time period (→ function group "**display** (09)") an automatic return is made to the home position (measured value display).



### Note!

- The device continues to measure while data entry is in progress, i.e. the current measured values are output via the signal outputs in the normal way.
- If the envelope curve mode is active on the display, the measured values are updated in a slower cycle time. Thus, it is advisable to leave the envelope curve mode after the measuring point has been optimised.
- If the power supply fails, all preset and parameterised values remain safely stored in the EEPROM.
- All functions are described in detail, as is the overview of the operating menu itself, in the manual "**BA00245F - Description of Instrument Functions**" on the enclosed CD-ROM.


## 5.4 Basic Setup with the device display

### 5.4.1 Function "measured value" (000)




This function displays the current measured value in the selected unit (see "**customer unit**" (042) function). The number of digits after decimal point can be selected in the "**no.of decimals**" (095) function.

### 5.4.2 Function group "basic setup" (00)

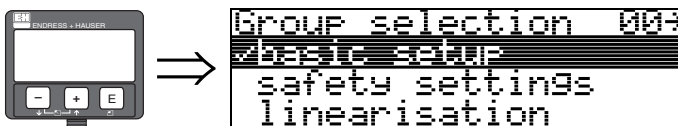

### 5.4.3 Function "tank properties" (002)

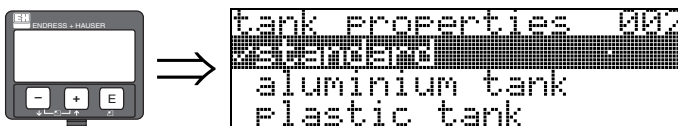

This function is used to select the tank properties.

#### Selection:

- **standard**
- aluminium tank
- plastic tank
- bypass / pipe
- Coax probe
- concrete wall

#### **standard**

The "**standard**" option is recommended for normal containers for rod and rope probes.

#### **aluminium tank**

The "**aluminium tank**" option is designed especially for high aluminium silos that cause an increased level of noise when empty. This option is only useful for probes longer than 4 m. For short probes (< 4 m) select the "**standard**" option!



Note!

If "**aluminium tank**" is selected, the device calibrates of its own accord when first filled, depending on the medium's properties. Slope errors can, therefore, occur when beginning the first filling procedure.

### plastic tank

Select the "**plastic tank**" option when installing probes in wood or plastic containers **without** metallic surfaces at the process connection (see installation in plastic containers). When using a metallic surface at the process connection, the "**standard**" option is sufficient!



Note!

In principle the employment of a metallic surface area should be preferred at the process connection!

### bypass / pipe

The "**bypass / pipe**" option is designed especially for the installation of probes in a bypass or a stilling well. If this option is selected, the upper blocking distance is preset to 100 mm.


### coax probe

Select the "**coax probe**" option when using a coaxial probe. When this setting is made, the evaluation is adapted to the high sensitivity of the coax probe. This option should, therefore, **not** be selected when using rope or rod probes.

### concrete wall

The "**concrete wall**" option takes into account the signal-damping property of concrete walls when mounting with < 1 m distance to the wall.

## 5.4.4 Function "medium property" (003)

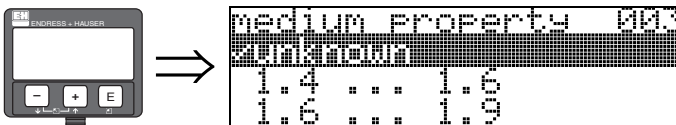

This function is used to select the dielectric constant.

Selection

- **unknown**
- 1.4 ... 1.6 (use coaxial or Rod probe with installation in metallic pipes ≤ DN150)
- 1.6 ... 1.9
- 1.9 ... 2.5
- 2.5 ... 4.0
- 4.0 ... 7.0
- > 7.0

| Media group | DC (Er)    | Typical bulk solids  | Typical liquids  | Measuring range               |                               |
|-------------|------------|--|--|-------------------------------|-------------------------------|
|             |            |  |  | bare metallic probes          | PA-coated rope probes         |
| 1           | 1.4 to 1.6 |  | – Condensed gases, e.g. N <sub>2</sub> , CO <sub>2</sub>                     | 4 m (157"), only coax probe   | —                             |
| 2           | 1.6 to 1.9 | – Plastic granulate<br>– White lime, special cement<br>– Sugar | – Liquefied gas, e.g. Propane<br>– Solvent<br>– Frigen / Freon<br>– Palm oil | 25 m to 30 m (984" to 1181")  | 12,5 m to 15 m (492" to 590") |
| 3           | 1.9 to 2.5 | – Portland cement, plaster                                     | – Mineral oils, fuels  | 30 m to 35 m (1181" to 1378") | —                             |
|             |            | – Flour  | —  | —                             | 15 m to 25 m (590" to 984")   |
| 4           | 2.5 to 4   | – Grain, seeds   | —  | —                             | 25 m to 30 m (984" to 1181")  |
|             |            | – Ground stones<br>– Sand                                      | – Benzene, styrene, toluene<br>– Furan<br>– Naphthalene                      | 35 m (1378")                  | 25 m to 30 m (984" to 1181")  |
| 5           | 4...7      | – Naturally moist (ground) stones, ores<br>– Sal               | – Chlorobenzene, chloroform<br>– Cellulose spray<br>– Isocyanate, aniline    | 35 m (1378")                  | 35 m (1378")                  |
| 6           | > 7        | – Metallic powder<br>– Carbon black<br>– Coa                   | – Aqueous solutions<br>– Alcohols<br>– Ammonia                               | 35 m (1378")                  | 35 m (1378")                  |

The lower group applies to very loose or loosened bulk solids. Reduction of the max. possible measuring range by means of:

- Extremely loose surfaces of bulk solids, e.g. bulk solids with low piled density when filled pneumatically.
- Build-up, primarily of moist products.



Note!

Due to the high diffusion rate of ammonia it is recommended to use the FMP45 with gas-tight bushing for measurements in this medium.

5.4.5 Function "process propert." (004)




Use this function to adapt the device reaction to the filling speed in the tank. The setting impacts on an intelligent filter.

Selection:

- **standard**
- fast change
- slow change
- test:no filter

| Selection:          | standard   | fast change   | slow change   | test:no filter  |
|---------------------|--|---|---|---|
| Application:        | For all normal applications, bulk solids and fluids at low to medium filling speed and sufficiently large tanks. | Small tanks, primarily with fluids, at high filling speeds. | Applications with strong surface movement, e.g. caused by stirrer, primarily large tanks with slow to medium filling speed. | Shortest reaction time: <ul style="list-style-type: none"><li>■ For test purposes</li><li>■ Measurement in small tanks at high filling speeds, if "rapid change" setting is too slow.</li></ul> |
| 2-wire electronics: | Dead time: 4 s<br>Rise time: 18 s  | Dead time: 2 s<br>Rise time: 5 s                            | Dead time: 6 s<br>Rise time: 40 s   | Dead time: 1 s<br>Rise time: 0 s  |

5.4.6 Function "end of probe" (030)

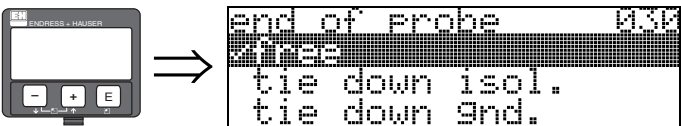


Use this function to select the polarity of the probe end signal. If the probe end is uncovered or in an insulated attachment, there is a negative probe end signal. The signal from the probe end is positive if the attachment is grounded.

Selection:

- **free**
- tie down isol.
- tie down gnd.<sup>1)</sup>

1) These settings lead to a false output signal for empty tanks.

5.4.7 Function "probe length" (031)

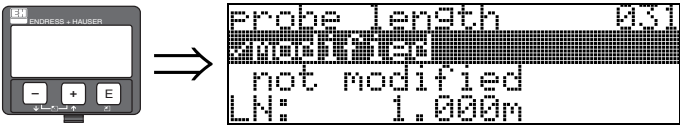

Use this function to select whether the probe length was changed after factory calibration. Only then is it necessary to enter or correct the probe length.


Selection:

- not modified
- modified



Note!  
If "modified" was selected in the "probe length" (031) " function, the probe length is defined in the next step.

5.4.8 Function "probe" (032)

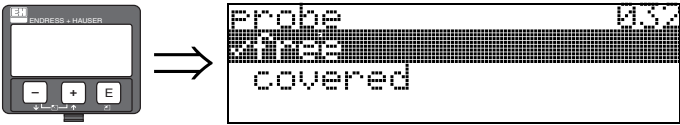


Use this function to select whether the probe is at the time of the commissioning uncovered or covered. If the probe is uncovered, the Levelflex can determine the probe length automatically "determine length" (034) function. If the probe is covered, a correct entry is required in the "probe length" (033) function.

Selection:


- free
- covered

5.4.9 Function "probe length" (033)

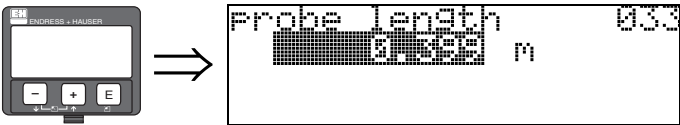

Use this function, the probe length can be entered manually.

### 5.4.10 Function "determine length" (034)

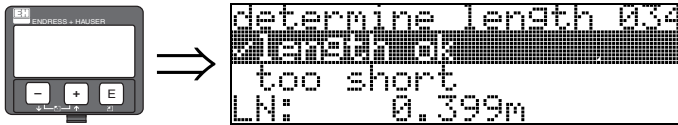

Use this function, the probe length can be determined automatically.


Due to the mounting conditions, the automatically determined probe length may be larger than the actual probe (typically 20 to 30 mm longer). This has no influence on the measuring accuracy. When entering the empty value for a linearisation, please use the "empty calibration" instead of the automatically determined probe length

#### Selection:


- Length ok
- too short
- too long

After selection "length too short" or "length too long", the calculation of the new value need approx. 10 s.

### 5.4.11 Function "empty calibr." (005)

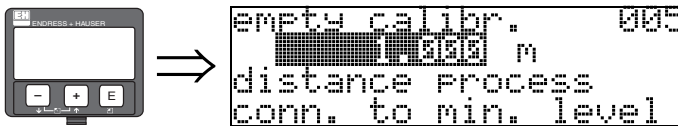


This function is used to enter the distance from the flange (reference point of the measurement) to the minimum level (= zero).

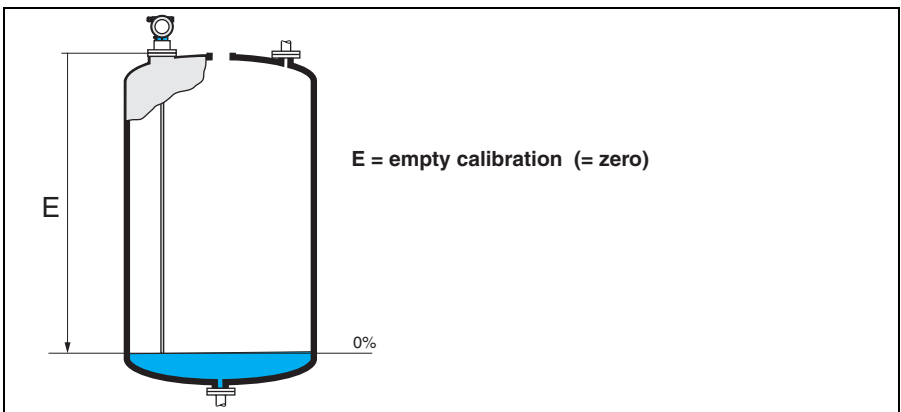


L00-FMP4xxxx-14-00-06-en-008

### 5.4.12 Function "full calibr." (006)

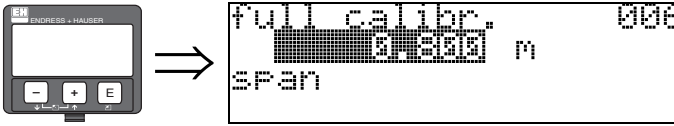

This function is used to enter the distance from the minimum level to the maximum level (= span).

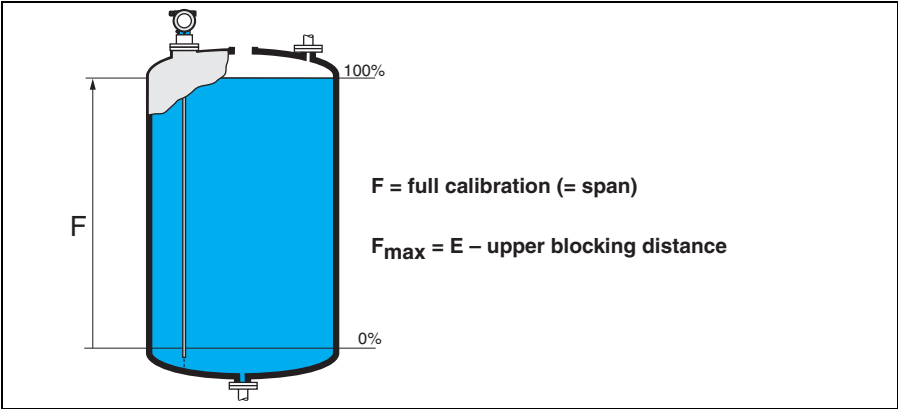


L00-FMP4xxxx-14-00-06-en-009



Note!

The usable measuring range lies between the upper blocking distance and the probe end. The values for empty distance "E" and span "F" can be set independently of this.

### 5.4.13 Function "dist./meas.value" (008)

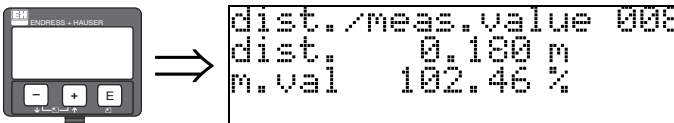


The **distance** measured from the reference point to the product surface and the **meas. value** calculated with the aid of the empty adjustment are displayed. Check whether the values correspond to the actual meas. value or the actual distance. The following cases can occur:

- Distance correct – meas. value correct → continue with the next function  
"check distance" (051)
- Distance correct – meas. value incorrect → Check "empty calibr." (005)
- Distance incorrect – meas. value incorrect → continue with the next function  
"check distance" (051).




### 5.4.14 Function "check distance" (051)

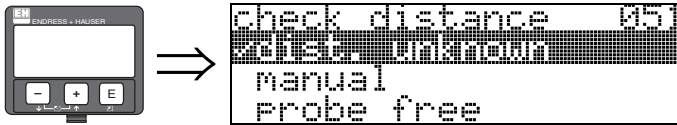

This function triggers the mapping of interference echoes. To do so, the measured distance must be compared with the actual distance to the product surface. The following options are available for selection:

#### Selection:

- distance = ok
- dist. too small
- dist. too big
- dist. unknown
- **manual**
- probe free

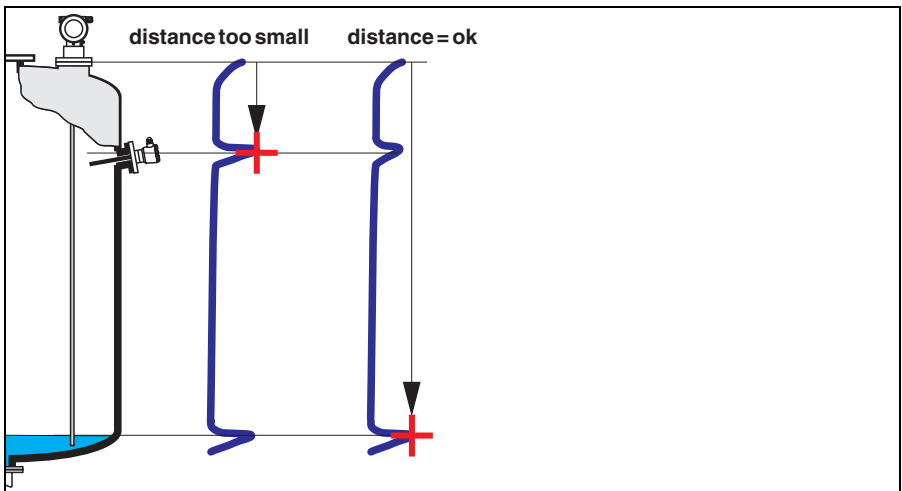

L00-FMP4xxxx-14-00-06-en-010

**distance = ok**

Use this function at part-covered probe. Choosing function **"manual"** or **"probe free"** at free probe.

- mapping is carried out up to the currently measured echo
- The range to be suppressed is suggested in the **"range of mapping" (052)** function

Anyway, it is wise to carry out a mapping even in this case.



Note!

At free probe, the mapping should be confirmed with the choice **"probe free"**.

**dist. too small**

- At the moment, an interference is being evaluated
- Therefore, a mapping is carried out including the presently measured echoes
- The range to be suppressed is suggested in the **"range of mapping" (052)** function

**dist. too big**

- This error cannot be remedied by interference echo mapping
- Check the application parameters **(002)**, **(003)**, **(004)** and **"empty calibr." (005)**.

**dist.unknown**

If the actual distance is not known, no mapping can be carried out.

**manual**

A mapping is also possible by manual entry of the range to be suppressed. This entry is made in the **"range of mapping" (052)** function.



Caution!

The range of mapping must end 0.3 m (20") before the echo of the actual level. In case of empty vessel it is possible to make a map over the whole probe length.


**probe free**

If the probe is uncovered, mapping is carried out along the whole probe length.



Caution!

Only begin mapping in this function if the probe is safely uncovered. Otherwise, the device will not make correct measurements!

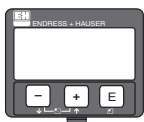**5.4.15 Function "range of mapping" (052)**

```
range of mapping 052
  0.000 m
input of
mapping range
```

This function displays the suggested range of mapping. The reference point is always the reference point of the measurement (→ 24). This value can be edited by the operator. For manual mapping, the default value is 0.3 m

### 5.4.16 Function "start mapping" (053)




This function is used to start the interference echo mapping up to the distance given in **"range of mapping" (052)**.

#### Selection:


- **off**: no mapping is carried out
- **on**: mapping is started

### 5.4.17 Function "dist./meas.value" (008)

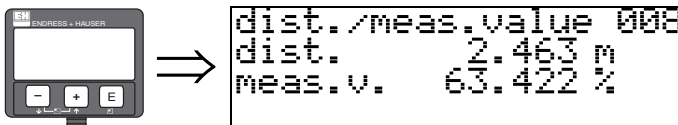

The distance measured from the reference point to the product surface and the meas. value calculated with the aid of the empty alignment are displayed again. Check whether the values correspond to the actual meas. value or the actual distance. The following cases can occur:

- Distance correct – meas. value correct → basic setup completed
- Distance incorrect – meas. value incorrect → a further interference echo mapping must be carried out **"check distance" (051)**.
- Distance correct – meas. value incorrect → check **"empty calibr." (005)**

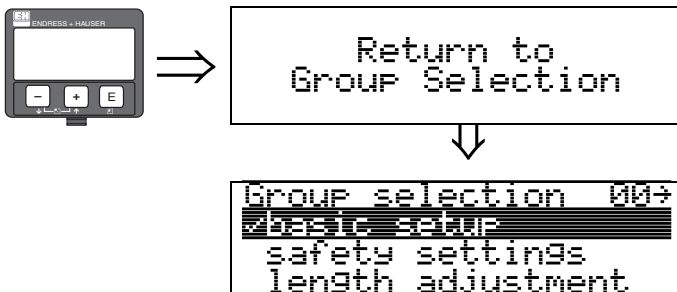

After 3 s, the following message appears




#### Note!

After the basic setup, an evaluation of the measurement with the aid of the envelope curve (**"envelope curve" (0E)** function group) is recommended (→ 38).

### 5.5 Blocking distance

#### Function "upper block. dist" (059)

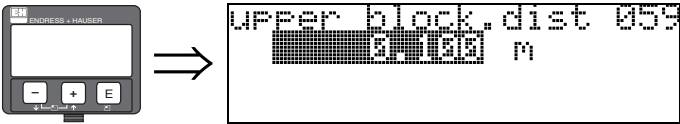


For rod probes and for rope probes with lengths of up to 8 m, the upper blocking distance is preset to 0.2 m on delivery. For rope probes with lengths of more than 8 m, the upper blocking distance is preset to 2.5 % of the probe length. For media with  $DC > 7$ , the upper blocking distance for rod and rope probes can be reduced to 0.1 m, if the probe is mounted flush with the wall or in a nozzle of maximum 50 mm.

#### Blocking distance and measuring range

At the lower end of the probe there is no blocking distance but a transition region with reduced accuracy, see section "Maximum measured error", → 37.

| FMP41C     | LN [m]<br>min | LN [m]<br>max | UB [m]<br>min     |
|------------|---------------|---------------|-------------------|
| Rod probe  | 1             | 30            | 0.2 <sup>1)</sup> |
| Rope probe | 0.3           | 4             | 0.2               |

1) The indicated blocking distances are preset. At media with  $DC > 7$ , the upper blocking distance UB can be reduced to 0.1 m for rod and rope probes. The upper blocking distance UB can be entered manually.

 **Note!**  
Within the upper and lower blocking distance, a reliable measurement can not be guaranteed.

#### For stilling well applications

The upper blocking distance (UB) is preset to 100 mm when the "bypass/pipe" parameter has been selected in the **"tank properties" (002)** function.


Maximum measured error

Typical statements for reference conditions:  
DIN EN 61298-2, percentage of the span.


| Output:   | digital   | analog   |
|---|---|----------|
| sum of non-linearity, non-repeatabilityand hysteresis | measurig range:<br>– up to 10 m: ±3 mm<br>– > 10 m: ± 0.03 %<br><br><b>for PA coated rope</b><br>measuring range:<br>– up to 5 m: ±5 mm<br>– > 5 m: ± 0.1 % | ± 0.06 % |
| Offset / Zero   | ±4 mm   | ± 0.03 % |

If the reference conditions are not met, the offset/zero arising from the mounting situation may be up to ±12 mm. This additional offset/zero can be compensated for by entering a correction (function **"offset" (057)**)during commissioning.

*Differing from this , the following measuring error is present in the vicinity of the probe end:*

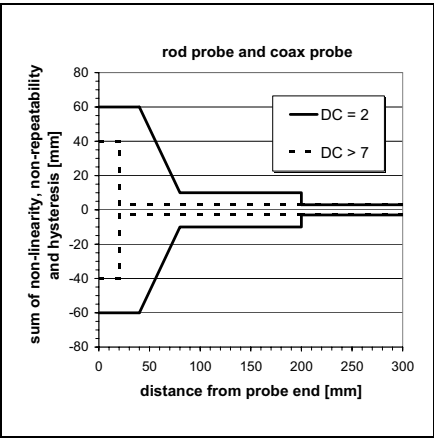

L00-FMP4xxxx-05-00-00-en-001

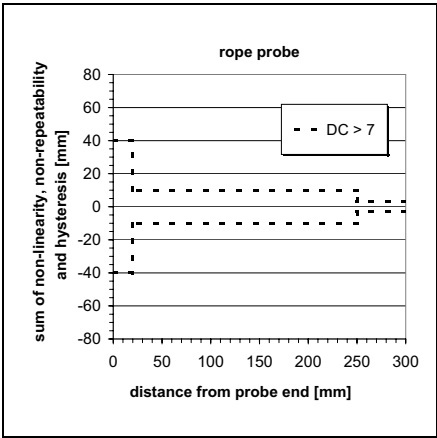


L00-FMP4xxxx-05-00-00-en-002



Note!

Please reenter the blocking distance in the function group **"extended calibr." (05)** function **"upper block dist." (059)** when installing the device in a high nozzle:  
upper blocking distance (UB) = nozzle height (H) + 50 mm.

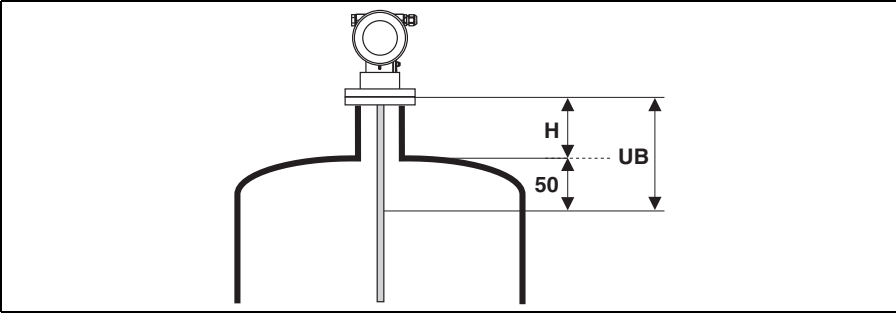

L00-FMP4xxxx-14-00-06-xx-001


## 5.6 Envelope curve with device display

After the basic setup, an evaluation of the measurement with the aid of the envelope curve "envelope curve" (0E) function group) is recommended.

### 5.6.1 Function "plot settings" (0E1)

Here you can select which information is shown on the display:

- just the envelope curve
- The envelope curve and the echo evaluation line FAC
- The envelope curve and interference echo suppression (map)

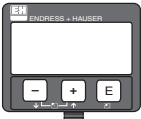

Note!

The interference echo suppression (map) are explained in BA00245F/00/EN "Description of Instrument Functions".

## 5.6.2 Function "recording curve" (0E2)

In this function, specify whether you want to display

- an individual envelope curve
- The current envelope curve, with cyclical refreshment



Note!

If the envelope curve mode is active on the display, the measured values are updated in a slower cycletime. Thus, it is advisable to leave the envelope curve mode after the measuring point has been optimised.

[www.endress.com/worldwide](http://www.endress.com/worldwide)

---

**Endress+Hauser**   
People for Process Automation

---

KA01043F/00/EN/13.10  
71120297  
CCS/FM+SGML 6.0

