BA02021F/00/EN/02.21 71510169 2021-02-01 Valid as of version 01.03.zz

Operating Instructions Liquicap M FMI52 HART

Capacitive Continuous level measurement for liquids





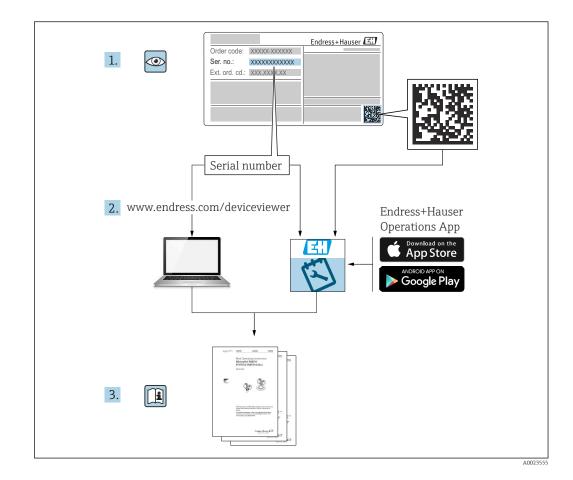


Table of contents

1	About this document	6
1.1 1.2	Document functionDocument conventions1.2.1Safety symbols1.2.2Electrical symbols1.2.3Tool symbols1.2.4Symbols for certain types of information and graphics	6 6 6 7 7
1.3 1.4	Documentation1.3.1Technical Information1.3.2Certificates1.3.3Hygienic compatibilityRegistered trademarks	, 8 8 8 9 9
	-	-
2	5	.0
2.1 2.2 2.3	Workplace safety1Operational safety12.3.1Ex-area1	10 10 10 10
2.4	Product safety 1	10
3	Incoming acceptance and product	1
		.1
3.1 3.2 3.3	Product identification 1	11 11 11
4	Mounting 1	2
4.1 4.2	Mounting requirements14.2.1Mounting the sensor14.2.2Measuring condition14.2.3Minimum probe length for nonconductive media < 1 µS/cm	12 12 13 13
4.3	4.3.1Extension heights: separate housing .14.3.2Wall bracket .14.3.3Wall mounting .14.3.4Pipe mounting .14.3.5Shortening the connecting cable .1	16 16 17 18 18
4.4	4.4.1Probe installation24.4.2Aligning the housing2	20 21 22 22
4.5		22
5		24
5 5.1	Connecting requirements 2	24 24 24

5.2	5.2.1 5.2.2 5.2.3	Connector	24 25 25 25 25 26 27 27
6	Opera	tion options 2	29
6.1	-	1	29
0.1	6.1.1	Display and operating elements at	29 29
	6.1.2	Operation via the optional display and operating module	30
	6.1.3	1 5	30 32
6.2		1 5	эд 35
6.3		5	35 35
0.5	6.3.1	, , , , ,	35
	6.3.2		36
	6.3.3	Software locking	36
6.4			36
0.1	6.4.1		36
	6.4.2		36
	6.4.3		36
6.5		5	37
	6.5.1	1	37
	6.5.2	-	37
7	Comm	nissioning 3	38
7.1		-	38
7.2	Basic se	etup without the display or operating	
			38
	7.2.1	Function switch: position 1.	20
	7.2.2	Operation Function switch: position 2. Carry	39
		out empty calibration - for empty	
			39
	7.2.3	Function switch: position 2. Carry	
		out empty calibration - for almost	
		1 5	39
	7.2.4	Function switch: position 3. Carry	
			40
	7.2.5	Function switch: position 3. Carry out full calibration - for almost full	
	F 0 (40
	7.2.6	Function switch: position 4.	11
	7 7 7	5	41
	7.2.7	Function switch: position 5.	1. 1
	7 7 0	5 5	41
	7.2.8	Function switch: position 6. Proof test - self-test	42

	7.2.9	Function switch: position 7. Reset -	
		restore factory settings	42
	7.2.10	Function switch: position 8.	
		Download or upload sensor DAT	
		(EEPROM)	42
7.3	Menu:"	Basic setup". Commissioning with	
		and operating module	43
	7.3.1	Initial commissioning	43
	7.3.2	Function: "Basic setup"	45
	7.3.3	Function: "Medium property"	46
	7.3.4	Operating mode: "Empty calibr." and	
		function - "Wet"	46
	7.3.5	Operating mode: "Full calibr." and	
		function - "Wet"	47
	7.3.6	Operating mode: "Empty calibr." and	
		function - "Dry"	47
	7.3.7	Operating mode: "Full calibration"	
		and function - "Dry" for conductive	
		and nonconductive media	48
	7.3.8	Operating mode: "Empty calibration"	
		and function - "Dry" for "Interface" or	
		"Unknown" medium properties	48
	7.3.9	Operating mode: "Full calibration"	
		and function - "Dry" for "Interface" or	
		"Unknown" medium properties	49
	7.3.10	Function: "Output damping"	49
7.4	Menu: "	Safety setting"	50
	7.4.1	Function: "Safety settings"	51
	7.4.2	Function: "Safety settings"	51
	7.4.3	Function: "Safety settings"	52
	7.4.4	Function: "Operating mode"	52
	7.4.5	Function: "Safety settings"	53
	7.4.6	Function: "Output on alarm"	53
	7.4.7	Function: "Proof test" - self-test	54
7.5		"Linearization"	55
	7.5.1	Function: "Linearization"	56
	7.5.2	Function: "Linearization"	59
7.6		'Output"	62
	7.6.1	Submenu: "Extended calibr."	62
	7.6.2	Submenu: "HART setting"	64
	7.6.3	Menu: "Simulation"	65
7.7		"Device properties"	65
	7.7.1	Submenu: "Display"	67
	7.7.2	Submenu: "Diagnosis"	67
7.0	7.7.3	Submenu: "System parameters"	69
7.8	Operati	on	70
7.9		re: operating program from Endress	70
			70 70
	7.9.1	FieldCare	
	7.9.2 7.9.3	Interface measurement	71
	1.7.0	Dry calibration for interface measurement	71
	7.9.4	Wet calibration for interface	11
	1.2.4	measurement	73
		measurement	ר י
0		action and tranklast - the -	7/
8	•	ostics and troubleshooting	74
8.1	Diagno	stic information via LEDs	74
	8.1.1	Green LED flashing	74

	Liquicap M FMI52 H	ART
	8.1.2 Red LED flashing	74
8.2	System error messages	74
	8.2.1 Error signal	74
	8.2.2 Last errors	74
	8.2.3 Types of error	74
	8.2.4 Error codes	75
8.3	Possible measuring errors	76
	8.3.1 Measured value is incorrect	76
8.4	Firmware history	77
9	Maintenance	78
9.1	External cleaning	78
9.2	Cleaning the probe	78
9.3	Seals	78
9.4	Endress+Hauser services	78
10	Repair	79
10.1	General notes	79
10.2	Spare parts	79
10.3	Repairing Ex-certified devices	79
10.4	Replacement	80
10.5	Return	80
10.6	Disposal	80
	10.6.1 Removing the measuring device	80
	10.6.2 Disposing of the measuring device	80
11	Accessories	81
11.1	Protective cover	81
11.2	Shortening set for FMI52	81
11.2	Commubox FXA195 HART	81
11.4	Surge arresters	81
	11.4.1 HAW562	81
	11.4.2 HAW569	81
11.5	Weld-in adapter	81

Technical data

12.1.3 Probe lengths for continuous

12.1.1 Capacitance values of the probe 82 12.1.2 Additional capacitance

12.2.1 Measured variable 83 12.2.2 Measuring range 83

12.3.1 Output signal

12.3.2 Signal on alarm

12.4.1 Reference operating conditions

12.4.4 Switch-on behavior

12.4.5 Measured value reaction time

12.4.6 Response time 85

12.4.2 Maximum measured error 84 12.4.3 Influence of ambient temperature . . .

measurement in conductive liquids . .

12

12.1

12.2

12.3

82

82

82

82

84

84

84

84

84

84

84

85

	12.4.7	Accuracy of factory calibration	85
	12.4.8	Resolution	86
12.5	Operati	ng conditions: Environment	86
	12.5.1	Ambient temperature range	86
	12.5.2	Climate class	86
	12.5.3	Vibration resistance	86
	12.5.4	Shock resistance	86
	12.5.5	Cleaning	87
	12.5.6	Degree of protection	87
	12.5.7	Electromagnetic compatibility	
		(EMC)	88
12.6	Operati	ng conditions: Process	88
	12.6.1	Process temperature range	88
	12.6.2	Process pressure limits	89
	12.6.3	Pressure and temperature derating	90
Index	ĸ		92

1 About this document

1.1 Document function

These Operating Instructions contain all the information that is required in various phases of the life cycle of the device: from product identification, incoming acceptance and storage, to mounting, connection, operation and commissioning through to troubleshooting, maintenance and disposal.

These instructions provide all the information required for use of the software: from the product description, installation and use to system integration, operation, diagnostics and troubleshooting to software updates and disposal.

1.2 Document conventions

1.2.1 Safety symbols

DANGER

This symbol alerts you to a dangerous situation. Failure to avoid this situation will result in serious or fatal injury.

WARNING

This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in serious or fatal injury.

A CAUTION

This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in minor or medium injury.

NOTICE

This symbol contains information on procedures and other facts which do not result in personal injury.

1.2.2 Electrical symbols

\sim

Alternating current

\sim

Direct current and alternating current

_ _ _

Direct current

Ŧ

Ground connection

A grounded terminal which, as far as the operator is concerned, is grounded via a grounding system.

Protective earth (PE)

Ground terminals that must be connected to ground prior to establishing any other connections.

The ground terminals are located on the interior and exterior of the device:

- Interior ground terminal: protective earth is connected to the mains supply.
- Exterior ground terminal: device is connected to the plant grounding system.

1.2.3 Tool symbols

96

Phillips head screwdriver

● *d* Flat blade screwdriver

Office Contract Contr

⊖ ¢ Allen key

ダ Open-ended wrench

1.2.4 Symbols for certain types of information and graphics

Permitted Procedures, processes or actions that are permitted

✓ ✓ Preferred
Procedures, processes or actions that are preferred

Forbidden Procedures, processes or actions that are forbidden

Tip Indicates additional information

Reference to documentation

Reference to page

Reference to graphic

Notice or individual step to be observed

1., 2., 3. Series of steps

Result of a step

Help in the event of a problem

Sisual inspection

Deration via operating tool

🕅 Write-protected parameter

1, 2, 3, ... Item numbers

A, B, C, ... Views

Hazardous area Indicates the hazardous area

X Safe area (non-hazardous area) Indicates the non-hazardous area

$\underline{\Lambda} \rightarrow \mathbf{I}$ Safety instructions

Observe the safety instructions contained in the associated Operating Instructions

Temperature resistance of the connection cables

Specifies the minimum value of the temperature resistance of the connection cables

• LED not lit

-Ò-

LED lit

LED flashes

1.3 Documentation

1.3.1 Technical Information

Liquicap M FMI52 TI01524F

1.3.2 Certificates

ATEX safety instructions

Liquicap M FMI52

- II 1/2 G Ex ia IIC T3...T6 Ga/Gb II 1/2 G Ex ia IIB T3...T6 Ga/Gb II 1/2 D Ex ia IIIC T90 °C Da/Db XA00327F
- II 1/2 Ex ia/db IIC T6...T3 Ga/Gb II 1/2 Ex ia/db eb IIC T6...T3 Ga/Gb II 1/2 D Ex ia /tb IIIC T90 °C Da/Db XA00328F
- Ga/Gb Ex ia IIC T3...T6 Zone 20/21 Ex iaD 20/Ex tD A21 IP65 T 90 °C IECEx BVS 08.0027X XA00423F
- II 3 G Ex nA IIC T6 Gc
 II 3 G Ex nA nC IIC T5 Gc
 II 3C D Ex tc IIIC T100 °C Dc
 XA00346F

INMETRO safety instructions

Liquicap M FMI52

- Ex d [ia Ga] IIB T3...T6 Ga/Gb Ex d [ia Ga] IIC T3...T6 Ga/Gb Ex de [ia Ga] IIC T3...T6 Ga/Gb XA01171F
- Ex ia IIC T* Ga/Gb Ex ia IIB T* Ga/Gb Ex ia IIIC T90 °C Da/Db IP66 XA01172F

NEPSI safety instructions

- Liquicap M FMI52 Ex ia IIC/IIB T3...T6 Ga/Gb XA00417F
- Liquicap M FMI52
 Ex d ia IIC/IIB T3/T4/T6 Ga/Gb
 Ex d e ia IIC/IIB T3/T4/T6 Ga/Gb
 XA00418F
- Liquicap M FMI52 Ex nA IIC T3...T6 Gc Ex nA nC IIC T3...T6 Gc XA00430F

Overfill protection DIBt (WHG) Liquicap M FMI52 ZE00265F

Functional safety (SIL2) Liquicap M FMI52 SD00198F

Control Drawings (CSA and FM)

- Liquicap M FMI52 FM IS ZD00220F
- Liquicap M FMI52 CSA IS ZD00221F
- Liquicap M FMI52 CSA XP ZD00233F

1.3.3 Hygienic compatibility

Information regarding device versions that meet the requirements of 3A Sanitary Standard No. 74 and/or are certified by the EHEDG:

SD02503F

Suitable fittings and seals must be used to ensure hygiene-compliant design according to 3A and EHEDG specifications.

Comply with the maximum permitted temperature of the process seal.

The gap-free connections can be cleaned of all residue using the typical cleaning methods within this industry (CIP and SIP).

1.4 Registered trademarks

HART®

Registered trademark of the FieldComm Group, Austin, USA

TRI CLAMP®

Registered trademark of Alfa Laval Inc., Kenosha, USA

2 Basic safety instructions

2.1 Requirements for the personnel

The personnel must fulfill the following requirements to carry out the necessary tasks:

- Are trained, qualified to perform specific functions and tasks.
- Are authorized by the plant owner or operator to perform specific tasks.
- Are familiar with federal or national regulations.
- ► Have read and understood the instructions in the manual and supplementary documentation.
- They follow instructions and comply with conditions.

2.2 Workplace safety

For work on and with the device:

• Wear the required protective equipment according to federal or national regulations.

2.3 Operational safety

When performing configuration, testing, and maintenance work on the device, alternative supervisory measures must be taken to guarantee the operational safety and process safety.

2.3.1 Ex-area

When using the measuring system in Ex-areas, the appropriate national standards and regulations must be observed. Separate Ex-documentation, which constitutes an integral part of this documentation, is supplied with the device. The installation procedures, connection data and safety instructions it contains must be observed.

- Make sure that the technical staff has adequate training.
- The special measuring and safety-related requirements for the measuring points must be observed.

2.4 Product safety

This measuring device is designed following good engineering practice to meet state-ofthe-art safety requirements, has been tested, and left the factory in a condition in which it is safe to operate.

It meets general safety standards and legal requirements. It is compliant with the EC directives listed in the device-specific EC Declaration of Conformity. Endress+Hauser confirms this by affixing the CE mark to the device.

3 Incoming acceptance and product identification


3.1 Incoming acceptance

Check whether the packaging or content is damaged. Check that the goods delivered are complete and compare the scope of delivery with the information in your order.

3.2 Product identification

The measuring device can be identified in the following ways:

- nameplate data
- extended order code with a breakdown of the device features on the delivery note
- the serial number from nameplates in W@M Device Viewer (www.endress.com/deviceviewer): all of the information on the measuring device is displayed along with an overview of the scope of the technical documentation provided
- the serial number on the nameplate into the *Endress+Hauser Operations App* or use the *Endress+Hauser Operations App* to scan the 2-D matrix code (QR Code) on the nameplate

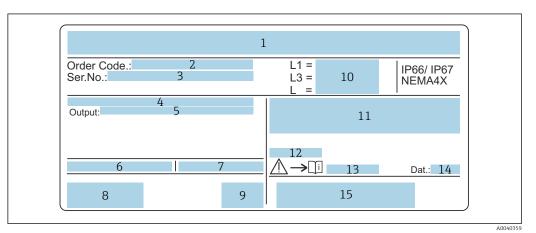

■ 1 The nameplate

- 2 Order number
- 3 Serial number
- 4 Electronic insert
- 5 Electronic insert output value
- 6 Ambient temperature at housing
- 7 Max. permissible pressure in a tank
- 8 Safety certificates
- 9 Functional safety
- 10 Probe length values
- 11 ATEX approval
- 12 WHG approval (German Water Resources Act)
- 13 Safety information
- 14 Production date
- 15 Bar code


3.3 Storage and transport

For storage and transportation, pack the device to protect it against impact. The original packing offers the best protection for this. The permitted storage temperature is -50 to +85 °C (-58 to +185 °F).

4 Mounting

4.1 Quick installation guide

A probe installation

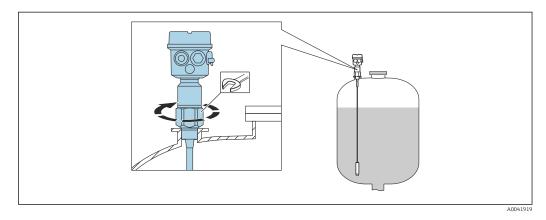


1. Screw the probe onto the proper place.

2. Fasten the probe with proper torque in accordance with the thread size.

Thread size and torque value

- G½: < 80 Nm (59.0 lbf ft)
- G¾: < 100 Nm (73.7 lbf ft)
- G1: < 180 Nm (132.8 lbf ft)
- G1½: < 500 Nm (368.7 lbf ft)

Aligning the housing

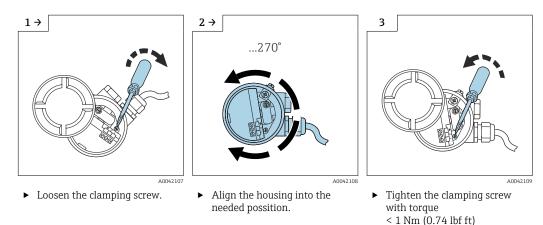


4.2 Mounting requirements

4.2.1 Mounting the sensor

The Liquicap M FMI52 can be installed vertically from above.

📔 Make sure that:


- the probe is not installed in the area of the filling curtain
- the probe is not in contact with the container wall
- the distance from the container floor is $\geq 10 \text{ mm} (0.39 \text{ in})$
- multiple probes are mounted next to each other at the minimum distance between the probes of 500 mm (19.7 in)

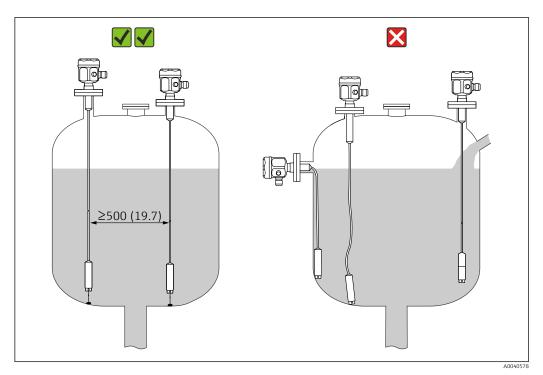

Unit of measurement mm (in)

4.2.2 Measuring condition

Measuring range L1 is possible from the tip of the probe to the process connection.

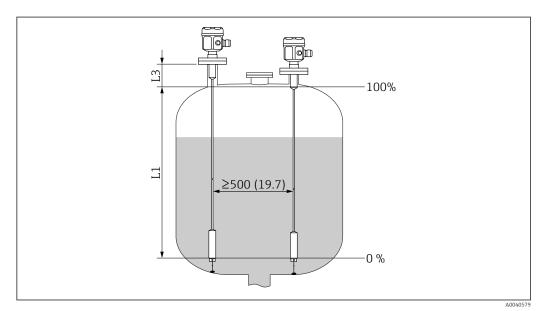

Unit of measurement mm (in)

- L1 Measuring range
- L3 Inactive length



When installing in a nozzle, use inactive length L3.

The 0 % and 100 % calibration can be inverted.

4.2.3 Minimum probe length for nonconductive media < 1μ S/cm

The minimum probe length can be calculated using the formula:

$$l_{\min} = \frac{\Delta C_{\min}}{C_{\rm s} \cdot (\epsilon_{\rm r} - 1)}$$

A004

l_{min} minimum probe length

∆C_{min}5 pF

-

*C*_s probe capacitance in air

 ε_r dielectric constant, e.g. oil = 2.0

To check the probe capacitance in the air, go to the chapter $\rightarrow \square$ 82.

4.2.4 Installation examples

Rope probes

The probe can be installed from above in conductive tanks made from metal.


If the process connection of the probe is insulated from the metal tank using a seal material, then the ground connection on the probe housing must be connected to the tank using a short line.

- The probe may not come into contact with the container wall! Do not install probes in the area of the filling curtain.
 - If multiple probes are mounted next to each other, a minimum distance of 500 mm (19.7 in) between the probes must be observed.
 - When mounting, ensure there is a good electrically conductive connection between the process connection and the tank. Use an electrically conductive sealing band for example.


A fully insulated rope probe may be neither shortened nor extended.

Damaged insulation of the probe rope causes improper measurements.


The following application examples show the vertical installation for continuous level measurement.

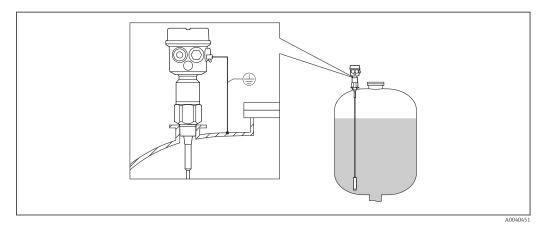

2 Rope probe

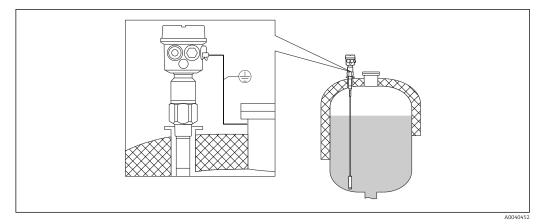

A probe with inactive length for the insulated tanks

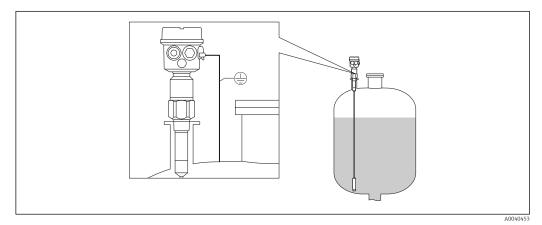

• 4 A probe with fully insulated inactive length for mounting nozzles


Shortening the rope


For information about the shortening kit, see Brief Operating Instructions KA061F/00.

Tensioning weight with tension

The end of the probe needs to be secured if the probe would otherwise touch the silo wall or another part in the tank. This is what the internal thread in the probe weight is intended for. The bracing can be conductive or insulating to the tank wall.

To avoid too high tensile load, the rope should be loose or guyed with a spring. The maximum tensile load may not exceed 200 Nm (147.5 lbf ft).

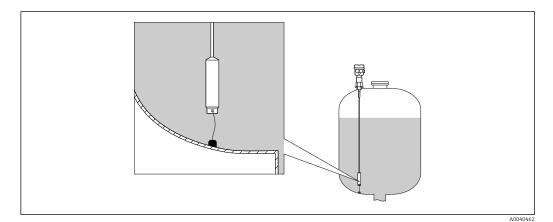

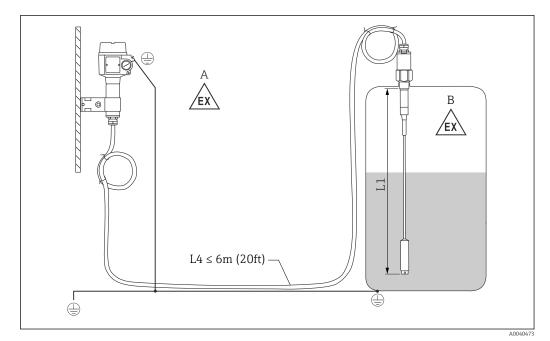

4.3 Probe with separate housing

☑ 5 Connection of the probe and separate housing

- A Explosive zone 1
- B Explosive zone 0
- L1 Rope length: max 9.7 m (32 ft)
- L4 Cable length: max. 6 m (20 ft)

The maximum cable length L4 and rope length L1 cannot exceed 10 m (33 ft).


The maximum cable length between the probe and separate housing is 6 m (20 ft). The required cable length must be indicated in the ordering process of a Liquicap M with separate housing.

If the cable connection has to be shortened or led through a wall, then it must be separated from the process connection.

4.3.1 Extension heights: separate housing

The cable:

- has a minimum bending radius of $r \ge 100 \text{ mm} (3.94 \text{ in})$
- diameter Ø 10.5 mm (0.14 in)
- outer jacket made of silicone, notch resistance

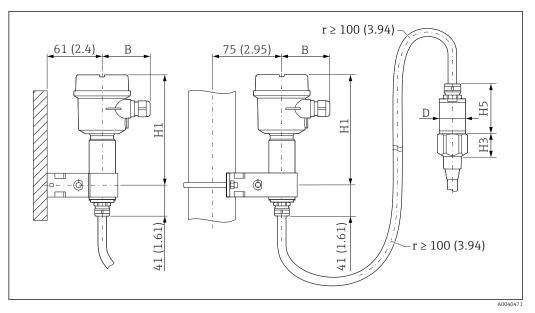

Housing side: wall mounting, pipe mounting, and sensor side. Unit of measurement mm (in)

Values of parameters ¹⁾:

Polyester housing (F16)

- B: 76 mm (2.99 in)
- H1: 172 mm (6.77 in)

Polyester housing (F15)

- B: 64 mm (2.52 in)
- H1: 166 mm (6.54 in)

Aluminum housing (F17)

- B: 65 mm (2.56 in)
- H1: 177 mm (6.97 in)

D and H5 parameter


- rope probe without fully insulated inactive length and threads G³/4", G1", NPT³/4", NPT1", Clamp 1", Clamp 1¹/₂", Universal Ø44 mm (1.73 in), flange < DN50, ANSI 2", 10K50:
 - D: 38 mm (1.5 in)
 - H5: 66 mm (2.6 in)
- rope probe without fully insulated inactive length and threads G1½", NPT1½", Clamp 2", DIN 11851, flange ≥ DN50, ANSI 2", 10K50
 - D: 50 mm (1.97 in)
 - H5:89 mm (3.5 in)
- rope probe with fully insulated inactive length:
 - D: 38 mm (1.5 in)
 - H5: 89 mm (3.5 in)

4.3.2 Wall bracket

The wall bracket is a part of the scope of delivery.


- To use the wall bracket as a drill template, the wall bracket must be first screwed to the separate housing.
 - The distance between the holes is reduced by screwing it to the separate housing.

¹⁾ See parameters on the drawings.

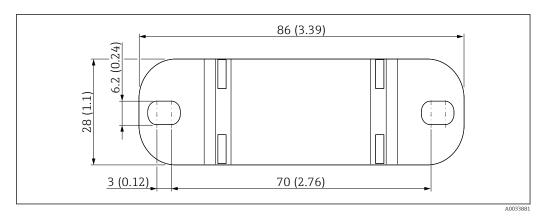

Unit of measurement mm (in)


Wall mounting 4.3.3

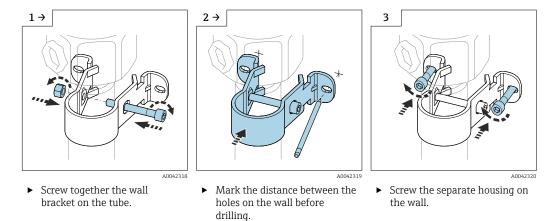

Pipe mounting 4.3.4

bracket on the tube.

The maximum pipe diameter is 50.8 mm (2 in). $1 \rightarrow$ 2

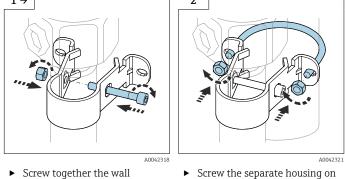

a pipe.

4.3.5 Shortening the connecting cable

NOTICE

Risk of damage to connections and cable.

Make sure that neither the connecting cable nor the probe is turning with the pressing screw!

Recalibration must be performed before commissioning.


The maximum connection length between the probe and the separate housing is 6 m (20 ft).


When ordering a device with separate housing, the desired length must be specified.


If the cable connection has to be shortened or led through a wall, it must be separated from the process connection.

Disconnecting the connection cable


Make sure that the connecting cable and the probe is not turning with the pressing screw.

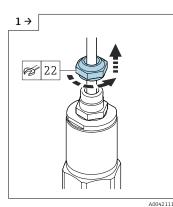

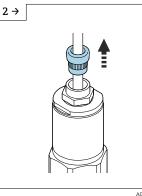


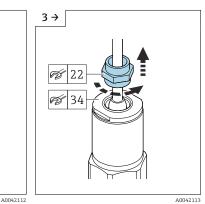


- Loosen the pressing screw with an open-end wrench AF22.
- Pull the insert seal out of the cable gland.
- ► Block the adapter disk with the open-end wrench AF34 and loosen the cable gland with the open-end wrench AF22.

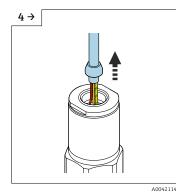


Pull out the cable with the cone.

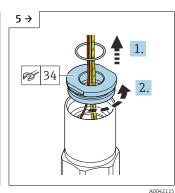

 Remove the seal and loosen the adapter disk with the open-end wrench AF34.

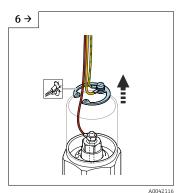

Remove the snap ring with a snap ring pliers.

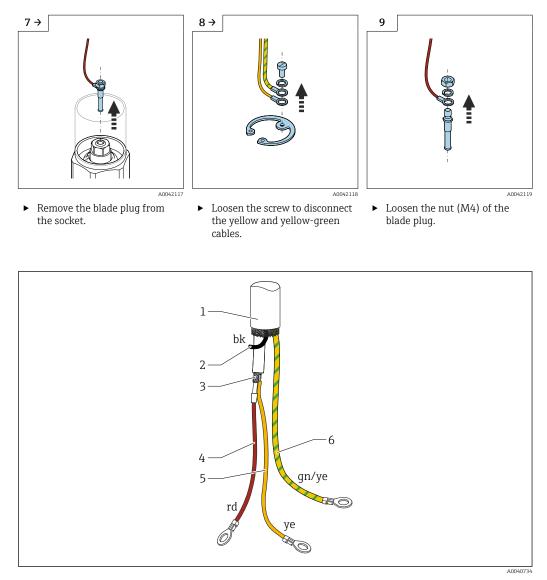

☑ 7 Cable connections

- 1 External screening (not required)
- 2 Strand black (bk) (not required)
- 3 Coaxial cable with central core and screening
- 4 Solder the red (rd) strand with the central core of the coaxial cable (probe)
- 5 Solder the strand with the screening of the yellow (ye) coaxial cable (ground)
- 6 Strand yellow and green (gn/ye) with a ring terminal

• We recommend reusing all strands with ring terminals in case of shortening the connecting cable

- To avoid the risk of short-circuiting when the strands are not to be reused, the connections of the new ring terminals must be insulated with a heat shrinking sleeve
- Use heat-shrink tubes to insulate all soldered joints

4.4 Installation instructions

NOTICE


Do not damage the probe insulation during installation!

► Check the rope insulation.

NOTICE

Do not screw the probe using the probe housing!

• Use an open-end wrench to screw the probe.

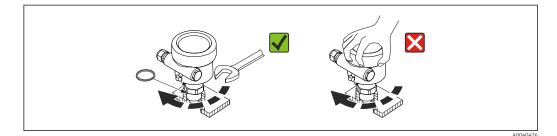

4.4.1 Probe installation

Probe with thread

Cylindrical threads G¹/₂, G³/₄, G1, G1¹/₂

To be used with the elastomer fiber seal supplied or another chemically resistant seal. Make sure that the temperature resistance of a seal is correct.

The following applies to probes with a parallel thread and supplied seal:

Thread G¹/₂

- for pressures up to 25 bar (362.5 psi): 25 Nm (18.4 lbf ft)
- maximum torque: 80 Nm (59.0 lbf ft)

Thread G³/₄

- for pressures up to 25 bar (362.5 psi): 30 Nm (22.1 lbf ft)
- maximum torque: 100 Nm (73.8 lbf ft)

Thread G1

- for pressures up to 25 bar (362.5 psi): 50 Nm (36.9 lbf ft)
- maximum torque: 180 Nm (132.8 lbf ft)

Thread G1¹/₂

- for pressures up to 100 bar (1450 psi): 300 Nm (221.3 lbf ft)
- maximum torque: 500 Nm (368.8 lbf ft)

Conical threads ½ NPT, ¾ NPT, 1 NPT, 1½ NPT

Wrap the thread with a suitable sealing material. Use conductive sealing material only.

Probe with Tri-Clamp, sanitary connection or flange

The process seal must meet the specifications of the application. Check the seal's resistance to temperature and medium.


If the flange is PTFE-clad, this generally suffices as the seal up to the permitted operating pressure.

Probe with PTFE-clad flange

Use spring washers!

Depending on process pressure and process temperature, check and re-tighten the screws at regular intervals.

Recommended torque: 60 to 100 Nm (44.3 to 73.8 lbf ft).

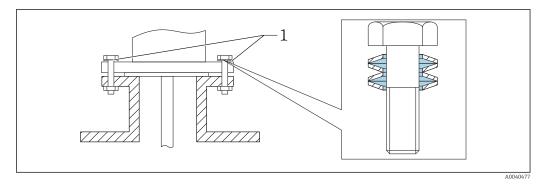


1 Spring washer

4.4.2 Aligning the housing

The housing can be rotated 270° to align with the cable entry. To prevent moisture penetration, route the connecting cable downwards in front of the cable gland and secure it with a cable tie. This is particularly recommended for outdoor mounting.

Aligning the housing

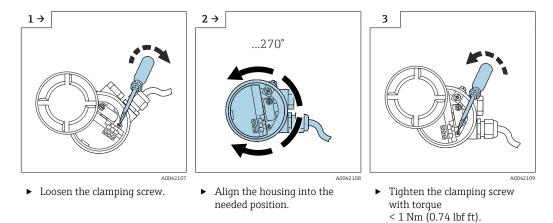

The clamping screw for aligning the housing type T13 is located in the electronics compartment.

4.4.3 Sealing the probe housing

Make sure that the cover is sealed. Water cannot enter into the device when performing installation, connection and configuration tasks. Always seal the housing cover and cable entries securely.

The O-ring seal on the housing cover is shipped with a coat of special lubricant applied. In this way, the cover can be sealed tight and the aluminum thread does not bite when screwing down.

Never use mineral oil-based grease as this destroys the O-ring.

4.5 Post-installation check

After installing the measuring device, carry out the following checks:

 \Box Do a visual check for damages.

□ Does the device meet the specifications at the measuring point with regard to process temperature and pressure, ambient temperature, measuring range?

□ Has the process connection been tightened with the tightening torque?

 $\hfill\square$ Check if the measuring points are correctly labeled.

 $\hfill\square$ Is the device adequately protected against precipitation and direct sunlight?

5 Electrical connection

Before connecting the power supply, note the following:

- the supply voltage must match the data specified on the nameplate
- switch off the supply voltage before connecting the device
- connect the potential equalization to the ground terminal on the sensor
- When using the probe in hazardous areas, the relevant national standards and the information in the safety instructions (XA) must be observed.

Use the specified cable gland only.

5.1 Connecting requirements

5.1.1 Potential equalization

ADANGER

Risk of explosion!

• Connect the cable screen on the sensor side only if installing the probe in Ex-areas!

Connect the potential equalization to the outer ground terminal of the housing (T13, F13, F16, F17, F27). In the case of the stainless steel housing F15, the ground terminal can also be located in the housing. For further safety instructions, please refer to the separate documentation for applications in hazardous areas.

5.1.2 Electromagnetic compatibility (EMC)

Interference emission to EN 61326, Electrical Equipment Class B. Interference immunity to EN 61326, Annex A (Industrial) and NAMUR Recommendation NE 21 (EMC).


Failure current is in accordance with NAMUR NE43: FEI50H = 22 mA.

A standard commercial instrument cable can be used.

Information on connecting shielded cables is provided in Technical Information TI00241F "EMC test procedures".

5.1.3 Cable specification

Connect the electronic inserts by using commercially available instrument cables. If a potential equalization is present, and the shielded instrument cables are used, connect the shielding on both sides to optimize the shielding effect.

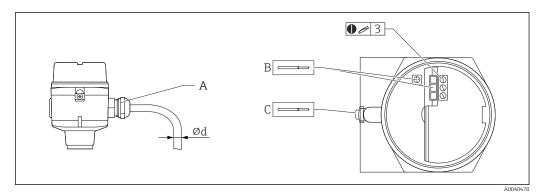

A Cable entry

- B Electronic insert connections: cable size max. 2.5 mm² (14 AWG)
- *C* The ground connection outside the housing, cable size max. 4 mm² (12 AWG)
- Ød Cable diameter


Cable entries

- Nickel-plated brass: Ød = 7 to 10.5 mm (0.28 to 0.41 in)
- Synthetic material: Ød = 5 to 10 mm (0.2 to 0.38 in)
- Stainless steel: Ød = 7 to 12 mm (0.28 to 0.47 in)

5.1.4 Connector

For the version with a connector M12, the housing does not have to be opened for connecting the signal line.

PIN assignment for M12 connector

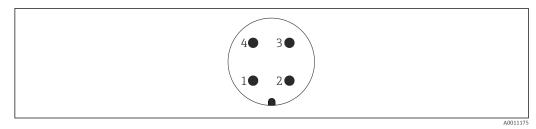

- 1 Positive potential
- 2 Not used
- 3 Negative potential
- 4 Ground

5.1.5 Supply voltage

All of the following voltages are terminal voltages directly at the device:

- 12.0 to 36.0 V_{DC} in the non-hazardous area
- 12.0 to 30.0 V_{DC} in the Ex ia hazardous area
- 14.4 to 30.0 V_{DC} in the Ex d hazardous area

5.2 Wiring and connecting

5.2.1 Connection compartment

Depending on explosion protection, the connection compartment is available in the following variants:


Standard protection, Ex ia protection

- polyester housing F16
- stainless steel housing F15
- aluminum housing F17
- aluminum housing F13 with gas-tight process seal
- stainless steel housing F27
- aluminum housing T13, with the separate connection compartment

Ex d protection, Gas-tight process seal


- aluminum housing F13 with gas-tight process seal
- stainless steel housing F27 with gas-tight process seal
- aluminum housing T13, with the separate connection compartment

Connecting the electronic insert to the power supply:

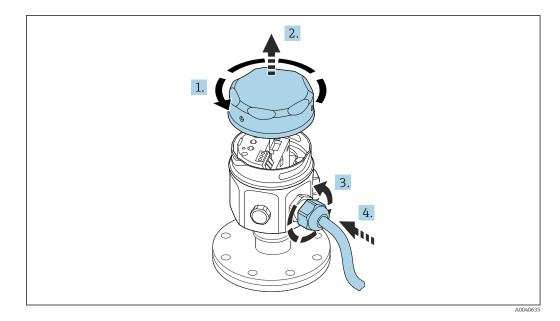

- 1. Unscrew the housing cover.
- 2. Remove the housing cover.
- 3. Release the cable gland.
- 4. Insert the cable.

Connecting the electronic insert to the power supply mounted in the housing T13:

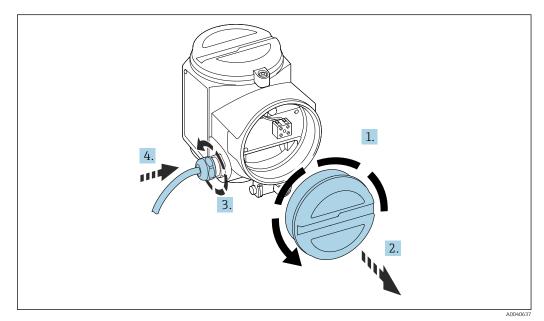


- 1. Unscrew the housing cover.
- 2. Remove the housing cover.
- 3. Release the cable gland.
- 4. Insert the cable.

5.2.2 Terminal assignment

2-wire, 4 to 20 mA with HART


The twin-core connecting cable is connected to the screw terminals with conductor cross-section 0.5 to 2.5 mm^2 (20 to 13 AWG) in the connection compartment at the

electronic insert. If the superimposed communication signal (HART) is used, a shielded cable must be used with the shielding connected at the sensor and power supply. Protective circuits against reverse polarity, HF influences, and overvoltage peaks are integrated.

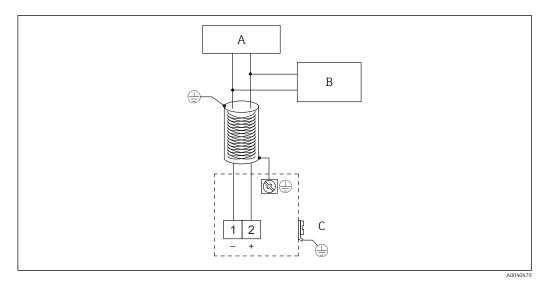

- A Supply voltage, communication resistor 250 Ω
- B Commubox FXA195
- C Grounding terminal

5.2.3 Connecting HART with other supply units

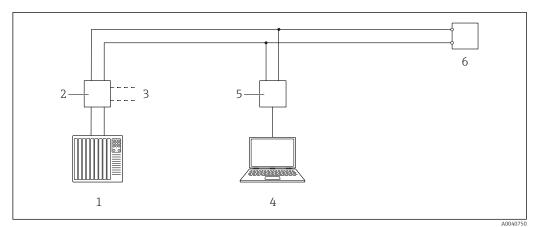

🗟 8 Remote control via HART protocol

1 PLC

- 2 Transmitter power supply unit e.g. RN221N with communication resistor
- 3 Connection output for Commubox FXA191, FXA195
- 4 Computer with control software (DeviceCare or FieldCare, AMS Device Manager, SIMATIC PDM)
- 5 Commubox FXA191 (RS232) or FXA195 (USB)
- 6 Transmitter



If the HART communication resistor is not integrated with the supply unit, a 250 Ω communication resistor must be included in the 2-wire line.

5.3 Post-connection check

After wiring the measuring device, carry out the following checks:

□ Is the terminal assignment correct?

 \Box Is the cable gland sealed tight?

□ Is the housing cover fully screwed?

 $\hfill\square$ Is the device operational and is the green LED flashing when the device is on?


6 Operation options

6.1 Overview of operation options

This device can operate with:

- the operating elements at the FEI50H electronic insert
- the display and operating module
- the HART protocol with Commubox FXA195 and FieldCare operating program

6.1.1 Display and operating elements at the FEI50H electronic insert

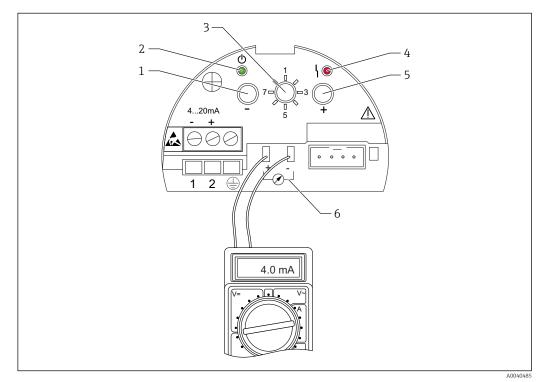

FEI50H electronic insert

- 1 Key 🖂
- 2 Green LED operational status
- 3 Function switch
- 4 Red LED fault
- 5 Key 🖅
- 6 Current pick-off 4 to 20 mA

Function switch

- 1: Operation: select for normal operation
- 2: Empty calibration: select to set empty calibration
- 3: Full calibration: select to set full calibration
- 4: Measuring modes: select to choose between operation for media that form buildup (e.g. yogurt) or for media without buildup (e.g. water)
- 5: Measuring range: select the measuring range in pF for:
 - measuring range probe length < 6 m (20 ft) corresponds to 2 000 pF
 measuring range probe length > 6 m (20 ft) corresponds to 4 000 pF

- 6: Self-test: select to activate the self-test
- 7: Reset factory settings: select to restore the factory settings
- 8: Upload sensor DAT (EEPROM)
 select to transfer the calibration values in the electronic insert to the sensor DAT (EEPROM) if replacing the probe

- select to transfer the calibration values of the sensor DAT (EEPROM) to the electronics if replacing the electronic insert

Red LED - indicates a fault or malfunction

- Flashes 5x per second:
 - capacity at probe is too large, short-circuit at the probe or FEI50H is defective
- Flashes 1x per second:
 - the temperature in the electronic insert is outside the permitted temperature range

Key 🗄

Press to execute the functions set via the function switch

Display connector

Connector dedicated for optional onsite display and operating module

Current pick-off 4 to 20 mA

Connect the multimeter for full or empty calibration without disconnecting the main circuit

Key 🗆


Press to execute the functions set via the function switch

Green LED - indicates operation

- Flashes 5x per second: the device operates
- Flashes 1x per second: the device is in the calibration mode

6.1.2 Operation via the optional display and operating module

Display and operating elements

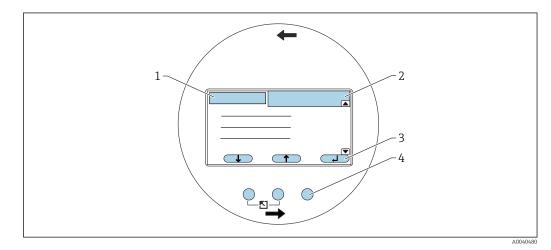

■ 10 Display and operating elements

- 1 Menu title
- 2 Item code of a displayed function
- 3 Key symbols
- 4 Hardware keys

Symbols on the display

Operating mode of the device

- User (
- user parameters can be edited
- Lock (
- all parameters are locked

 Scrollbar
- scroll up or down to access more functions

Locking state of the currently displayed parameter

- Display parameter
- the parameter cannot be edited in the current operating mode of the device
- Write parameter [____]
- the parameter can be edited


Key symbols

The keys work as softkeys. This means that their function and meaning depend on the current position in the operating menu. The key functions are indicated by symbols in the bottom line of the display.

- Down
 - moves the bar downwards in a picklist
- Up 💶 💶
 - moves the bar upwards in a picklist
- Enter
 - enter the selected submenu or selected function
 - confirm the edited function value
- Previous function
- go to the previous function within the function group
 - go to the next function within the function group
- Confirm selection **Confirm** select the option from the picklist
- Increase value
- increases the selected position of an alphanumeric function
- Decrease value decreases the selected position of an alphanumeric function
- Error list
 - opens the list of the errors currently present
 - the symbol is inverted and flashes if a warning is present
 - the symbol appears constantly if an alarm is present


Hardware key combinations

The following hardware key combinations apply regardless of the menu item in question: **Escape**




- 1 Due to editing a function: exits the editing mode for the current function
- 2 Due to navigating: returns to the next-highest menu level

Increase contrast




Increases the contrast of the display module

Decrease contrast



Decreases the contrast of the display module

Locking and unlocking




1 Locks the device against parameter changes

2 Press all three keys to unlock the device

6.1.3 The operating menu

Function codes

The functions of Liquicap M are arranged in an operating menu. 5-digit item code is shown on the display for every function to aid orientation within the menu.

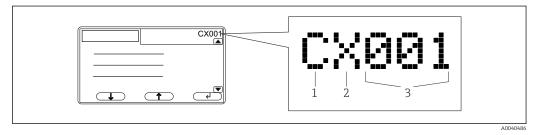

- 1 Function group
- 2 Channel
- 3 Number of the function within the group

The first position refers to ²):

- C: Basic setup
- S: Safety setting
- L: Linearization
- O: Output
- D: Device properties

The second position refers to


the position is out of function

The third position refers to

the individual functions within the function group

Launching menus

- The display automatically switches to the main screen with the measured value, if the submenu is not chosen or the navigation key is not pressed for 15 minutes.
 - Navigation always starts with the main screen: measured value display.

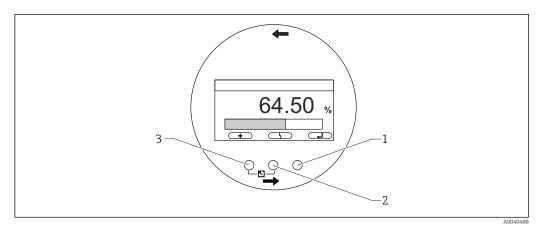

- 1 Main menu button
- 2 Actual errors button
- 3 Measured value button

Measured value

displays the measured value in %, mA or pF

Main menu

- contains all the parameters of Liquicap M, and is split into submenus
- the submenus contain additional submenus
- to overview the menu, submenus, and all functions \rightarrow \cong 38

Actual errors

- if an error is detected, the display shows related softkey symbol over the center key
- if the symbol flashes then a warning was detected
- if the symbol is displayed continuously then an alarm-type error was detected

A More information about the differences between "Alarm" and "Warning" $\rightarrow \square$ 74.



Press the center key to display the currently pending errors list.

Selecting a submenu



²⁾ The available function groups depend on the device version, the installation environment and the operating mode selected.

If the submenu contains additional submenus, continue in the same manner until you reach the function level.

▶ Press ■ D or ■ D to select the function in submenu.

Return to the next-highest menu level any time by pressing "Escape" $\rightarrow \square$ 31.

If the menu has only one submenu then the soft keys are not displayed.

Selecting a function and subfunction

If the function level has been reached, it is possible to navigate through the functions with \boxdot and \boxdot . The current values of all the related subfunctions are displayed.

- 1. Press **A C and** or **A C and** to select the ordered function.
- 2. Press **1** to enter the selected function.
- 3. Press **end** or **end** to select the ordered subfunction.
- 4. Press **1** to enter the selected function.

If the function has only one subfunction, then the soft keys are not displayed.

Return to the next-highest menu level any time by pressing "Escape" $\rightarrow \square$ 31.

Editing functions with the picklist

1. Press **end** or **end** to select the ordered option.

2. Press **1** to select this option.

The new value is now transferred to the device.

Edit another subfunction in the same way.

Return to the next-highest menu level any time by pressing "Escape" $\rightarrow \square$ 31.

Editing numeric and alphanumeric functions

If you select a numeric function like "Empty calibration", "Full calibration" or an alphanumeric function like "Device marking", the editor for numbers or alphanumeric characters opens.

- 1. Press **Press** or **Press** until this position shows the ordered value.
- 2. Press **1** to enter the value and go to the next position.
- 3. Repeat step for the next position.
- 4. Once all the necessary positions have been entered, press **and appears** or **appears** at the marker.
- 5. Press **1** to transfer the entire value to the device.

Special functions when making entries

They also call up the following symbols for special editing tasks which make inputting information easier and make it possible to make corrections quickly.

In the editor for numbers and alphanumeric characters, the **second** and **second** keys not only call up numbers and letters.



■ 11 The number to the left of the marker is transferred to the device.

		A0040581

E 12 Exit the editor. The old function value remains.



■ 13 The marker jumps to the next position.

¢
A004058

I4 The marker jumps back to the previous position.

*

■ 15 The current position and all positions to the right are deleted.

Return to the measured value display

Pressing the left and center key simultaneously has the following effect:


- it takes you from the editing mode to the display mode of the functions
- it takes you from the display mode of the functions to the submenu
- it takes you from the submenu to the main menu
- it takes you from the main menu to the measured value display

6.2 Error messages

If the automatic monitoring function of Liquicap M detects an error, the related softkey symbol **(177-171)** appears over the center key.

If the softkey symbol (is flashing, only "Warning"-type errors are present.

If the symbol **market** is displayed continuously, at least one "Alarm"-type error is present.



To find information about the differences between "Alarm" and "Warning" $\rightarrow \square 74$

6.3 Locking and unlocking configuration

6.3.1 Key locking

Press all three keys simultaneously. The device is then locked.

6.3.2 Key unlocking

Press all three keys simultaneously. The device is then unlocked.

6.3.3 Software locking

P Locking the device is descripted in "Safety settings" $\rightarrow \square 51$.

In the menu, the current locking status of the device is displayed in the "Status" subfunction under "Safety settings" SAX01.

The following values can appear:

Unlocked

All parameters can be modified

Locked

The device is locked from the operating menu. It can only be enabled again by entering "100" in the "Safety settings" function. If an attempt is made to change a parameter, the device goes to the "Safety settings" function. "Key locking" is displayed in the "Status" subfunction. Press all the keys simultaneously. The device then goes back to the defult settings and all parameters can be changed again.

Key locked

The device has been locked with the operating keys. It can only be enabled again by pressing all three keys simultaneously.

😭 A key symbol is shown on the display when locked.

6.4 Resetting to factory setting

The reset can affect the measurement as the current values are overwritten by factory values: 0% (4 mA) and 100 % (20 mA).

6.4.1 Using the reset

A reset is always recommended if a device with an unknown history is used.

6.4.2 Effects of a reset

- all parameters are reset to the factory setting
- the linearization is reset to "linear"

The linearization table is retained and can be activated again where necessary.

The factory settings of the parameters are marked in bold in the menu overview.

For more information go to the chapter "Basic setup" $\rightarrow \square$ 30.

6.4.3 Performing a reset

To do a reset, enter the value "333" in the "Device properties \rightarrow Diagnosis \rightarrow Password reset / Reset" function.

6.5 Operation via FieldCare Device Setup

6.5.1 Function scope

FDT-based plant asset management tool from Endress+Hauser. It can configure all smart field devices in a system and helps you manage them. By using the status information, it is also a simple but effective way of checking their status and condition.

For additional information about FieldCare, see Operating Instructions BA00027S and BA00059S

Connection options: HART via Commubox FXA195 and the USB port of a computer

6.5.2 Source for device description files

- www.endress.com \rightarrow Downloads
- CD–ROM (contact Endress+Hauser)
- DVD (contact Endress+Hauser)

7 Commissioning

The device is operated via the electronic insert, the display or with FieldCare. If a display is attached to the electronic insert, the function keys \Box or \boxdot and the Mode switch at the electronic insert are deactivated. All other settings can be made using the function keys on the display or with FieldCare.

7.1 Installation and function check

Make sure that the post-installation check and final check have been completed before you start your measuring point:

- go to the chapter "Post-installation check" \rightarrow 🗎 22
- go to the chapter "Post-connection check" \rightarrow 🗎 27

7.2 Basic setup without the display or operating module

This section describes how to commission the device with the function switch and the operating keys \Box nad \pm on the FEI50H electronic insert.

On leaving the factory, Liquicap M devices are calibrated for media with a conductivity of \ge 100 µS/cm for all water-based liquids such as acids and alkalis.


A recalibration is only necessary if the 0 to 100 % value should be adjusted to suit customer-specific requirements, the distance to the tank wall is < 250 mm (9.84 in) or if the liquid is not conductive.

Only the "Wet-type" calibration can be carried out without the display and operating module.

During the "Wet-type" calibration, the 0 % value or the 100 % value is adjusted to customer-specific requirements. This calibration can be carried out if the tank is empty, full or partially filled.

During full calibration, the probe must be covered by the liquid in the installed state.

An empty and full calibration must be performed.

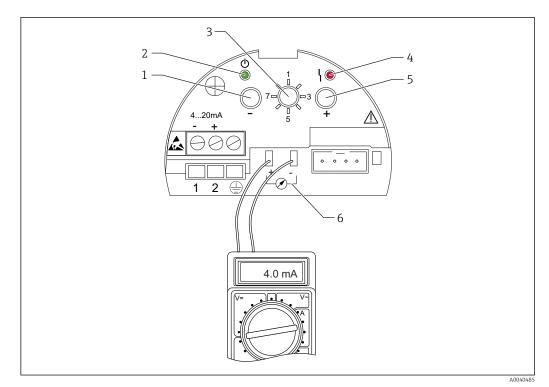

🗷 16 FEI50H electronic insert

- 1 Key 🖂
- 2 Green LED operational status
- 3 Function switch
- 4 Red LED fault
- 5 Key 🖅
- 6 Current pick-off 4 to 20 mA

7.2.1 Function switch: position 1. Operation

In normal operation, the function switch must be set to position 1.

7.2.2 Function switch: position 2. Carry out empty calibration - for empty tanks

When the tank is empty (0 %), the empty calibration sets the signal current to the lower value of 4 mA. When empty calibration is completed, the electric current value of 4 mA is displayed at the ammeter.

To perform empty tank calibration:

- 1. Turn the function switch to position 2.
- **2.** Press the \boxdot and \boxdot keys together for 2 s until the green or red LED flashes.
- 3. Release the two keys.
- 4. The flashing stops after 5 s.
 - └ Empty calibration is saved.

7.2.3 Function switch: position 2. Carry out empty calibration - for almost empty tanks

If possible, the exact tank level should be known and should not exceed < 30 %.

Exceeding the permitted tank level reduces the accuracy of the zero-point that corresponds to the empty tank. An ammeter must be connected to the current pick-off at the electronic insert. For example, the level was determined for 15 %, the electric current value that corresponds to that 15 % must be determined.

The lower current value can be adjusted with the \square and \boxdot keys.

The following must also be considered:

- the lower current value means that the tank is empty, 0 % is 4 mA.
- the upper current value means that the tank is full, 100 % is 20 mA.
- this results in a measuring range of 16 mA for a change from 0 to 100 %. For example 0.16 mA increase in the current for every 1 % increase in the level.
- for a 15 % level, this is 15 % × 0.16 mA per % which equals the 2.4 mA. This must be added to 4 mA to obtain the current value to be set: 2.4 mA + 4 mA = 6.4 mA.

To perform empty tank calibration on a partially filled tank:

- 1. Turn the function switch to position 2.
- 2. Press the \boxdot or \boxdot keys for 2 s.
- 3. Set the desired current value (>4 mA) using the multimeter connected.
- 4. Release the key.
 - └ Empty calibration is saved.

7.2.4 Function switch: position 3. Carry out full calibration - for full tanks

If the tank is full (100 %), the full calibration sets the signal current to the upper value of 20 mA.

When full calibration is completed, the current value of 20 mA is displayed at the ammeter.

To perform full tank calibration:

- 1. Turn the function switch to position 3.
- **2.** Press the \Box and \pm keys together for 2 s until the green or red LED flashes.
- 3. Release the two keys again.
- 4. The flashing stops after 10 s.
 - ← Full calibration is saved.

7.2.5 Function switch: position 3. Carry out full calibration - for almost full tanks

If possible, the exact level of the tank should be known and should be as large as possible (> 70 %).

Too low level reduces the accuracy of the upper point which corresponds to the full tank. An ammeter must be connected to the current pick-off at the electronic insert.

For example, the level was determined for 90 %, the electric current value that corresponds to the level of 90 % must be determined. The upper current value can be adjusted with the \Box and \pm keys. The \pm key increases the value, the \Box key reduces the value.

The following must also be considered:

- the lower current value means that the tank is empty, 0 % is 4 mA.
- the upper current value means that the tank is full, 100 % is 20 mA.
- this results in a measuring range of 16 mA for a change from 0 to 100 %. For example 0.16 mA increase in the current for every 1 % increase in the level.
- for a 90 % level, this is 90 % \times 0.16 mA per % which equals the 14.4 mA. This must be added to the 4 mA to obtain the current value to be set: 4 mA + 14.4 mA = 18.4 mA. It is possible to take the upper current value and then subtract 10 % x 0.16 mA per % which equals 1.6 mA from 20 mA.

To perform full calibration on a partially filled tank:

- 1. Turn the function switch to position 3.
- 2. Press \boxdot or \boxdot key for 2 s.
- 3. Connect the multimeter to the current pick-off.
- 4. Set the ordered electric current value < 20 mA.
- 5. Release the key.
 - └ The full calibration is saved.

7.2.6 Function switch: position 4. Measuring modes

Before carrying out empty and full calibration, the medium properties must be configured. If the medium is conductive and tends to form buildup, the "Buildup" operating mode must be selected.

In this operating mode, the buildup on the probe rope is compensated.

The "No buildup" operating mode is set at the factory.

Subfunction: "Medium property"

The **No buildup** operating mode should be set for media that do not tend to form buildup on the probe rope (e.g. water, beverages). As of conductivity of 100 μ S/cm like all water-based liquids such as acids, alkalis, the measured value is independent of the conductivity of the liquid (independent of concentration fluctuations).

In the **Buildup** operating mode, the buildup compensation function integrated into the software is activated. In this operating mode, the measured value is independent of the conductivity of the liquid as of conductivity of 1000 μ S/cm (independent of concentration fluctuations).

This compensates measuring errors caused by conductive media sticking to the probe rope such as yogurt. This corresponds to buildup compensation.

To choose between media forming buildup and media not forming buildup:

- 1. Turn the function switch to position 4.
- 2. Press \oplus key for media that tend to form buildup.

└ The green LED confirms your entry by flashing three times.

- 3. Press \Box key for media that do not form buildup.
 - └ The green LED confirms your entry by flashing three times.

7.2.7 Function switch: position 5. Measuring range

At the factory, the measuring range is always calibrated to the ordered probe length. If the electronic insert is used in another probe, the measuring range must be configured in accordance with the probe length.

To configure the measuring range 2 000 pF for probe length < 6 m (20 ft) or 4 000 pF for probe length > 6 m (20 ft):

1. Turn the function switch to position 5.

2. Press \Box to set measuring range 2 000 pF

← The green LED flashes three times - the value is set.

└ The green LED flashes three times - the value is set.

7.2.8 Function switch: position 6. Proof test - self-test

Before and after the automatic proof test, it is essential to check whether the level value displayed corresponds to the actual level value ³⁾.

When the self-test is activated, the current output is set to 4 mA and follows a ramp function up to 22 mA. This test is completed after approximately 40 s.

To activate the device self-test:

- 1. Turn the function switch to position 6.
- 2. Press \boxdot and \boxdot keys together to start the function test.
 - └ The green LED flashes quickly until the current error is reached. The red LED flashes until the test is completed.

After the self-test, the device automatically returns to the operating mode.

7.2.9 Function switch: position 7. Reset - restore factory settings

The reset can affect the measurement as the current values are overwritten by the factory values of calibration 0% (4 mA) and 100% (20 mA).

To restore the factory settings:

- 1. Disconnect the electronic insert from the power supply.
- 2. Turn the function switch to position 7.
- **3.** Press and hold the ⊡ and ± keys together while the device is being reconnected to the power supply.
 - ← Red LED flashes slowly and then starts to flash quickly.
- 4. Wait until the red LED stops flashing.
- 5. Release the \Box and \pm keys.

7.2.10 Function switch: position 8. Download or upload sensor DAT (EEPROM)

Calibration values can be transmitted with this function.

A distinction is made between two types:

- the sensor has been replaced and the electronic insert should continue to be used
- the electronic insert has been replaced but the sensor should continue to be used

The calibration values already set can be transferred from the sensor to the electronic insert or from the electronic insert to the sensor.

Download

To transfer the calibration values from the electronic insert to the sensor:

- 1. Turn the function switch to position 8.
- **2.** Press the \Box key to start downloading from the electronic insert to the sensor.
 - ← The green LED flashes for 2 s, confirming your entry.

The device restarts.

Upload

To transfer the calibration values from the sensor to the electronic insert:

1. Turn the function switch to position 8.

³⁾ This applies from version FW: V 01.03.00

Press the ± key to start uploading from the sensor to the electronic insert.
The green LED flashes for 2 s, confirming your entry.

The green LED hashes for 2 s, commin

The device restarts.

7.3 Menu: "Basic setup". Commissioning with display and operating module

This section describes how to commission the Liquicap M, the display and the operating module. The procedure for commissioning through FieldCare, DeviceCare or FieldXpert handheld terminal is the same. More detailed information can be found in the Operating Instructions for FieldCare BA 224F/00 supplied together with the handheld terminal.

7.3.1 Initial commissioning

On the first power-up, you are requested to select the language for the display texts. After this selection, the measured value is displayed.

If a reset is performed at the device and if the power supply is switched off and on again, the language of the display texts has to be selected again.

Menu structures: Main menu

The main menu is activated by means of the right Enter key \blacksquare .

The following menu headings appear. These are explained in more detail over the following pages:

- Basic setup $\rightarrow \triangleq 45$
- Safety setting $\rightarrow \square 51$
- Linearization $\rightarrow \square 55$
- Output $\rightarrow \square 62$
- Device properties $\rightarrow \square 65$

Liquicap M devices are calibrated on leaving the factory for media with a conductivity of $\geq 100 \ \mu$ S/cm. Recalibration is only necessary if the 0 % value or the 100 % value should be adjusted to suit customer-specific requirements, the distance to the tank wall is < 250 mm (9.84 in) or if the liquid is not conductive.


A distinction is generally made between two types of calibration:

Wet calibration

During wet calibration, the probe must be covered by a liquid in the installed state. This calibration can be done if the tank is empty, full or partially full. Empty and full calibration must be performed.

Dry calibration

During dry calibration, empty and full calibration can be done without the probe being in contact with the liquid. The calibration values can be entered directly in units of length.

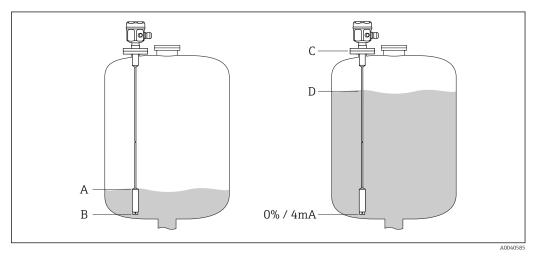

- A Customer specified 0% level (empty tank)
- *B Factory setting for 0% level (empty tank)*
- C Factory setting for 100% level (full tank)
- D Customer specified 100% level (full tank)

Configure the settings in the "Basic setup" menu:

The factory settings are shown in bold.

A	Menu		
В	Function		
С	Subfunction		
D	Function value		

А	В	С	D
		C 363	
Basic setup	Basic setup	Medium property	no buildup
			buildup
		Cal. type	Dry
			Wet
	Medium property ¹⁾	Medium property	Conductive
			Nonconductive ²⁾
			interface
			unknown
		DC value ³⁾	Value
		Unit level ⁴⁾	% (percentage)
			m
			mm
			ft
			inch
	Empty calibr.	Value empty	0 %
		Measure capacity	xxxx pF
		Confirm cal.:	Yes
	Full calibr.	Value full	100 %
		Measure capacity	xxxx pF
		Confirm cal.:	Yes
	Output damping	Output damping	1 s

1) Function is only displayed if the function value "Dry" was selected under the subfunction "Cal. type".

2) Can only be selected for probes with a ground tube.

 Subfunction is only displayed if the function value "Nonconductive" was selected under the subfunction "Medium property".

 Subfunction is only displayed if the function value "Nonconductive" or "Conductive" was selected under the subfunction "Medium property".

7.3.2 Function: "Basic setup"

Subfunction: "Medium property"

The "No buildup" operating mode should be set for media that do not tend to form buildup on the probe rope, like water, beverages, etc. For conductivity of 100 μ S/cm, the measured value is independent ⁴⁾ of the conductivity of the liquid.

In the "Buildup" operating mode, the buildup compensation function integrated with the software is activated. In this operating mode, the measured value is independent $^{\rm 4)}$ of the conductivity of the liquid conductivity of 1000 μ S/cm.

This compensates measuring errors caused by conductive media sticking to the probe rope such as yogurt. This corresponds to buildup compensation.

Subfunction: "Cal. type"

In the "Dry" "Cal. type" empty and full calibration can be carried out without the probe being in contact with the liquid. The calibration values can be entered directly in units of length.

⁴⁾ Independent of concentration fluctuations.

In the "Wet" "Cal. Type", the probe must be covered by the liquid in the installed state for a full calibration. This calibration can also be carried out if the tank is partially full. Both the empty calibration and full calibration must be performed.

7.3.3 Function: "Medium property"

This function is only displayed if the function value "Dry" was selected under the subfunction "Cal. type".

Subfunction: "Medium property"

The properties of the medium are entered here.

- \bullet "Nonconductive": the conductivity of the medium is $\leq 1~\mu S/cm$ only with the ground tube
- "Conductive": the conductivity of the medium is $\geq 100 \ \mu S/cm$
- "Interface": the properties of the two media can be entered in the operating program of ToF Tool. The associated calibration values are then calculated
- "Unknown": the medium properties are not known. The capacitance values of the "Empty calibr." and "Full calibr." functions can be entered directly

Subfunction: "DC value"

This subfunction is only displayed if the function value "Nonconductive" was selected under the subfunction "Medium property".

The dielectric constant for the liquid to be measured is entered here, go to the "Measuring condition" $\rightarrow \cong 13$.


Subfunction: "Unit level"



This subfunction is only displayed if the function value "Conductive" or "Nonconductive" was selected under "Medium property".

The desired level unit for Basic setup is entered here.

7.3.4 Operating mode: "Empty calibr." and function - "Wet"



With "Empty calibration", the 0% value or the 4 mA value is assigned to the level value.

The procedure applies to the "Wet" type of calibration. Information on "Dry" calibration is provided below.

Subfunction: "Value empty"

The current level value is entered here, for example 5% partial filling \rightarrow "Value empty" 5% or 0% partial filling \rightarrow "Value empty" 0%.

To keep the calibration error to a minimum, the level should be between 0% and 30%.

Subfunction: "Measure capacity"

The capacitance value currently measured is displayed here.

Subfunction: "Confirm cal."

In this function, empty calibration is confirmed and the "Measure capacity" currently measured is assigned to the percentage level value entered as "Value empty".

7.3.5 Operating mode: "Full calibr." and function - "Wet"

With "Full calibration", the 100% value or the 20 mA value is assigned to the level value.

The procedure applies to the "Wet" type of calibration. Information on "Dry" calibration is provided further below.

Subfunction: "Value full"

The current level value is entered here, for example 90% partial filling \rightarrow "Value full" 90% or 100% filling \rightarrow "Value full" 100%.

To keep the calibration error to a minimum, the level should be between 70% and 100%.

Subfunction: "Measure capacity"

The capacitance value currently measured is displayed here.


Subfunction: "Confirm cal."

Full calibration must be confirmed with this function.

7.3.6 Operating mode: "Empty calibr." and function - "Dry"

The "Empty" value can be entered directly in units of length if the medium property has been set to conductive or nonconductive.

Subfunction: "Value empty ", medium property for the conductive and nonconductive medium

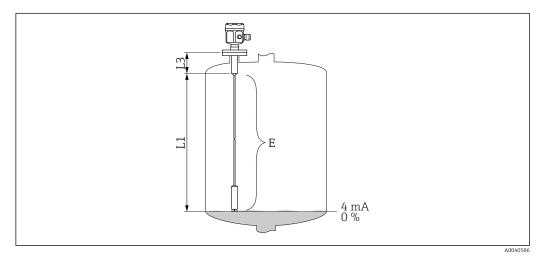

L1 Active probe length.

L3 Thread length.

E The distance from the active probe rope to the desired zero-point.

Value E:

Empty calibration \leq active probe length

 $E \le L1$ - (thread length L3 + plug)

Thread length:

L3 for $G1\frac{1}{2} = 25 \text{ mm} (0.98 \text{ in})$

L3 for $G < 1\frac{1}{2} = 19 \text{ mm} (0.75 \text{ in})$

Plug for rope probes: 18 mm (0.71 in)

Subfunction: "Cap. empty"

The calculated capacitance value is displayed here. This field cannot be edited.


Subfunction: "Confirm cal."

Empty calibration is confirmed with this subfunction.

7.3.7 Operating mode: "Full calibration" and function - "Dry" for conductive and nonconductive media

The "Full" value can be entered directly in units of length.

Subfunction: "Value full", medium property - conductive, nonconductive

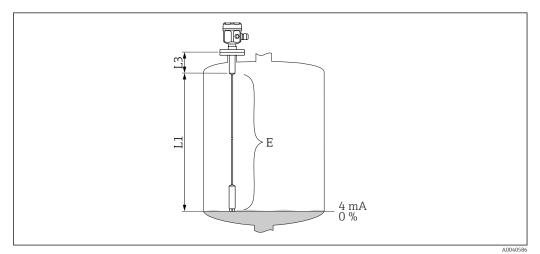

L1 Active probe rope.

L3 Thread length.

E The distance from the zero-point to the desired 100% point.

Value full:

 $E \leq Empty value \rightarrow \cong 47$

Subfunction: "Cap. full"

The calculated capacitance value is displayed here. This field cannot be edited.

Subfunction: "Confirm cal."

Full calibration is confirmed with this subfunction.

7.3.8 Operating mode: "Empty calibration" and function - "Dry" for "Interface" or "Unknown" medium properties

Subfunction: "Value empty"

This field displays 0% and cannot be edited.

Subfunction: "Cap. empty"

Enter the capacitance value, for example calculated with CapCalc.xls.

Subfunction: "Confirm cal."

Empty calibration must be confirmed with this subfunction.

7.3.9 Operating mode: "Full calibration" and function - "Dry" for "Interface" or "Unknown" medium properties

Subfunction: "Value full"

This field displays 100% and cannot be edited.

Subfunction: "Cap. full"

Enter the capacitance value, for example calculated with CapCalc.xls.

Subfunction: "Confirm cal."

Empty calibration must be confirmed with this subfunction.

7.3.10 Function: "Output damping"

With this function, you can set the reaction time of your measuring device to changes in the level. If surfaces are turbulent, a higher response time ⁵⁾ should be selected.

⁵⁾ In the software, the name for "Respone time" is "Output damping". For more information see the chapter "Response time" $\rightarrow \square$ 85.

7.4 Menu: "Safety setting"

Follow the settings in the "Safety settings" menu.

The factory settings are shown in bold.

A	Menu
В	Function
С	Subfunction
D	Function value

А	В	С	D
		C 2 C 3	
Safety settings	Safety settings	Code	100
		Status	Unlocked
			Locked
	Safety settings	Operating mode	Standard
			SIL/WHG
		Output damping	1 s
		Output 1	MAX
		Parameter okay	No
			Yes
	Safety settings	Cap. empty	x.xx pF
		Value empty	x.xxx %
		Cap. full	2000.00 pF
		Value full	100.000 %
		Parameter okay	No
			Yes
	Operating mode	Operating mode	Standard
			SIL/WHG
		SIL op. mode ¹⁾	Unlocked
			Locked
		Status	Unlocked
			Locked
	Output on alarm	Output	Max
			Hold
			User-spec.
		Output value ²⁾	xx.xx mA
	Proof test	Proof test	Off
			On

1) This subfunction is only displayed if the "SIL/WHG" option was selected under the "Operating mode" subfunction.

2) This subfunction is only displayed if the "User-specific" option was selected under the "Output" subfunction.

7.4.1 Function: "Safety settings"

Subfunction: "Code"

With this subfunction, you can lock the device against unpermitted or unintentional changes.

Enter a number that is not equal 100 to lock the device. The parameters cannot be modified.

Enter 100 to unlock the device. Parameters can be modified again.

Subfunction: "Status"

This subfunction displays the current locking status of the device.

The following values can appear:

Unlocked

All writeable parameters can be modified.

Locked

The device has been locked via the operating menu. It can only be unlocked by entering "100" in the "Code" subfunction.

7.4.2 Function: "Safety settings"

Subfunction: "Operating mode"

This subfunction displays the set operating mode and cannot be edited.

Operating modes:

- Standard
- SIL/WHG

Subfunction: "Output damping"

This subfunction displays the response time $^{6)}$ setting. Response time is the time during which the measuring system reacts to changes in level of the liquid and is between 0 to 60 s.

Subfunction: "Output 1"

This subfunction displays the set value which the output assumes in an alarm condition.

Values:

- MAX (22 mA)
- Hold the last value is held
- User-spec.

Subfunction: "Parameter okay"

With this subfunction, you confirm that the parameter values displayed under the "Safety settings II" function are correct.

The "Parameter okay" subfunction has to be confirmed with "Yes" so the device can be locked for the SIL/WHG operating mode. In addition, the SIL/WHG function value has to be selected for the "Operating mode" subfunction and "Locked" must be set for the "Status" subfunction. The device can be unlocked using the special release code. The release code is "7452".

⁶⁾ In the software, the name for "Respone time" is "Output damping". For more information see the chapter "Response time" → 🗎 85.

7.4.3 Function: "Safety settings"

Subfunction: "Cap. empty"

This subfunction displays the measured capacitance during empty calibration in pF.

Subfunction: "Value empty"

This subfunction displays the empty calibration value in %.

Subfunction: "Cap. full"

This subfunction displays the measured capacitance during full calibration in pF.

Subfunction: "Value full"

This subfunction displays the full calibration value in %.

Subfunction: "Parameter okay"

With this subfunction, you confirm that the parameter values displayed under the "Safety settings II" function are correct.

The "Parameter okay" subfunction has to be confirmed with "Yes" so the device can be locked for the SIL/WHG operating mode. In addition, the SIL/WHG function value has to be selected for the "Operating mode" subfunction and "Locked" must be set for the "Status" subfunction. The device can be unlocked using the special release code. The release code is "7452".

7.4.4 Function: "Operating mode"

Subfunction: "Operating mode"

With this subfunction, you can switch from the Standard operating mode to the SIL/WHG operating mode:

- Standard
- SIL/WHG

The following parameters are set to defined values in the "SIL/WHG" operating mode:

- Output damping: response time ⁷⁾ is fixed at 1 s.
- Output on alarm: The "Output on alarm" function is fixed at 22 mA.

In the "SIL/WHG" operating mode, cyclic self-monitoring of the device is like a memory test, processor test, current output, etc.

Subfunction: "SIL operating mode"

You can lock or unlock the device in this subfunction. No parameters can be changed in the locked state.

Subfunction: "Status"

This subfunction displays the current locking status of the device.

The following values can appear:

⁷⁾ In the software, the name for "Respone time" is "Output damping". For more information see the chapter "Response time" → 🗎 85.

Unlocked

All writeable parameters can be modified.

Locked

The device has been locked via the operating menu.

The device can be only unlocked by entering "100" in the subfunction "Code" $\rightarrow \square$ 51.

7.4.5 Function: "Safety settings"

Subfunction: "Operating mode"

The "Standard" or "SIL/WHG" operating mode entered is displayed here.

Subfunction: "Output damping"

The response time ⁸⁾ entered is displayed here.

Subfunction: "Value empty"

The capacitance of the empty calibration is displayed here.

Subfunction: "Value full"

The capacitance of the full calibration is displayed here.

Subfunction: "Parameter okay"

With this subfunction, you confirm that the parameter values displayed under the "Safety settings II" function are correct.

The "Parameter okay" subfunction has to be confirmed with "Yes" so the device can be locked for the SIL/WHG operating mode. In addition, the SIL/WHG function value has to be selected for the "Operating mode" subfunction and "Locked" must be set for the "Status" subfunction. The device can be unlocked using the special release code. The release code is "7452".

7.4.6 Function: "Output on alarm"

Subfunction: "Output"


This function determines the value the output in question assumes when an alarm condition occurs.

Options:

- Max
 - 22 mA
- Hold
- the last value is retained
- User-spec.

as defined in the "Output value" subfunction

⁸⁾ In the software, the name for "Respone time" is "Output damping". For more information see the chapter "Response time" $\rightarrow \cong$ 85.

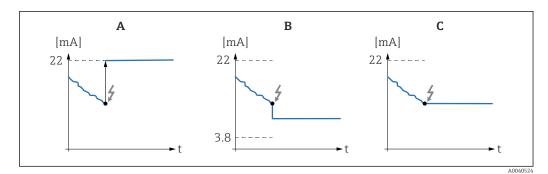

A Output current flow in "Max" setting

- B Output current flow in "User spec." setting
- C Output current flow in "Hold" setting

Subfunction: "Output value" - only for "Output" and "User-specific"

In this function, specify the user-specific value the current output should assume in an alarm condition.

Value range: 3.8 to 22 mA.

7.4.7 Function: "Proof test" - self-test

From version FW: V 01.03.00:

- before and after the automatic proof test, it is essential to check whether the level value displayed corresponds to the actual level value
- after the self-test, the device automatically returns to the operating mode

Subfunction: "Proof test"

With this subfunction, you activate the device self-test. All electronic components relevant to the function are tested. Within approximately 40 s, the current output goes through the range of 4 to 22 mA.

Menu: "Linearization" 7.5

"Linearization" is used for converting the level to any unit. You can determine the volume or the mass in a tank of any shape. Liquicap M makes various linearization modes available for situations that occur frequently. Furthermore, a linearization table can be entered for tanks and containers of any shape.



The number and type of subfunctions depend on the type of linearization selected. Only the "Type" and "Mode" subfunctions are always available.



The factory settings are shown in bold.

You can make the following settings in the "Linearization" menu.

A	Menu
В	Submenu
С	Function
D	Subfunction
Е	Function value

А	В	C	D	E
Linearization	Linearization	Туре	None	
			Linear	
			Horizontal cyl ¹⁾	
			Sphere ¹⁾	
			Pyramid bottom ²⁾	
			Conical bottom ²⁾	
			Angled bottom ²⁾	
			Table	
		Mode	level	
			Ullage	
		Simulation	Sim. off	
			Sim. level	
			Sim. volume	
		Sim. level value ³⁾ or	xx.x %	
		Sim. vol. value ³⁾	xx.x %	
	Linearization	Customer unit	% (percentage)	
			1	
			hl	
			m3	
			dm3	
			cm3	
			ft3	
			usgal	
			igal	
			kg	
			lb	

А	В	С	D	E
		1	ton	
			m3	
			ft3	
			mm	
			inch	
			user-spec.	
		Customized text ⁴⁾		
		Diameter ⁵⁾	xxxx m	
		Intermed. height ⁶⁾	xx m	
		Edit ⁷⁾	Read	Table No.: 1
				Input level: x m
				Input volume: %
			Manual	Table No.: 1
				Input level: x m
				Input volume: %
			Semi-automat.	Table No.: 1
				Input level: x m
				Input volume: %
			Delete	
		Status table ⁶⁾	Enabled	
			Disabled	
		Max. scale ⁸⁾	100 %	

- 1) If you enter a value for this function, you must also enter a value for the "Diameter" subfunction in another step.
- 2) If you enter a value for this function, you must also enter a value for the "Intermed. height" subfunction in another step.
- 3) The function is displayed if the "Sim. off" option was not selected under the "Simulation" subfunction.
- 4) The function is displayed if the "User-spec." option was selected under the "Customer unit" subfunction.
- The function is displayed if the "Horizontal cyl" or "Sphere" option was selected under the "Type" subfunction. 5) 6) The function is displayed if the "Pyramid bottom", "Conical bottom" or "Angled bottom" option was selected
- under the "Type" subfunction. 7) The function is displayed if the "Table" option was selected under the "Type" subfunction
- 8)
- This function is not displayed if the "Table" option was selected under the "Type" subfunction

7.5.1 Function: "Linearization"

Subfunction: "Type"

Select the type of linearization in this subfunction.


Options:

None

In this type of linearization, the measured level is not converted but instead is output linearly in the level unit selected $\rightarrow \square 46$.

Linear

In this type of linearization, the measured value output is linear to the measured level.

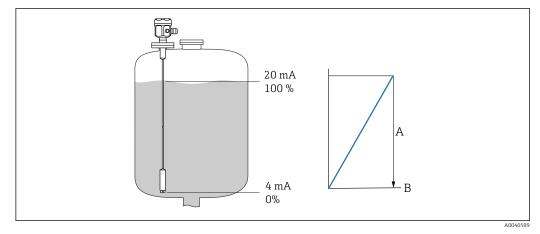

A The maximum tank content.


The following parameters must be specified:

- the unit for the linearized value
- the maximum tank contents measured in a customer unit

Options:

- Horizontal cyl.
- Sphere

In these types of linearization, the volume in a spherical tank or in a horizontal cylindrical tank is calculated from the liquid level.

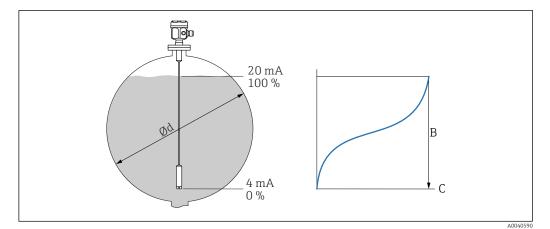

- Ød The cylindrical or spherical tank diameter
- C The maximum tank content


The following parameters must be specified:

- the unit for the linearized value
- the tank diameter
- the maximum tank contents measured in a customer unit

Options:

- Pyramid bottom
- Conical bottom
- Angled bottom

In these types of linearization, the volume in a spherical tank or in a horizontal cylindrical tank is calculated from the liquid level.

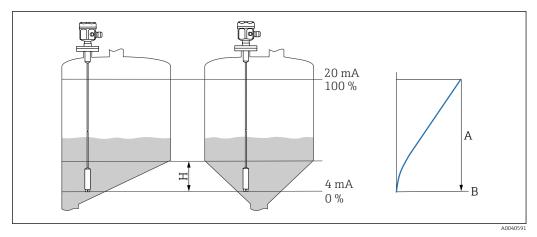

- *B* The maximum tank content
- H The intermediate height


The following parameters must be specified:

- the unit for the linearized value
- The intermediate height in accordance with the diagram
- the maximum tank contents measured in a customer unit

Options:

Table

In this type of linearization, the measured value is calculated using a linearization table. The table can comprise up to 32 "Level - Volume" value pairs. The table must be monotone.

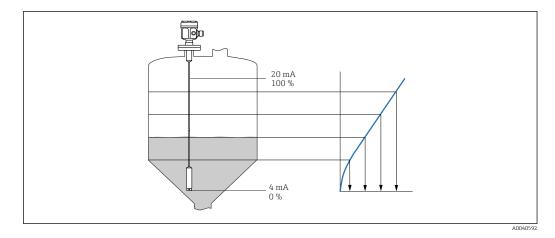


The following parameters must be specified:

- the unit for the linearized value
- the linearization table

Subfunction: "Mode"

In this subfunction, specify whether the measurement should refer to level A or to the empty area B.

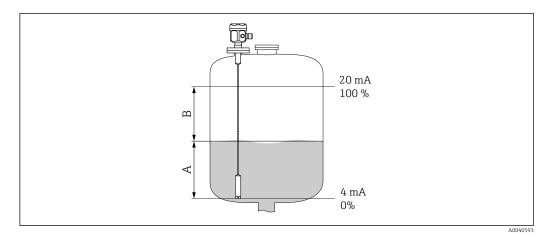

A Filled area

B Empty area

Subfunction: "Simulation"

In this subfunction, you can simulate the level or the volume by entering a level under "Sim. level value" or a volume under "Sim. vol. value".

Subfunction: "Sim. level value" or "Sim. vol. value"

In this subfunction, you can enter the level or volume value to be simulated.

7.5.2 Function: "Linearization"

Subfunction: "Customer unit"

In this subfunction, enter the desired unit for the linearized values, for example: kg, $\rm m^3,\, ft^3.$

Subfunction: "Customized text"

In this subfunction, enter your specific name for the unit. The measured value indicated in the main screen will then be displayed in this unit.

Subfunction: "Diameter"

In this subfunction, specify the diameter of the horizontal cylindrical tank or the spherical tank. Subfunction is available only for the "dry" type of basic setup.

Subfunction: "Intermed. height"

In this function, specify the intermediate height H ($\blacksquare \rightarrow \blacksquare$ 56) of the container in question. The probe length L1 must be entered here in the event of a wet calibration.

Subfunction: "Edit"

Use this function to enter, modify or read the linearization table.

The following options are available:

Read

The table editor is opened. The existing table can be read but not edited.

- Manual
 - The table editor is opened. Table values can be entered or modified.
- Semi-automat.


The table editor is opened. The level value is read in automatically. The related measured value must be entered by the user.

Delete

The linearization table is deleted.

The linearization table can only be edited if it is disabled.

The table editor

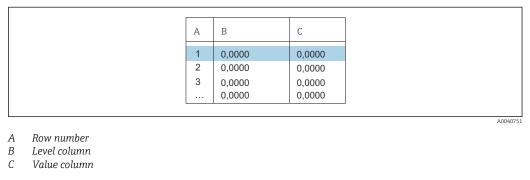

1. Press **1** to go to the next row.

2. Press 🚛 📰 to go to the previous row.

3. Press **EXAMPLE** to open marked row for editing.

А
1 2 3

- A Row number
- B Level column
- C Value column

1. Press **1** or **1** to navigate within the table.

2. Press **Contraction** or **Contraction** to navigate on No. column.

3. Press **EXAMPLE** to "Delete", "Insert" or "Move" the entire row.

You can return to the previous step by pressing **Escape** $\rightarrow \triangleq$ 31.

Subfunction: "Status table"

In this function, you can specify whether the linearization table should be used or not.

Options:

- Enabled
- The table is used.
- Disabled

The table is not used. The measured value is output linearly with regard to the level unit.

A0040752

Subfunction: "Max. scale"

In this function, specify the maximum contents of the tank in the customer unit.

Menu: "Output" 7.6

The factory settings are shown in bold.

You can make the following settings in the "Output" menu:

A	Menu	
В	Function	
С	Subfunction	
D	Function value	
Е	Additional function values	

Α	В	С	D	E
		C3C3		
Output	Extended calibr.	Extended calibr.	Measuring range	2 000 pF
				4000 pF
			Sensor DAT Stat.	Upload
				Download
		Output/Calculat	Curr. turn down	On
				Off
			Turn down 4 mA ¹⁾	0%
			Turn down 20 mA ¹⁾	100%
			4 mA threshold	On
				Off
	HART setting	HART setting	HART address	0
			No. of preambles	5
			Short TAG HART	TAG
		Output/Calculat	Current span	4 to 20 mA
				Fix. curr. HART
l			mA value ²⁾	4 mA
	Simulation	Simulation		Off
				On
		Simulation value 3)		xx.xx mA

1) This function is only displayed if the "On" option was selected under the "Curr. turn down" subfunction.

This function is only displayed if the function value "Fix. curr. HART" was selected under the "Current span" 2) subfunction. This function is only displayed if the "On" option was selected under the "Simulation" function.

3)

7.6.1 Submenu: "Extended calibr."

Function: "Extended calibr."

In this function, you can specify the measuring range.

Subfunction: "Measuring range"

Specify the measuring range in this subfunction.

- $C_A = 0$ to 2 000 pF for probe length < 6 m (20 ft)
- $C_A = 0$ to 4000 pF for probe length > 6 m (20 ft)
- At the factory, the measuring range is always calibrated to the probe length ordered. If the electronic insert is used in another probe, the measuring range must be configured in accordance with the probe length.

Function: "Output/Calculat."

Subfunction: "Sensor DAT stat."

This subfunction shows the status of the sensor DAT.

- OK sensor DAT is ready for use
- Error sensor DAT is not ready for use or missing

Subfunction: "Sensor DAT"

Calibration values can be transmitted with this function. A distinction is made between two types:

- the sensor has been replaced and the electronic insert should continue to be used
- the electronic insert has been replaced but the sensor should continue to be used

For these instances, the calibration values already set can be transferred from the sensor to the electronic insert or from the electronic insert to the sensor.

Upload

To transfer the calibration values from the sensor to the electronic insert.

Download

To transfer the calibration values from the electronic insert to the sensor.

Subfunction: "Curr. turn down"

This subfunction is not available for "Current span", "Fix. curr. HART".


This function can switch on the current turn down. The current output refers only to a freely definable part of the measuring range. This is then magnified when displayed.

Subfunction: "Turn down 4 mA"


This subfunction is available only for "Curr. turn down", "On".

Enter the measured value at which the current should be 4 mA.

Subfunction: "Turn down 20 mA"



Enter the measured value at which the current should be 20 mA.

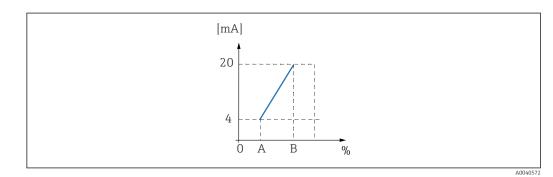

A Turn down 4 mA

B Turn down 20 mA


Subfunction: "4 mA threshold" - for Current span = 4 to 20 mA

It is possible to switch on the 4 mA threshold in this subfunction. The 4 mA threshold means that the current never is below, 4 mA even if the measured value is negative.

Options:

- Off
 - The threshold is switched off. Currents under 4 mA can occur.
- On

The threshold is switched on. The current is never below 4 mA.

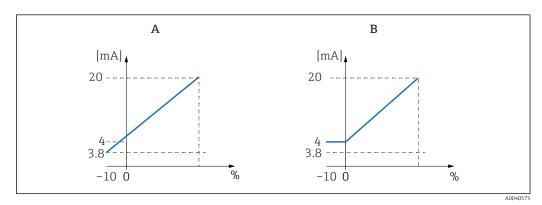

A 4 mA threshold off.

B 4 mA threshold on.

7.6.2 Submenu: "HART setting"

Function: "HART settings"

Subfunction: "HART address"

In this subfunction, specify the HART communication address for the device.

Possible values:

- for standard operation: 0
- for multidrop operation: 1 15

In multidrop operation, the output current is 4 mA as standard. However, it can be changed in the "mA value" function.

Subfunction: "No. of preambles"

In this subfunction, specify the number of preambles for the HART protocol. Increase the value if there are communication problems on the lines.

Subfunction: "Short TAG HART"

Here, you can enter the TAG name for HART communication in the device.

Function: Output / Calculat.


Subfunction: "Current span"

In this subfunction, select the current span to which the measuring range should be mapped.

Options:

- 4 to 20 mA
- the measuring range 0 to 100 % is mapped to the 4 to 20 mA current span
- Fix. curr. HART

a fixed current is the output. Its value can be specified in the "mA value" subfunction. The measured value is only transmitted via the HART signal

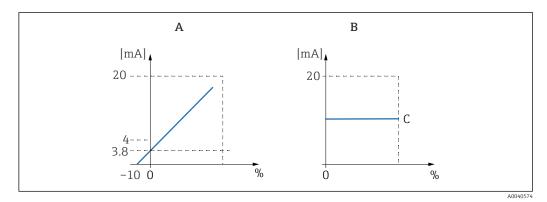

- A Current span = 4 to 20 mA.
- B Current span = fix. curr. HART.
- C mA value

7.6.3 Menu: "Simulation"

Function: "Simulation"

Subfunction: "Simulation"

This function switches on or off the simulation of output current.

Options:

Off

The device is not in the simulation mode. The device is in the measuring mode. • On

The device is in the simulation mode. A measured value is not output. Instead, the current output assumes the value defined in the "Simulation value" subfunction.

Subfunction: "Simulation value" - only for "Simulation On" mode

Specify the current value to be simulated in this function.

7.7 Menu: "Device properties"

The factory settings are shown in bold.

You can configure the following settings in the "Device properties" menu:

A	Menu
В	Submenu
C	Function
D	Subfunction
Е	Function value

А	В	С	D	Е
		N N N		
Device properties	Display	Language		English
				Deutsch
				Français
				Italiano
				Español

А	В	C	D	E
				Nederlands
		Display format	Format	Decimal
				ft-in-1/16"
			No of decimals	x
				x.x
				x.xx
				x.xxx
			Sep. character	. (dot)
				,
			Back to home	900 s
	Diagnostics	Actual error	Actual error 1	
			Actual error 2	
			Actual error 3	
		Last error	reset errorlist	Кеер
				Delete
			Last error 2	
			Last error 3	
		Password/reset	Reset	12345
			Status	Unlocked
		Electronic temp.	Electronic temp.	xx.x °C
		-	Max. temp.	
			Min. temp.	
			Temperature unit	°C
			-	۴
				K
			Min/Max temp.	Кеер
			-	Delete
				Reset Min.
				Reset Max.
		Measure capacity	Measure capacity	xxxx.xx pF
			Max. capacity val	xxxx.xx pF
			Min. capacity val	xxxx.xx pF
			Min/Max capacity	Кеер
			initial capacity	Delete
				Reset Min.
				Reset Max.
	System parameters	Device information	Device designation	Liquicap-FMI5x
	System parameters		Serial No.	
			EC Serial No.	
			Device marking	FMI52- OrderCode
		Device information		
		Device information	Dev. rev Software version	x V01.xx.xxx

А	В	С	D	Е
		Device information	Working hour	xxxxx h
			Current run time	000d00h00m
		Probe length	Probe length	xxx mm
			Sensitivity	0.0

7.7.1 Submenu: "Display"

Function: "Language"

Select the language for the display and operating module.

Options:

- English
- Deutsch
- Français
- Español
- Italiano
- Nederlands

Function: "Display format"

The "Display format" refers to how the measured value is displayed.

Subfunction: "Format"

Select the display format for displaying numbers.

Options:

- Decimal
- ft-in-1/16"

Subfunction: "No. of decimals"

Select the number of places after the decimal point for displaying numbers.

Options:

- X
- X.X
- x.xx
- X.XXX

Subfunction: "Sep. character"

Select the separator for displaying decimal numbers.

Options:

- . (dot)
- , (comma)

7.7.2 Submenu: "Diagnosis"

Function: "Actual error"

With this function, you can call up the list of all currently pending errors. The errors are arranged by priority.

If you select an error, a text field appears with a brief description of the error.

Error code list \rightarrow 75

Function: "Last error"

With this function, you can call up the list of all rectified errors. The option of resetting the error list with "Reset error list" is also available. It overwrites the last three error codes with 0.

Function: "Password / reset"

This function restores the factory settings. All parameters are reset to factory settings.

Subfunction: "Reset"

The factory settings are bold in the menu overview.

Enter the reset code "333" or "7864" to reset all the parameters to the factory settings.

During a "333" reset, linearization is reset to "linear". However, any linearization table available is retained and can be activated again where necessary.

During a "7864" reset, linearization is reset to "linear" and the linearization table is deleted.

The subfunctions are also reset:

- "Electronic temp."
- "Max. temp."
- "Max. capacity val."
- "Min. capacity val."
- "Min/Max capacity"

Function: "Electronic temp."

This function displays the temperature measured by the electronic insert.

Subfunction: "Electronic temp."

The subfunction displays the current electronics temperature.

Subfunction: "Max. temp."

The subfunction displays the highest temperature value measured by the device.

Subfunction: "Min. temp."

The subfunction displays the lowest temperature value measured by the device.

Subfunction: "Temperature unit"

The subfunction determines the temperature unit.

Options:

- °C
- °F
- K

Subfunction: "Min/Max temp."

The subfunction resets the "Min/Max temp."

Function: "Measure capacity"

This function displays measuring capacities that were measured by the electronic insert during operation.

Subfunction: "Measure capacity"

This subfunction displays the currently measured capacity.

Subfunction: "Max. capacity val."

This subfunction displays the highest capacitance value measured by the device.

Subfunction: "Min. capacity val."

This subfunction displays the lowest capacitance value measured by the device.

Subfunction: "Min/Max capacity"

The subfunction resets the "Min. or Max. capacity".

7.7.3 Submenu: "System parameters"

All functions listed in this section can be viewed only.

Function: "Device information"

This function displays all device information with which the device can be identified.

Subfunction: "Device marking"

This subfunction displays the device name e.g. Liquicap M-FMI52.

Subfunction: "Serial No."

This subfunction displays the serial number of the device that was assigned in the factory.

Subfunction: "EC Serial No."

This subfunction displays the serial number of the electronic insert.

Subfunction: "Device marking"

This subfunction displays the device marking and the order code.

Subfunction: "Dev. rev"

This subfunction displays the version of the electronic-hardware.

Subfunction: "Software version"

This subfunction displays the software version of the device that was assigned in the factory.

Subfunction: "DD version"

This function indicates the DD version with which this device can be operated using FieldCare.

Subfunction: "Working hour"

This subfunction displays the number of operating hours.

Subfunction: "Current run time"

This subfunction displays the "current run time" of the device. The first three digits display the number of days, followed by "d". The next two digits display the hours, followed by "h". The last two digits indicate the minutes.

Function: "Probe length"

In this function, more probe information can be displayed.

Subfunction: "Probe length"

You can read the current probe length in this subfunction.

Probe length (L1) = A - (thread length - plug)

More information are provided $\rightarrow \cong 47$.

Subfunction: "Sensitivity"

You can read off the current sensitivity in mm/pF in this subfunction.

7.8 Operation

After Basic setup, Liquicap M outputs the measured value via:

- the display and operating module
- the current output ⁹⁾
- the digital HART signal

7.9 FieldCare: operating program from Endress+Hauser

The FieldCare operating program is Endress+Hauser plant asset management tool based on FDT technology. It is possible to use FieldCare to configure all Endress+Hauser devices as well as third-party devices which support the FDT standard. The following operating systems are supported:

- Windows 7 Professional SP1 (x32+x64)
- Windows 7 Ultimate SP1 (x32+x64)
- Windows 7 Enterprise SP1 (x32+x64)
- Windows Server 2008 R2 SP2
- Windows 8.1
- Windows 8.1 Professional
- Windows 8.1 Enterprise
- Windows 10 Professional
- Windows 10 Enterprise

FieldCare supports the following functions:

- configuration of transmitters in online operation
- tank linearization
- loading and saving device data by upload and download
- documentation of the measuring point

Connection options:

HART via Commubox FXA195 and the USB port of a computer.

After reinstalling FieldCare, or by clicking a link in the Help menu, a video can be activated that explains the possible applications of the program in just a few minutes.

7.9.1 FieldCare

Function scope

FDT-based plant asset management tool from Endress+Hauser. It can configure all smart field devices in a system and helps you manage them. By using the status information, it is also a simple but effective way of checking their status and condition.

For additional information about FieldCare, see Operating Instructions BA00027S and BA00059S

Connection options: HART via Commubox FXA195 and the USB port of a computer

⁹⁾ The entire measuring range (0 to 100 %) is then mapped to the range (4 to 20 mA) of the current output.


Source for device description files

- www.endress.com \rightarrow Downloads
- CD–ROM (contact Endress+Hauser)
- DVD (contact Endress+Hauser)

7.9.2 Interface measurement

If there are different media in the container like water and oil, the capacitance values for "Empty calibration" and "Full calibration" can be calculated.

CapCalc.xls is a capacitance calculation program in FieldCare which can be used to calculate the calibration values for level measurement and interface measurement.

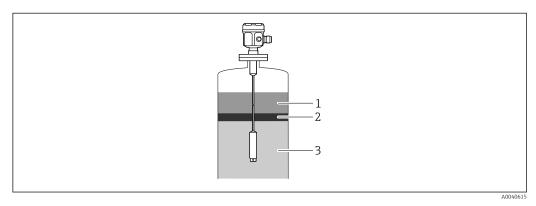

- 1 Conductive medium ≥100 µS/cm
- 2 Emulsion
- 3 Noncoductive medium < 1 μS/cm, DC < 5

The program calculates the calibration values on the basis of the entered data. The secure functioning of interface measurement can already be determined at this time. The calculated calibration values can be transmitted to the FEI50H electronic insert via the display or FieldCare.


Capacitance interface measurement is also suitable for very pronounced emulsion layers. The emulsion layer average is always measured.

7.9.3 Dry calibration for interface measurement

Calculating the calibration data with CapCalc

1.	Language					
		🥏 🖉 🔳 e	🗐 (A			
	Device Type:	Liquicap M	dev. rev.:	0	status:	unlocked
	Model:	FMI 5×	device marking:	LIQUICAP-FMI5×		

Click the "CA" button in the toolbar to start CapCalc.

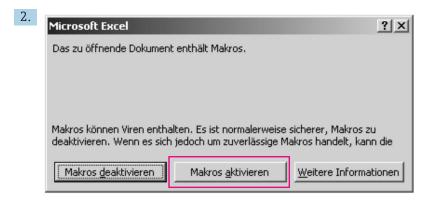

Click "Activate macros" button.

3.	
	Next

Click the "Next" button in the top right.

Editing the probe and application-specific data

Editing the probe and application-specific data.

Hauptstraße 1 79689 Maulburg Germany		En	dress+Hauser People for Process Automation	لينجا	Sprache wählen Select language
Customer	Muster GmbH+Co.KG	Attention	Hans Mustermann	19.01.2007	Print
Customer-No.	X0815	Phone	0815 - 12345		
Street	Musterstraße 5	Fax	0815-0789		Info
ZIP-Code/Town	12345	Reference	Trennschichtmessung		IIIIO
	Musterstadt	Tag	1122334455		
Probe type	FMI51, rod 10mm, PTFE or PFA			- MARINA CAR	Probe type
Probe diameter	8 mm			1	rione ryhe
Probe diameter with	isolation 10 mm			2	
DC-value of isolatio	n 1,9				
Base capacity	27,67 pF		100%		liary capacities
Auxiliary capacities	0 pF			AUX	nary capacities
Probe length L 1 inactive length L 3 Value Empty E	1000 mm 0 mm 1000 mm	Value Empty E Value Full F	Probe length 1.1		
Value Full F Wall distance	500 mm 250 mm		E .		
			OK	D	C handbook
Medium top				-	
Name	01	artes Artes			
Conductivity	0,01 µS/c	m Calibration	data level		
Dielectric constant	2,1	-			
Medium bottom	water				
Name					
Name Conductivity	180 µS/c	m Calibration	data level		
Me dium bottom Name Conductivity Dielectric constant		m Calibration	data level		

Click the "Probe type" button.

- 2. Select the probe type.
- 3. Enter the length probe L1 in accordance with the nameplate.
- 4. Enter the inactive length L3 in accordance with the nameplate.
- 5. Enter the "Value empty E".
- 6. Enter the "Value full F".
- 7. Enter the "Wall distance".
- 8. Enter the conductivity value of the medium in the "Medium top".
- 9. Enter the dielectric constant value of the medium in the "Medium top".

- 10. Enter the conductivity value of the medium in the "Medium bottom".
- 11. Enter the dielectric constant value of the medium in the "Medium bottom".
- **12.** Click the "Calibration data interface measurement" button to obtain the capacitance values for the calibration.
 - └ The capacitance values for empty calibration and full calibration are calculated and displayed as a result.

Use the "DC handbook" button to transfer the DC values and the conductivity of the corresponding media to the calculation program, if the medium properties are not known.

7.9.4 Wet calibration for interface measurement

This chapter describes the wet calibration procedure for "Empty calibration" and "Full calibration".

Empty calibration

1. Fill the container with the top medium.

2. Perform "Empty calibration 0%" regarding procedure $\rightarrow \square$ 38.

If it is not possible to fill the tank, perform the "Empty calibration" with the probe exposed in the air, however expect a calibration inaccuracy approximately 2.5 % per meter. The water and oil are the reference media.

Full calibration

1. Fill the container with the bottom medium.

2. Perform "Full calibration 100%" regarding procedure $\rightarrow \implies$ 38.

The empty and full calibration is completed and all data are saved in the electronic insert and DAT sensor.

8 Diagnostics and troubleshooting

The operating status of the device is indicated by the LEDs on the electronic insert.

8.1 Diagnostic information via LEDs

8.1.1 Green LED flashing

Green LED indicates operation:

- flashes every 5 s
- the device is in the operation mode
- flashes once per 1 s the device is in the calibration mode
- flashes 4x: the device confirms a parameter change, function switch position 4, 5, 6

8.1.2 Red LED flashing

To analyze the errors find the list in the chapter "Error codes" \rightarrow 🗎 75

Red LED indicates a fault.

- Warning: LED flashes 5x per second
 - capacitance at probe is too high
 - probe insulation break detection
 - FEI50H is defective
- Alarm: LED flashes 1x per second the temperature in the electronic insert is over the permitted range

8.2 System error messages

8.2.1 Error signal

Errors occurring during commissioning or during operation are displayed as follows:

- error symbol, error code and error description on the display and operating module
- current output, can be set:
 - Max: 110%, 22 mA
 - Hold last value is retained
 - User-spec. value

8.2.2 Last errors

This function enables to call up a list of most recent errors.

8.2.3 Types of error

The alarm is represented by the symbol $\$ which appears on the display. An error message is also shown on the display.

The output signal assumes a value that can be specified with the "Output on alarm" function:

- Max: 110%, 22 mA
- Hold last value is retained
- User-spec. value

The warning is represented by the flashing symbol $\frac{1}{2}$ which appears on the display. An error message is shown on the display.

The device continues measuring.

8.2.4 Error codes

The error codes shown on the display are 4-digit codes:

Position 1: Type of error

- A alarm
- W warning

```
Positions 2-4:
```

refers to the error in according to with the error list

Alarm codes

- A 101, A 102, A 110, A 152
 Checksum error

 total reset and recalibration is necessary
- A 106
 - Downloading please wait wait until the downloading is complete
- A 111, A 112, A 113, A 114, A 115, A 155, A 164, A 171, A 404, A 405, A 407, A 408, A 409, A 410, A 411, A 412, A 413, A 414, A 415, A 416, A 417, A 418, A 421, A 422, A 423, A 424
 Electronics defective
- switch the device off and then on
- if the error persists contact Endress+Hauser Service
- A 116
 - Download error
 - repeat download or perform a total reset
 - A 426
 - Data of Sensor-DAT (EEPROM) not consistent
 - repeat download from the electronic insert or perform a total reset
- A 427
 - Current output not calibrated
 - repeat download or perform a total reset
- A 1121
- current output not calibrated
- contact Endress+Hauser-Service
- A 400
- Measured capacitance too high
- change measuring range, verify probe
- A 403 Measured capacitance too low
- verify probeA 420
 - No sensor DAT (EEPROM) available - exchange sensor
- A 428
 Probe insulation break detection
 verify probe
- A 1601
 Linearization curve not monotone for level
 re-enter linearization
- A 1604
 - Calibration faulty
 - correct calibration

Warning codes

- W103, W153
 Initializing Please wait
 - if the massage does no
 - if the message does not disappear after a few seconds replace the electronics
- W153
 - Initializing
 - if the message does not disappear after a few seconds replace the electronics
- W 425
 - Warning insulation defective
 - check insulation
- W 429
- Proof test active
- wait until the proof test is completed
- W 1601
 - Linearization curve not monotone for level re-enter linearization
- re-enter lineariz
- W 1611
- Level linearization points
- enter additional linearization points
- W 1662
 - The temperature at electronic insert too high (max. temp. at sensor exceeded) lower ambient temperature by suitable measures
- W 430

Data of probe and electronic insert not compatible - check probe, perform a total reset

• W 1671

Linearization table entered incorrectly - re-adjust table

■ W 1681

Current outside measuring range

- perform basic setup and check linearization
- W 1683 Current turn down calibration faulty
 - repeat calibration
- W 1801

Level simulation switched on

- switch off level simulation
- W 1802 Simulation switched on
 - switch off simulation
- W 1806
 - The current output is in simulation mode
 - set the current output to normal mode
- W 511
 - The electronic insert has lost calibration data
 - contact Endress+Hauser-Service

If none of the proposed remedial measures achieves the desired result, perform the reset $\rightarrow \cong 42$

8.3 Possible measuring errors


8.3.1 Measured value is incorrect

If the measured values are incorrect, follow this procedure:

- 1. Verify empty and full calibration.
- 2. Clean the probe.


3. Verify the probe.

- 4. Change the installation position. Do not mount the probe in a filling curtain.
- 5. Check ground from process connection to the tank wall. Resistance measurement must be $< 1 \Omega$.
- 6. For conductive media, check the probe insulation. Resistance measurement must be $> 800 \text{ k}\Omega$.
- 7. Increase the response time, if the surface is turbulent.

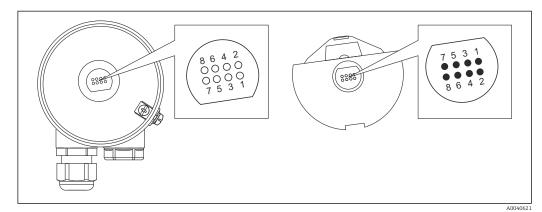

☑ 17 Electronic insert contacts

- 1 Guard
- 2 SDA_TXD
- 3 GND
- GND EEPROM
 GND
- $6 \quad DVCC \ 3 \ V_{DC}$
- 7 Probe
- 8 SCL RXD



8.4 Firmware history

Firmware V 01.00.zz / 08.2005

Updates:

- original-firmware
- operable with FieldCare version 2.08.00 and higher

Firmware V 01.03.zz / 02.2007

Updates:

expansion feature suitable for SIL 2 applications

9 Maintenance

No special maintenance work is required for the Liquicap M level transmitter.

9.1 External cleaning

Do not use a corrosive or aggressive cleaning agent to clean the housing surface and seals.

9.2 Cleaning the probe

Depending on the application, buildup of contamination or soiling can form on the probe rope. A high level of material buildup can affect the measurement result.

The regular cleaning of the probe rope is recommended if the medium tends to create a high level of buildup.

Make sure that the insulation of the probe rope is not damaged if hosing down or during mechanical cleaning.

Make sure that the probe rope insulation is resistant to cleaning agents.

9.3 Seals

The process seals of the sensor must be replaced periodically, especially when using molded aseptic seals!

The intervals between seal replacement depend on the frequency of the cleaning cycles and on the fluid and cleaning temperature.

9.4 Endress+Hauser services

Endress+Hauser offers a wide range of services.

Your Endress+Hauser Sales Center can provide detailed information on the services.

10 Repair

10.1 General notes

The Endress+Hauser repair and conversion concept provides the following:

- The measuring devices have a modular design.
- Spare parts are grouped into logical kits with the associated Installation Instructions.
- Repairs are carried out by Endress+Hauser Service or by appropriately trained customers.
- Certified devices can only be converted to other certified devices by Endress+Hauser Service or at the factory.

10.2 Spare parts

Find spare parts

Check whether it is possible to use the spare part for the measuring device.

- 1. Launch the Endress+Hauser Device Viewer via a web browser: www.endress.com/deviceviewer
- 2. Enter the order code or the product root in the respective field.
 - Once the order code or the product root has been entered, all the suitable spare parts are listed.
 - The product status is displayed.

Available drawings of the spare parts are displayed.

- 3. Locate the order code of the spare part set (on the product label on the package).
 - ► NOTE! The order code of the spare part set (on the product label on the package) can differ from the production number (on the label directly on the spare part)!
- 4. Check whether the order code of the spare part set appears in the list of the spare parts displayed:
 - YES: The spare part set may be used for the measuring device.
 NO: The spare part set may not be used for the measuring device.
 If you have any questions please contact your Endress+Hauser Service organization.
- 5. On the **Spare parts** tab click the PDF symbol in the **MH** column.
 - └ The Installation Instructions attached to the listed spare part are opened as a PDF file and can also be saved as a PDF file.
- 6. Click one of the drawings shown on the **Spare part drawings** tab.
 - └ The corresponding exploded drawing is opened as a PDF file and can also be saved as a PDF file.

10.3 Repairing Ex-certified devices

If repairing Ex-certified devices remember that:

- Ex-certified devices may only be repaired by experienced and skilled staff or by Endress+Hauser Service
- observe all applicable standards, certificates, national Ex-area regulations and all Safety Instructions (XA)
- use only genuine spare parts from Endress+Hauser
- note the device designation on the nameplate to order the spare parts
- replace the component by the same type
- carry out the replacing in accordance with the instructions

- carry out the individual test for the device
- change the device only with a device certificated by Endress+Hauser
- report every change and repair of the device

10.4 Replacement

After replacing a Liquicap M or the electronic insert, the calibration values must be transferred to the replacement device.

Options:

- if the probe is replaced, the calibration values in the electronic insert can be transferred to the sensor DAT (EEPROM) module via a manual download
- if the electronic insert is replaced, the calibration values of the sensor DAT (EEPROM) module can be transferred to the electronics via a manual upload

It is possible to restart the device without having to carry out a new calibration $\rightarrow \triangleq 63$.

10.5 Return

The requirements for safe device return can vary depending on the device type and national legislation.

- 1. Refer to the website for more information: http://www.endress.com/support/return-material
- 2. Return the device if repairs or a factory calibration are required, or if the wrong device was ordered or delivered.

10.6 Disposal

10.6.1 Removing the measuring device

1. Switch off the device.

WARNING

Danger to personnel from process conditions.

- Beware of hazardous process conditions such as pressure in the measuring device, high temperatures or aggressive fluids.
- 2. Carry out the mounting and connection steps from the "Mounting the measuring device" and "Connecting the measuring device" sections in reverse order. Observe the safety instructions.

10.6.2 Disposing of the measuring device

WARNING

Danger to personnel and environment from fluids that are hazardous to health.

Ensure that the measuring device and all cavities are free of fluid residues that are hazardous to health or the environment, e.g. substances that have permeated into crevices or diffused through plastic.

Observe the following notes during disposal:

- Observe valid federal/national regulations.
- ► Ensure proper separation and reuse of the device components.

11 Accessories

11.1 Protective cover

Protective cover for F13, F17 and F27 housing order number: 71040497

Protective cover for F16 housing order number: 71127760

11.2 Shortening set for FMI52

Shortening set for Liquicap M FMI52.

Order number: 942901-0001

11.3 Commubox FXA195 HART

For intrinsically safe HART communication with FieldCare via the RS232C interface or USB.

11.4 Surge arresters

11.4.1 HAW562

For supply lines: BA00302K.
For signal lines: BA00303K.

11.4.2 HAW569

For signal lines in field housing: BA00304K.

• For signal or supply lines in field housing: BA00305K.

11.5 Weld-in adapter

All available weld-in adapters are described in the document TI00426F.

The documentation is available in the Download section on Endress+Hauser web site: www.endress.com

12 Technical data

12.1 Probe

12.1.1 Capacitance values of the probe

The basic capacitance of the probe is approximately 18 pF.

12.1.2 Additional capacitance

Mount the probe at a minimum distance of 50 mm (1.97 in) from a conductive container wall:

approximately 1.0 pF/100 mm (3.94 in) in the air for a rope probe

Fully insulated probe rope in water: approximately 19 pF/100 mm (3.94 in)

12.1.3 Probe lengths for continuous measurement in conductive liquids

The maximum length of the rope probe is:

- < 6 m (20 ft) for capacitive range 0 to 2000 pF.
- > 6 m (20 ft) for capacitive range 0 to 4000 pF.

12.2 Input

12.2.1 Measured variable

Continuous measurement of change in capacitance between the probe rope and container wall, depending on the level of a liquid.

The probe covered -> high capacitance.


The probe not covered -> low capacitance.

12.2.2 Measuring range

- measuring frequency:
- 500 kHz
- span ∆C
 - recommended: 25 to 4000 pF
- possible: 2 to 4 000 pF
- final capacitance C_E: max. 4000 pF
- adjustable initial capacitance C_A:
 - 6 m (20 ft) 0 to 2000 pF
 - > 6 m (20 ft) 0 to 4000 pF

12.2.3 Measuring condition

Measuring range L1 is possible from the tip of the probe to the process connection.

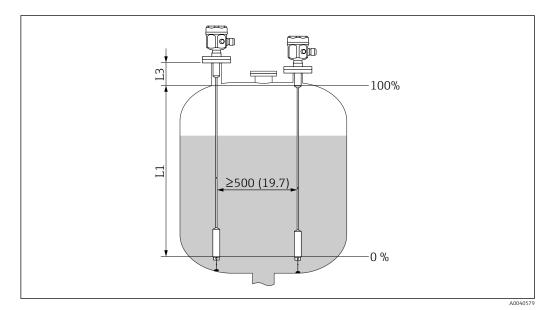

Unit of measurement mm (in)

L1 Measuring range

L3 Inactive length



When installing in a nozzle, use inactive length L3.

The 0 % and 100 % calibration can be inverted.

12.3 Output

12.3.1 Output signal

FEI50H (4 to 20 mA / HART version 5)

3.8 to 20.5 mA with HART protocol

12.3.2 Signal on alarm

FEI50H (4 to 20 mA / HART version 5)

Fault diagnosis can be called up via:

- red LED on the local display
- error symbol on the local display
- plain text on the display
- current output 22 mA
- digital interface: HART status error message

12.3.3 Linearization

FEI50H (4 to 20 mA / HART version 5)

The Liquicap M linearization function enables conversion of the measured value into any desired length or volume units. Linearization tables for volume calculation of horizontal cylindrical tanks and spherical tanks are pre-programmed. Any other tables with up to 32 value pairs can be input manually or semi-automatically.

12.4 Performance characteristics

12.4.1 Reference operating conditions

Room temperature: $+20 \degree C (+68 \degree F) \pm 5 \degree C (\pm 8 \degree F)$.

Span: $\Delta C = 25$ to 4000 pF recommended, 2 to 4000 pF possible.

12.4.2 Maximum measured error

Non-repeatability (reproducibility) as per DIN 61298-2: maximum ± 0.1 %

Non-linearity for limit point setting (linearity) as per DIN 61298-2: maximum $\pm 0.25~\%$

12.4.3 Influence of ambient temperature

Electronic insert

< 0.06 %/10 K related to the full-scale value

Separate housing

Change in capacitance of connecting cable 0.015 pF / m per K


12.4.4 Switch-on behavior

14 s, the stable measured value after the switch-on procedure, a start-up in safe status 22 mA

12.4.5 Measured value reaction time

Operating mode: $t_1 \le 0.3$ s

SIL operating mode: $t_1 \leq 0.5 \ s$

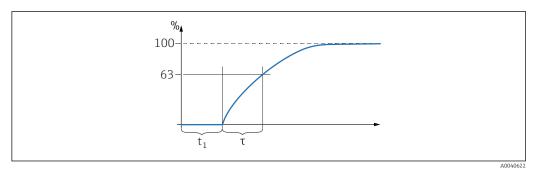

τ Time constant

 t_1 Dead time

12.4.6 Response time

FEI50H (4 to 20 mA / HART version 5)

The response time affects the speed at which the display and the current output react to changes in the level.

The factory setting for time constant $\tau = 1$ s; 0 to 60 s can be set.

In the software, the name for **Respone time** is **Output damping**.


12.4.7 Accuracy of factory calibration

Empty calibration (0%) and full calibration (100%):

- probe length < 2 m (6.6 ft)
 ≤ 5 mm (0.2 in)
- probe length > 2 m (6.6 ft) approximately ≤ 2 %

Reference conditions for the factory calibration:

- medium conductivity $\geq 100 \ \mu S/cm$
- minimum distance to tank wall = 250 mm (9.84 in)

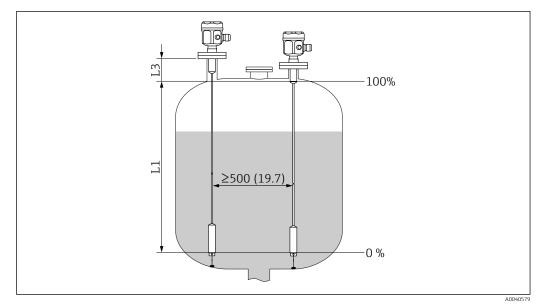

Unit of measurement mm (in)

L1 Measuring range from the tip of the probe to the process connection

L3 The inactive length

In an installed state, recalibration is only necessary when:

- the 0 % or the 100 % values have to be adjusted specifically for the customer
- the liquid is not conductive
- the probe distance to the tank wall is < 250 mm (9.84 in)

12.4.8 Resolution

Analog in % (4 to 20 mA)

- 11 bit/ 2 048 steps, 8 μA
- the resolution of the electronics can be directly converted to units of length of the probe e.g. rope probe length is 1000 mm, resolution equals 1000 mm/2048 = 0.48 mm

12.5 Operating conditions: Environment

12.5.1 Ambient temperature range

- F16 housing: -40 to +70 °C (-40 to +158 °F)
- remaining housing: -50 to +70 °C (-58 to +158 °F)
- observe derating
- use a protective cover, when operating outdoors

12.5.2 Climate class

DIN EN 60068-2-38/IEC 68-2-38: Z/AD check

12.5.3 Vibration resistance

DIN EN 60068-2-64/IEC 68-2-64: 20 to 2000 Hz, 0.01 g^2 /Hz

12.5.4 Shock resistance

DIN EN 60068-2-27/IEC 68-2-27: 30g acceleration

12.5.5 Cleaning

Housing:

Make sure that the housing surface and seals are resistant to cleaning agents.

Probe:

Depending on the application, buildup of contamination or soiling can form on the rope. A high level of material buildup can affect the measurement result.

The regular cleaning of the rope is recommended if the medium tends to create a high level of buildup.

Make sure that the insulation of the rope is not damaged if hosing down or during mechanical cleaning.

12.5.6 Degree of protection

All protection degree regarding EN60529.

NEMA4X protection degree regarding NEMA250.

Polyester housing F16

Protection degree:

- IP66
- IP67
- NEMA 4X

Stainless steel housing F15

- Protection degree:
- IP66
- IP67
- NEMA 4X

Aluminum housing F17

Protection degree:

- IP66
- IP67
- NEMA 4X

Aluminum housing F13 with gas-tight process seal

Protection degree:

- IP66
- IP68 ¹⁰⁾
- NEMA 4X

Stainless steel housing F27 with gas-tight process seal Protection degree:

- IP66
- IP67
- IP68¹⁰⁾
- NEMA 4X

Aluminum housing T13 with gas-tight process seal and separate connection compartment (Ex d)

Protection degree:

- IP66
- IP68¹⁰⁾
- NEMA 4X

¹⁰⁾ Only with M20 cable entry or $G\frac{1}{2}$ thread.

Separate housing

Protection degree:

- IP66
- IP68¹⁰⁾
- NEMA 4X

12.5.7 Electromagnetic compatibility (EMC)

Interference emission to EN 61326, Electrical Equipment Class B. Interference immunity to EN 61326, Annex A (Industrial) and NAMUR Recommendation NE 21 (EMC).

Failure current is in accordance with NAMUR NE43: FEI50H = 22 mA.

A standard commercial instrument cable can be used.

Information on connecting shielded cables is provided in Technical Information TI00241F "EMC test procedures".

12.6 Operating conditions: Process


12.6.1 Process temperature range

The following diagrams apply for:

- insulation
 - PTFE
 - PFA
 - FEP
- standard applications outside hazardous areas

The temperature is restricted to $T_a - 40 \degree C$ (-40 $\degree F$) when the polyester housing F16 is used or if additional option B is selected: free from paint-wetting impairment substances, only FMI51.


Probe with compact housing

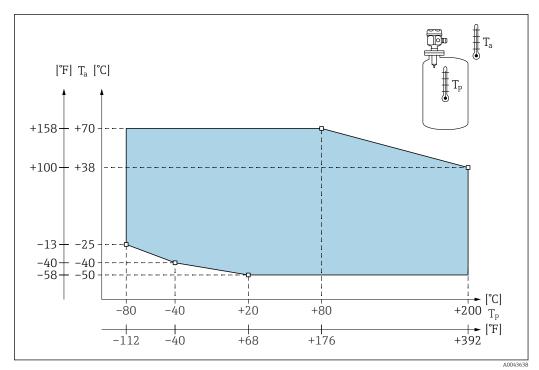

T_a Ambient temperature

T_p Process temperature

Probe with separate housing

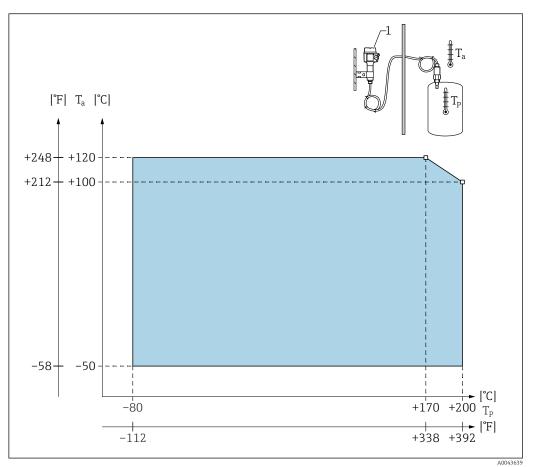

T_a Ambient temperature

T_p Process temperature

1 The permitted ambient temperature at the separate housing is the same as indicated for the compact housing.

Influence of process temperature

Error in case of fully insulated probes typically 0.13 %/K related to the full-scale value.

12.6.2 Process pressure limits

The process pressure limits depends on process connections.



See also chapter "Process connections" in TI01521F.

Rope probe without inactive length or with inactive length in 316L

E+H Configurator settings:

- Feature: 20
- Options: 1, 2, 5
- -1 to 25 bar (-14.5 to 362.5 psi)
- -1 to 100 bar (-14.5 to 1450 psi)
- in regards to an inactive length, the maximum permitted process pressure is 63 bar (913.5 psi)
- for CRN approval and inactive length: the maximum permitted process pressure is 32 bar (464 psi)

Rope probe with fully insulated inactive length

E+H Configurator settings:

- Feature: 20
 - Options: 3, 6

-1 to 50 bar (-14.5 to 725 psi)

Refer to the following standards for the pressure values permitted at higher temperatures:

- EN 1092-1: 2005 Table, Appendix G2 With regard to its resistance and temperature property, the material 1.4435 is identical to 1.4404 (AISI 316L) which is grouped under 13E0 in EN 1092-1 Tab. 18. The chemical composition of the two materials can be identical.
- ASME B 16.5a 1998 Tab. 2-2.2 F316
- ASME B 16.5a 1998 Tab. 2.3.8 N10276
- JIS B 2220

The lowest value from the derating curves of the device and the selected flange applies.


12.6.3 Pressure and temperature derating

For rope probes without inactive length or with inactive length in 316L, process connections ³/₄", 1", flanges <DN50, <ANSI 2", <JIS 10K and process connections ³/₄", 1", flanges <DN50, <ANSI 2", <JIS 10K

Rope insulation: FEP, PFA

E+H Configurator settings:


- Feature: 20
- Options: 1, 2, 5

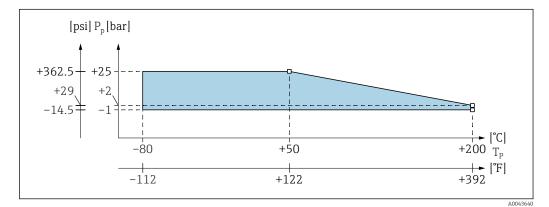



- *P_p Process pressure*
- *T_p Process temperature*

For rope probes without inactive length or with inactive length in 316L, process connections 1½", flanges \geq DN50, \geq ANSI 2", \geq JIS 50A

Rope insulation: FEP, PFA





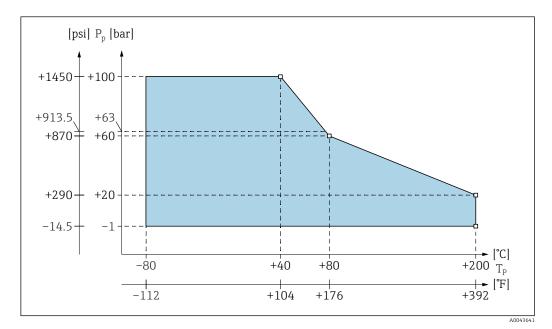


P_p Process pressure

 T_p Process temperature


63 Process pressure for probes with an inactive length

For rope probe with a fully insulated inactive length

Rope insulation: FEP, PFA



- Feature: 20
- Options: 3, 6

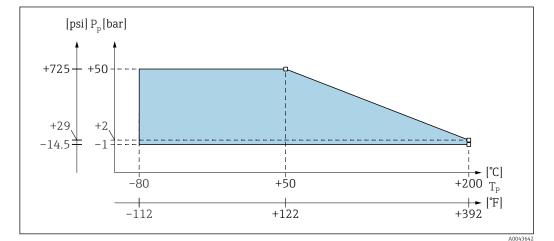

P_p Process pressure

T_p Process temperature

Index

0...9

4 mA threshold
A About this document
Ambient temperature range 86

В

-	
Basic safety instructions	10
Basic setup without the display or operating module	38

С

Cable specification
Calculating the calibration data with CapCalc 71
Capacitance values of the probe
CE mark 10
Certificates
Cleaning the probe
Climate class
Commissioning
Commubox FXA195 HART 81
Conical threads
Connecting HART
Connecting requirements
Connection compartment
Connector
Cylindrical threads

D

Declaration of Conformity	10
Degree of protection	87
Diagnostic information via LEDs	74
Diagnostics and troubleshooting	74
Display and operating elements	30
Disposal	80
Document	
Function	
Document conventions	
Document function	. 6
Documentation	
Dry calibration for interface measurement	71

Ε

Editing functions with the picklist	34
Editing numeric and alphanumeric functions	34
Editing the probe and application-specific data	72
Effects of a reset	36
Electrical connection	24
Electromagnetic compatibility	88
Endress+Hauser services	
Repair	78
Environment	86
Error codes	75

Error messages	35 74
Explosive area	10
Explosive area	16
Extension heights: separate nousing	78
	70
F	
FEI50H electronic insert	29
FieldCare	70
Function	70
Firmware history	
Function codes	32
Function switch: position 1.	
Operation	39
Function switch: position 2	
Carry out empty calibration - for almost empty	
tanks	39
Function switch: position 2.	
Carry out empty calibration - for empty tanks	39
Function switch: position 3	
Carry out full calibration - for almost full tanks	40
Carry out full calibration - for full tanks	
Function switch: position 4	
Measuring modes	41
Function switch: position 5	
Measuring range	41
Function switch: position 6	
Proof test - self-test	42
Function switch: position 7	
Reset - restore factory settings	42
Function switch: position 8	
Download or upload sensor DAT (EEPROM)	42
Function: "Actual error"	67
Function: "Basic setup"	45
Function: "Device information"	69
Function: "Display format"	67
Function: "Electronic temp."	68
Function: "Extended calibr."	62
Function: "HART settings"	64
Function: "Language"	67
Function: "Last error"	68
Function: "Linearization"	59
Function: "Measure capacity"	68
Function: "Medium property"	46
Function: "Operating mode"	52
Function: "Output damping"	49
Function: "Output on alarm"	53
Function: "Password / reset"	68
Function: "Proof test"	
Self-test	
Function: "Safety settings"	53
Function: "Simulation"	65
Function: Output / Calculat	
Funktion: "Output/Calculat."	63

G

Green LED flashing	74
Н	
I landrug no logic complimations	21

Hardware key combinations	I
Hygienic compatibility	3

I

Incoming acceptance	11
Influence of ambient temperature	
Initial commissioning	
Input	83
Installation and function check	38
Installation examples	14
Installation instructions	20
Interface measurement	71

К

Key locking	35
Key symbols	31
Key unlocking	36

L

L	
Last errors	74
Launching menus	33
Linearization	84
Locking and unlocking configuration	35

М

M12 connector	25
Maintenance	78
Maximum	
measured error	84
Measured value is incorrect	76
Measured value reaction time	85
Measured variable	83
Measuring condition 13,	83
Measuring device	
Conversion	79
Disposal	80
Removing	80
Repairs	
Measuring range	
Menu structures: Main menu	
Menu: "Basic setup"	
Commissioning with display and operating module	
	43
Menu: "Device properties"	65
Menu: "Linearization"	
Menu: "Output"	62
Menu: "Safety setting"	50
Menu: "Simulation"	65
Minimum probe length for nonconductive media	13
Mounting	12
Mounting requirements	12
Mounting the sensor	
0	

0

Operating conditions	86
Operating conditions: Process	88

Operating mode: "Empty calibr."	
Function - "Dry"	47
Function - "Wet"	46
Operating mode: "Empty calibration"	
Function - "Dry" for "Interface" or "Unknown"	
medium properties	48
Operating mode: "Full calibr."	
Function - "Wet"	47
Operating mode: "Full calibration"	
Function - "Dry"	
Conductive and nonconductive media	48
Function - "Dry" for "Interface" or "Unknown"	
medium properties	49
Operation	70
Operation options	29
Operation via FieldCare Device Setup	37
Operation via the optional display and operating	
module	30
Operational safety	10
Output	84
Output damping	85
Output signal	84
Overview of operation options	29

Ρ

-
Performance characteristics
Performing a reset
Pipe mounting
Possible measuring errors
Post-connection check
Post-installation check
Potential equalization
Pressure and temperature derating
Probe installation
Probe length
Probe with PTFE-clad flange
Probe with separate housing
Probe with Tri-Clamp 21
Process pressure limits
Process temperature range
Product identification
Product safety
Protective cover

Q

Quick installation	guide										•		12

R

Red LED flashing	74
Reference operating conditions	84
Registered trademarks	. 9
Repair	
Repairing Ex-certified devices	79
Replacement	
Device components	
Requirements for the personnel	10
Resetting to factory setting - reset	36
Resolution	86
Response time	85

Return to the measured value display	
S	
Sealing the probe housing	22
Seals	
Selecting a function and subfunction	
Selecting a submenu	
Shock resistance	
Shortening set	00
for FMI52	81
Shortening the connecting cable	
Signal on alarm	
Software locking	
Spare parts	
Special functions when making entries	
Storage	
Subfunction: "Cal. type"	
Subfunction: "Cap. empty"	
Subfunction: "Cap. full"	
Subfunction: "Code"	
Subfunction: "Confirm cal."	
Subfunction: "Curr. turn down"	
Subfunction: "Current run time"	69
Subfunction: "Current span"	64
Subfunction: "Customer unit"	59
Subfunction: "Customized text"	59
Subfunction: "DC value"	46
Subfunction: "DD version"	69
Subfunction: "Dev. rev"	69
Subfunction: "Device marking"	69
Subfunction: "Diameter"	59
Subfunction: "EC Serial No."	69
Subfunction: "Edit"	59
Subfunction: "Electronic temp."	
Subfunction: "Format"	67
Subfunction: "HART address"	
Subfunction: "Intermed. height"	59
Subfunction: "Max. capacity val."	
Subfunction: "Max. scale"	
Subfunction: "Max. temp."	
Subfunction: "Measure capacity" 46, 47,	
Subfunction: "Medium property" 41, 45,	
Subfunction: "Min. capacity val."	
Subfunction: "Min. temp."	
Subfunction: "Min/Max capacity"	
Subfunction: "Min/Max temp."	
Subfunction: "Mode"	
Subfunction: "No. of decimals"	
Subfunction: "No. of preambles"	
Subfunction: "Operating mode" 51, 52,	53
Subfunction: "Output 1"	51
Subfunction: "Output damping" 51,	53
Subfunction: "Output value"	
Subfunction: "Output"	
Subfunction: "Parameter okay	
Subfunction: "Parameter okay"	
Subfunction: "Probe length"	
Subfunction: "Proof test"	54

Subfunction: "Reset"Subfunction: "Sensitivity"Subfunction: "Sensor DAT stat."Subfunction: "Sensor DAT"Subfunction: "Sin No."Subfunction: "Sin No."Subfunction: "Sim level value" or "Sim. vol. value"Subfunction: "Simulation value"Subfunction: "Simulation"Subfunction: "Software version"Subfunction: "Status table"	70 63 67 69 64 52 65 65 65 69 60
Subfunction: "Status"	68 56 46
nonconductive medium . Subfunction: "Value empty"	53 48 69 67 62 64 69 25 81 84 . 7 31
TTechnical data .Technical data: probe .Technical Information .Terminal assignment .The operating menu .The table editor .Transport .Turn down 4 mA .Types of error .	82 . 8 26 32 60 11
U Using the reset	36
V Vibration resistance	86
W Wall bracket	17 18 81 73 25 10



www.addresses.endress.com

