Valid as of version 01.06.zz (Device firmware) Products Solutions

Services

Special Documentation Proline Promass 500 HART

Web server







Table of contents

T	Document information	. 4
1.1	Document function	4
1.2	Target group	. 4
1.3	Using this document	4
1.4	Symbols	. 4
2	Basic safety instructions	6
2.1	Requirements for the personnel	. 6
2.2	Designated use	
2.3	Workplace safety	
2.4	Operational safety	
2.5	Product safety	
2.6	IT security	
2.7	Device-specific IT security	. 7
3	Product features and availability	10
3.1	Product features	10
3.2	Availability	10
3.3	Identification in the measuring device	10
4	Commissioning	12
4.1	Prerequisites - computer	12
4.2	Prerequisites - measuring device	17
4.3	Connecting the computer to the measuring device	17
4.4	Establishing a connection to the Web server.	19
4.5	Setting the IP address	20
4.6	Overview of the Web server parameters	20
5	Operation options	23
	_	
5.1	Logging on	23 24
5.2 5.3	User interface	24 25
5.5	Logging out	40
6	Diagnostics and troubleshooting	26
6.1	General Web server troubleshooting	26
6.2	Diagnostic information in the Web browser	27
6.3	Diagnostic information in the measuring	
	device	28
6.4	Checking the network connection	28
7	Tachnical data	20

1 Document information

1.1 Document function

This manual is a Special Documentation; it does not replace the Operating Instructions pertaining to the device. It serves as a reference for using the Web server integrated in the measuring device.

1.2 Target group

The document is aimed at specialists who work with the device over the entire life cycle and perform specific configurations.

1.3 Using this document

1.3.1 Information on the document structure

This Special Documentation contains a range of information, including:

- Prerequisites for use on the computer and measuring device
- Connection of the computer via the service interface or WLAN interface
- Configuration of the communication interface
- Establishing a connection
- Diagnostics and troubleshooting

1.3.2 Device documentation

The Technical Documentation for the measuring device is available:

- Via the *W@M Device Viewer*: enter the serial number from the nameplate (www.endress.com/deviceviewer).
- Via the *Endress+Hauser Operations App*: enter the serial number from the nameplate or scan the 2-D matrix code (QR code) on the nameplate.
- Technical documentation is also available from the Downloads area of the Endress +Hauser website: www.endress.com → Downloads. However this technical documentation applies to a particular instrument family and is not assigned to a specific measuring device.

1.4 Symbols

1.4.1 Safety symbols

⚠ DANGER

This symbol alerts you to a dangerous situation. Failure to avoid this situation will result in serious or fatal injury.

WARNING

This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in serious or fatal injury.

A CAUTION

This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in minor or medium injury.

Proline Promass 500 HART Document information

NOTICE

This symbol contains information on procedures and other facts which do not result in personal injury.

1.4.2 Symbols for certain types of Information

Symbol	Meaning
✓	Permitted Indicates procedures, processes or actions that are permitted.
×	Forbidden Indicates procedures, processes or actions that are forbidden.
i	Tip Indicates additional information.
	Reference to documentation
A	Reference to page
	Reference to graphic
•	Notice or individual step to be observed
1., 2., 3	Series of steps
L_	Result of a step

1.4.3 Symbols in graphics

Symbol	Meaning
1, 2, 3,	Item numbers
1., 2., 3	Series of steps

2 Basic safety instructions

2.1 Requirements for the personnel

The personnel for installation, commissioning, diagnostics and maintenance must fulfill the following requirements:

- ► Trained, qualified specialists must have a relevant qualification for this specific function and task.
- ► Are authorized by the plant owner/operator.
- ► Are familiar with federal/national regulations.
- ▶ Before starting work, read and understand the instructions in the manual and supplementary documentation as well as the certificates (depending on the application).
- ▶ Follow instructions and comply with basic conditions.

The operating personnel must fulfill the following requirements:

- ► Are instructed and authorized according to the requirements of the task by the facility's owner-operator.
- ▶ Follow the instructions in this manual.

2.2 Designated use

2.3 Workplace safety

For work on and with the device:

Wear the required personal protective equipment according to federal/national regulations.

If working on and with the device with wet hands:

▶ It is recommended to wear gloves on account of the higher risk of electric shock.

2.4 Operational safety

Risk of injury!

- ▶ Operate the device only if it is in proper technical condition, free from errors and faults.
- ► The operator is responsible for the interference-free operation of the device.

Modifications to the device

Unauthorized modifications to the device are not permitted and can lead to unforeseeable dangers!

▶ If modifications are nevertheless required, consult with the manufacturer.

2.5 Product safety

This measuring device is designed in accordance with good engineering practice to meet state-of-the-art safety requirements, has been tested, and left the factory in a condition in which it is safe to operate.

It meets general safety standards and legal requirements. It also complies with the EU directives listed in the device-specific EU Declaration of Conformity. Endress+Hauser confirms this by affixing the CE mark to the device.

Proline Promass 500 HART Basic safety instructions

Furthermore, the device meets the legal requirements of the applicable UK regulations (Statutory Instruments). These are listed in the UKCA Declaration of Conformity along with the designated standards.

By selecting the order option for UKCA marking, Endress+Hauser confirms a successful evaluation and testing of the device by affixing the UKCA mark.

Contact address Endress+Hauser UK: Endress+Hauser Ltd. Floats Road Manchester M23 9NF United Kingdom www.uk.endress.com

2.6 IT security

Our warranty is valid only if the product is installed and used as described in the Operating Instructions. The product is equipped with security mechanisms to protect it against any inadvertent changes to the settings.

IT security measures, which provide additional protection for the product and associated data transfer, must be implemented by the operators themselves in line with their security standards.

2.7 Device-specific IT security

The device offers a range of specific functions to support protective measures on the operator's side. These functions can be configured by the user and guarantee greater inoperation safety if used correctly. An overview of the most important functions is provided in the following section:

Function/interface	Factory setting	Recommendation
Write protection via hardware write protection switch → 🖺 7	Not enabled	On an individual basis following risk assessment
Access code (also applies for Web server login or FieldCare connection) → 🖺 8	Not enabled (0000)	Assign a customized access code during commissioning
WLAN (order option in display module)	Enabled	On an individual basis following risk assessment
WLAN security mode	Enabled (WPA2- PSK)	Do not change
WLAN passphrase (password) → 🖺 8	Serial number	Assign a customized WLAN passphrase during commissioning
WLAN mode	Access point	On an individual basis following risk assessment
Web server → 🖺 8	Enabled	On an individual basis following risk assessment
OPC-UA → 🗎 9	_	On an individual basis following risk assessment
CDI-RJ45 service interface → 🗎 9	_	On an individual basis following risk assessment

2.7.1 Protecting access via hardware write protection

Write access to the parameters of the device via the local display, Web browser or operating tool (e.g. FieldCare, DeviceCare) can be disabled via a write protection switch (DIP switch on the main electronics module). When hardware write protection is enabled, only read access to the parameters is possible.

Hardware write protection is disabled when the device is delivered.

2.7.2 Protecting access via a password

Different passwords are available to protect write access to the device parameters or access to the device via the WLAN interface.

User-specific access code

Protect write access to the device parameters via the local display, Web browser or operating tool (e.g. FieldCare, DeviceCare). Access authorization is clearly regulated through the use of a user-specific access code.

WLAN passphrase

The network key protects a connection between an operating unit (e.g. notebook or tablet) and the device via the WLAN interface which can be ordered as an option.

■ Infrastructure mode

When the device is operated in infrastructure mode, the WLAN passphrase corresponds to the WLAN passphrase configured on the operator side.

User-specific access code

Write access to the device parameters via the local display, Web browser or operating tool (e.g. FieldCare, DeviceCare) can be protected by the modifiable, user-specific access code.

When the device is delivered, the device does not have an access code and is equivalent to 0000 (open).

WLAN passphrase: Operation as WLAN access point

A connection between an operating unit (e.g. notebook or tablet) and the device via the WLAN interface, which can be ordered as an optional extra, is protected by the network key. The WLAN authentication of the network key complies with the IEEE 802.11 standard.

When the device is delivered, the network key is pre-defined depending on the device. It can be changed via the **WLAN settings** submenu in the **WLAN passphrase** parameter.

Infrastructure mode

A connection between the device and WLAN access point is protected by means of an SSID and passphrase on the system side. Please contact the relevant system administrator for access.

General notes on the use of passwords

- The access code and network key supplied with the device should be changed during commissioning.
- Follow the general rules for generating a secure password when defining and managing the access code or network key.
- The user is responsible for the management and careful handling of the access code and network key.

2.7.3 Access via Web server

The Web server is enabled when the device is delivered. The Web server can be disabled if necessary (e.g. after commissioning) via the **Web server functionality** parameter.

The device and status information can be hidden on the login page. This prevents unauthorized access to the information.

[i

For detailed information on device parameters, see:

The "Description of Device Parameters" document

Proline Promass 500 HART

2.7.4 Access via OPC-UA

The following Security Modes are supported as per the OPC UA Specification (IEC 62541):

- None
- Basic128Rsa15 signed
- Basic128Rsa15 signed and encrypted

Username and password

Authentication is via a username and login password.

The fixed username defined for OPC UA is "Maintenance". It cannot be changed. Access is only possible in the maintenance user role.

The password corresponds to the login password. A change in the login password affects the user.

2.7.5 Access via service interface (CDI-RJ45)

The device can be connected to a network via the service interface (CDI-RJ45). Device-specific functions quarantee the secure operation of the device in a network.

The use of relevant industrial standards and guidelines that have been defined by national and international safety committees, such as IEC/ISA62443 or the IEEE, is recommended. This includes organizational security measures such as the assignment of access authorization as well as technical measures such as network segmentation.



Transmitters with an Ex de approval may not be connected via the service interface (CDI-RJ45)!

Order code for "Approval transmitter + sensor", options (Ex de): BA, BB, C1, C2, GA, GB, MA, MB, NA, NB

3 Product features and availability

3.1 Product features

Thanks to the integrated Web server the device can be operated and configured via a Web browser and via the service interface (CDI-RJ45) or via the WLAN interface. The structure of the operating menu is the same as for the local display. In addition to the measured values, device status information is also displayed and allows users to monitor the status of the device. Furthermore the device data can be managed and the network parameters can be configured.

A device that has a WLAN interface (can be ordered as an option) is required for the WLAN connection: order code for "Display; operation", option G "4-line, illuminated; touch control + WLAN". The device acts as an Access Point and enables communication by computer or a mobile handheld terminal.


3.2 Availability

The integrated Web server is a standard feature. It does not need to be ordered for the device ex works as it is provided as standard when the device is delivered to the customer. Connection is via the APL field switch and Ethernet switch.

3.3 Identification in the measuring device

An adhesive label on the inside of the electronics compartment cover or the connection compartment describes all the available hardware components, and their functions, for the measuring device. The service interface (CDI-RJ45) has the following identification:


3.3.1 **Proline 500 – digital**

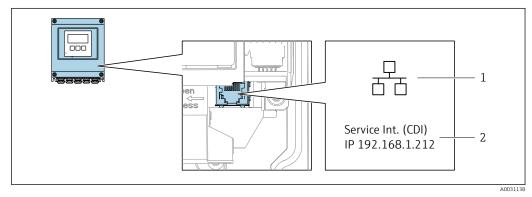

■ 1 Example of the CDI-RJ45 service interface

- 1 Symbol for service interface
- 2 Information on the default setting for the WLAN IP address

Proline 500 3.3.2

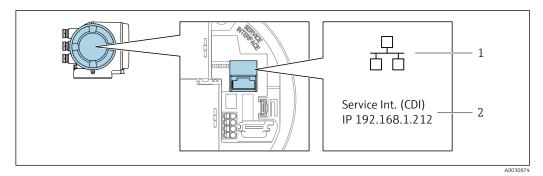

₽ 2 Example of the CDI-RJ45 service interface

- Symbol for service interface Information on the default setting for the WLAN IP address

4 Commissioning

Establishing a connection to the integrated Web server

- 3. Connect the measuring device to the computer $\rightarrow \blacksquare 17$.
- 4. Establish a connection to the Web server $\rightarrow \triangleq 19$.
- - ► The measuring device can be operated via the Web server.

4.1 Prerequisites - computer

4.1.1 Hardware

Hardware	Interface	
	CDI-RJ45	WLAN
Interface	The computer must have an RJ45 interface.	The operating unit must have a WLAN interface.
Connection	Ethernet cable with RJ45 connector.	Connection via Wireless LAN.
Screen	Recommended size: ≥12" (depends on the screen resolution)	

4.1.2 Software

Software	Interface	
	CDI-RJ45	WLAN
Recommended operating systems	 Microsoft Windows 8 or higher. Mobile operating systems: iOS Android Microsoft Windows XP is supported. Microsoft Windows 7 is supported. 	
Web browsers supported	 Microsoft Internet Explorer 8 or higher Microsoft Edge Mozilla Firefox Google Chrome Safari 	

4.1.3 Configuring the computer


Settings	Interface	
	CDI-RJ45	WLAN
User rights	Appropriate user rights (e.g. administrator rights) for TCP/IP and proxy server settings are necessary (for adjusting the IP address, subnet mask etc.).	
Proxy server settings of the Web browser	The Web browser setting <i>Use proxy server for LAN</i> must be disabled .	

Proline Promass 500 HART Commissioning

Settings	Interface	
	CDI-RJ45	WLAN
JavaScript	JavaScript must be enabled.	
	1	2/servlet/basic.html in the address bar of the onal but simplified version of the operating
	 <u> </u> 	ware version: To enable correct data display, y (cache) of the Web browser under Internet
Network connections	Only the active network connections to the measuring device should be used.	
	Switch off all other network connections such as WLAN.	Switch off all other network connections.

Configuring IP settings for Windows


- To configure the IP settings, appropriate user rights (e.g. administrator rights) are required for the computer.
 - Before configuring the IP settings, close all the windows of the Web browser.
- 1. Click Start (Windows icon).
 - ► The Start menu appears.
- 2. In the Start menu, select Control Panel.
 - This opens a new window with the control panel elements.

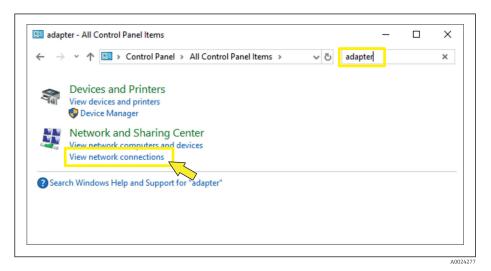


3. Enter the term "adapter" in the search field.

└─ The *Network and Sharing Center* is listed in the search results.

- 4. Select the Network Connections option under Network and Sharing Center.
 - └ This opens a new window with the network connections.

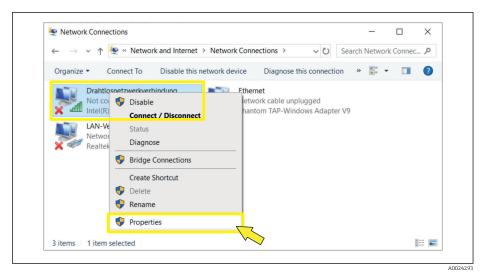


- 5. In the window, select the *Ethernet or wireless network connection* network adapter for the connection.
- 6. Right-click to open the picklist and select *Properties*.
 - ► The *Local Area Connection Properties* dialog box opens.

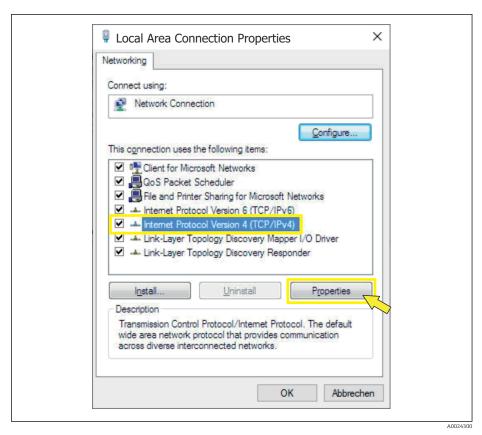

7. Select the *Internet Protocol Version 4 (TCP/IPv4)* item.

Proline Promass 500 HART Commissioning

- 8. Click the *Properties* button.
 - ► The *Internet Protocol Version 4 (TCP/IPv4) Properties* window opens.

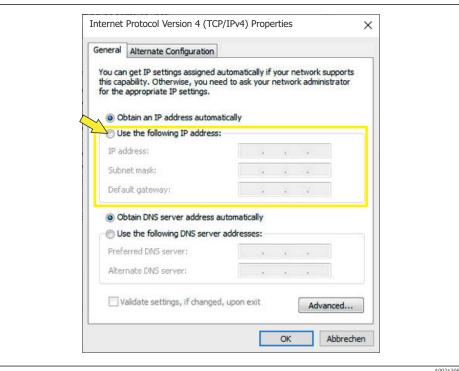

- 9. In the General tab, select the Use the Following IP Address option.
- 10. Enter the IP address, subnet mask and default gateway as indicated in the following table and then click *Ok* to confirm.

Standard settings for IP address, subnet mask and default gateway

IP address	192.168.1.XXX	
	For XXX, all sequences of numbers apart from: 0, 212 and 255 \rightarrow e.g. 192.168.1.213	
Subnet mask	255.255.255.0	
Default gateway	192.168.1.212 or leave cells empty	

The standard settings correspond to those for private networks. In the case of Ethernet-based networks, the settings can deviate from this standard setting and may need to be changed.


Changing the proxy server settings

To establish communication, the proxy server setting *Use a Proxy Server for Your LAN* must be deselected for the Web browser.

To change the proxy server setting, appropriate user rights (e.g. administrator rights) are required for the computer.


Changing the proxy server settings taking Internet Explorer as the sample browser

- 1. Open the Web browser.
- 2. In the Options menu, select the Internet Options item.
 - This opens a new window with the Internet options.

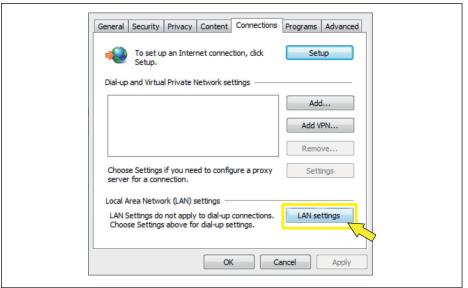

A00243

- 3. Select the *Connections* tab.
- 4. Under Local Area Network Settings click the LAN Settings button.
 - └ This opens a new window with the *Local Area Network Settings*.

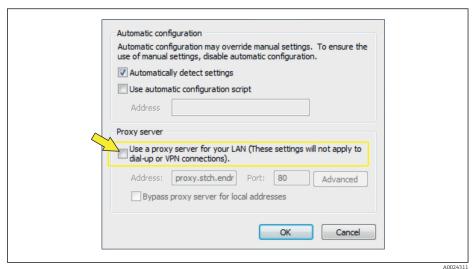

.

5. Deselect the *Use a Proxy Server for Your LAN* checkbox and then click *Ok* to confirm.

Proline Promass 500 HART Commissioning

4.2 Prerequisites - measuring device

4.2.1 Enabling the web server

The web server must be enabled in the measuring device (default setting).

If the web server is disabled, it can be enabled again via the **Web server functionality** parameter ($\Rightarrow \triangleq 22$). To do so, users can choose from the following operation options:

- Local display
- Operating tool e.g. FieldCare, DeviceCareAMS Device Manager, SIMATIC PDM

4.2.2 Determining the IP address of the measuring device

The IP address of the device is required to establish communication between the device (Web server) and a computer (client). The device has the default fixed IP address: 192.168.1.212. This can be entered in the Web browser on the computer to establish communication.

Using the local display or operating tool

The **IP** address parameter can be used to determine the IP address via the local display or an operating tool e.g. FieldCare, DeviceCare, AMS Device Manager, SIMATIC PDM.

4.3 Connecting the computer to the measuring device

The measuring device can be connected to the computer via:

- Service interface (CDI-RJ45)
- WLAN interface

4.3.1 Via service interface (CDI-RJ45)

Preparing the measuring device

Proline 500 - digital

- 1. Loosen the 4 fixing screws on the housing cover.
- 2. Open the housing cover.
- 3. The location of the connection socket depends on the measuring device and the communication protocol:

Connect the computer to the RJ45 plug via the standard Ethernet connecting cable $\rightarrow \blacksquare 10$.

Proline 500

- 1. Depending on the housing version:

 Loosen the securing clamp or fixing screw of the housing cover.
- 2. Depending on the housing version:
 Unscrew or open the housing cover.
- 3. The location of the connection socket depends on the measuring device and the communication protocol:

Connect the computer to the RJ45 plug via the standard Ethernet connecting cable $\rightarrow \blacksquare 10$.

Configuring the Internet protocol of the computer

The following information refers to the default Ethernet settings of the device.

IP address of the device: 192.168.1.212 (factory setting)

Commissioning Proline Promass 500 HART

NOTICE

Risk of electric shock! Components carry dangerous voltages!

- ▶ Never open the measuring device while it is connected to the supply voltage.
- ► The information and safety instructions in the Operating Instructions pertaining to the measuring device must always be observed → 🖺 4.
- 1. Switch on the measuring device.
- 2. Connect to the computer using a cable $\rightarrow \triangleq 10$.
- 3. If a 2nd network card is not used, close all the applications on the notebook.
 - Applications requiring Internet or a network, such as e-mail, SAP applications, Internet or Windows Explorer.
- 4. Close any open Internet browsers.
- 5. Configure the properties of the Internet protocol (TCP/IP) as defined in the table:

IP address	192.168.1.XXX; for XXX all numerical sequences except: 0, 212 and 255 \rightarrow e.g. 192.168.1.213
Subnet mask	255.255.255.0
Default gateway	192.168.1.212 or leave cells empty

4.3.2 Via WLAN interface

Configuring the Internet protocol of the mobile terminal

NOTICE

If the WLAN connection is lost during the configuration, settings made may be lost.

▶ Make sure that the WLAN connection is not disconnected while configuring the device.

NOTICE

In principle, avoid simultaneous access to the measuring device via the service interface (CDI-RJ45) and the WLAN interface from the same mobile terminal. This could cause a network conflict.

- ▶ Only activate one service interface (CDI-RJ45 service interface or WLAN interface).
- ▶ If simultaneous communication is necessary: configure different IP address ranges, e.g. 192.168.0.1 (WLAN interface) and 192.168.1.212 (CDI-RJ45 service interface).

Preparing the mobile terminal

► Enable WLAN reception on the mobile terminal.

Establishing a connection from the mobile terminal to the measuring device

- 1. In the WLAN settings of the mobile terminal: Select the measuring device using the SSID (e.g. EH_Promass_500_A802000).
- 2. If necessary, select the WPA2 encryption method.
- 3. Enter the password: serial number of the measuring device ex-works (e.g. L100A802000).
 - LED on display module flashes: it is now possible to operate the measuring device with a web browser.
- The serial number can be found on the nameplate.
- To ensure the safe and swift assignment of the WLAN network to the measuring point, it is advisable to change the SSID name. It should be possible to clearly assign the new SSID name to the measuring point (e.g. tag name) because it is displayed as the WLAN network.

Proline Promass 500 HART Commissioning

Disconnecting

► After configuring the device: Terminate the WLAN connection between the operating unit and measuring device.

4.4 Establishing a connection to the Web server

4.4.1 Requirements

The IP settings in the measuring device and computer must match before a connection can be established successfully. In particular this concerns the IP addressing and Web browser settings.

The following conditions must be met to connect:

- The web server of the measuring device is enabled \rightarrow $\stackrel{\triangle}{=}$ 17.
- The IP address of the measuring device is known \rightarrow 🗎 17.
- $\mbox{ } \blacksquare$ The computer used meets the requirements for hardware and software .
- The measuring device and computer are connected to one another
- The measuring device is switched on.

4.4.2 Starting the Web browser

- If JavaScript cannot be enabled:
 Enter http://192.168.1.212/servlet/basic.html in the address bar of the web browser.
 A fully functional but simplified version of the operating menu structure starts in the Web browser.
- When installing a new firmware version: To enable correct data display, clear the temporary memory (cache) of the Web browser under **Internet options**.
- 1. Start the Web browser on the computer.
- 2. Enter the IP address of the web server in the address line of the web browser: 192.168.1.212
 - ► The login page appears.
- \blacksquare If a login page does not appear, or if the page is incomplete \rightarrow \supseteq 26

4.5 Setting the IP address

The IP address of the measuring device is required to establish communication between the measuring device (Web server) and a computer (client).

Assign or specify the IP address via:	Description
Use of the default IP address 1)	 The measuring device uses the fixed IP address: 192.168.1.212 The device is connected via the CDI-RJ45 service interface.

¹⁾ Factory setting

4.6 Overview of the Web server parameters

4.6.1 Language

Navigation

"Operation" menu \rightarrow Web server language


Parameter overview with brief description

Parameter	Description	Selection	Factory setting
Web server language	Set web server language.	 English Deutsch Français Español Italiano Nederlands Portuguesa Polski pусский язык (Russian) Svenska Türkçe 中文 (Chinese) 日本語 (Japanese) 한국어 (Korean) tiếng Việt (Vietnamese) čeština (Czech) 	English

4.6.2 "Web server" submenu

Navigation

"Expert" menu \rightarrow Communication \rightarrow Web server

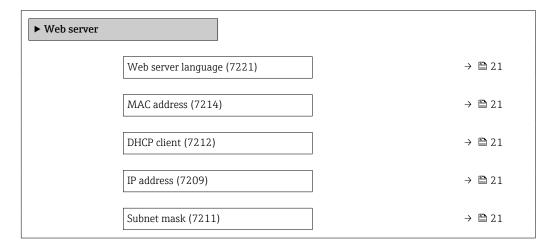

Proline Promass 500 HART Commissioning

Default gateway (7210)	→ 🖺 22
Web server functionality (7222)	→ 🖺 22
Login page (7273)	→ 🖺 22


Parameter overview with brief description

Parameter	Description	Selection / User interface / User entry	Factory setting
Web server language	Set web server language.	 English Deutsch Français Español Italiano Nederlands Portuguesa Polski русский язык (Russian) Svenska Türkçe 中文 (Chinese) 日本語 (Japanese) 한국어 (Korean) tiếng Việt (Vietnamese) čeština (Czech) 	English
MAC address	Displays the MAC address of the measuring device. MAC = Media Access Control	Unique 12-digit character string comprising letters and numbers, e.g.: 00:07:05:10:01:5F	Each measuring device is given an individual address.
DHCP client	Select to activate/deactivate DHCP client functionality. Effect If the DHCP client functionality of the web server is selected, the IP address, Subnet mask and Default gateway are set automatically. Identification is via the MAC address of the measuring device. The IP address in the IP address parameter is ignored as long as the DHCP client parameter is active. This is also the case, in particular, if the DHCP server cannot be reached. The IP address in the parameter of the same name is only used if the DHCP client parameter is inactive.	User entry English Deutsch Français Español Italiano Nederlands Portuguesa Polski pyccкий язык (Russian) Svenska Türkçe 中文 (Chinese) 日本語 (Japanese) ・ 한국어 (Korean) ・ tiếng Việt (Vietnamese) ・ čeština (Czech) Unique 12-digit character string comprising letters and numbers, e.g.:	
IP address	IP address of the Web server integrated in the measuring device. If the DHCP client is switched off and write access is enabled, the IP address can also be entered.		192.168.1.212
Subnet mask	Displays the subnet mask. If the DHCP client is switched off and write access is enabled, the Subnet mask can also be entered.	,	255.255.255.0

Parameter	Description	Selection / User interface / User entry	Factory setting
Default gateway	Displays the default gateway. If the DHCP client is switched off and write access is enabled, the Default gateway can also be entered.	4 octet: 0 to 255 (in the particular octet)	0.0.0.0
Web server functionality	Switch the Web server on and off.	OffHTML OffOn	On
Login page	Select format of login page.	Without headerWith header	With header


Proline Promass 500 HART Operation options

Operation options 5

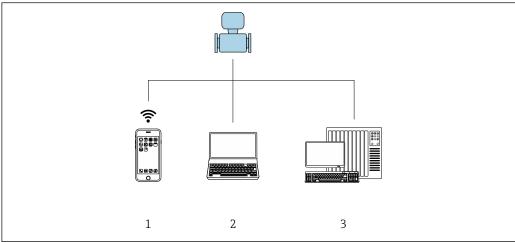

- **₽** 3 Example of a Proline flowmeter with an integrated web server
- Mobile end device with Web browser (e.g. Internet Explorer) and WLAN interface
- 2 Computer with Web browser (e.g. Internet Explorer), connection via cable or WLAN interface
- Control station via network

5.1 Logging on

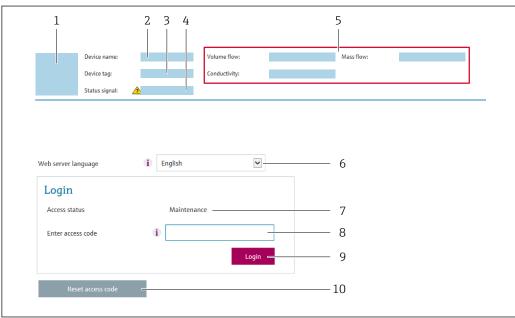

A0029413


- Picture of device
- Device name
- Tag name
- Status signal
- Current measured values
- Web server language
- User role
- 8 Access code
- Login
- Reset access code
- 1. Select the required operating language for the web browser (6).
- Enter the user-specific access code (8).
- 3. Confirm entry with **Login**(9).

Operation options Proline Promass 500 HART

Access code 0000 (default setting); can be changed by customer

If no action is performed for 10 minutes, the Web browser automatically returns to the login page.

5.2 User interface

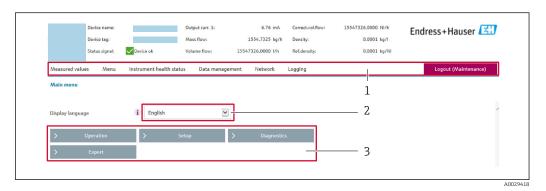

- 1 Function row
- 2 Local display language
- 3 Navigation area

5.2.1 Header

The following information appears in the header:

- Device name
- Device tag
- Device status with status signal \rightarrow $\stackrel{ riangle}{ riangle}$ 27
- Current measured values

5.2.2 Function row

Functions	Meaning
Measured values	Displays the measured values of the device
Menu	 Access to the operating menu from the measuring device The structure of the operating menu is the same as for the local display For detailed information on the structure of the operating menu, see the Operating Instructions for the measuring device
Device status	Displays the diagnostic messages currently pending, listed in order of priority
Data management	Data exchange between PC and measuring device: Device configuration: Load settings from the device (XML format, save configuration) Save settings to the device (XML format, restore configuration) Logbook - Export Event logbook (.csv file) Documents - Export documents: Export backup data record (.csv file, create documentation of the measuring point configuration) Verification report (PDF file, only available with the "Heartbeat Verification" application package) Firmware update - Flashing a firmware version

Proline Promass 500 HART Operation options

Functions	Meaning
Network configuration	Configuration and checking of all the parameters required for establishing the connection to the measuring device: Network settings (e.g. IP address, MAC address) Device information (e.g. serial number, firmware version)
Logout	End the operation and call up the login page

5.2.3 Navigation area

If a function is selected in the function bar, the submenus of the function open in the navigation area. The user can now navigate through the menu structure.

5.2.4 Working area

Depending on the selected function and the related submenus, various actions can be performed in this area:

- Configuring parameters
- Reading measured values
- Calling up help text
- Starting an upload/download

5.3 Logging out

- Before logging out, perform a data backup via the **Data management** function (upload configuration from device) if necessary.
- 1. Select the **Logout** entry in the function row.
 - ► The home page with the Login box appears.
- 2. Close the Web browser.
- 3. If no longer needed:

 Reset the modified properties of the Internet protocol (TCP/IP) → □ 17.

Diagnostics and troubleshooting 6

For details on the diagnostic information, see the Operating Instructions for the device \rightarrow $\ \cong$ 4.

General Web server troubleshooting 6.1


For access

Error	Possible causes	Remedy
No connection to Web server	Web server disabled	Using the "FieldCare" or "DeviceCare" operating tool, check whether the Web server of the measuring device is enabled, and enable it if necessary.
	Incorrect settings for the Ethernet interface of the computer	1. Check the properties of the Internet protocol (TCP/IP) → 17. 2. Check the network settings with the IT manager.
No connection to Web server	Incorrect IP address	Check the IP address: 192.168.1.212 → 🖺 17
No connection to Web server	Incorrect WLAN access data	Check WLAN network status. Log on to the device again using WLAN access data. Check that WLAN is enabled on the measuring device and operating device.
	WLAN communication disabled	-
Not connecting to Web server, FieldCare or DeviceCare	No WLAN network available	 Check if WLAN reception is present: LED on display module is lit blue Check if WLAN connection is enabled: LED on display module flashes blue Switch on instrument function.
Network connection not present or unstable	WLAN network is weak.	 Operating device is outside of reception range: Check network status on operating device. To improve network performance, use an external WLAN antenna.
	Parallel WLAN and Ethernet communication	 Check network settings. Temporarily enable only the WLAN as an interface.
Web browser frozen and operation no longer possible	Data transfer active	Wait until data transfer or current action is finished.
	Connection lost	Check cable connection and power supply. Refresh the Web browser and restart if necessary.
Content of Web browser incomplete or difficult to read	Not using optimum version of Web server.	Use the correct Web browser version . Clear the Web browser cache and restart the Web browser.
	Unsuitable view settings.	Change the font size/display ratio of the Web browser.
No or incomplete display of contents in the Web browser	JavaScript not enabledJavaScript cannot be enabled	Enable JavaScript. Enter http://XXX.XXX.X.X.XX/servlet/basic.html as the IP address.

6.2 Diagnostic information in the Web browser

6.2.1 Diagnostic options

Any faults detected by the measuring device are displayed in the Web browser on the home page once the user has logged on.

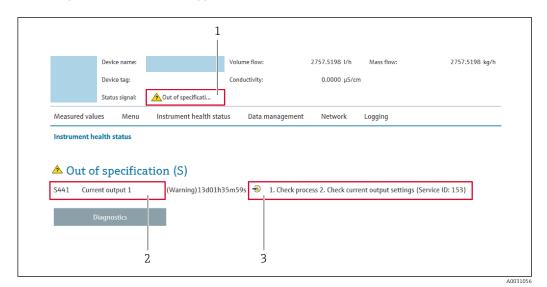

- 1 Status area with status signal
- 2 Diagnostic information
- 3 Remedial measures with service ID
- In addition, diagnostic events which have occurred can be shown in the **Diagnostics**
 - Via parameter
 - Via submenu

Status signals

The status signals provide information on the state and reliability of the device by categorizing the cause of the diagnostic information (diagnostic event).

Symbol	Meaning
8	Failure A device error has occurred. The measured value is no longer valid.
	Function check The device is in the service mode (during a simulation, for example).
A	Out of specification The device is being operated: Outside its technical specification limits (e.g. outside the process temperature range) Outside of the configuration carried out by the user (e.g. maximum flow in parameter 20 mA value)
&	Maintenance required Maintenance is required. The measured value is still valid.

The status signals are categorized in accordance with VDI/VDE 2650 and NAMUR Recommendation NE 107.

6.2.2 Calling up remedy information

Remedy information is provided for every diagnostic event to ensure that problems can be rectified quickly. These measures are displayed in red along with the diagnostic event and the related diagnostic information.

6.3 Diagnostic information in the measuring device

6.3.1 Overview of Web server information events

Unlike a diagnostic event, an information event is displayed in the event logbook only and not in the diagnostic list.

Information event	Event text
I1000	(device OK)
I1110	Write protection switch changed
I1361	Web server login failed
I1627	Web server login successful
I1631	Web server access changed

6.4 Checking the network connection

The network connection between the computer and measuring device can be checked using the "ping" utility of the Internet Control Message Protocol (ICMP).

- The "ping" utility sends an ICMP(v6) "echo request" packet (ping, ICMP packet type 8 (0x08)) to the target address of the measuring device. According to the protocol specification, the measuring device must send back a response: ICMP "echo reply" (pong, ICMP packet type 0 (0x00)).
- 1. Click Start (Windows icon).
 - → The Start screen opens along with the search field.
- 2. In the search field, enter "cmd" (command).
 - ► A link to "cmd.exe" is displayed in the results field.
- 3. Select the "cmd.exe" link.
 - ► A new command window opens.
- 4. Enter ping and the IP address, e.g.: ping 192.168.1.212
 - ► The network connection status is displayed.
- Depending on the operating system used, or the version of the operating system, other tools can also be used, such as Powershell.exe, prompt etc.

If the measuring device cannot be reached the router responsible delivers the following response:

- "Network unreachable"
 - or
- "Host unreachable"
- 1. Check the IP address settings $\rightarrow \blacksquare 17$.
- 2. Check whether the Web server is enabled $\rightarrow \triangleq 17$.

Proline Promass 500 HART Technical data

7 Technical data

Web server	Stack: standard TCP stack with IPv4 functionality
Connection and session management	 Fixed IP address, i.e. no access possible from outside the network Open ports: 80 (HTTP for Web server) 8000 (for Endress+Hauser Service communication) Only one connection possible at any one time via Hypertext Transfer Protocol (HTTP) Time out after 10 minutes
Supported functions	 Java Script Hypertext Markup Language (HTML) Cascading Style Sheets (CSS)
Functions not supported	 Domain Name System (DNS) Hyper Text Transfer Protocol Secure (HTTPS)



www.addresses.endress.com