
# Brief Operating Instructions **Proline 300**


HART transmitter with ultrasonic time-of-flight sensor



These instructions are Brief Operating Instructions; they are **not** a substitute for the Operating Instructions pertaining to the device.

**Brief Operating Instructions part 2 of 2: Transmitter**Contain information about the transmitter.

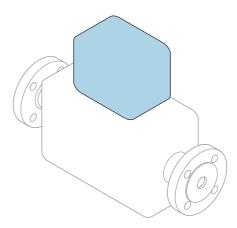

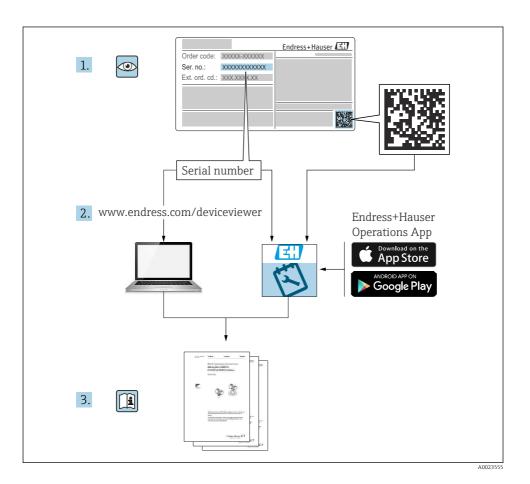

## Brief operating instructions Flowmeter

The device consists of a transmitter and a sensor.

The process of commissioning these two components is described in two separate manuals which together form the Brief Operating Instructions for the flowmeter:

- Brief Operating Instructions Part 1: Sensor
- Brief Operating Instructions Part 2: Transmitter

Please refer to both parts of the Brief Operating Instructions when commissioning the device, as the contents of the manuals complement one another:

#### **Brief Operating Instructions Part 1: Sensor**

The Sensor Brief Operating Instructions are aimed at specialists with responsibility for installing the measuring device.

- Incoming acceptance and product identification
- Storage and transport
- Mounting procedure

#### **Brief Operating Instructions Part 2: Transmitter**

The Transmitter Brief Operating Instructions are aimed at specialists with responsibility for commissioning, configuring and parameterizing the measuring device (until the first measured value).

- Product description
- Mounting procedure
- Electrical connection
- Operation options
- ullet System integration
- Commissioning
- Diagnostic information

#### Additional device documentation



These Brief Operating Instructions are **Brief Operating Instructions Part 2:** 

#### Transmitter.

The "Brief Operating Instructions Part 1: Sensor" are available via:

- Internet: www.endress.com/deviceviewer
- Smart phone/tablet: Endress+Hauser Operations App

Detailed information about the device can be found in the Operating Instructions and the other documentation:

- Internet: www.endress.com/deviceviewer
- Smart phone/tablet: Endress+Hauser Operations App

Proline 300 HART

## Table of contents

| 1          | About this document                                 | 5    |
|------------|---|------|
| 1.1        | Symbols used  | . 5  |
| 2          | Safety instructions                                 | . 7  |
| 2.1        | Requirements for the personnel                      |      |
| 2.2        | Intended use  |      |
| 2.3        | Workplace safety                                    |      |
| 2.4        | Operational safety                                  |      |
| 2.5        | Product safety                                      | 8    |
| 2.6        | IT security   |      |
| 2.7        | Device-specific IT security                         |      |
| 3          | Product description                                 | 10   |
| 4          | Mounting procedure                                  | 11   |
| 4.1        | Mounting the sensor                                 |      |
| 4.2        | Mounting the transmitter                            |      |
| 4.3        | Cover lock  |      |
| 4.4        | Weather protection cover                            |      |
| 4.5        | Transmitter post-installation check                 |      |
| 5          | Electrical connection                               | 16   |
|            |   |      |
| 5.1<br>5.2 | Electrical safety                                   |      |
| 5.2<br>5.3 |   |      |
| 5.4        | Connecting the measuring device                     |      |
| 5.4<br>5.5 | Ensuring potential equalization                     |      |
| 5.6        | Post-connection check                               |      |
| J.U        |   |      |
| 6          | Operation options                                   | 25   |
| 6.1        | Overview of operation options                       |      |
| 6.2        | Structure and function of the operating menu        | 26   |
| 6.3        | Access to operating menu via local display          | . 27 |
| 6.4        | Access to the operating menu via the operating tool | . 30 |
| 6.5        | Access to the operating menu via the web server     | 30   |
| 7          | System integration                                  | 31   |
| 8          | Commissioning                                       | 31   |
| 8.1        | Installation and function check                     |      |
| 8.2        | Setting the operating language                      |      |
| 8.3        | Configuring the measuring device                    |      |
| 8.4        | Protecting settings from unauthorized access        |      |
| 9          | Diagnostic information                              | 34   |

Proline 300 HART About this document

#### 1 About this document

## 1.1 Symbols used

#### 1.1.1 Safety symbols

#### **⚠** DANGER

This symbol alerts you to a dangerous situation. Failure to avoid this situation will result in serious or fatal injury.

#### **WARNING**

This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in serious or fatal injury.

#### **A** CAUTION

This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in minor or medium injury.

#### NOTICE

This symbol contains information on procedures and other facts which do not result in personal injury.

#### 1.1.2 Symbols for certain types of information

| Symbol   | Meaning   | Symbol    | Meaning  |
|----------|---|-----------|--|
| <b>✓</b> | Permitted Procedures, processes or actions that are permitted.        |           | Preferred Procedures, processes or actions that are preferred. |
| X        | <b>Forbidden</b> Procedures, processes or actions that are forbidden. | i         | <b>Tip</b> Indicates additional information.                   |
| Î        | Reference to documentation  | A         | Reference to page  |
|          | Reference to graphic  | 1., 2., 3 | Series of steps  |
| L.       | Result of a step  | <b></b>   | Visual inspection  |

#### 1.1.3 Electrical symbols

| Symbol Meaning |  | Symbol                | Meaning   |
|----------------|--|-----------------------|---|
| Direct current |  | ∼ Alternating current |   |
| ≂              | Direct current and alternating current | ≐                     | Ground connection A grounded terminal which, as far as the operator is concerned, is grounded via a grounding system. |

About this document Proline 300 HART

| Symbol | Meaning  |
|--------|--|
|        | Potential equalization connection (PE: protective earth) Ground terminals that must be connected to ground prior to establishing any other connections.  |
|        | The ground terminals are located on the interior and exterior of the device:  Interior ground terminal: potential equalization is connected to the supply network.  Exterior ground terminal: device is connected to the plant grounding system. |

## 1.1.4 Communication-specific symbols

| Symbol      | ymbol Meaning   |   | Meaning   |
|-------------|---|---|---|
| (i·         | Wireless Local Area Network (WLAN) Communication via a wireless, local network. |   | Bluetooth<br>Wireless data transmission between<br>devices over a short distance. |
| <b>\\\\</b> | LED Light emitting diode is on.   | • | <b>LED</b> Light emitting diode is off.   |
| -\-         | <b>LED</b> Light emitting diode is flashing.                                    |   |   |

## 1.1.5 Tool symbols

| Symbol           | Symbol Meaning            |                        | Meaning   |
|------------------|---------------------------|------------------------|-----------|
| Torx screwdriver |                           | Flat-blade screwdriver |           |
| 06               | Phillips head screwdriver |                        | Allen key |
| Ø.               | Open-ended wrench         |                        |           |

## 1.1.6 Symbols in graphics

| Symbol                | Symbol Meaning |                | Meaning                        |
|-----------------------|----------------|----------------|--------------------------------|
| 1, 2, 3, Item numbers |                | 1., 2., 3      | Series of steps                |
| A, B, C, Views        |                | A-A, B-B, C-C, | Sections                       |
| EX                    | Hazardous area |                | Safe area (non-hazardous area) |
| ≋➡                    | Flow direction |                |                                |

Proline 300 HART Safety instructions

## 2 Safety instructions

#### 2.1 Requirements for the personnel

The personnel must fulfill the following requirements for its tasks:

- ► Trained, qualified specialists must have a relevant qualification for this specific function and task.
- ► Are authorized by the plant owner/operator.
- ► Are familiar with federal/national regulations.
- ▶ Before starting work, read and understand the instructions in the manual and supplementary documentation as well as the certificates (depending on the application).
- ► Follow instructions and comply with basic conditions.

#### 2.2 Intended use

#### Application and media

The measuring device described in this manual is intended only for the flow measurement of gases.

Depending on the version ordered, the measuring device can also measure potentially explosive, flammable, poisonous and oxidizing media.

Measuring devices for use in explosive atmospheres, in hygienic applications or where there is a high risk of pressures, are labeled accordingly on the nameplate.

To ensure that the measuring device is in proper condition during the operation period:

- ▶ Only use the measuring device in full compliance with the data on the nameplate and the general conditions listed in the Operating Instructions and supplementary documentation.
- ▶ Refer to the nameplate to check whether the ordered device can be operated for the intended application in areas requiring specific approvals (e.g. explosion protection, pressure equipment safety).
- ▶ Use the measuring device only for media to which the process-wetted materials are sufficiently resistant.
- ► Keep within the specified pressure and temperature range.
- ► Keep within the specified ambient temperature range.
- Protect the measuring device permanently against corrosion from environmental influences.

#### Incorrect use

Non-designated use can compromise safety. The manufacturer is not liable for damage caused by improper or non-designated use.

### **A** WARNING

#### Danger of breakage due to corrosive or abrasive fluids and ambient conditions!

- ► Verify the compatibility of the process fluid with the sensor material.
- ► Ensure the resistance of all fluid-wetted materials in the process.
- ► Keep within the specified pressure and temperature range.

Safety instructions Proline 300 HART

#### NOTICE

#### Verification for borderline cases:

► For special fluids and fluids for cleaning, Endress+Hauser is glad to provide assistance in verifying the corrosion resistance of fluid-wetted materials, but does not accept any warranty or liability as minute changes in the temperature, concentration or level of contamination in the process can alter the corrosion resistance properties.

#### Residual risks

#### **A** CAUTION

Risk of hot or cold burns! The use of media and electronics with high or low temperatures can produce hot or cold surfaces on the device.

- ► Mount suitable touch protection.
- ► Use suitable protective equipment.

#### **A** WARNING

#### Danger from medium escaping!

For device versions with a rupture disk: medium escaping under pressure can cause injury or material damage.

► Take precautions to prevent injury and material damage if the rupture disk is actuated.

#### 2.3 Workplace safety

When working on and with the device:

▶ Wear the required personal protective equipment as per national regulations.

#### 2.4 Operational safety

Damage to the device!

- ▶ Operate the device in proper technical condition and fail-safe condition only.
- lacktriangle The operator is responsible for the interference-free operation of the device.

### 2.5 Product safety

This measuring device is designed in accordance with good engineering practice to meet state-of-the-art safety requirements, has been tested, and left the factory in a condition in which it is safe to operate.

It meets general safety standards and legal requirements. It also complies with the EU directives listed in the device-specific EU Declaration of Conformity. The manufacturer confirms this by affixing the CE mark to the device..

#### 2.6 IT security

Our warranty is valid only if the product is installed and used as described in the Operating Instructions. The product is equipped with security mechanisms to protect it against any inadvertent changes to the settings.

Proline 300 HART Safety instructions

IT security measures, which provide additional protection for the product and associated data transfer, must be implemented by the operators themselves in line with their security standards.

#### 2.7 **Device-specific IT security**

The device offers a range of specific functions to support protective measures on the operator's side. These functions can be configured by the user and quarantee greater in-operation safety if used correctly.



For detailed information on device-specific IT security, see the Operating Instructions for the device

#### 2.7.1 Access via service interface (CDI-RJ45)

The device can be connected to a network via the service interface (CDI-RJ45). Device-specific functions guarantee the secure operation of the device in a network.

The use of relevant industrial standards and quidelines that have been defined by national and international safety committees, such as IEC/ISA62443 or the IEEE, is recommended. This includes organizational security measures such as the assignment of access authorization as well as technical measures such as network segmentation.



Transmitters with an Ex de approval may not be connected via the service interface (CDI-RJ45)!


Product description Proline 300 HART

## 3 Product description

The device consists of a Proline 300 transmitter and a Proline Prosonic Flow ultrasonic time-of-flight sensor.

The device is available as a compact version:

The transmitter and sensor form a mechanical unit.

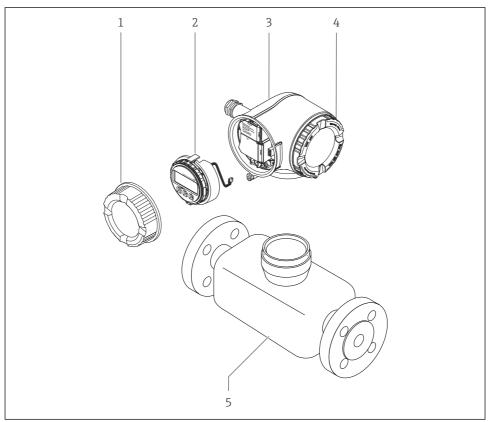

A0029586

- 1 Connection compartment cover
- 2 Display module
- 3 Transmitter housing
- 4 Electronics compartment cover
- 5 Sensor





Proline 300 HART Mounting procedure

## 4 Mounting procedure


#### 4.1 Mounting the sensor

For detailed information about mounting the sensor, see the Sensor Brief Operating Instructions  $\rightarrow \stackrel{ ext{lighta}}{\Rightarrow} 3$ 

#### 4.2 Mounting the transmitter

#### 4.2.1 Turning the transmitter housing

To provide easier access to the connection compartment or display module, the transmitter housing can be turned.

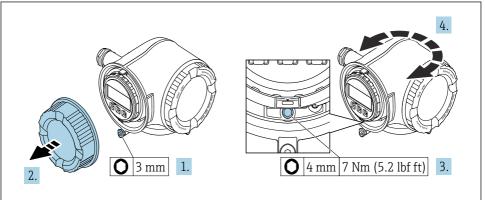


A0029993

#### ■ 1 Non-Ex housing

- 1. Depending on the device version: Loosen the securing clamp of the connection compartment cover.
- 2. Unscrew the connection compartment cover.
- 3. Loosen the securing screw.
- 4. Turn the housing to the desired position.
- 5. Tighten the securing screw.
- 6. Screw on the connection compartment cover.
- 7. Depending on the device version: Attach the securing clamp of the connection compartment cover.

Mounting procedure Proline 300 HART

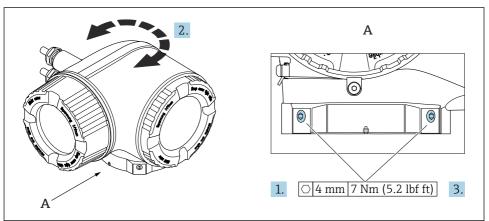


A0043150

- 2 Ex housing
- 1. Loosen the fixing screws.
- 2. Turn the housing to the desired position.
- 3. Tighten the securing screws.

Proline 300 HART Mounting procedure

#### 4.2.2 Turning the display module

The display module can be turned to optimize display readability and operability.

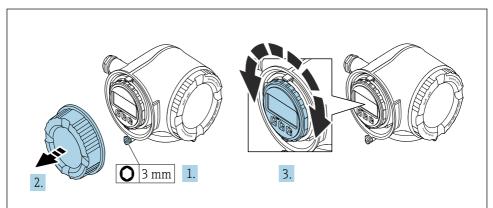

A0030035

- 1. Depending on the device version: Loosen the securing clamp of the connection compartment cover.
- 2. Unscrew the connection compartment cover.
- 3. Turn the display module to the desired position: max.  $8 \times 45^{\circ}$  in each direction.
- 4. Screw on the connection compartment cover.
- **5.** Depending on the device version: Attach the securing clamp of the connection compartment cover.

Mounting procedure Proline 300 HART


#### 4.3 Cover lock

#### **NOTICE**

Order code "Housing", option L "Cast, stainless": The covers of the transmitter housing are provided with a borehole to lock the cover.

The cover can be locked using screws and a chain or cable provided by the customer on site.

- ▶ The use of stainless steel chains or cables is recommended.
- ► If a protective coating is applied, it is recommended to use a heat shrink tube to protect the housing paint.

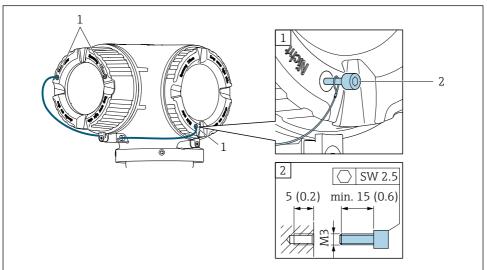


A0029800

- 1 Cover borehole for the securing screw
- 2 Securing screw to lock the cover

Proline 300 HART Mounting procedure

## 4.4 Weather protection cover

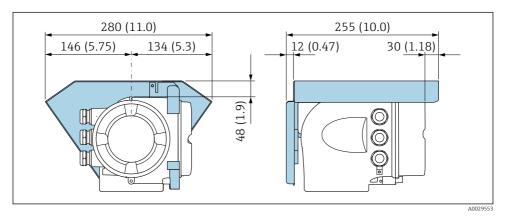

**■** 3 Engineering unit mm (in)

## 4.5 Transmitter post-installation check

The post-installation check must always be performed after the following tasks:

- Turning the transmitter housing
- Turning the display module

| Is the device undamaged (visual inspection)?  |  |
|---|--|
| Turning the transmitter housing:  Is the securing screw firmly tightened?   |  |
| <ul><li> Is the connection compartment cover screwed on tightly?</li><li> Is the securing clamp firmly tightened?</li></ul> |  |
| Turning the display module:  Is the connection compartment cover screwed on tightly?  |  |
| ■ Is the securing clamp firmly tightened?   |  |

Electrical connection Proline 300 HART

#### 5 Electrical connection

#### **WARNING**

## Live parts! Incorrect work performed on the electrical connections can result in an electric shock.

- ► Set up a disconnecting device (switch or power-circuit breaker) to easily disconnect the device from the supply voltage.
- ► In addition to the device fuse, include an overcurrent protection unit with max. 10 A in the plant installation.

#### 5.1 Electrical safety

In accordance with applicable national regulations.

#### 5.2 Connecting requirements

#### 5.2.1 Required tools

- For cable entries: Use corresponding tools
- For securing clamp: Allen key 3 mm
- Wire stripper
- When using stranded cables: Crimper for wire end ferrule
- For removing cables from terminal: Flat blade screwdriver ≤ 3 mm (0.12 in)

#### 5.2.2 Requirements for connecting cable

The connecting cables provided by the customer must fulfill the following requirements.

#### Protective grounding cable for the outer ground terminal

Conductor cross-section < 2.1 mm<sup>2</sup> (14 AWG)

The use of a cable lug enables the connection of larger cross-sections.

The grounding impedance must be less than 2  $\Omega$ .

#### Permitted temperature range

- The installation guidelines that apply in the country of installation must be observed.
- The cables must be suitable for the minimum and maximum temperatures to be expected.

### Power supply cable (incl. conductor for the inner ground terminal)

Standard installation cable is sufficient.

Proline 300 HART Electrical connection

#### Signal cable

Current output 4 to 20 mA HART

A shielded cable is recommended. Observe grounding concept of the plant.

Current output 0/4 to 20 mA

Standard installation cable is sufficient

Pulse /frequency /switch output

Standard installation cable is sufficient

Double pulse output

Standard installation cable is sufficient

Relay output

Standard installation cable is sufficient.

Current input 0/4 to 20 mA

Standard installation cable is sufficient

Status input

Standard installation cable is sufficient

#### Cable diameter

Cable glands supplied:
 M20 × 1.5 with cable Ø 6 to 12 mm (0.24 to 0.47 in)

■ Spring-loaded terminals: Suitable for strands and strands with ferrules. Conductor cross-section 0.2 to 2.5 mm² (24 to 12 AWG).

#### Requirements for connecting cable – remote display and operating module DKX001

Optionally available connecting cable

| Standard cable           | $2 \times 2 \times 0.34 \text{ mm}^2$ (22 AWG) PVC cable with common shield (2 pairs, pair-stranded)   |  |  |  |
|--------------------------|--|--|--|--|
| Flame resistance         | According to DIN EN 60332-1-2  |  |  |  |
| Oil resistance           | According to DIN EN 60811-2-1  |  |  |  |
| Shield                   | Tin-plated copper braid, optical cover ≥ 85 %  |  |  |  |
| Capacitance: core/shield | ≤ 200 pF/m   |  |  |  |
| L/R                      | < 24 μH/Ω  |  |  |  |
| Available cable length   | 5 m (15 ft)/10 m (35 ft)/20 m (65 ft)/30 m (100 ft)  |  |  |  |
| Operating temperature    | When mounted in a fixed position: $-50$ to $+105$ °C ( $-58$ to $+221$ °F); when cable can move freely: $-25$ to $+105$ °C ( $-13$ to $+221$ °F) |  |  |  |

Electrical connection Proline 300 HART

Standard cable - customer-specific cable

With the following order option, no cable is supplied with the device and must be provided by the customer:

Order code for DKX001: Order code  $\bf 040$  for "Cable", option  $\bf 1$  "None, provided by customer, max  $\bf 300~m$ "

A standard cable with the following minimum requirements can be used as the connecting cable, even in the hazardous area (Zone 2, Class I, Division 2 and Zone 1, Class I, Division 1):

| Standard cable           | 4 wires (2 pairs); pair-stranded with common shield, minimum wire cross-section 0.34 $\mbox{mm}^2$ (22 AWG) |  |  |
|--------------------------|---|--|--|
| Shield                   | Tin-plated copper braid, optical cover $\geq$ 85 %  |  |  |
| Cable impedance (pair)   | Minimum $80 \Omega$   |  |  |
| Capacitance: core/shield | Maximum 1000 nF for Zone 1, Class I, Division 1   |  |  |
| L/R                      | Maximum 24 $\mu$ H/ $\Omega$ for Zone 1, Class I, Division 1  |  |  |

Proline 300 HART Electrical connection

#### 5.2.3 Terminal assignment

#### Transmitter: supply voltage, input/outputs

The terminal assignment of the inputs and outputs depends on the individual order version of the device. The device-specific terminal assignment is documented on an adhesive label in the terminal cover.

| Supply voltage |       | Input/o | utput 1  | Input/o | utput 2 | Input/o | utput 3 |        |
|----------------|-------|---------|--|---------|---------|---------|---------|--------|
| ſ              | 1 (+) | 2 (-)   | 26 (+)   | 27 (-)  | 24 (+)  | 25 (-)  | 22 (+)  | 23 (-) |
|                |       |         | Device-specific terminal assignment: adhesive label in terminal cover. |         |         |         |         |        |

#### 5.2.4 Preparing the measuring device

#### NOTICE

#### Insufficient sealing of the housing!

Operational reliability of the measuring device could be compromised.

- ▶ Use suitable cable glands corresponding to the degree of protection.
- 1. Remove dummy plug if present.
- 2. If the measuring device is supplied without cable glands: Provide suitable cable gland for corresponding connecting cable.
- 3. If the measuring device is supplied with cable glands:Observe requirements for connecting cables → 

  16.

## 5.3 Connecting the measuring device


#### NOTICE

#### An incorrect connection compromises electrical safety!

- ▶ Only properly trained specialist staff may perform electrical connection work.
- ▶ Observe applicable federal/national installation codes and regulations.
- ► Comply with local workplace safety regulations.
- ▶ Always connect the protective ground cable ⊕ before connecting additional cables.
- When using in potentially explosive atmospheres, observe the information in the devicespecific Ex documentation.


Electrical connection Proline 300 HART

#### 5.3.1 Connecting the transmitter

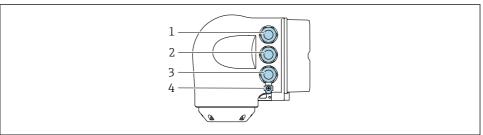

10026701


- 1 Terminal connection for supply voltage
- 2 Terminal connection for signal transmission, input/output
- 3 Terminal connection for signal transmission, input/output or terminal connection for network connection via service interface (CDI-RJ45); optional: connection for external WLAN antenna or remote display and operating module DKX001
- 4 Protective earth (PE)

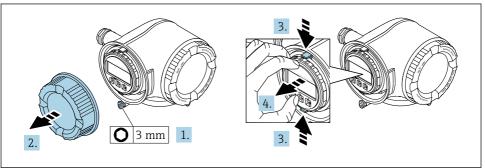

A0029813


- 1. Loosen the securing clamp of the connection compartment cover.
- 2. Unscrew the connection compartment cover.
- 3. Squeeze the tabs of the display module holder together.
- 4. Remove the display module holder.

Proline 300 HART Electrical connection

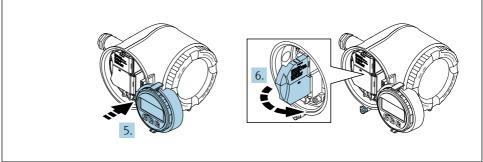

A0029814


- 5. Attach the holder to the edge of the electronics compartment.
- 6. Open the terminal cover.

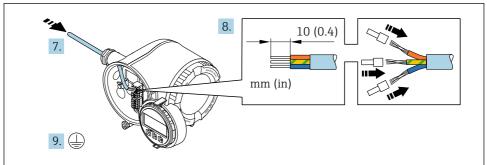

A0029815

- 7. Push the cable through the cable entry. To ensure tight sealing, do not remove the sealing ring from the cable entry.
- 8. Strip the cable and cable ends. In the case of stranded cables, also fit ferrules.
- 9. Connect the protective ground.

Electrical connection Proline 300 HART

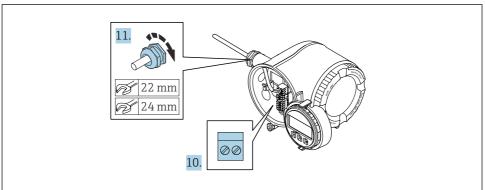

A0029816

- 10. Connect the cable according to the terminal assignment.
  - Signal cable terminal assignment: The device-specific terminal assignment is documented on an adhesive label in the terminal cover.
     Supply voltage connection terminal assignment: Adhesive label in the terminal cover or → □ 19.
- 11. Firmly tighten the cable glands.
  - ► This concludes the cable connection process.
- 12. Close the terminal cover.
- 13. Fit the display module holder in the electronics compartment.
- 14. Screw on the connection compartment cover.
- 15. Secure the securing clamp of the connection compartment cover.

Proline 300 HART Electrical connection


#### 5.3.2 Connecting the remote display and operating module DKX001

i

The remote display and operating module DKX001 is available as an optional extra.

The measuring device is always supplied with a dummy cover when the remote display
and operating module DKX001 is ordered directly with the measuring device. Display
or operation at the transmitter is not possible in this case.

• If ordered subsequently, the remote display and operating module DKX001 may not be connected at the same time as the existing measuring device display module. Only one display or operation unit may be connected to the transmitter at any one time.

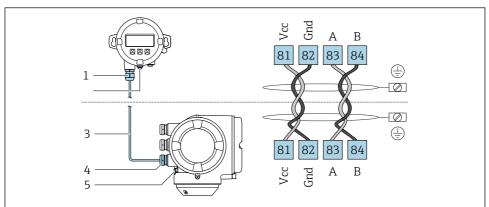

Δ002751

- 1 Remote display and operating module DKX001
- 2 Terminal connection for potential equalization (PE)
- 3 Connecting cable
- 4 Measuring device
- 5 Terminal connection for potential equalization (PE)

### 5.4 Ensuring potential equalization

#### 5.4.1 Requirements

No special measures for potential equalization are required.



For devices intended for use in hazardous locations, please observe the guidelines in the  $\operatorname{Ex}$  documentation (XA).

## 5.5 Ensuring the degree of protection

The measuring device fulfills all the requirements for the degree of protection IP66/67, Type 4X enclosure.


To guarantee the degree of protection IP66/67, Type 4X enclosure, carry out the following steps after electrical connection:

1. Check that the housing seals are clean and fitted correctly.

Electrical connection Proline 300 HART

- 2. Dry, clean or replace the seals if necessary.
- 3. Tighten all housing screws and screw covers.
- 4. Firmly tighten the cable glands.
- 5. To ensure that moisture does not enter the cable entry:

  Route the cable so that it loops down before the cable entry ("water trap").

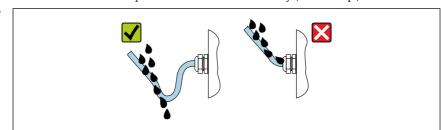

A0029278

6. The cable glands supplied do not ensure housing protection when not in use. They must therefore be replaced by dummy plus corresponding to the housing protection.


## 5.6 Post-connection check

| Are cables or the device undamaged (visual inspection)?  |  |
|--|--|
| Is the protective earthing established correctly?  |  |
| Do the cables used comply with the requirements?   |  |
| Are the mounted cables relieved of tension?  |  |
| Are all cable glands installed, securely tightened and leak-tight? Cable run with "water trap" → 🖺 23?         |  |
| Is the terminal assignment correct ?   |  |
| If supply voltage is present, do values appear on the display module?  |  |
| Are dummy plugs inserted in unused cable entries and have transportation plugs been replaced with dummy plugs? |  |

Proline 300 HART Operation options

## 6 Operation options

## 6.1 Overview of operation options

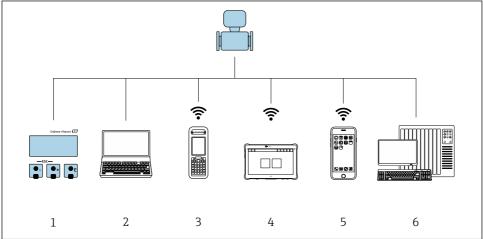


A0034513

- 1 Local operation via display module
- 2 Computer with Web browser (e.g. Internet Explorer) or with operating tool (e.g. FieldCare, DeviceCare, AMS Device Manager, SIMATIC PDM)
- 3 Field Xpert SFX350 or SFX370
- 4 Field Xpert SMT70
- 5 Mobile handheld terminal
- 6 Control system (e.g. PLC)

Operation options Proline 300 HART

## 6.2 Structure and function of the operating menu

#### 6.2.1 Structure of the operating menu

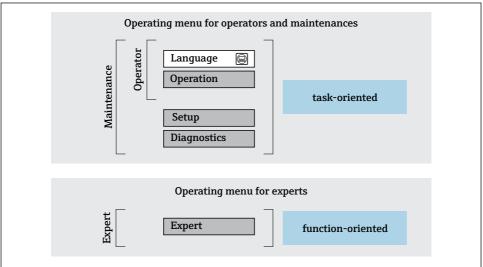

A0014058-EN

**■** 4 Schematic structure of the operating menu


#### 6.2.2 Operating philosophy

The individual parts of the operating menu are assigned to certain user roles (e.g. operator, maintenance etc.). Each user role contains typical tasks within the device life cycle.



Proline 300 HART Operation options

### 6.3 Access to operating menu via local display

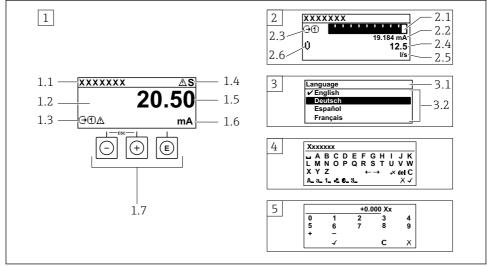

A001401

- 1 Operational display with measured value shown as "1 value, max." (example)
- 1.1 Device tag
- 1.2 Display area for measured values (4-line)
- 1.3 Explanatory symbols for measured value: Measured value type, measuring channel number, symbol for diagnostic behavior
- 1.4 Status area
- 1.5 Measured value
- 1.6 Unit for the measured value
- 1.7 Operating elements
- 2 Operational display with measured value shown as "1 bar graph + 1 value" (example)
- 2.1 Bar graph display for measured value 1
- 2.2 Measured value 1 with unit
- 2.3 Explanatory symbols for measured value 1: measured value type, measuring channel number
- 2.4 Measured value 2
- 2.5 Unit for measured value 2
- 2.6 Explanatory symbols for measured value 2: measured value type, measuring channel number
- 3 Navigation view: picklist of a parameter
- 3.1 Navigation path and status area
- *3.2* Display area for navigation: ✓ designates the current parameter value
- 4 Editing view: text editor with input mask
- 5 Editing view: numeric editor with input mask

Operation options Proline 300 HART

#### 6.3.1 Operational display

| Explanatory symbols for the measured value   | Status area  |
|--|--|
| ■ Depends on the device version, e.g.:  □ Û: Volume flow □ m̂: Mass flow □ P̂: Density □ G: Conductivity □ L: Temperature □ T: Totalizer □ C: Output □ D: Input □ 1 ① Measurement channel number 1) □ Diagnostic behavior 2) □ S: Alarm □ M: Warning | The following symbols appear in the status area of the operational display at the top right:  ■ Status signals  ■ F: Failure  ■ C: Function check  ■ S: Out of specification  ■ M: Maintenance required  ■ Diagnostic behavior  ■ ﴿ S: Alarm  ■ ﴿ Warning  □ : Locking (locked via hardware))  ■ (⇒: Communication via remote operation is active. |

- If there is more than one channel for the same measured variable type (totalizer, output etc.). For a diagnostic event that concerns the displayed measured variable. 1)
- 2)

#### 6.3.2 Navigation view

| Display area  |
|---|
| ■ Icons for menus ■ ③: Operation ■ ✔: Setup ■ ②: Diagnostics ■ ★: Expert ■ ►: Submenus ■ ∴: Wizards ■ ∅: Parameters within a wizard |
| ■ 🗟: Parameter locked   |
|   |

#### 6.3.3 **Editing view**

| Text editor |  | Text correction symbols under ৄৄ ← |  |
|-------------|--|------------------------------------|--|
| <b>√</b>    | Confirms selection.  | C                                  | Clears all entered characters.                                       |
| X           | Exits the input without applying the changes.  | ₽                                  | Moves the input position one position to the right.                  |
| C           | Clears all entered characters.   | €                                  | Moves the input position one position to the left.                   |
| €XC+→       | Switches to the selection of the correction tools.   | æ                                  | Deletes one character immediately to the left of the input position. |
| Aa1@        | Toggle  Between upper-case and lower-case letters  For entering numbers  For entering special characters |                                    |  |

Proline 300 HART Operation options

| Numeric editor                                |  |  |
|---|--|--|
| Confirms selection.                           | Moves the input position one position to the left. |  |
| Exits the input without applying the changes. | Inserts decimal separator at the cursor position.  |  |
| Inserts minus sign at the cursor position.    | C Clears all entered characters.                   |  |

## 6.3.4 Operating elements

| Operating key | Meaning   |
|---------------|---|
|               | Minus key   |
|               | In menu, submenu<br>Moves the selection bar upwards in a picklist   |
|               | In wizards Goes to previous parameter   |
|               | In the text and numeric editor Move the entry position to the left.   |
|               | Plus key  |
| <b>(+)</b>    | In menu, submenu Moves the selection bar downwards in a picklist  |
|               | In wizards Goes to the next parameter   |
|               | In the text and numeric editor  Move the entry position to the right.   |
|               | Enter key   |
|               | In the operational display Pressing the key briefly opens the operating menu.   |
| E             | <ul> <li>In menu, submenu</li> <li>Pressing the key briefly:</li> <li>Opens the selected menu, submenu or parameter.</li> <li>Starts the wizard.</li> <li>If help text is open, closes the help text of the parameter.</li> <li>Pressing the key for 2 s in a parameter:</li> <li>If present, opens the help text for the function of the parameter.</li> </ul> |
|               | In wizards Opens the editing view of the parameter and confirms the parameter value   |
|               | <ul> <li>In the text and numeric editor</li> <li>Pressing the key briefly confirms your selection.</li> <li>Pressing the key for 2 s confirms your entry.</li> </ul>  |

Operation options Proline 300 HART

| Operating key   | Meaning   |  |
|---|---|--|
|   | Escape key combination (press keys simultaneously)  |  |
| <u></u> ++  | <ul> <li>In menu, submenu</li> <li>Pressing the key briefly:</li> <li>Exits the current menu level and takes you to the next higher level.</li> <li>If help text is open, closes the help text of the parameter.</li> <li>Pressing the key for 2 s returns you to the operational display ("home position").</li> <li>In wizards</li> </ul> |  |
| Exits the wizard and takes you to the next higher level |   |  |
|   | In the text and numeric editor Exits the Editing view without applying the changes.   |  |
|   | Minus/Enter key combination (press and hold down the keys simultaneously)   |  |
| -+E   | <ul> <li>If keypad lock is active:         Pressing the key for 3 s deactivates the keypad lock.</li> <li>If keypad lock is not active:         Pressing the key for 3 s opens the context menu including the option for activating the keypad lock.</li> </ul>   |  |

#### 6.3.5 **Further information**



Further information on the following subjects:

- Calling up help text
- User roles and related access authorization
- Disabling write protection via access code
- Enabling and disabling the keypad lock

Operating instructions for the device  $\rightarrow \triangleq 3$ 

#### Access to the operating menu via the operating tool 6.4



For detailed information on access via FieldCare and DeviceCare, see the Operating Instructions for the device  $\rightarrow \implies 3$ 

#### 6.5 Access to the operating menu via the web server



The operating menu can also be accessed via the web server. See the Operating Instructions for the device.  $\rightarrow = 3$ 

Proline 300 HART System integration

#### 7 **System integration**



- Overview of device description files:
  - Current version data for the device
  - Operating tools
- Measured variables via HART protocol
- Burst mode functionality in accordance with HART 7 Specification

#### 8 Commissioning

#### Installation and function check 8.1


Before commissioning the device:

- ▶ Make sure that the post-installation and post-connection checks have been performed successfully.
- "Post-mounting check" checklist → 🖺 15
- "Post-connection check" checklist > \exists 24

#### 8.2 Setting the operating language

Factory setting: English or ordered local language

Commissioning Proline 300 HART

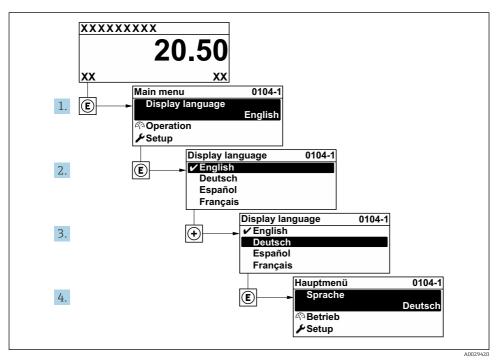

■ 5 Taking the example of the local display

## 8.3 Configuring the measuring device

The **Setup** menu with its submenus and various guided wizards is used for fast commissioning of the measuring device. They contain all the parameters required for configuration, such as for measurement or communication.

The number of submenus and parameters can vary depending on the device version. The selection can vary depending on the order code.

| Example: Available submenus, wizards | Meaning  |
|--------------------------------------|--|
| System units                         | Configuration of the units for all measured values |
| I/O configuration                    | User configurable I/O module                       |
| Current input                        | Configuration of the input/output type             |
| Status input                         |  |
| Current output 1 to n                |  |
| Pulse/frequency/switch output 1 to n |  |
| Relay output                         |  |
| Double pulse output                  |  |

Proline 300 HART Commissioning

| Example: Available submenus, wizards | Meaning  |
|--------------------------------------|--|
| Display                              | Configuration of the display format on the local display   |
| Low flow cut off                     | Configuration of the low flow cut off  |
| Advanced setup                       | Additional parameters for configuration:  Sensor adjustment Totalizer Display WLAN settings Data backup Administration |

#### Protecting settings from unauthorized access 8.4

The following write protection options exist in order to protect the configuration of the measuring device from unintentional modification:

- Protect access to parameters via access code
- Protect access to local operation via key locking
- Protect access to measuring device via write protection switch



For detailed information on protecting settings against unauthorized access, see the Operating Instructions for the device.  $\rightarrow \triangleq 3$ 




For detailed information on protecting the settings against unauthorized access in custody transfer applications, see the Special Documentation for the device.

Diagnostic information Proline 300 HART

## 9 Diagnostic information

Faults detected by the self-monitoring system of the measuring device are displayed as a diagnostic message in alternation with the operational display. The message about remedial measures can be called up from the diagnostic message, and contains important information on the fault.

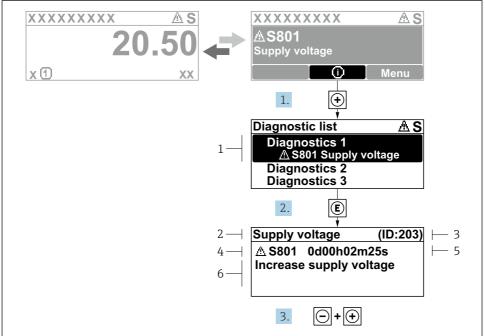

A0029431-EN

- 6 Message for remedial measures
- 1 Diagnostic information
- 2 Short text
- 3 Service ID
- 4 Diagnostic behavior with diagnostic code
- 5 Operation time when error occurred
- 6 Remedial measures
- 1. The user is in the diagnostic message.

Press ± (① symbol).

- ► The **Diagnostic list** submenu opens.
- 2. Select the desired diagnostic event with  $\pm$  or  $\Box$  and press  $\Box$ .
  - ► The message about the remedial measures opens.
- 3. Press  $\Box$  +  $\pm$  simultaneously.
  - ightharpoonup The message about the remedial measures closes.





www.addresses.endress.com