01.00.zz

Products Solutions


Services

# Operating Instructions **Liquiphant FTL51B Density**

Vibronic Density measurement for liquids





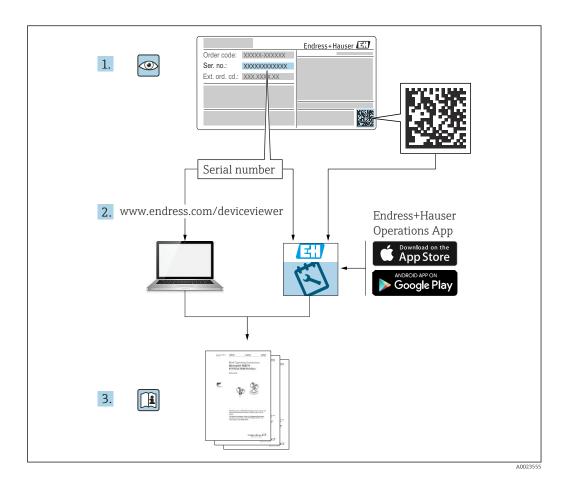

# Table of contents

1	About this document 5		6.2.2 Connecting protective earth (PE)	
1.1	Purpose of this document 5	6.3	Connecting the device	19
1.2	Symbols		FEL60D) for density measurement	
	1.2.1Safety symbols51.2.2Electrical symbols5		6.3.2 Connecting the cables	
	1.2.3 Tool symbols 5		6.3.3 Post-connection check	23
	1.2.4 Symbols for certain types of information 5	7	Operation options	24
	1.2.5 Symbols in graphics 6	7.1	Overview of operation options	
			7.1.1 Operating concept	
2	Basic safety instructions 6		7.1.2 Elements on the electronic insert	24
2.1 2.2	Requirements for the personnel 6 Intended use 6	8	Commissioning	
2.3	2.2.1 Incorrect use 6	8.1	Function check	
2.4	Workplace safety 6 Operational safety	8.2	Switching on the device	۷4
2.5	Product safety	9	Operation	25
2.6	IT security	9.1	Light signals	
3	Product description		3 3	
3.1	Product design 8	10	Diagnostics and troubleshooting	25
		10.1	Diagnostic information via light emitting	2.5
4	Incoming acceptance and product		diodes	
	identification 8	10.2	Firmware history	
4.1	Incoming acceptance 8			
4.2	Product identification	11	Maintenance	
	4.2.1 Nameplate 9 4.2.2 Manufacturer address 9	11.1	Maintenance tasks	
4.3	Storage and transport 9		11.1.1 Cleaning	20
	4.3.1 Storage conditions 9 4.3.2 Transporting the device 9	12	Repair	26
	4.5.2 Transporting the device	12.1	General notes	26
5	Mounting 10		12.1.1 Repair concept	26
5.1	Mounting requirements	12.2	12.1.2 Repair of Ex-certified devices Spare parts	
	5.1.1 Flow velocity - installation in pipes 11	12.3	Return	
	5.1.2 Inlet and outlet runs	12.4	Disposal	27
	5.1.4 Avoid buildup	10	A	20
	5.1.5 Take clearance into consideration 15	13	Accessories for Liquiphant Density.	28
	5.1.6 Support the device	13.1 13.2	Device Viewer	28
5.2	Mounting the device	15.2	compartment housing, aluminum	28
	5.2.1 Required tool	13.3	Weather protection cover for single	
5.3	5.2.2 Installation		compartment housing, aluminum or 316L, cast	28
5.4	Post-mounting check	13.4	M12 socket	28
		13.5	Sliding sleeves for unpressurized operation	
6	Electrical connection	13.6	High pressure sliding sleeves	30
6.1	Required tool			
6.2	Connecting requirements			
	<b>3</b>			

6.3	Connecting the device	19	
	6.3.1 2-wire density (electronic insert		
	FEL60D) for density measurement	19	
	6.3.2 Connecting the cables	22	
	6.3.3 Post-connection check	23	
7	Operation options	24	
=	1		
7.1	Overview of operation options	24 24	
	<ul><li>7.1.1 Operating concept</li><li>7.1.2 Elements on the electronic insert</li></ul>	24	
	7.1.2 Elements on the electronic insert	۷ <del>4</del>	
8	Commissioning	24	
8.1	Function check	24	
8.2	Switching on the device	24	
9	Operation	25	
9.1	Light signals	25	
10	Diagnostics and troubleshooting	25	
10.1	Diagnostic information via light emitting	25	
	diodes	25	
10.2	Firmware history	26	
10.2	Thinware instory	20	
11	Maintenance	26	
<b>11</b> 11.1	Maintenance	<b>26</b> 26	
11.1	Maintenance tasks	26 26	
11.1 <b>12</b>	Maintenance tasks	26 26 <b>26</b>	
11.1	Maintenance tasks	26 26 <b>26</b> 26	
11.1 <b>12</b>	Maintenance tasks	26 26 <b>26</b> 26 26	
11.1 <b>12</b> 12.1	Maintenance tasks  11.1.1 Cleaning  Repair  General notes  12.1.1 Repair concept  12.1.2 Repair of Ex-certified devices	26 26 26 26 26 26 26	
11.1 12 12.1	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts	26 26 26 26 26 26 26 27	
11.1 <b>12</b> 12.1 12.2 12.3	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return	26 26 26 26 26 26 27 27	
11.1 12 12.1	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts	26 26 26 26 26 26 26 27	
11.1 <b>12</b> 12.1 12.2 12.3	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return	26 26 26 26 26 26 27 27	
11.1  12 12.1  12.2 12.3 12.4  13	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density	26 26 26 26 26 27 27 27 27	
11.1 12 12.1 12.2 12.3 12.4	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density Device Viewer	26 26 26 26 26 26 27 27 27	
11.1  12 12.1  12.2 12.3 12.4  13	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density Device Viewer Weather protection cover for dual	26 26 26 26 26 27 27 27 27	
11.1  12 12.1  12.2 12.3 12.4  13 13.1	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density Device Viewer	26 26 26 26 26 27 27 27 27 28	
11.1  12 12.1  12.2 12.3 12.4  13 13.1 13.2	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density  Device Viewer  Weather protection cover for dual compartment housing, aluminum	26 26 26 26 26 27 27 27 27 28	
11.1  12 12.1  12.2 12.3 12.4  13 13.1 13.2	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density  Device Viewer  Weather protection cover for dual compartment housing, aluminum Weather protection cover for single	26 26 26 26 26 27 27 27 27 28	
11.1 12 12.1 12.2 12.3 12.4 13 13.1 13.2 13.3	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density .  Device Viewer  Weather protection cover for dual compartment housing, aluminum Weather protection cover for single compartment housing, aluminum or 316L, cast M12 socket	26 26 26 26 26 27 27 27 27 28 28	
11.1 12 12.1 12.2 12.3 12.4 13 13.1 13.2 13.3	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density  Device Viewer  Weather protection cover for dual compartment housing, aluminum Weather protection cover for single compartment housing, aluminum or 316L, cast  M12 socket Sliding sleeves for unpressurized operation .	26 26 26 26 27 27 27 28 28 28 28 29	
11.1 12 12.1 12.2 12.3 12.4 13 13.1 13.2 13.3	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density .  Device Viewer  Weather protection cover for dual compartment housing, aluminum Weather protection cover for single compartment housing, aluminum or 316L, cast M12 socket	26 26 26 26 26 27 27 27 27 28 28 28	
11.1 12 12.1 12.2 12.3 12.4 13 13.1 13.2 13.3	Maintenance tasks 11.1.1 Cleaning  Repair  General notes 12.1.1 Repair concept 12.1.2 Repair of Ex-certified devices Spare parts Return Disposal  Accessories for Liquiphant Density  Device Viewer  Weather protection cover for dual compartment housing, aluminum Weather protection cover for single compartment housing, aluminum or 316L, cast  M12 socket Sliding sleeves for unpressurized operation .	26 26 26 26 27 27 27 28 28 28 28 29	

14	Accessories for Density Computer	
	FML621	31
14.1 14.2 14.3 14.4	Device Viewer	31 31 31 32
15	Technical data	32
15.1	Input	32
	15.1.1 Measured variable	32
	15.1.2 Measuring range	32
15.2	Output	32
	15.2.1 Output and input variants	32
	15.2.2 Ex connection data	32
15.3	Environment	33
	15.3.1 Ambient temperature range	33
	15.3.2 Storage temperature	33 33
	15.3.3 Humidity	33
	15.3.4 Operating autitude	33
	15.3.6 Degree of protection	33
	15.3.7 Vibration resistance	33
	15.3.8 Shock resistance	34
	15.3.9 Mechanical load	34
	15.3.10 Pollution degree	34
	15.3.11 Electromagnetic compatibility	34
15.4	Process	34
	15.4.1 Process temperature range	34
	15.4.2 Thermal shock	34
	15.4.3 Process pressure range	34
4	15.4.4 Pressure tightness	34
15.5	Additional technical data	34
Inde	x	35
minuc.	42	

# 1 About this document

# 1.1 Purpose of this document

These Operating Instructions contain all the information that is required in the various phases of the life cycle of the device: from product identification, incoming acceptance and storage, to mounting, connection, operation and commissioning through to troubleshooting, maintenance and disposal.

# 1.2 Symbols

# 1.2.1 Safety symbols

#### **⚠** DANGER

This symbol alerts you to a dangerous situation. Failure to avoid this situation will result in serious or fatal injury.

#### **▲** WARNING

This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in serious or fatal injury.

#### **A** CAUTION

This symbol alerts you to a dangerous situation. Failure to avoid this situation can result in minor or medium injury.

#### **NOTICE**

This symbol contains information on procedures and other facts which do not result in personal injury.

# 1.2.2 Electrical symbols

Grounded clamp, which is grounded via a grounding system.

Protective earth (PE)

Ground terminals, which must be grounded prior to establishing any other connections. The ground terminals are located on the inside and outside of the device.

# 1.2.3 Tool symbols



○ 

Allen key

Open-ended wrench

# 1.2.4 Symbols for certain types of information

**✓** Permitted

Procedures, processes or actions that are permitted.

**X** Forbidden

Procedures, processes or actions that are forbidden.

**Fi** Tir

Indicates additional information

Reference to documentation

Reference to another section

#### 1., 2., 3. Series of steps

# 1.2.5 Symbols in graphics

**A, B, C ...** View

1, 2, 3 ... Item numbers

/EX Hazardous area

X Safe area (non-hazardous area)

# 2 Basic safety instructions

# 2.1 Requirements for the personnel

The personnel must fulfill the following requirements to carry out the necessary tasks, e. q., commissioning and maintenance:

- ► Trained, qualified specialists must have a relevant qualification for the specific function and task
- ► Are authorized by the plant owner/operator
- ► Are familiar with federal/national regulations
- Must have read and understood the instructions in the manual and supplementary documentation
- Follow instructions and comply with conditions

# 2.2 Intended use

- Use the device only for measuring the density of liquids.
- Improper use can pose hazards
- Ensure that the device is free of defects while it is in operation
- Use the device only for media to which the wetted materials have an adequate level of resistance
- Do not exceed or drop below the relevant limit values for the device
  - For more details, see the "Technical data" section
  - See the Technical Documentation

#### 2.2.1 Incorrect use

The manufacturer is not liable for damage caused by improper or non-intended use.

#### Residual risks

Due to heat transfer from the process, the temperature of the electronics housing and the assemblies contained therein may rise to 80  $^{\circ}$ C (176  $^{\circ}$ F) during operation.

Danger of burns from contact with surfaces!

► If necessary, ensure protection against contact to prevent burns.

# 2.3 Workplace safety

For work on and with the device:

► Wear the required personal protective equipment according to federal/national regulations.

# 2.4 Operational safety

Risk of injury!

- ▶ Operate the device only if it is in proper technical condition, free from errors and faults.
- ► The operator is responsible for ensuring the interference-free operation of the device.

#### Modifications to the device

Unauthorized modifications to the device are not permitted and can lead to unforeseeable dangers.

▶ If, despite this, modifications are required, consult with Endress+Hauser.

#### Repair

To ensure continued operational safety and reliability:

- ▶ Only perform repair work on the device if this is expressly permitted.
- ▶ Observe federal/national regulations pertaining to the repair of an electrical device.
- ▶ Use original spare parts and accessories from Endress+Hauser only.

#### Hazardous area

To eliminate danger to persons or the facility when the device is used in the hazardous area (e.g. explosion protection):

- ► Check the nameplate to verify whether the ordered device can be used for the intended purpose in the hazardous area.
- ▶ Observe the specifications in the separate supplementary documentation that is an integral part of this manual.

# 2.5 Product safety

This device is designed in accordance with good engineering practice to meet state-of-theart safety requirements, has been tested, and left the factory in a condition in which it is safe to operate.

It meets the general safety standards and legal requirements. It also complies with the EU directives listed in the device-specific EU Declaration of Conformity. Endress+Hauser confirms this by affixing the CE mark to the device.

# 2.6 IT security

We only provide a warranty if the device is installed and used as described in the Operating Instructions. The device has safety mechanisms integrated to prevent users from inadvertently changing settings.

Provide additional protection for the device and data transfer to/from the device


► IT security measures defined in the plant owner/operator's own security policy must be implemented by plant owners/operators themselves.

# 3 Product description

Liquiphant FTL51B sensor with electronic insert FEL60D

For measuring the density of liquid media in conjunction with density computer FML621. Also suitable for use in hazardous areas.

# 3.1 Product design

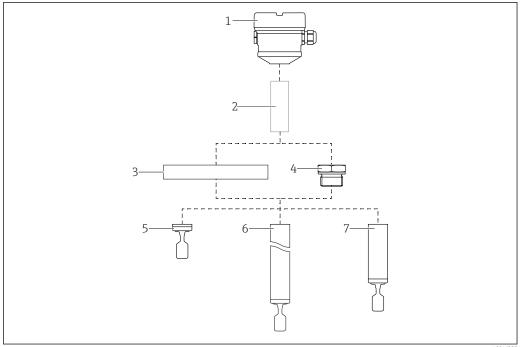

- Product design: Liquiphant FTL51B
- 1 Housing with electronic insert FEL60D and cover
- 2 Temperature spacer, pressure-tight feedthrough (second line of defense), optional
- 3 Process connection with flange (optional)
- 4 Process connection with thread (optional)
- 5 Compact probe version with tuning fork
- 6 Pipe extension probe with tuning fork
- 7 Short tube version of probe with tuning fork

# 4 Incoming acceptance and product identification

# 4.1 Incoming acceptance

Check the following during incoming acceptance:

- $\square$  Are the order codes on the delivery note and the product sticker identical?
- ☐ Are the goods undamaged?
- ☐ Do the data on the nameplate match the ordering information on the delivery note?
- ☐ If required (see nameplate): are the Safety Instructions e.g. XA provided?
- If one of these conditions is not met, please contact the manufacturer's sales office.

# 4.2 Product identification

The following options are available for identification of the device:

- Nameplate specifications
- Extended order code with breakdown of the device features on the delivery note
- Enter serial number from nameplates in *W@M Device Viewer* www.endress.com/deviceviewer. All of the information on the measuring device is displayed along with an overview of the scope of technical documentation provided.
- Enter the serial number on the nameplate into the *Endress+Hauser Operations app* or scan the 2-D matrix code on the nameplate with the *Endress+Hauser Operations app*

# 4.2.1 Nameplate

The information that is required by law and is relevant to the device is shown on the nameplate, e.g.:

- Manufacturer identification
- Order number, extended order code, serial number
- Technical data, degree of protection
- Firmware version, hardware version
- Approval-related information, reference to Safety Instructions (XA)
- DataMatrix code (information about the device)

#### 4.2.2 Manufacturer address

Endress+Hauser SE+Co. KG Hauptstraße 1 79689 Maulburg, Germany

Place of manufacture: See nameplate.

# 4.3 Storage and transport

# 4.3.1 Storage conditions


Use original packaging.

#### Storage temperature

-40 to +80 °C (-40 to +176 °F)

# 4.3.2 Transporting the device

- Transport the device to the measuring point in the original packaging
- Hold the device by the housing, temperature spacer, flange or extension pipe
- Do not bend, shorten or extend the tuning fork

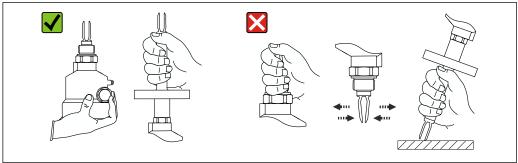

A003484

■ 2 Handling the device during transportation

# 5 Mounting


# **A** WARNING

Loss of protection rating if the device is opened in a wet environment.

▶ Only open the device in a dry environment!

Mounting instructions

- Any orientation for compact version and short pipe version up to approx.
   500 mm (19.7 in)
- Vertical orientation from above for device with long pipe
- Minimum distance between the fork tip and the tank wall or pipe wall: 10 mm (0.39 in)

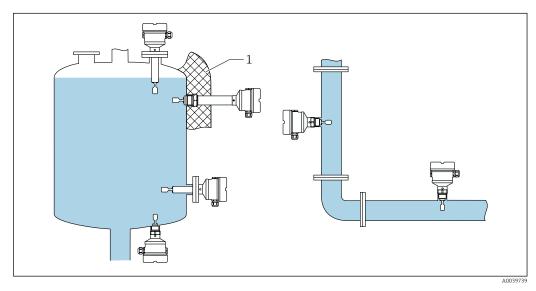


 $\blacksquare$  3 Installation examples for a vessel, tank or pipe

1 Vessel insulation (example with temperature spacer/pressure-tight feedthrough)
If process temperatures are high, the device should be included in a vessel insulation system to prevent the electronics from heating as a result of thermal radiation or convection.

# 5.1 Mounting requirements

For density measurement, the tuning fork must always be completely immersed.

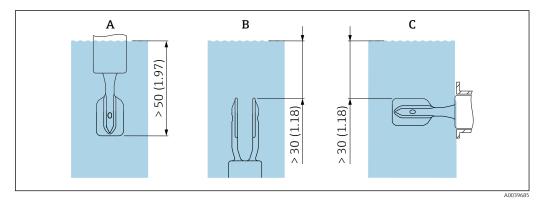


Unit of measurement mm (in)

- A Installation from above
- B Installation from below
- C Installation from the side

# 5.1.1 Flow velocity - installation in pipes

# Installing the tuning fork in the medium flow


- Flow velocity: < 2 m (6.6 ft) per second
- Prevents the formation of air bubbles (1)

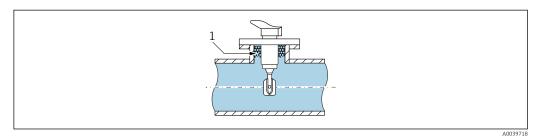

 $\blacksquare$  4 Installation example in pipes in the medium flow

# Installing the tuning fork away from the direct flow of medium

Flow velocity: < 2 to 5 m (6.6 to 16 ft) per second

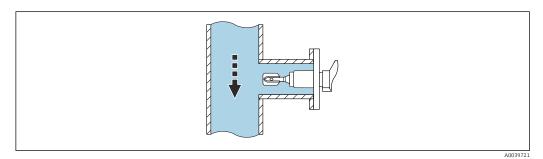

 $\blacksquare$  5 Installation example in pipes away from the direct flow of medium


# 5.1.2 Inlet and outlet runs

#### Inlet run

Install the sensor as far as possible from fittings such as valves, T-sections, elbows, flange elbows, etc.

To comply with the accuracy specification, the inlet run must meet the following requirements:

Inlet run:  $\geq 5x$  DN (nominal diameter) - min. 750 mm (29.5 in)

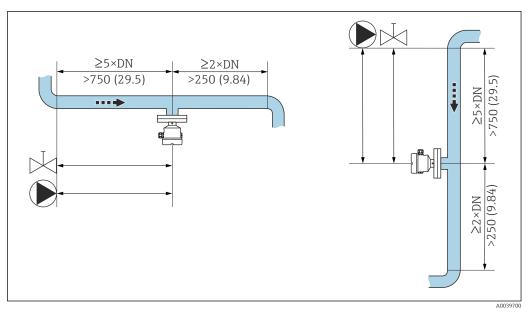


■ 6 Installing the inlet run. Unit of measurement mm (in)

#### Outlet run

To comply with the accuracy specification, the outlet run must meet the following requirements:

Outlet run:  $\geq 2x$  DN (nominal diameter) - min. 250 mm (9.84 in)

The pressure and temperature sensor must be installed on the outlet side of the flow direction after the Liquiphant density sensor. When installing pressure and temperature measuring points downstream of the device, make sure the distance between the measuring point and the device is sufficient.

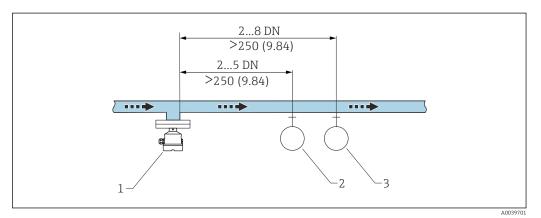

■ 7 Installing the outlet run. Unit of measurement mm (in)


- 1 Liquiphant density sensor
- 2 Pressure measuring point
- 3 Temperature measuring point

# **5.1.3** Correction factor

If the vibration of the tuning fork is affected by conditions at the mounting location, the measurement result can be adjusted using a correction factor (r).


#### Standard installation

Correction factor "r" as a factor of height "h", for entering in the Density Computer FML621 or ReadWin2000:

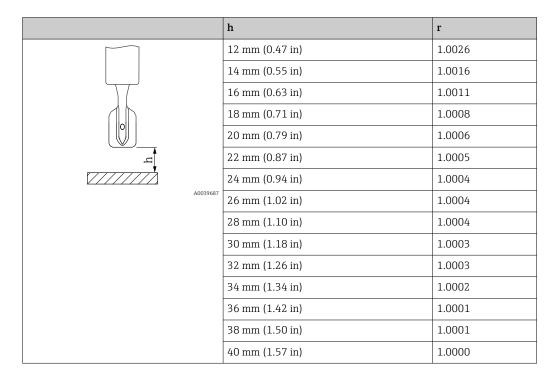

# Installation in a bypass


Correction factor "r" as a factor of the internal diameter of bypass "D", for entering in the Density Computer FML621 or ReadWin2000:

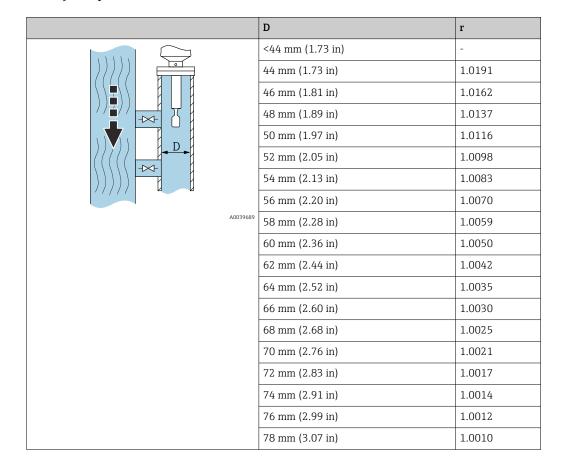

D	r
80 mm (3.15 in)	1.0008
82 mm (3.23 in)	1.0006
84 mm (3.31 in)	1.0005
86 mm (3.39 in)	1.0004
88 mm (3.46 in)	1.0003
90 mm (3.54 in)	1.0003
92 mm (3.62 in)	1.0002
94 mm (3.70 in)	1.0002
96 mm (3.78 in)	1.0001
98 mm (3.86 in)	1.0001
100 mm (3.94 in)	1.0001
>100 mm (3.94 in)	1.0000

# Installation in pipe

Correction factor "r" as a factor of the internal diameter of pipe "D", for entering in the Density Computer FML621 or ReadWin2000:

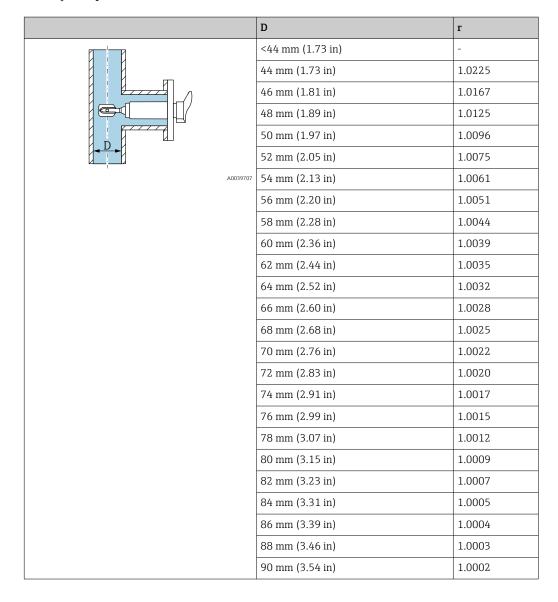

D	r
92 mm (3.62 in)	1.0002
94 mm (3.70 in)	1.0001
96 mm (3.78 in)	1.0001
98 mm (3.86 in)	1.0001
100 mm (3.94 in)	1.0001
>100 mm (3.94 in)	1.0000

# 5.1.4 Avoid buildup


# NOTICE

The presence of buildup or corrosion on the tuning fork affects the result of the measurement and must be avoided!

► Allow for maintenance intervals if required!

# **5.1.5** Take clearance into consideration


Allow sufficient space outside the tank for mounting, connection and replacement of the electronic insert.

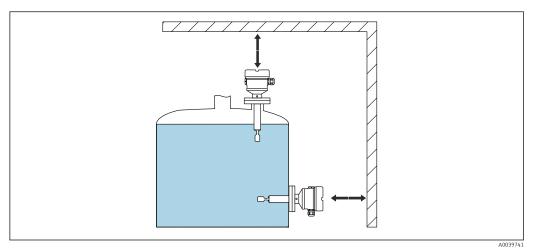

■ 8 Take clearance into consideration

# 5.1.6 Support the device


Support the device in the event of severe dynamic load. Maximum lateral loading capacity of the pipe extensions and sensors: 75 Nm (55 lbf ft).

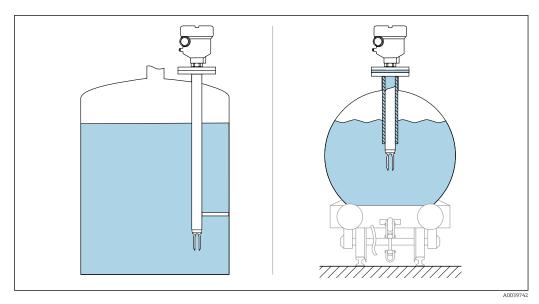

■ 9 Examples of support in the event of dynamic load

# 5.1.7 Weld-in adapter with leakage hole

Weld in the weld-in adapter in such a way that the leakage hole is pointing downwards. This enables any leaks to be detected quickly.

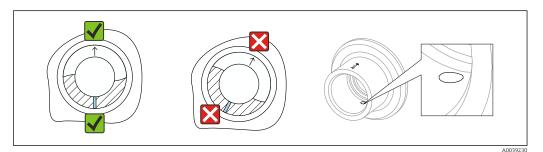

■ 10 Weld-in adapter with leakage hole

# 5.2 Mounting the device

# 5.2.1 Required tool

- Open-ended wrench for sensor installation
- Allen key for housing locking screw


# 5.2.2 Installation

# Align the tuning fork using the marking

The tuning fork can be aligned using the marking. Medium can thus run off easily and buildup is avoided.

Markings may include the following:

- Material information, thread name or circle on the hexagonal nut or on the weld-in adapter
- II symbol on the back of the flange or Tri-Clamp

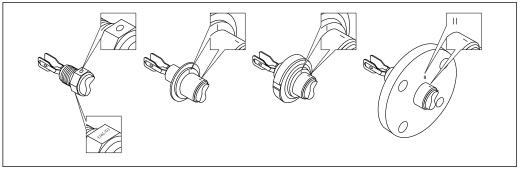


11 Markings to align the tuning fork

A0039125

# Installing in pipes

- Flow velocity up to 5 m/s with viscosity 1 mPa·s and density 1 g/cm³ (SGU). Check for correct functioning in the event of other process medium conditions.
- Flow velocity > 2 m/s: Implement structural measures to position the tuning fork away from the direct flow of medium. Examples include: a bypass or an increase in pipe diameter to reduce the flow.
- The flow will not be significantly impeded if the tuning fork is correctly aligned and the marking is pointing in the direction of flow.
- The marking is visible when installed.

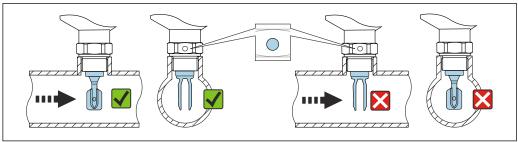


12 Installation in pipes (take fork position and marking into consideration)

A0034851

# Screwing in the device


- Turn by the hex bolt only, 15 to 30 Nm (11 to 22 lbf ft)
- Do not turn at the housing!

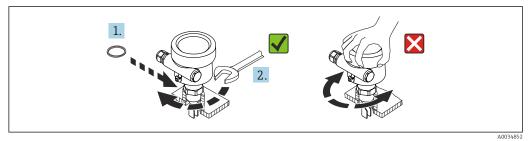

■ 13 Screwing in the device

A003403

# Aligning the cable entry

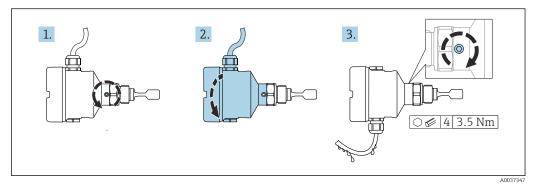

■ 14 Housing with external locking screw and drip loop

- The locking screw is not tightened when the device is delivered.
- 1. Loosen the external locking screw (maximum 1.5 turns).
- 2. Turn the housing, align the cable entry.
  - ► Avoid moisture in the housing, provide a loop to allow moisture to drain off.
- 3. Tighten the external locking screw.

# 5.3 Sliding sleeves

For more details, see the "Accessories" section.

# 5.4 Post-mounting check

- $\square$  Is the device undamaged (visual inspection)?
- ☐ Does the measuring device meet the measuring point specifications?

#### For example:

- Process temperature
- Process pressure
- Ambient temperature
- Measuring range
- ☐ Are the measuring point number and labeling correct (visual inspection)?
- ☐ Is the device adequately protected from wet conditions and direct sunlight?
- ☐ Is the device properly secured?

#### 6 **Electrical connection**

#### 6.1 Required tool

- Screwdriver for electrical connection
- Allen key for screw of cover lock

#### 6.2 Connecting requirements


#### 6.2.1 Cover with securing screw

In the case of devices for use in the hazardous area with a certain type of protection, the cover is sealed by a securing screw.

# NOTICE

If the securing screw is not positioned correctly, the cover cannot provide secure

- ▶ Open the cover: slacken the screw of the cover lock with a maximum of 2 turns so that the screw does not fall out. Fit the cover and check the cover seal.
- ▶ Close the cover: screw the cover securely onto the housing, making sure that the securing screw is positioned correctly. There should not be any gap between the cover and housing.

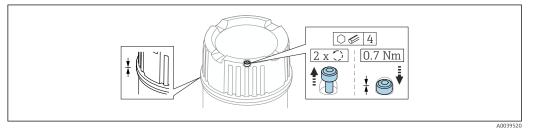

**■** 15 Cover with securing screw

#### 6.2.2 Connecting protective earth (PE)

When the device is used in hazardous areas, it must always be included in the potential equalization of the system, irrespective of the operating voltage. This is possible by connecting to the inner or outer protective ground connection (PE).

#### 6.3 Connecting the device



# Housing thread

The thread of the electronics and connection compartment is coated with lubricant varnish.

X Avoid additional lubrication.

#### 6.3.1 2-wire density (electronic insert FEL60D) for density measurement

# NOTICE


Operation with other switching units is not permitted.

Destruction of electronic components.

▶ Do not install the FEL60D electronic insert in devices that were originally used as point level switches.

# Terminal assignment

The output signal of the density sensor is based on pulse technology. With the aid of this signal, the fork frequency is continuously forwarded to the Density Computer FML621.

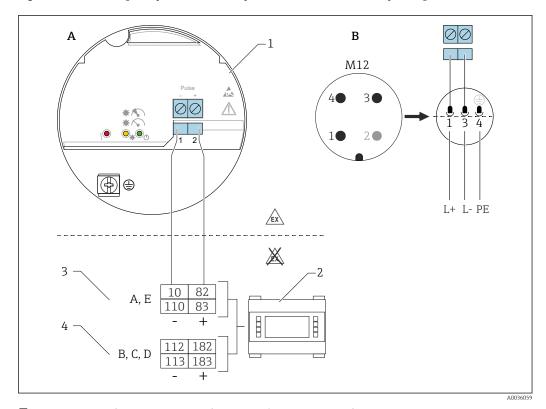

 $\blacksquare$  16 Connection diagram: Connecting the FEL60D electronic insert to the Density Computer FML621

- A Connection wiring with terminals
- B Connection wiring with M12 plug in housing according to EN61131-2 standard
- 1 Electronic insert FEL60D
- 2 Density Computer FML621
- 3 Slots A, E with extension cards (already included in the basic unit)
- 4 Slots B, C, D with extension cards (optional)

# Supply voltage

 $U = 24 V_{DC} \pm 15$  %, only suitable for connecting to the Density Computer FML621

#### Power consumption

P < 160 mW

#### **Current consumption**

I < 10 mA

# Overvoltage protection

Overvoltage category II

# Adjustment

### There are 3 different types of adjustment:


- Standard adjustment (order configuration): Two fork parameters are determined at the factory to describe the sensor characteristics and are provided in the calibration report with the product. These parameters must be transmitted to the Density Computer FML621.
- Special adjustment (select in the Product Configurator): Three fork parameters are determined at the factory to describe the sensor characteristics and are provided in the calibration report with the product. These parameters must be transmitted to the Density Computer FML621. This type of adjustment achieves an even higher level of accuracy.
- Field adjustment:
   With a field adjustment, the density determined by the user is transmitted to the FML621.
- All the necessary parameters of the Liquiphant Density are documented in the **adjustment report** and in the **sensor pass**.

The documents are included in the scope of delivery.

Further information and the documentation currently available can be found on the Endress+Hauser website: www.endress.com  $\rightarrow$  Downloads.

#### **Density measurement**

The Liquiphant Density measures the density of a liquid medium in pipes and tanks. The device is suitable for all Newtonian - ideal viscous - fluids. In addition, the device is also suitable for use in hazardous areas.

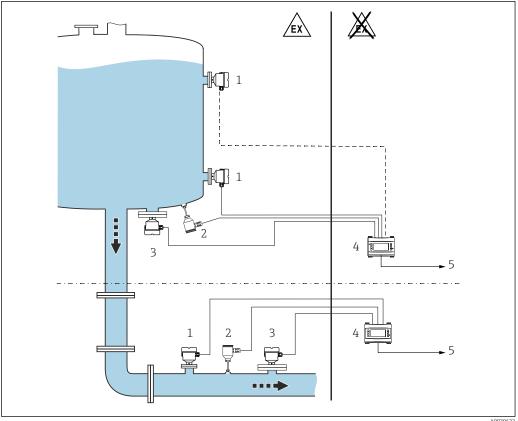

A00396


Density measurement with Density Computer FML621

- 1 Liquiphant Density  $\rightarrow$  Pulse output
- 2 Temperature sensor, e.g. 4 to 20 mA output
- 3 Pressure transmitter 4 to 20 mA output required for changes in pressure >6 bar
- Liquiphant Density Computer FML621 with display and operating unit
- 5 PLC
- The measurement can be affected by:
  - Air bubbles at the sensor
  - Unit not fully covered by medium
  - Solid media buildup on sensor
  - High flow velocity in pipes
  - Severe turbulence in the pipe due to inlet and outlet runs that are too short
  - Corrosion of the fork
  - Non-Newtonian non-ideal viscous behavior of the fluids

# 6.3.2 Connecting the cables

# Required tools

- Flat-blade screwdriver (0.6 mm x 3.5 mm) for terminals
- $\blacksquare$  Suitable tool with width across flats AF24/25 (8 Nm (5.9 lbf ft)) for M20 cable gland

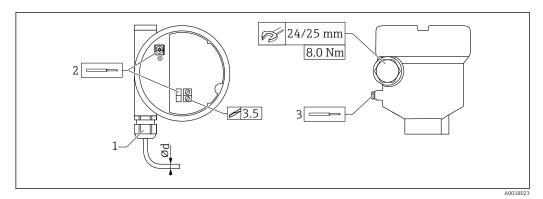

 $\blacksquare$  18 Example of coupling with cable entry, electronic insert with terminals

- M20 coupling (with cable entry), example
- 2 Conductor cross-section maximum 2.5 mm<sup>2</sup> (AWG14), ground terminal on inside in housing + terminals on the electronics
- 3 Conductor cross-section maximum 4.0 mm² (AWG12), ground terminal on outside of the housing (example: plastic housing with outer protective ground connection (PE))
- Ød Nickel-plated brass 7 to 10.5 mm (0.28 to 0.41 in), Plastic 5 to 10 mm (0.2 to 0.38 in), Stainless steel 7 to 12 mm (0.28 to 0.47 in)

# Pay attention to the following when using the M20 coupling

- Following cable entry:

   Counter-tighten the coupling
- Tighten the union nut of the coupling with 8 Nm (5.9 lbf ft)
- Screw the enclosed coupling into the housing with 3.75 Nm (2.76 lbf ft)

# 6.3.3 Post-connection check

- □ Is the device or cable undamaged (visual inspection)?
   □ Do the cables used comply with the requirements?
   □ Do the mounted cables have adequate strain relief?
- ☐ Are the cable glands mounted and firmly tightened?
- ☐ Does the supply voltage match the information on the nameplate?
- $\ \square$  No reverse polarity, is terminal assignment correct?
- ☐ If supply voltage is present, is the green LED lit?
- ☐ Are all the housing covers installed and tightened?
- $\Box$  Optional: Is the cover tightened with securing screw?


# 7 Operation options

# 7.1 Overview of operation options

# 7.1.1 Operating concept

Operation with the Density Computer FML621. For details, see documentation for the Density Computer FML621.

# 7.1.2 Elements on the electronic insert

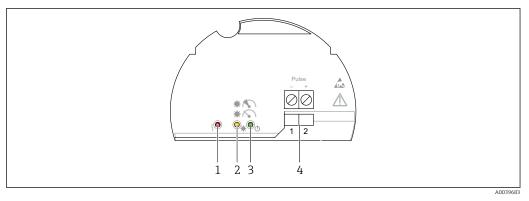

■ 19 Electronic insert FEL60D

- 1 LED red, for warning or alarm
- 2 LED yellow, stability of measurement
- 3 LED green, operational status (device is on)
- 4 Pulse output terminals

# 8 Commissioning

# 8.1 Function check

Before commissioning the measuring point, check whether the post-mounting and post-connection checks (checklist) have been performed:

- Post-mounting check" section
- Post-connection check" section

# 8.2 Switching on the device

- ► Switch on
  - ► The green LED is lit and the yellow LED flashes 2-3 times

The measurement is stable if both LEDs (green and yellow) are then lit.

# 9 Operation

# 9.1 Light signals

#### Yellow LED

Symbols, information

- Maintenance required

#### **Green LED**

Symbols, information


Ů / ☀ Power on

☼ / ● Power off

#### Red LED

Symbols, information

- 4 / No fault
- Maintenance required
- Device failure



# 10 Diagnostics and troubleshooting

The device indicates warnings and errors via the LEDs on the electronic insert. The errors diagnosed by the device are displayed in accordance with NE107. Depending on the diagnostic message, the device behaves as per a warning or fault condition.

The device behaves in accordance with NAMUR Recommendation NE131 "NAMUR standard device requirements for field devices for standard applications".

# 10.1 Diagnostic information via light emitting diodes

# 10.1.1 LED at electronic insert

#### 

- No supply voltage present: check supply voltage
- Reverse polarity: check terminal assignment
- Signal line is defective: check signal line
- Incorrect terminal assignment at FML: check terminal configuration at FML621

#### indicator: unstable process conditions

- Extreme vibrations from an external source: isolate measuring point from vibrations
- Extremely turbulent flow: provide a calming section
- Flow rate > 2 m/s: keep tuning fork away from direct flow of medium
- Buildup: remove buildup, allow for cleaning intervals

#### **\ ★** indicator: maintenance required

- Extreme vibrations from an external source: isolate measuring point from vibrations
- Flow rate > 2 m/s: keep tuning fork away from direct flow of medium
- Buildup: remove buildup, allow for cleaning intervals
- Tuning fork is blocked: change installation position

### կ 🌣 indicator: device failure

- Electronic insert is defective: replace electronic insert
- No connection to sensor: replace sensor

# 10.2 Firmware history

### V01.00.zz (06.2019)

- Valid for electronic insert: FEL60D
- Valid from documentation version: BA01974F/00/EN/01.19 (Liquiphant FTL51B Density)
- Changes: none; 1st version (original software)

# 11 Maintenance

No special maintenance work is required.

# 11.1 Maintenance tasks

# 11.1.1 Cleaning

It is not permitted to use the device with abrasive media. Material abrasion on the tuning fork can result in the device malfunctioning.

- Clean the tuning fork as necessary
- Cleaning is also possible in the installed state, e. g. CIP Cleaning in Place and SIP Sterilization in Place


# 12 Repair

# 12.1 General notes

# 12.1.1 Repair concept

Endress+Hauser repair concept

- The devices have a modular design
- Customers can carry out repairs



# 12.1.2 Repair of Ex-certified devices

# **MARNING**

# Incorrect repair can affect electrical safety!

Explosion Hazard!

- ► Only specialist personnel or the Endress+Hauser service team may carry out repairs on Ex-certified devices.
- ► Relevant standards and national regulations on hazardous areas, safety instructions and certificates must be observed.
- ▶ Use only original Endress+Hauser spare parts.
- ► Please note the device designation on the nameplate. Only identical parts may be used as replacements.
- ► Carry out repairs according to the instructions.
- ▶ Only the Endress+Hauser service team is permitted to modify a certified device and convert it to another certified version.
- ► All repairs and modifications must be documented.

# 12.2 Spare parts

- Some replaceable device components are identified by a spare part nameplate. This contains information about the spare part.
- All the spare parts for the measuring device, along with the order code, are listed in the *W@M Device Viewer* (www.endress.com/deviceviewer) and can be ordered. If available, users can also download the associated Installation Instructions.
- Device serial number or QR code:
  Located on the device and spare part nameplate.

# 12.3 Return

The requirements for safe device return can vary depending on the device type and national legislation.

- 1. Refer to the web page for information: http://www.endress.com/support/return-material
  - ► Select the region.
- 2. Return the device if repairs or a factory calibration are required, or if the wrong device was ordered or delivered.

# 12.4 Disposal



If required by the Directive 2012/19/EU on waste electrical and electronic equipment (WEEE), the product is marked with the depicted symbol in order to minimize the disposal of WEEE as unsorted municipal waste. Do not dispose of products bearing this marking as unsorted municipal waste. Instead, return them to the manufacturer for disposal under the applicable conditions.

# 13 Accessories for Liquiphant Density


# 13.1 Device Viewer

All the spare parts for the device, along with the order code, are listed in the *Device Viewer* (www.endress.com/deviceviewer).

# 13.2 Weather protection cover for dual compartment housing, aluminum

Material: stainless steel 316L

Order number: 71438303

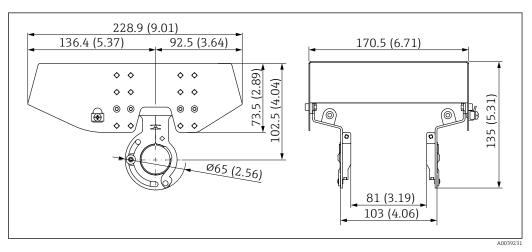


■ 20 Weather protection cover for dual compartment housing, aluminum. Unit of measurement mm (in)

# 13.3 Weather protection cover for single compartment housing, aluminum or 316L, cast

■ Material: plastic

Order number: 71438291

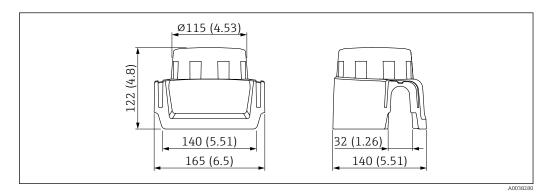

■ 21 Weather protection cover for single compartment housing made of aluminum or 316L, cast. Unit of measurement mm (in)

# 13.4 M12 socket

The M12 sockets listed are suitable for use in the temperature range -25 to +70 °C (-13 to +158 °F).

#### M12 socket IP69

- Terminated at one end
- Angled
- 5 m (16 ft) PVC cable (orange)
- Slotted nut 316L (1.4435)
- Body: PVC
- Order number: 52024216


#### M12 socket IP67

- Angled
- 5 m (16 ft) PVC cable (gray)
- Slotted nut Cu Sn/Ni
- Body: PUR
- Order number: 52010285

# 13.5 Sliding sleeves for unpressurized operation

Not suitable for use in explosive atmospheres.

For installation from above and immersion in the liquid for density measurement.

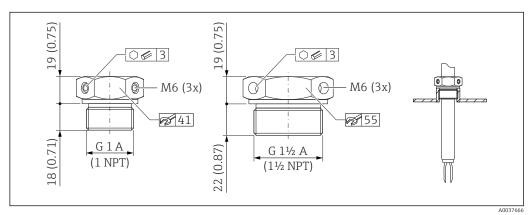

 $\blacksquare$  22 Sliding sleeves for unpressurized operation  $p_e = 0$  bar (0 psi). Unit of measurement mm (in)

# G 1, DIN ISO 228/I

- Material: 1.4435 (AISI 316L)
- Weight: 0.21 kg (0.46 lb)
- Order number: 52003978
- Order number: 52011888, approval: with inspection certificate EN 10204 3.1 material

# NPT 1, ASME B 1.20.1

- Material: 1.4435 (AISI 316L)
- Weight: 0.21 kg (0.46 lb)
- Order number: 52003979
- Order number: 52011889, approval: with inspection certificate EN 10204 3.1 material

#### G 1½, DIN ISO 228/I


- Material: 1.4435 (AISI 316L)
- Weight: 0.54 kg (1.19 lb)
- Order number: 52003980
- Order number: 52011890, approval: with inspection certificate EN 10204 3.1 material

### NPT 1½, ASME B 1.20.1

- Material: 1.4435 (AISI 316L)
- Weight: 0.54 kg (1.19 lb)
- Order number: 52003981
- $\blacksquare$  Order number: 52011891, approval: with inspection certificate EN 10204 3.1 material

# 13.6 High pressure sliding sleeves

- For installation from above and immersion in the liquid for density measurement
- Suitable for max. process pressure 100 bar (1450 psi)
- For use in hazardous areas
- Seal package made of graphite
- For G 1, G 1½: seal is included in the delivery

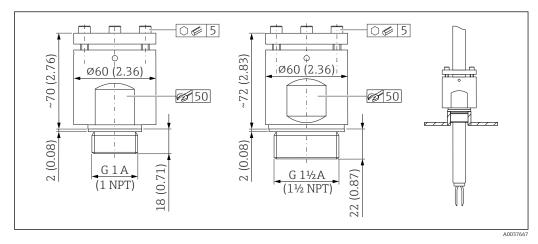

■ 23 High pressure sliding sleeves. Unit of measurement mm (in)

G 1. DIN ISO 228/I

■ Material: 1.4435 (AISI 316L)

■ Weight: 1.13 kg (2.49 lb)

Order number: 52003663

• Order number: 52011880, approval: with inspection certificate EN 10204 - 3.1 material

G 1, DIN ISO 228/I

■ Material: AlloyC22

■ Weight: 1.13 kg (2.49 lb)

• Approval: with inspection certificate EN 10204 - 3.1 material

Order number: 71118691

NPT 1, ASME B 1.20.1

Material: 1.4435 (AISI 316L)

Weight: 1.13 kg (2.49 lb)

Order number: 52003667

• Order number: 52011881, approval: with inspection certificate EN 10204 - 3.1 material

NPT 1, ASME B 1.20.1

■ Material: AlloyC22

Weight: 1.13 kg (2.49 lb)

• Approval: with inspection certificate EN 10204 - 3.1 material

Order number: 71118694

G 11/2, DIN ISO 228/1

Material: 1.4435 (AISI 316L)

■ Weight: 1.32 kg (2.91 lb)

• Order number: 52003665

• Order number: 52011882, approval: with inspection certificate EN 10204 - 3.1 material

G 1½, DIN ISO 228/1

■ Material: AlloyC22

• Weight: 1.32 kg (2.91 lb)

• Approval: with inspection certificate EN 10204 - 3.1 material

NPT 11/2, ASME B 1.20.1

Material: 1.4435 (AISI 316L)Weight: 1.32 kg (2.91 lb)

Order number: 52003669

• Order number: 52011883, approval: with inspection certificate EN 10204 - 3.1 material

NPT 1½, ASME B 1.20.1
• Material: AlloyC22

■ Weight: 1.32 kg (2.91 lb)

• Approval: with inspection certificate EN 10204 - 3.1 material

• Order number: 71118695

# 14 Accessories for Density Computer FML621

# 14.1 Device Viewer

All the spare parts for the device, along with the order code, are listed in the *Device Viewer* (www.endress.com/deviceviewer).

# 14.2 General

#### RXU10-A1

Cable set for Density Computer FML621 for connecting to a PC or modem

#### FML621A-AA

Remote display for panel mounting:

- B: 144 mm (5.67 in)
- H: 72 mm (2.83 in)
- T: 43 mm (1.69 in)

#### RMS621A-P1

PROFIBUS interface

#### 51004148

Adhesive label, printed, max. 2 x 16 characters

#### 51002393

Metal sign for TAG number

#### 51010487

Sign, paper, TAG 3 x 16 characters

# 14.3 Extension cards

The device can be extended with a maximum of three universal or digital or current or  $Pt100\ cards$ .

#### FML621A-DA

Digital

- 6 x digital input
- 6 x relay output
- Kit with terminals and fixing frame

#### FML621A-DB

Digital, ATEX-approved

- 6 x digital input
- 6 x relay output
- Kit with terminals

#### FML621A-CA

2x U, I, TC

- 2x 0 to 20 mA or 4 to 20 mA per pulse
- 2x digital
- 2x SPST relay

#### FML621A-CB

Multifunction, 2x U, I, TC ATEX

- 2x 0 to 20 mA or 4 to 20 mA per pulse
- 2x digital
- 2x SPST relay

#### FML621A-TA

Temperature (Pt100/Pt500/Pt1000)

Complete, including terminals and securing frame

#### FML621A-TB

Temperature, ATEX-approved (Pt100/PT500/PT1000)

Complete, including terminals

#### FML621A-UA

Universal - PFM or pulse or analog or transmitter power supply

Complete, including terminals and securing frame

#### FML621A-UB

Universal ATEX-approved - PFM or pulse or analog or transmitter power supply Complete, including terminals

# 14.4 PROFINET® Interface

Order code RMS621A-P2

# 15 Technical data

# 15.1 Input

### 15.1.1 Measured variable

Density of liquids

# 15.1.2 Measuring range

Density range: 0.3 to 2 g/cm<sup>3</sup>

# 15.2 Output

# 15.2.1 Output and input variants

2-wire density (FEL60D) for density measurement

Connection to Density Computer FML621

### 15.2.2 Ex connection data

See safety instructions (XA): All data relating to explosion protection are provided in separate Ex documentation and are available from the Downloads Area of the

Endress+Hauser-website. The Ex documentation is supplied as standard with all Ex devices.

# 15.3 Environment

# 15.3.1 Ambient temperature range

 $-40 \text{ to } +70 ^{\circ}\text{C} (-40 \text{ to } +158 ^{\circ}\text{F})$ 

In the hazardous area, the permitted ambient temperature can be limited depending on the zones and gas groups. Pay attention to the information in the Ex documentation (XA).

The minimum permitted ambient temperature of the plastic housing is limited to -20 °C (-4 °F); for North America, "indoor use" applies.

Outdoor operation in strong sunlight:

- Mount the device in the shade
- Avoid direct sunlight, particularly in warmer climatic regions
- Use a protective cover, which can be ordered as an accessory

# 15.3.2 Storage temperature

 $-40 \text{ to } +80 ^{\circ}\text{C} (-40 \text{ to } +176 ^{\circ}\text{F})$ 

# 15.3.3 Humidity

Operation up to 100 %. Do not open in a condensing atmosphere.

# 15.3.4 Operating altitude

As per IEC 61010-1 Ed.3:

- Up to 2000 m (6600 ft) above sea level
- Can be extended to 3 000 m (9 800 ft) above sea level if overvoltage protection is used

#### 15.3.5 Climate class

As per IEC 60068-2-38 test Z/AD

# 15.3.6 Degree of protection

In accordance with DIN EN 60529, NEMA 250

#### IP66/IP68 NEMA 4X/6P

Types of housing:

- Single compartment; plastic
- Single compartment; aluminum, coated; Ex d/XP
- Single compartment; 316L, cast; Ex d/XP
- Dual compartment L-shaped, aluminum, coated; Ex d/XP

If the "M12 plug" option is selected as the electrical connection, **IP66/67 NEMA TYPE 4X** applies for all housing types.

#### 15.3.7 Vibration resistance

As per IEC60068-2-64-2009  $a(RMS) = 50 \text{ m/s}^2$ , f = 5 to 2000 Hz, t = 3 axes x 2 h

#### 15.3.8 Shock resistance

In accordance with IEC60068-2-27-2008: 300 m/s<sup>2</sup> [= 30  $g_n$ ] + 18 ms  $g_n$ : standard acceleration of gravity

#### 15.3.9 Mechanical load

Support the device in the event of severe dynamic load. Maximum lateral loading capacity of the pipe extensions and sensors: 75 Nm (55 lbf ft).

For more details, see the "Supporting the device" section.

#### 15.3.10 Pollution degree

Pollution degree 2

# 15.3.11 Electromagnetic compatibility

Electromagnetic compatibility as per EN 61326 series and NAMUR recommendation EMC (NE21).

# 15.4 Process

# 15.4.1 Process temperature range

0 to 80 °C (32 to 176 °F)

#### 15.4.2 Thermal shock

≤ 120 K/s

# 15.4.3 Process pressure range

-1 to +25 bar (-14.5 to +362.5 psi)

# **MARNING**

The maximum pressure for the device depends on the lowest-rated element, with regard to pressure, of the selected component. This means that it is necessary to pay attention to the process connection as well as the sensor.

- ▶ Pressure specifications, see the associated Technical Information.
- ► Only operate the device within the specified limits!
- ► The Pressure Equipment Directive (2014/68/EU) uses the abbreviation "PS". The abbreviation "PS" corresponds to the MWP (maximum working pressure) of the device.
- Canadian CRN approval: more details about the maximum pressure values are available in the download area of the product page under: www.endress.com→ Downloads.

# 15.4.4 Pressure tightness

Up to vacuum

# 15.5 Additional technical data



- Technical Information Liquiphant FTL51B Density: TI01466F
- Technical Information Liquiphant FTL51B: TI01403F

# Index

A
About this document Symbols - description
C
CE mark (Declaration of Conformity)
DDeclaration of Conformity7Disposal27Document
Purpose
E Electrical connection Terminal assignment
I
Identifying the device9Incoming acceptance8Inspection8
M
Mounting Mounting requirements
<b>N</b> Nameplate
<b>O</b> Operational safety
P
Post-connection check
Product safety
R
Repair concept26Requirements for the personnel6Return27
S
Securing screw19Spare parts27Nameplate27
T
Technical data Measured variables Measuring ranges
Process range
Transporting Handling

W	
W@M Device Viewer	27
Workplace safety	6



www.addresses.endress.com