

Installation Instruction

Source holder and O-ring set

Source container FQG66

EA01138F/00/A2/01.15
71309178



71309178

This instruction is valid for the following spare part sets:

Order number	Original spare part set
XPF0034 - ###	Source holder FQG66
71305404	O-Ring set FQG66

i We recommend that the Installation Instructions be kept with the packaging at all times.

Designated use


The spare part set and Installation Instruction are used to replace a faulty unit with a functioning unit of the same type.

Use genuine parts from Endress+Hauser only.

Only original spare part sets, intended by Endress+Hauser for the measuring device, shall be used.

The verification has to be done via W@M Device Viewer this procedure is explained below.

i For some devices there is an overview of the correct spare part set inside the connection compartment cover.
If the spare part is listed there, the verification is not required.

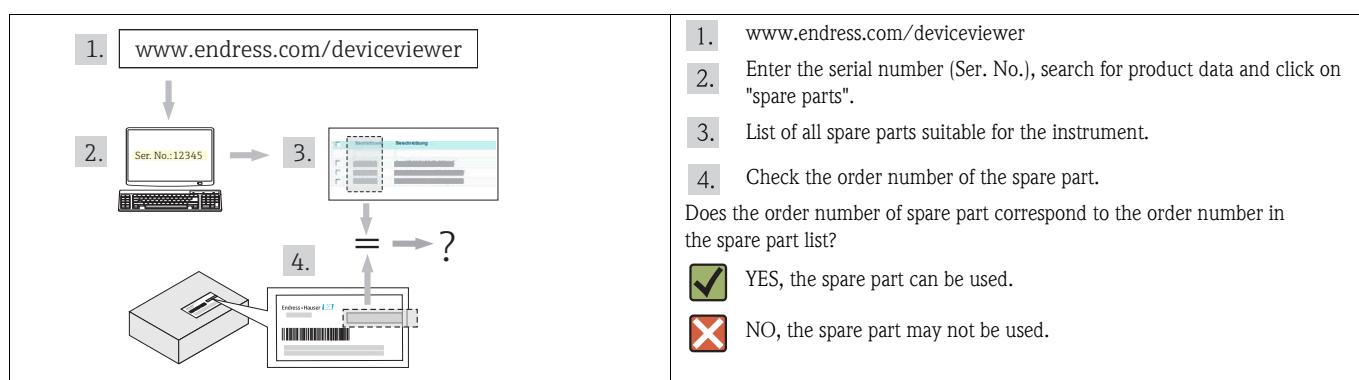

Authorized personnel to carry out repairs

Authorization to carry out a repair depends on the approval of the measuring device. The table shows the respective group of persons for each.

i The person who carries out the repair is responsible for safety during the work, the quality of work completed and safety of the device after repair.

Approval of the measuring device	Group of persons authorized to carry out repairs
Without approval	2, 3
With approval (for Ex. IECEx, ATEX, FM, CSA, TIIS, NEPSI)	2, 3

1 = Trained customer technician, 2 = Service technician authorized by Endress+Hauser, 3 = Endress+Hauser (send measuring device back to manufacturer)

Safety instructions

- Check whether the spare part matches the identification label on the measuring device. See chapter "Designated use".
- The spare parts set and Installation Instructions are used to replace a faulty unit with a functioning unit of the same type. Use genuine parts from Endress+Hauser only.
- In the case of Ex-certified measuring devices: Observe the information in the documentation "Safety Instructions" (XA, ZD). The relevant Safety Instructions (XA) are indicated on the nameplate.
- The measuring device is energized. Danger: Risk of electric shock! Open the measuring device in a de-energized state only.
- Before removing the device: set the process in a safe condition and purge the pipe of dangerous materials.
- Hot surfaces! Risk of injury! Before commencing work, allow the system and measuring device to cool down to a touchable temperature.
- In the case of measuring devices in custody transfer, the custody transfer status no longer applies once the lead seal has been removed.
- Comply with national regulations governing mounting, electrical installation, commissioning, maintenance and repair procedures.
- Requirements with regard to specialized technical staff for the mounting, electrical installation, commissioning, maintenance and repair of the measuring devices:
 - trained in instrument safety
 - familiar with the individual operation conditions of the devices
 - for Ex-certified measuring devices: also trained in explosion protection
- Follow the Operating Instructions for the device.
- Risk of damaging electronic components! Ensure you have a working environment protected from electrostatic discharge.
- After removing the electronics cover, there is a risk of electric shock as shock protection is removed!
Switch off the measuring device before removing internal covers.
- Modifications to the measuring device are not permitted.
- In the case of measuring devices in safety-related applications in accordance with IEC 61508 or IEC 61511: After repair recommission in accordance with Operating Instructions. Document the repair procedure.
- Only open housing for a brief period. Avoid the penetration of foreign bodies, moisture or contaminants.
- Replace defective seal/gaskets with genuine parts from Endress+Hauser only.
- If threads are damaged or defective, the measuring device must be repaired.
- Threads (e.g. of the cover for the electronics and terminal compartment), which have been prepared by Endress+Hauser with an abrasion resistant dry lubrication should not be additionally lubricated.
Threads without lubricant must be lubricated with an acid-free, non-hardening grease.
- If spacing is reduced or the dielectric strength of the measuring device cannot be guaranteed during repair work, perform a test on completion of the work (e.g. high-voltage test in accordance with the manufacturer's instructions).
- Service connector:
 - do not connect in potentially explosive atmospheres.
 - only connect to Endress+Hauser service devices.
- Observe the instructions for transporting and returning the device outlined in the Operating Instructions.
- If you have any questions, contact your E+H service organization.

Exchange of source holder

⚠ WARNING

During exchange of slide bearing set you may be exposed to ionizing radiation.

- Contact your responsible radiation safety officer for particular instructions.
- Check the source container, it must be fixed in the OFF position.
- Avoid any unnecessary exposure to radiation.
- Keep unavoidable exposure to radiation as low as possible.
- Observe the instructions on radiation protection in Operating Instruction BA01327F.

The spare part set consists of source holder with O-ring and protection pipe and a new reference O-ring.

The reference O-ring is positioned under the cap and offers valuable clues about the difficult accessible O-ring at the source holder.

An exchange of the source holder requires also an exchange of the reference O-ring. This is to ensure the redundancy of the O-rings after the exchange of the source holder.






i With the exchange of the source holder, it is mandatory to replace the reference O-ring!

Source holder

The procedure for the exchange of source holder is the same as for loading and changing the source. It is described in the attached documentation SD00297F.

i The corresponding documentation SD00297F must have been read and understood. All safety instructions, regulations and series of steps contained in this documentation, especially the instructions on radiation protection, must be strictly observed.

Replacement of reference O-ring

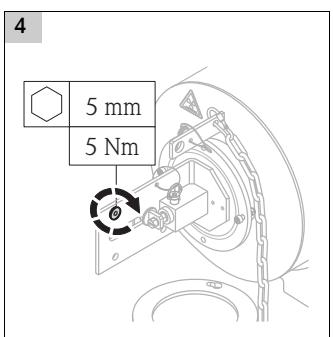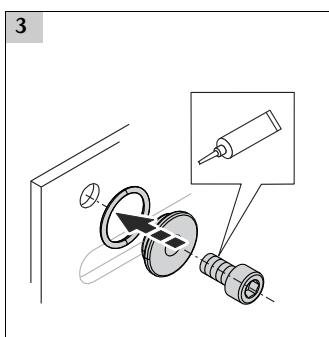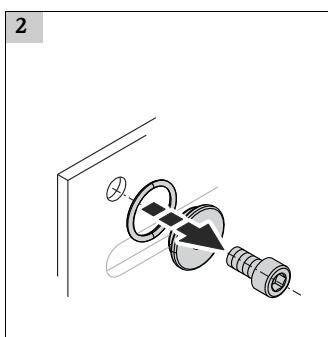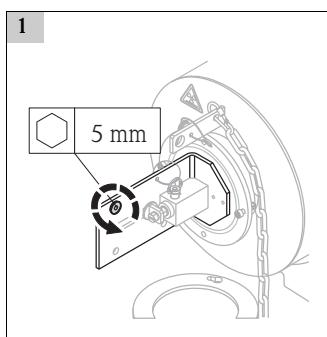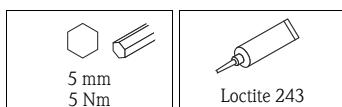

O-ring set

The O-ring set consists of an O-ring at the source holder and a reference O-ring.


The reference O-ring is placed under der cap and offers valuable clues about the difficult accessible O-ring at the source holder. The exchange of one O-ring requires also the exchange of the second. This is to ensure the redundancy of the O-rings.

 It is always mandatory to replace both O-rings!

Exchange of O-ring at source holder



The procedure for the exchange of O-ring at source holder is the same as the procedure when loading and changing the source, this is described in the attached documentation SD00297F.

 The corresponding documentation SD00297F must have been read and understood. All safety instructions, regulations and series of steps contained in this documentation, especially the instructions on radiation protection, must be strictly observed.

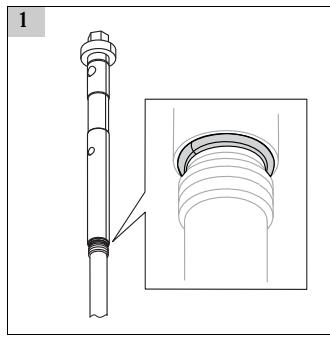


FQG66_gasket7


Exchange of reference O-ring

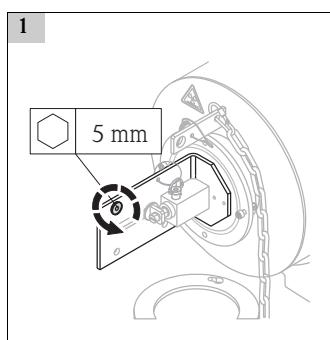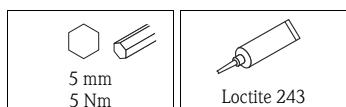


FQG66_gasket3

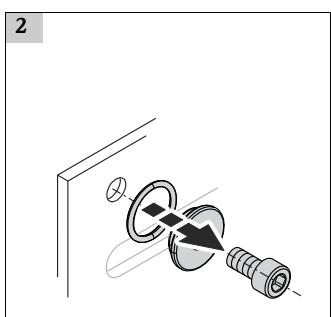

FQG66_gasket4

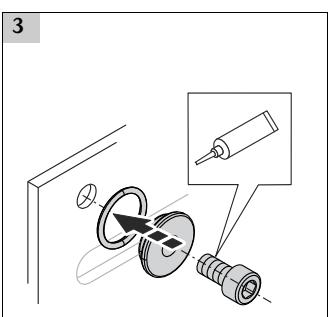

FQG66_gasket5

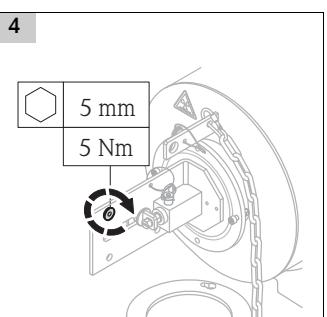

FQG66_gasket6



Einbauanleitung

Präparaträger und Dichtungsset

Strahlenschutzbehälter FQG66

EA01138F/00/A2/01.15
71309178

Die Einbauanleitung ist für folgende Ersatzteilsets gültig:

Bestellnummer	Original Ersatzteilset
XPF0034 - ###	Präparaträger FQG66
71305404	Dichtungsset FQG66


i Wir empfehlen Einbauanleitung und Verpackung immer zusammen aufzubewahren.

Bestimmungsgemäße Verwendung

Ersatzteilset und Einbauanleitung dienen dazu, eine defekte Einheit gegen eine funktionierende Einheit des gleichen Typs zu ersetzen. Es dürfen nur Originalteile von Endress+Hauser verwendet werden. Grundsätzlich dürfen nur Ersatzteilsets verwendet werden, die von Endress+Hauser für das Messgerät vorgesehen sind. Die Überprüfung ist via W@M Device Viewer durchzuführen, die Vorgehensweise dazu ist nachfolgend beschrieben.

i Bei einigen Messgeräten befindet sich im Anschlussraumdeckel eine Ersatzteilübersicht.

Ist das Ersatzteilset dort aufgelistet, entfällt die Überprüfung.

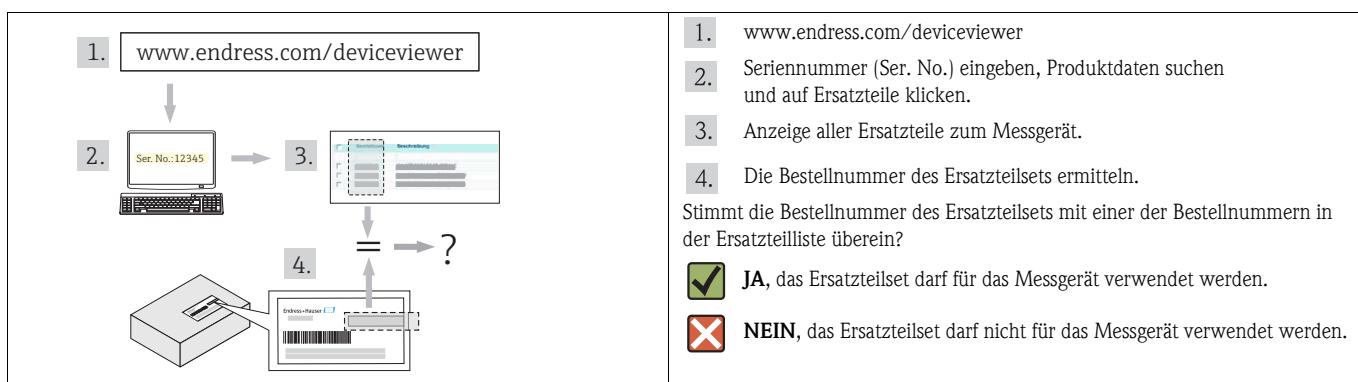

Reparaturberechtigte Personen

Die Berechtigung zur Durchführung einer Reparatur ist von der Zulassung des Messgeräts abhängig. Die Tabelle zeigt den jeweils berechtigten Personenkreis.

i Die Person, die eine Reparatur vornimmt, übernimmt die Verantwortung für die Sicherheit während der Arbeiten, die Qualität der Ausführung und die Sicherheit des Geräts nach der Reparatur.

Zulassung des Messgeräts	Reparaturberechtigter Personenkreis
ohne Zulassung	2, 3
mit Zulassung (z.B. IECEx, ATEX, FM, CSA, TIIS, NEPSI)	2, 3

1 = Ausgebildete Fachkraft des Kunden, 2 = Von Endress+Hauser autorisierter Servicetechniker, 3 = Endress+Hauser (Messgerät an Hersteller zurücksenden)

Sicherheitshinweise

- Prüfen, ob das vorliegende Ersatzteil zur Kennzeichnung auf dem Messgerät passt, wie auf der Titelseite beschrieben.
- Ersatzteilset und Einbauanleitung dienen dazu, eine defekte Einheit gegen eine funktionierende Einheit des gleichen Typs zu ersetzen. Nur Originalteile von Endress+Hauser verwenden.
- Bei Ex-zertifizierten Messgeräten: Sicherheitshinweise im separaten Dokument "Safety Instructions" (XA, ZD) beachten.
Auf dem Typenschild ist angegeben, welche Sicherheitshinweise für das jeweilige Gerät relevant sind.
- Messgerät unter Spannung! Lebensgefahr durch Stromschlag. Messgerät nur im spannungslosen Zustand öffnen.
- Vor einem Geräteausbau: Prozess in sicheren Zustand bringen und Leitung von gefährlichen Prozessstoffen befreien.
- Verbrennungsgefahr durch heiße Oberflächen! Vor Arbeitsbeginn: Anlage und Messgerät auf berührungssichere Temperatur abkühlen.
- Bei Messgeräten im abrechnungspflichtigen Verkehr: Nach Entfernen der Plombe ist der geeichte Zustand aufgehoben.
- Nationale Vorschriften bezüglich der Montage, elektrischen Installation, Inbetriebnahme, Wartung und Reparatur einhalten.
- Folgende Anforderungen an das Fachpersonal für Montage, elektrische Installation, Inbetriebnahme, Wartung und Reparatur der Messgeräte müssen erfüllt sein:
 - In Gerätesicherheit ausgebildet
 - Mit den jeweiligen Einsatzbedingungen der Geräte vertraut.
 - Bei Ex-zertifizierten Messgeräten zusätzlich im Explosionsschutz ausgebildet.
- Die Betriebsanleitung zum Messgerät ist zu beachten.
- Beschädigungsgefahr elektronischer Bauteile! Eine ESD-geschützte Arbeitsumgebung herstellen.
- Nach Entfernen der Elektronikabdeckung: Stromschlaggefahr durch aufgehobenen Berührungsschutz!
Messgerät ausschalten, bevor interne Abdeckungen entfernt werden.
- Änderungen am Messgerät sind nicht zulässig.
- Bei Messgeräten in sicherheitstechnischen Applikationen gemäß IEC 61508 bzw. IEC 61511: Nach Reparatur Neuinbetriebnahme gemäß Betriebsanleitung durchführen. Reparatur dokumentieren.
- Gehäuse nur kurzzeitig öffnen. Eindringen von Fremdkörpern, Feuchtigkeit oder Verunreinigung vermeiden.
- Defekte Dichtungen nur durch Original-Dichtungen von Endress+Hauser ersetzen.
- Defekte Gewinde erfordern eine Instandsetzung des Messgeräts.
- Wenn bei den Reparaturarbeiten Abstände reduziert oder die Spannungsfestigkeit des Messgeräts nicht sichergestellt werden kann: Prüfung nach Abschluss der Arbeiten durchführen (z.B. Hochspannungstest gemäß Herstellerangaben).
- Servicestecker:
 - nicht in explosionsfähiger Atmosphäre anschließen.
 - nur an Servicegeräte von Endress+Hauser anschließen.
- Die in der Betriebsanleitung aufgeführten Hinweise zum Transport und zur Rücksendung beachten.
- Bei Fragen kontaktieren Sie bitte Ihre zuständige Endress+Hauser Serviceorganisation.

Präparatträger

⚠️ WARNUNG

Das Ersatzteilset besteht aus dem Präparatträger mit O-Ring und Schutzrohr sowie einem Referenz O-Ring.

Der Referenz O-Ring sitzt unter der Haube und gibt Aufschluss über den schwer zugänglichen O-Ring am Präparatträger.

Beim Austausch des Präparatträgers muss der Referenz O-Ring zwingend mit ausgetauscht werden. Nur so wird gewährleistet, dass die Redundanz auch nach dem Austausch erhalten bleibt.






i Der Referenz O-Ring muss zwingend mit ausgetauscht werden!

Austausch des Präparatträgers

Die Vorgehensweise zum Austausch des Präparatträgers entspricht der Vorgehensweise zur Strahlerbeladung und zum Strahlertausch, diese ist in der beigelegten SD00297F ausführlich beschrieben.

i Die zugehörige Dokumentation SD00297F zur Strahlerbeladung und zum Strahlertausch muss gelesen und verstanden worden sein.
Alle Sicherheitshinweise, Vorschriften und Handlungsschritte in dieser Dokumentation, insbesondere Hinweise zum Strahlenschutz, sind unbedingt zu beachten.

Austausch des Referenz O-Rings

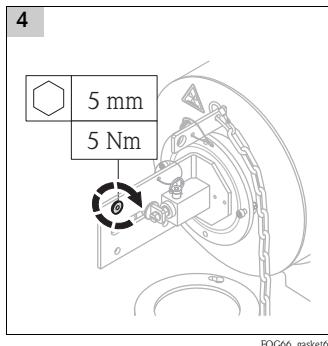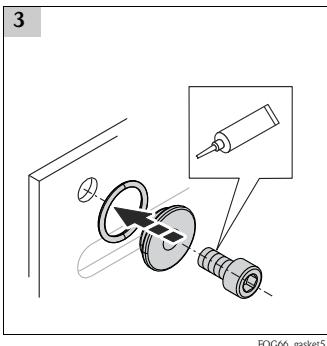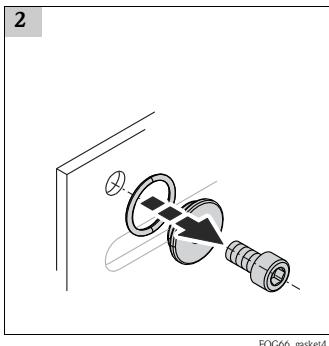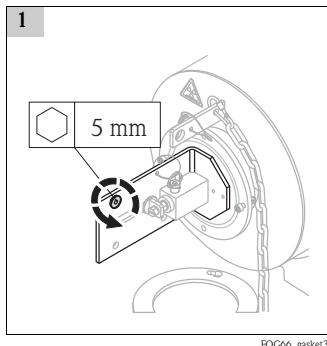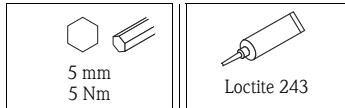

O-Ring Set

⚠️ WARNUNG

Das O-Ring Set besteht aus dem O-Ring am Präparaträger und einem Referenz O-Ring.


Der Referenz O-Ring gibt Aufschluss über den schwer zugänglichen O-Ring am Präparathalter, ist dieser porös oder brüchig, müssen beide O-Ringe ersetzt werden. Nur so wird gewährleistet, dass die Redundanz der O-Ringe erhalten bleibt

- i** Es müssen zwingend immer beide O-Ringe ausgetauscht werden!

Austausch des O-Rings am Präparaträger



Die Vorgehensweise zum Austausch des O-Ring am Präparaträger entspricht der Vorgehensweise zur Strahlerbeladung und zum Strahlertausch, diese ist in der beigelegten SD00297F ausführlich beschrieben.

- i** Die zugehörige Dokumentation SD00297F zur Strahlerbeladung und zum Strahlertausch muss gelesen und verstanden worden sein.
Alle Sicherheitshinweise, Vorschriften und Handlungsschritte in dieser Dokumentation, insbesondere Hinweise zum Strahlenschutz, sind unbedingt zu beachten.

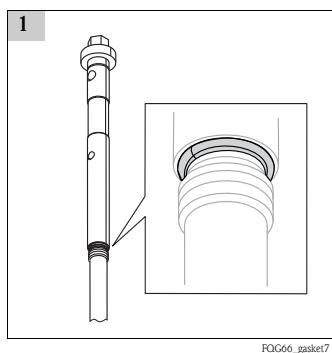


FOG66_gasket7


Austausch des Referenz O-Rings

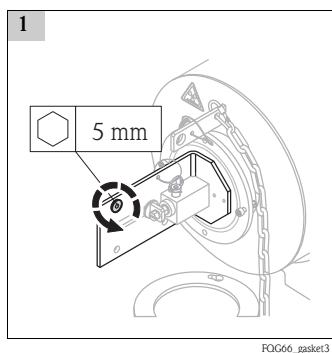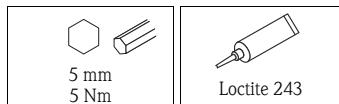


FOG66_gasket3

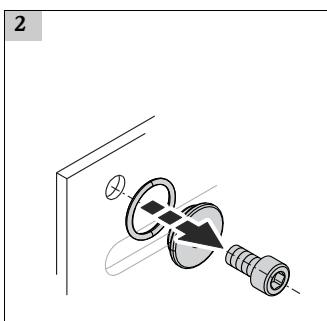

FOG66_gasket4

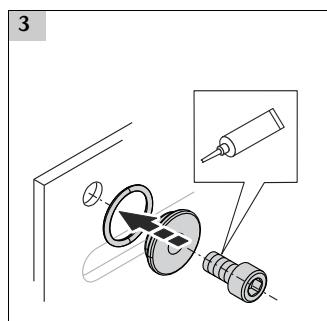

FOG66_gasket5

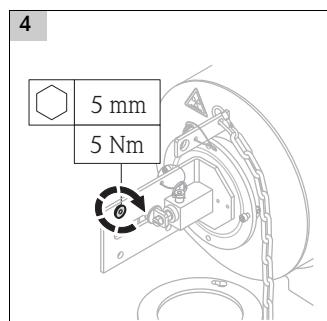

FOG66_gasket6