Safety Instructions Cerabar PMP43

Ex ia IIIB T135 °C Da Ex ic IIIB T135 °C Dc





Cerabar PMP43

Table of contents

About this document	. 4
Associated documentation	. 4
upplementary documentation	. 4
ertificates and declarations	. 4
Manufacturer address	. 4
xtended order code	. 4
afety instructions: General	. 6
afety instructions: Specific conditions of use	. 7
afety instructions: Installation	. 8
emperature tables	. 9
onnection data	10

XA03560P-A Cerabar PMP43

About this document



The document number of these Safety Instructions (XA) must match the information on the nameplate.

Associated documentation

All documentation is available on the Internet:

www.endress.com/Deviceviewer

(enter the serial number from the nameplate).

To commission the device, please observe the Operating Instructions pertaining to the device:

BA02305P

Supplementary documentation

Explosion protection brochure: CP00021Z

The explosion protection brochure is available on the Internet: www.endress.com/Downloads

Certificates and declarations

Certificate of Conformity

Certificate number: CML 25IPN2337X

Affixing the certificate number certifies conformity with the following standards (depending on the device version):

- JNIOSH-TR-46-1:2020
- JNIOSH-TR-46-6:2015

Manufacturer address

Endress+Hauser SE+Co. KG

Hauptstraße 1

79689 Maulburg, Germany

Address of the manufacturing plant: See nameplate.

Extended order code

The extended order code is indicated on the nameplate, which is affixed to the device in such a way that it is clearly visible. Additional information about the nameplate is provided in the associated Operating Instructions.

Structure of the extended order code

PMP43	-	*****	+	A*B*C*D*E*F*G*.
(Device		(Basic		(Optional
type)		specifications)		specifications)

* = Placeholder

At this position, an option (number or letter) selected from the specification is displayed instead of the placeholders.

Basic specifications

The features that are absolutely essential for the device (mandatory features) are specified in the basic specifications. The number of positions depends on the number of features available. The selected option of a feature can consist of several positions.

Optional specifications

The optional specifications describe additional features for the device (optional features). The number of positions depends on the number of features available. The features have a 2-digit structure to aid identification (e.g. JA). The first digit (ID) stands for the feature group and consists of a number or a letter (e.g. J = Test, Certificate). The second digit constitutes the value that stands for the feature within the group (e.g. A = 3.1 material (wetted parts), inspection certificate).

More detailed information about the device is provided in the following tables. These tables describe the individual positions and IDs in the extended order code which are relevant to hazardous locations.

Extended order code: Cerabar



The following specifications reproduce an extract from the product structure and are used to assign:

- This documentation to the device (using the extended order code on the nameplate).
- The device options cited in the document.

Device type

PMP43

XA03560P-A Cerabar PMP43

Basic specifications

Position 1, 2 (Approval)			
Selected op	ption	Description	
PMP43	JH	JPN Ex ia IIIB T135 °C Da	
	JT	JPN Ex ic IIIB T135 °C Dc	

Position 3, 4 (Output)			
Selected option		Description	
PMP43	BA	2-wire, 4-20 mA HART	

Position 9 (Application)			
Selected option		Description	
PMP43	А	Process temperature max 100 °C (212 °F)	
	В	Process temperature max 130 °C (266 °F), 150 °C (302 °F) max 1 h	
	С	Process temperature max 150 °C (302 °F)	
	D	Process temperature max 200 °C (392 °F)	

Optional specifications

No options specific to hazardous locations are available.

Safety instructions: General

- The device is intended to be used in explosive atmospheres as defined in the scope of IEC 60079-0 or equivalent national standards. If no potentially explosive atmospheres are present or if additional protective measures have been taken: The device may be operated according to the manufacturer's specifications.
- Comply with the installation and safety instructions in the Operating Instructions.
- Staff must meet the following conditions for mounting, electrical installation, commissioning and maintenance of the device:
 - Be suitably qualified for their role and the tasks they perform
 - Be trained in explosion protection
 - Be familiar with national regulations
- Install the device according to the manufacturer's instructions and national regulations.
- Do not operate the device outside the specified electrical, thermal and mechanical parameters.

- Only use the device in media to which the wetted materials have sufficient durability.
- Avoid electrostatic charging:
 - Of plastic surfaces (e.g. enclosure, sensor element, special varnishing, attached additional plates, ...)
 - Of isolated capacities (e.g. isolated metallic plates)
- Alterations to the device can affect the explosion protection and must be carried out by staff authorized to perform such work by Endress+Hauser

Safety instructions: Specific conditions of use

- To avoid electrostatic charging: Do not rub surfaces with a dry cloth.
- In the event of additional or alternative special varnishing on the enclosure or other metal parts or for adhesive plates:
 - Observe the danger of electrostatic charging and discharge.
 - Do not install in the vicinity of processes (≤ 0.5 m) generating strong electrostatic charges.
- Avoid sparks caused by impact and friction.
- In the case of process connections made of polymeric material or with polymeric coatings, avoid electrostatic charging of the plastic surfaces.
- The process connection of the device must be installed in such a way that quarantees a sufficiently tight joint (IP66/67).
- Applications in which the process temperature exceeds the maximum surface temperature limits of the required maximum surface temperature: The ignition hazard posed by hot surfaces on the process connecting parts of the device must be taken into account.
- It is essential for the device to use a power supply that is galvanically isolated from earth.
- When using an intrinsically safe barrier, the barrier must be connected to the same earth as the device.

Device group III, Application in dust


Ambient and process temperature range: -40 to +70 °C.

Electronics enclosure with display (LCD or LED)

Do not use in areas with a moving dust atmosphere.

XA03560P-A Cerabar PMP43


Safety instructions: Installation

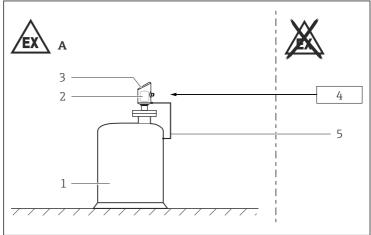

A0058127

- A Basic specifications Position 1, 2 = JH: Zone 20, Basic specifications Position 1, 2 = JT: Zone 22
- 1 Tank; Basic specifications Position 1, 2 = JH: Zone 20, Basic specifications Position 1, 2 = JT: Zone 22
- 2 Electronic insert
- 3 Enclosure
- 4 Associated intrinsically safe power supply units
- 5 Local earthing
- Continuous service temperature of the connecting cable: $\geq T_a + 20 \text{ K}$.
- Observe the pertinent guidelines when interconnecting intrinsically safe circuits.
- Observe the maximum process conditions according to the manufacturer's Operating Instructions.
- Install the device to exclude any mechanical damage or friction during the application. Pay particular attention to flow conditions and tank fittings.
- Perform the following to achieve the degree of protection IP66/68:
 - Select a suitable cable / connector.
 - Mount the cable / connector correctly.
- Supplied cables / connectors comply with the requirements of the type of protection marked on the nameplate.

Permitted ambient conditions

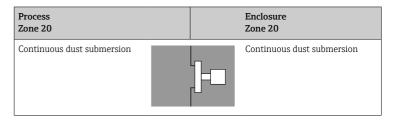

Intrinsic safety

The intrinsically safe input power circuit of the device is isolated from ground. The dielectric strength is at least 500 $V_{\text{rms}}.\;$

Potential equalization

- Integrate the device into the local potential equalization.
- If not earthed directly via the process connection, provide separate earthing.

Temperature tables



- The specified surface temperature takes into account all direct heat influences from process heat and self-heating at the enclosure.
- The specified ambient and process temperature ranges exclusively refer to the explosion protection and must not be exceeded. Operationally permitted ambient temperature ranges can be restricted depending on the version: See Operating Instructions.
- Do not exceed the max. ambient temperature at the enclosure.

For detailed information see Technical Information.



Protection type of enclosure: IP66/68

Maximum surface temperature	Process temperature range	Ambient temperature range
T135℃	$-40~^{\circ}\text{C} \le T_p \le +70~^{\circ}\text{C}$	$-40 ^{\circ}\text{C} \le T_{\text{a}} \le +70 ^{\circ}\text{C}$

XAO3560P-A Cerabar PMP43

Connection data

Entity parameter

 $U_{i} = 30 \text{ V}$

 $I_i = 100 \text{ mA}$

 $P_i = 650 \text{ mW}$

 $C_i = 15 \text{ nF}$

 $L_i = 0.69 \text{ mH}$





www.addresses.endress.com