# Safety Instructions **Micropilot FMR60, FMR62, FMR67**

4-20 mA HART

ATEX, IECEx: Ex ec IIC Gc

Ex ic IIC Gc







### Micropilot FMR60, FMR62, FMR67

#### 4-20 mA HART

#### Table of contents

About this document
Associated documentation
Supplementary documentation
Manufacturer's certificates
Manufacturer address
Other standards
Extended order code 5
Safety instructions: General
Safety instructions: Special conditions
Safety instructions: Installation
Temperature tables
Connection data

## About this document



This document has been translated into several languages. Legally determined is solely the English source text.

The document translated into EU languages is available:

- In the download area of the Endress+Hauser website:
   www.endress.com -> Downloads -> Manuals and Datasheets ->
   Type: Ex Safety Instruction (XA) -> Text Search: ...
- In the Device Viewer: www.endress.com -> Product tools -> Access device specific information -> Check device features
- i

If not yet available, the document can be ordered.

# Associated documentation

This document is an integral part of the following Operating Instructions:

- BA01618F/00 (FMR60)
- BA01619F/00 (FMR62)
- BA01620F/00 (FMR67)

# Supplementary documentation

Explosion-protection brochure: CP00021Z/11

The Explosion-protection brochure is available:

- In the download area of the Endress+Hauser website:
   www.endress.com -> Downloads -> Brochures and Catalogs -> Text Search: CP00021Z
- On the CD for devices with CD-based documentation

# Manufacturer's certificates

#### **EU Declaration of Conformity**

Declaration Number:

EC 00478

The EU Declaration of Conformity is available: In the download area of the Endress+Hauser website: www.endress.com -> Downloads -> Declaration -> Type: EU Declaration -> Product Code: ...

#### **EU Certificate of Conformity**

Declaration Number:

EC 00478 X

List of applied standards: See EU Declaration of Conformity.

#### **IEC Declaration of Conformity**

Certificate number: IECEx IBE16 0035 X

Affixing the certificate number certifies conformity with the following standards (depending on the device version):

- IEC 60079-0:2017
- IEC 60079-7:2015 / A1:2018
- IEC 60079-11:2011

# Manufacturer address

Endress+Hauser SE+Co. KG Hauptstraße 1 79689 Maulburg, Germany

Address of the manufacturing plant: See nameplate.

#### Other standards

Among other things, the following standards shall be observed in their current version for proper installation:

- IEC/EN 60079-14: "Explosive atmospheres Part 14: Electrical installations design, selection and erection"
- EN 1127-1: "Explosive atmospheres Explosion prevention and protection - Part 1: Basic concepts and methodology"

# Extended order code

The extended order code is indicated on the nameplate, which is affixed to the device in such a way that it is clearly visible. Additional information about the nameplate is provided in the associated Operating Instructions.

#### Structure of the extended order code

FMR6x	-	*****	+	A*B*C*D*E*F*G*
(Device tvpe)		(Basic specifications)		(Optional specifications)

\* = Placeholder

At this position, an option (number or letter) selected from the specification is displayed instead of the placeholders.

#### Basic specifications

The features that are absolutely essential for the device (mandatory features) are specified in the basic specifications. The number of

positions depends on the number of features available. The selected option of a feature can consist of several positions.

#### Optional specifications

The optional specifications describe additional features for the device (optional features). The number of positions depends on the number of features available. The features have a 2-digit structure to aid identification (e.g. JA). The first digit (ID) stands for the feature group and consists of a number or a letter (e.g. J = Test, Certificate). The second digit constitutes the value that stands for the feature within the group (e.g. A = 3.1 material (wetted parts), inspection certificate).

More detailed information about the device is provided in the following tables. These tables describe the individual positions and IDs in the extended order code which are relevant to hazardous locations.

#### Extended order code: Micropilot



The following specifications reproduce an extract from the product structure and are used to assign:

- This documentation to the device (using the extended order code on the nameplate).
- The device options cited in the document.

Device type

FMR60, FMR62, FMR67

#### Basic specifications

Position 1, 2 (Approval)			
Selected option		Description	
FMR6x	BG 1) 2)	ATEX II 3 G Ex ec IIC T6T1 Gc	
	BH 3)	ATEX II 3 G Ex ic IIC T6T1 Gc	
	IG 1) 4)	IECEx II 3 G Ex ec IIC T6T1 Gc	
	IH 5)	IECEx II 3 G Ex ic IIC T6T1 Gc	

- 1) Combination with Position 4 = L, M, N in connection with Position 3 = A is not allowed.
- The designation changes in connection with Position 4 = L, M, N and Position 3 = B, 2) C: II 3 G Ex ec [ia Ga] IIC T6...T1 Gc. Special version only with Ex e certified entry.
- The designation changes in connection with Position 4 = L, M, N and Position 3 = B, 3) C: II 3 G Ex ic [ia Ga] IIC T6...T1 Gc
- 4) The designation changes in connection with Position 4 = L, M, N and Position 3 = B, C: Ex ec [ia Ga] IIC T6...T1 Gc. Special version only with Ex e certified entry.
- 5) The designation changes in connection with Position 4 = L, M, N and Position 3 = B, C: Ex ic [ia Ga] IIC T6...T1 Gc

Position 3 (Power Supply, Output)			
Selected option		Description	
FMR6x	Α	2-wire, 4-20 mA HART	
	В	2-wire, 4-20 mA HART, switch output (PFS)	
	С	2-wire, 4-20 mA HART, 4 to 20 mA	

Position 4 (Display, Operation)			
Selected option		Description	
FMR6x	Α	Without, via communication	
	С	SD02, 4-line, push buttons + data backup function	
	Е	SD03, 4-line, illum., touch control + data backup function	
	L 1) 2)	Prepared for display FHX50 + M12 connection	
	M 1) 2)	Prepared for display FHX50 + custom connection	
	N 1) 3)	Prepared for display FHX50 + NPT1/2"	

- 1)
- FHX50 is approved according to DEK12.0046X or DEKRA 12ATEX0151X. In connection with Position 5 = A: Observe the specifications in the "Overvoltage protection" and "Temperature tables" chapters! Only in connection with Position 5 = B, C2)
- 3)

Position 5 (Housing)			
Selected option		Description	
FMR6x	A 1)	GT19 dual compartment, plastic PBT	
	С	GT20 dual compartment, Alu, coated	
FMR62 FMR67	В	GT18 dual compartment, 316L	

1) Only in connection with Position 1, 2 = BH, IH

Position 6 (Electrical Connection)			
Selected option		Description	
FMR6x	Α	Gland M20, IP66/68 NEMA4X/6P	
	В	Thread M20, IP66/68 NEMA4X/6P	
	С	Thread G1/2, IP66/68 NEMA4X/6P	
	D	Thread NPT1/2, IP66/68 NEMA4X/6P	
	I 1) 2)	Plug M12, IP66/68 NEMA4X/6P	
	M 1) 2)	Plug 7/8", IP66/68 NEMA4X/6P	

- Only in connection with Position 1, 2 = BH, IH Only in connection with Position 3 = A  $^{\circ}$ 1)
- 2)

Position 7, 8 (Antenna)			
Selected opt	ion	Description	
FMR60	GA	Drip-off, PTFE DN50	
FMR62	GE	Integrated, PEEK, 3/4"	
	GF	Integrated, PEEK, 1-1/2"	
	GG	Integrated, PEEK, 20mm/M24x1.5, install > accessory hygienic adapter	
	GM	PTFE cladded flush mount DN50	
	GN	PTFE cladded flush mount DN80	
FMR67	GA	Drip-off, PTFE DN50	
	GP	PTFE flush mount DN80	
Shown in the temperature tables exemplary as follows:			

Position 9, 10 (Seal)			
Selected opt	ion	Description	
FMR60	A3	FKM Viton GLT, -4080°C/-40176°F	
	A4	FKM Viton GLT, -40130°C/-40266°F	
	C1	FFKM Kalrez, -20150°C/-4302°F	
	B4	EPDM, -40150°C/-40302°F	
FMR62	A5	FKM Viton GLT, -40150°C/-40302°F	
	A6	FKM Viton GLT, -40200°C/-40392°F	
	B5	EPDM, -40150°C/-40302°F	
	C1	FFKM Kalrez, -20150°C/-4302°F	
	C2	FFKM Kalrez, -20200°C/-4392°F	
	F5	PTFE cladded, -40150°C/-40302°F	
	F6	PTFE cladded, -40200°C/-40392°F	
FMR67	A3	FKM Viton GLT, -4080°C/-40176°F	
	A5	FKM Viton GLT, -40150°C/-40302°F	
	A6	FKM Viton GLT, -40200°C/-40392°F	
	in the te	mperature tables llows:	

Position 11-13 (Process Connection)			
Selected option		Description	
FMR60	GGJ	Thread ISO228 G1-1/2, 316L	
	RGJ	Thread ANSI MNPT1-1/2, 316L	
	XxG	Flange (different sizes), PP	
	XxJ	Flange (different sizes), 316L	

Position 11-13 (Process Connection)			
Selected option		Description	
FMR62	AxK	Flange (different sizes), PTFE>316/316L	
	CxK	Flange (different sizes), PTFE>316L	
	GxJ	Thread ISO (different sizes), 316L	
	KxK	Flange (different sizes), PTFE>316L	
	MxK	Slotted-nut (different sizes), PTFE>316L	
	RxJ	Thread ANSI (different sizes), 316L	
	TxK	Tri-Clamp (different sizes), PTFE>316L	
	U2J	Thread M24, 316L, install > accessory hygienic adapter	
FMR67	AxJ	Flange (different sizes), 316/316L	
	CxJ	Flange (different sizes), 316L	
	GGJ	Thread ISO228 G1-1/2, 316L	
	KxJ	Flange (different sizes), 316L	
	RGJ	Thread ANSI MNPT1-1/2, 316L	
	XxA	Align. device (different sizes)	
	XxG	Flange (different sizes), PP	
	XxJ	Flange (different sizes), 316L	

Position 14	(Air Purg	ge Connection)
Selected or	otion	Description
FMR67	A 1)	W/o
	12)	G1/4
	2 2)	NPT1/4
	3 1)	Adapter G1/4
	4 1)	Adapter NPT1/4

- 1)
- Only in connection with Position 7, 8 = GA Only in connection with Position 7, 8 = GP2)

#### Optional specifications

ID Nx (Acce	essory Mou	inted)
Selected op	tion	Description
FMR6x	NA	Overvoltage protection
	Bluetooth	

1) Only in connection with Position 4 = C, E

#### Safety instructions: General

- The device is intended to be used in explosive atmospheres as defined in the scope of IEC 60079-0 or equivalent national standards. If no potentially explosive atmospheres are present or if additional protective measures have been taken: The device may be operated according to the manufacturer's specifications.
- Staff must meet the following conditions for mounting, electrical installation, commissioning and maintenance of the device:
  - Be suitably qualified for their role and the tasks they perform
  - Be trained in explosion protection
  - Be familiar with national regulations
- Install the device according to the manufacturer's instructions and national regulations.
- Do not operate the device outside the specified electrical, thermal and mechanical parameters.
- Only use the device in media to which the wetted materials have sufficient durability.
- Avoid electrostatic charging:
  - Of plastic surfaces (e.g. enclosure, sensor element, special varnishing, attached additional plates, ..)
  - Of isolated capacities (e.g. isolated metallic plates)
- Modifications to the device can affect the explosion protection and must be carried out by staff authorized to perform such work by Endress+Hauser.
- Refer to the temperature tables for the relationship between the permitted ambient temperature for the sensor and/or transmitter, depending on the range of application and the temperature class.


#### Safety instructions: Special conditions

Permitted ambient temperature range at the electronics enclosure: –40 °C  $\leq$   $T_a$   $\leq$  +80 °C

- Observe the information in the temperature tables.
- In the case of process connections made of polymeric material or with polymeric coatings, avoid electrostatic charging of the plastic surfaces.
- To avoid electrostatic charging: Do not rub surfaces with a dry cloth.
- In the event of additional or alternative special varnishing on the enclosure or other metal parts or for adhesive plates:
  - Observe the danger of electrostatic charging and discharge.
  - Do not install in the vicinity of processes (≤ 0.5 m) generating strong electrostatic charges.
- Avoid electrostatic charging of the sensor (e.g. do not rub dry and install outside the filling flow).

*Basic specification, Position* 5 = A


Avoid electrostatic charging of the enclosure (e.g. friction, cleaning, maintenance, strong medium flow).

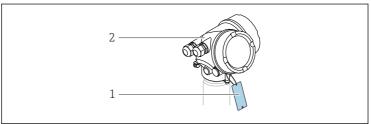

A0032146

- 1 Isolated capacitance:
  - with one metal plate:  $\leq$  3 pF (permitted in all areas for Equipment Groups II and III) with two to three metal plates:  $\leq$  10 pF (not permitted in Zone 0 and for
  - Equipment Group IIC)
- 2 Enclosure

#### Safety instructions: Installation

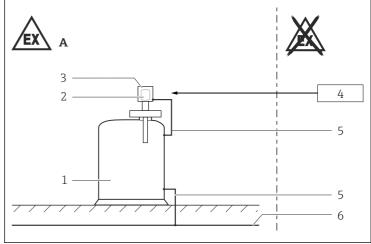

A0025536

- A Zone 2
- 1 Tank; Zone 2
- 2 Electronic insert
- 3 Enclosure
- 4 Ex ic: Certified associated apparatus Ex ec: Supply depending upon equipment version
- 5 Potential equalization line
- 6 Potential equalization
- After aligning (rotating) the enclosure, retighten the fixing screw (see Operating Instructions).
- Install the device to exclude any mechanical damage or friction during the application. Pay particular attention to flow conditions and tank fittings.
- After mounting and connecting the antenna, ingress protection of the enclosure must be at least IP65.
- Perform the following to achieve the degree of protection:
  - Screw the cover tight.
  - Mount the cable entry correctly.
- Continuous service temperature of the connecting cable:
   -40 °C to ≥ +85 °C; in accordance with the range of service temperature taking into account additional influences of the process conditions (T<sub>a min</sub>), (T<sub>a max</sub> +20 K).

Basic specification, Position 4 = N

Observe the requirements according to IEC/EN 60079-14 for conduit systems and the wiring- and installation instructions of the suitable Safety Instructions (XA). In addition, observe national regulations and standards for conduit systems.

#### Intrinsic safety

#### Ex ic

Basic specification, Position 1, 2 = BH, IH

- The device is only suitable for connection to certified, intrinsically safe equipment with explosion protection Ex ic.
- If the conditions  $U_i > U_o$ ,  $(I_i > I_o)$ ,  $C_a > C_i + C_{cable}$  and  $L_a > L_i + L_{cable}$  are met, the energy-limited installation concept (Ex ic) allows energy-limited devices or associated energy-limited devices to be connected according to the entity concept.
- The intrinsically safe input power circuit of the device is isolated from ground. If the device is only equipped with one input, the dielectric strength of the input is at least  $500~V_{rms}$ . If the device is equipped with more than one input, the dielectric strength of each individual input to ground is at least  $500~V_{rms}$ , and the dielectric strength of the inputs vis-à-vis one another is also at least  $500~V_{rms}$ .
- Observe the pertinent guidelines when interconnecting intrinsically safe circuits
- The device can be connected to the Endress+Hauser FXA291 service tool: refer to the Operating Instructions and specifications in the "Overvoltage protection" chapter.
- The device can be equipped with the Bluetooth® module: refer to the Operating Instructions and specifications in the "Bluetooth® module" chapter.

#### Increased safety

#### Ex ec

Basic specification, Position 1, 2 = BG, IG

- In potentially explosive atmospheres:
  - Do not disconnect electrical connections when energized.
  - Do not connect the service tool (e.g. FXA291).
- The device can be equipped with the Bluetooth® module: refer to the Operating Instructions and specifications in the "Bluetooth® module" chapter.

*Basic specification, Position 5 = A* 

The enclosure is not approved for Ex ec explosion protection.

#### Cable specification

Without Optional specification, ID Nx = NA (Overvoltage protection Type OVP10 and Type OVP20)

Basic specification, Position 3	Cross section connecting wire	Stripped insulation
A, B, C	0.5 to 2.5 mm <sup>2</sup>	10 mm

With Optional specification, ID Nx = NA (Overvoltage protection Type OVP10 and Type OVP20)

,	Cross section connecting wire		Stripped insulation
A, B, C	0.2 to 2.5 mm <sup>2</sup>	0.35 to 0.4 Nm	5 mm

#### Potential equalization

Integrate the device into the local potential equalization.

#### Overvoltage protection

- If an overvoltage protection against atmospheric over voltages is required: no other circuits may leave the enclosure during normal operation without additional measures.
- For installations which require overvoltage protection to comply with national regulations or standards, install the device using overvoltage protection (e.g. HAW56x from Endress+Hauser).
- Observe the safety instructions of the overvoltage protection.

Optional specification, ID Nx = NA

(Overvoltage protection Type OVP10 and Type OVP20)

The intrinsically safe input power circuit of the device is isolated from ground. If the device is only equipped with one input, the dielectric strength of the input is at least 290  $V_{\rm rms}.$  If the device is equipped with more than one input, the dielectric strength of each individual input to ground is at least 290  $V_{\rm rms},$  and the dielectric strength of the inputs vis-à-vis one another is also at least 290  $V_{\rm rms}.$ 

#### Bluetooth® module

Optional specification, ID Nx = NF

- With Bluetooth® module installed: Use of external hardware not allowed (e.g. external display, service interface).
- The intrinsically safe input power circuit of the Bluetooth® module is isolated from ground.

# Temperature tables

Optional specification, ID Nx = NA
(Overvoltage protection Type OVP10 and Type OVP20)
When using the internal overvoltage protection: Reduce the admissible ambient temperature at the enclosure by 2 K.

Basic specification, Position 5 = AWhen using the remote display FHX50: Reduce the admissible ambient temperature at the enclosure by 3 K.

Observe the permitted temperature range at the antenna.

#### **Description notes**

Unless otherwise indicated, the positions always refer to the basic specification.

1st column: Position 5 = A, B, ...

2nd column: Temperature classes T6 (85 °C) to T1 (450 °C)


Column P1 to P5: Position (temperature value) on the axes of the derating

- T<sub>a</sub>: Ambient temperature in °C
- $T_p$ : Process temperature in °C
- Column P2+ is only relevant for version B of the derating.

#### Example table

		P1		P2	P2		P2+		Р3		P4		
= C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta						
	Т6	-40	51	51	51	-	-	85	46	85	-40	-40	-40
	T5	-40	64	64	64	-	-	100	59	100	-40	-40	-40
	T4 T1	-40	64	64	64	-	-	130	54	130	-40	-40	-40


#### Example diagrams of possible deratings

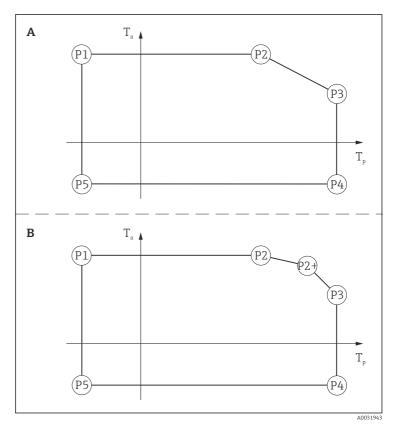


#### Ex ic: Zone 2

Page references to the temperature tables of the respective device types: See the following list.

- FMR60 → 🗎 18
- FMR62 → 🖺 22
- FMR67 → 🖺 26

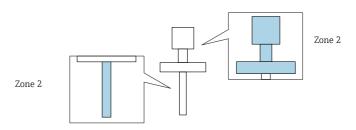



#### FMR60

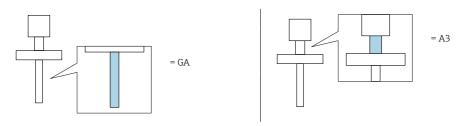

		P1		P2		P2+		P3		P4		P5	
=A		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	Tp	Ta	T <sub>p</sub>	Ta	Tp	Ta	Tp	Ta
	T6 T1	-40	43	43	43	-	-	80	32	80	-40	-40	-40


		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta								
	T6 T1	-40	51	51	51	-	-	80	47	80	-40	-40	-40

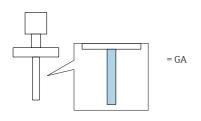


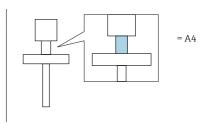

		P1		P2		P2+		Р3		P4		P5	
=A		T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	T6	-40	43	43	43	79	33	85	25	85	-40	-40	-40
	T5	-40	56	56	56	96	45	100	40	100	-40	-40	-40
	T4 T1	-40	56	56	56	117	39	130	22	130	-40	-40	-40


		P1		P2	P2 1		P2+		P3		P4		
= C		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	T6	-40	51	51	51	-	-	85	46	85	-40	-40	-40
	T5	-40	64	64	64	-	-	100	59	100	-40	-40	-40
	T4 T1	-40	64	64	64	-	-	130	54	130	-40	-40	-40




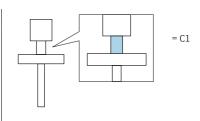

		P1		P2	P2		P2+		P3		P4		
= A		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta
	Т6	-20	43	43	43	79	33	85	25	85	-20	-20	-20
	T5	-20	56	56	56	96	45	100	40	100	-20	-20	-20
	T4 T1	-20	56	56	56	117	39	135	15	135	-20	-20	-20


		P1		P2	P2		P2+		P3		P4		
= C		T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-20	51	51	51	-	-	85	46	85	-20	-20	-20
	T5	-20	64	64	64	-	-	100	59	100	-20	-20	-20
	T4	-20	64	64	64	-	-	135	54	135	-20	-20	-20
	T3 T1	-20	64	64	64	-	-	150	50	150	-20	-20	-20



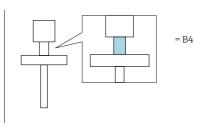

		P1		P2	P2		P2+		P3		P4		
=A		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-40	43	43	43	79	33	85	25	85	-40	-40	-40
	T5	-40	56	56	56	96	45	100	40	100	-40	-40	-40
	T4 T1	-40	56	56	56	117	39	135	15	135	-40	-40	-40


		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-40	51	51	51	-	-	85	46	85	-40	-40	-40
	T5	-40	64	64	64	-	-	100	59	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	54	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	150	50	150	-40	-40	-40

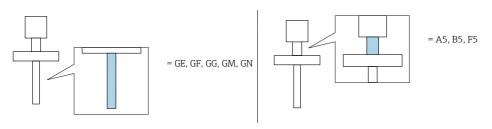

		P1		P2		P2+		P3		P4		P5	
= A		T <sub>p</sub>	Ta	Tp	Ta	T <sub>p</sub>	Ta						
	Т6	-40	43	43	43	-	-	85	34	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	46	100	-40	-40	-40
	T4	-40	56	56	56	-	-	135	38	135	-40	-40	-40
	T3 T1	-40	56	56	56	134	39	150	24	150	-40	-40	-40


		P1		P2		P2+		P3		P4		P5	
= B		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	T6	-40	51	51	51	-	-	85	45	85	-40	-40	-40
	T5	-40	64	64	64	-	-	100	58	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	52	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	150	47	150	-40	-40	-40

		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>
	T6	-40	51	51	51	-	-	85	47	85	-40	-40	-40
	T5	-40	64	64	64	-	-	100	60	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	56	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	150	54	150	-40	-40	-40

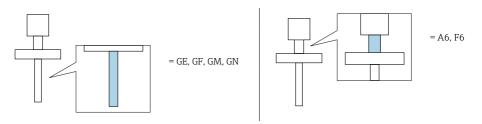

		P1		P2		P2+		Р3		P4		P5	
= A		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta								
	Т6	-40	43	43	43	-	-	85	38	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	51	100	-40	-40	-40
	T4	-40	56	56	56	-	-	135	47	135	-40	-40	-40
	T3 T1	-40	56	56	56	-	-	200	40	200	-40	-40	-40


		P1		P2		P2+		Р3		P4		P5	
= B, C		T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-40	51	51	51	-	-	85	48	85	-40	-40	-40
	T5	-40	64	64	64	-	-	100	61	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	58	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	200	53	200	-40	-40	-40

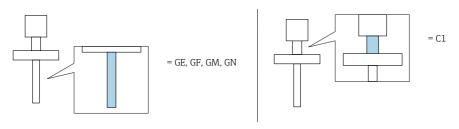

		P1		P2		P2+		P3		P4		P5	
= A		T <sub>p</sub>	Ta	Tp	Ta	T <sub>p</sub>	Ta						
	Т6	-20	43	43	43	-	-	85	34	85	-20	-20	-20
	T5	-20	56	56	56	-	-	100	46	100	-20	-20	-20
	T4	-20	56	56	56	-	-	135	38	135	-20	-20	-20
	T3 T1	-20	56	56	56	134	39	150	24	150	-20	-20	-20

		P1		P2		P2+		P3		P4		P5	
= B		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta						
	Т6	-20	51	51	51	-	-	85	45	85	-20	-20	-20
	T5	-20	64	64	64	-	-	100	58	100	-20	-20	-20
	T4	-20	64	64	64	-	-	135	52	135	-20	-20	-20
	T3 T1	-20	64	64	64	-	-	150	47	150	-20	-20	-20


		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>
	T6	-20	51	51	51	-	-	85	47	85	-20	-20	-20
	T5	-20	64	64	64	-	-	100	60	100	-20	-20	-20
	T4	-20	64	64	64	-	-	135	56	135	-20	-20	-20
	T3 T1	-20	64	64	64	-	-	150	54	150	-20	-20	-20

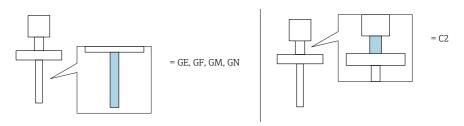


		P1		P2		P2+		Р3		P4		P5	
= A		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta								
	Т6	-20	43	43	43	-	-	85	38	85	-20	-20	-20
	T5	-20	56	56	56	-	-	100	51	100	-20	-20	-20
	T4	-20	56	56	56	-	-	135	47	135	-20	-20	-20
	T3 T1	-20	56	56	56	-	-	200	40	200	-20	-20	-20

		P1		P2		P2+		Р3		P4		P5	
= B, C		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta								
	Т6	-20	51	51	51	-	-	85	48	85	-20	-20	-20
	T5	-20	64	64	64	-	-	100	61	100	-20	-20	-20
	T4	-20	64	64	64	-	-	135	58	135	-20	-20	-20
	T3 T1	-20	64	64	64	-	-	200	53	200	-20	-20	-20

FMR67




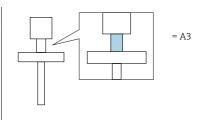


		P1		P2		P2+		P3		P4		P5	
= A		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta
	T6 T1	-40	43	43	43	-	-	80	32	80	-40	-40	-40

		P1		P2		P2+		P3		P4		P5	
= B		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	Tp	Ta	Tp	Ta	Tp	Ta
	T6 T1	-40	51	51	51	-	-	80	43	80	-40	-40	-40

		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	T6 T1	-40	51	51	51	-	-	80	47	80	-40	-40	-40




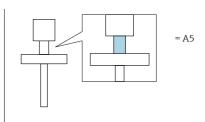


		P1		P2		P2+		P3		P4		P5	
= A		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-40	43	43	43	-	-	85	34	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	46	100	-40	-40	-40
	T4	-40	56	56	56	-	-	135	38	135	-40	-40	-40
	T3 T1	-40	56	56	56	134	39	150	24	150	-40	-40	-40

		P1		P2		P2+		P3		P4		P5	
= B		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta								
	Т6	-40	51	51	51	-	-	85	45	85	-40	-40	-40
	T5	-40	64	64	64	-	-	100	58	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	52	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	150	47	150	-40	-40	-40

		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta
	Т6	-40	51	51	51	-	-	85	47	85	-40	-40	-40
	T5	-40	64	64	64	-	-	100	60	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	56	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	150	54	150	-40	-40	-40



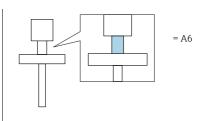


		P1		P2		P2+		P3		P4		P5	
= A		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-40	43	43	43	-	-	85	38	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	51	100	-40	-40	-40
	T4	-40	56	56	56	-	-	135	47	135	-40	-40	-40
	T3 T1	-40	56	56	56	-	-	200	40	200	-40	-40	-40

		P1		P2		P2+		P3		P4		P5	
= B, C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	T6	-40	51	51	51	-	-	85	48	85	-40	-40	-40
	T5	-40	64	64	64	-	-	100	61	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	58	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	200	53	200	-40	-40	-40


#### Ex ec: Zone 2

Page references to the temperature tables of the respective device types: See the following list.


- FMR60 → 🖺 29
- FMR62 → 🖺 32
- FMR67 → 🖺 36

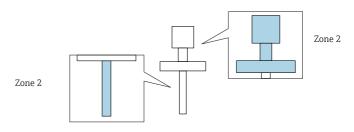


#### FMR60

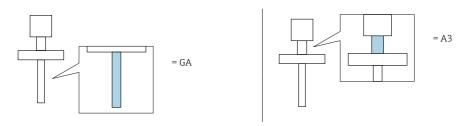


		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	T6 T1	-40	41	41	41	-	-	80	32	80	-40	-40	-40




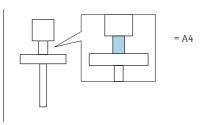


		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-40	41	41	41	-	-	85	34	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	49	100	-40	-40	-40
	T4 T1	-40	64	64	64	-	-	130	54	130	-40	-40	-40


#### FMR60



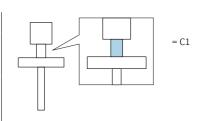


		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta
	Т6	-20	41	41	41	-	-	85	34	85	-20	-20	-20
	T5	-20	56	56	56	-	-	100	49	100	-20	-20	-20
	T4	-20	64	64	64	-	-	135	54	135	-20	-20	-20
	T3 T1	-20	64	64	64	-	-	150	50	150	-20	-20	-20

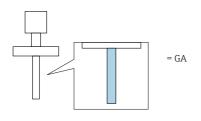

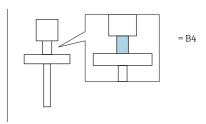

		P1		P2		P2+		Р3		P4		P5	
= C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta						
	T6	-40	41	41	41	-	-	85	34	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	49	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	54	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	150	50	150	-40	-40	-40

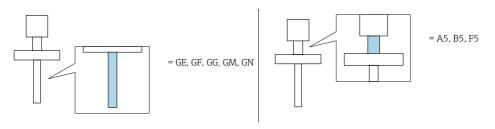


		P1		P2		P2+		P3		P4		P5	
= B		T <sub>p</sub>	Ta	Tp	Ta	T <sub>p</sub>	Ta						
	Т6	-40	41	41	41	-	-	85	33	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	48	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	52	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	150	47	150	-40	-40	-40

		P1		P2		P2+		P3		P4		P5	
= C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-40	41	41	41	-	-	85	36	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	51	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	56	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	150	54	150	-40	-40	-40




		P1		P2		P2+		Р3		P4		P5	
= B, C		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-40	41	41	41	-	-	85	37	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	52	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	58	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	200	53	200	-40	-40	-40

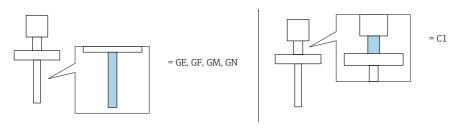



		P1		P2		P2+		P3		P4		P5	
= B		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta								
	Т6	-20	41	41	41	-	-	85	33	85	-20	-20	-20
	T5	-20	56	56	56	-	-	100	48	100	-20	-20	-20
	T4	-20	64	64	64	-	-	135	52	135	-20	-20	-20
	T3 T1	-20	64	64	64	-	-	150	47	150	-20	-20	-20

		P1		P2		P2+		Р3		P4		P5	
= C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	Т6	-20	41	41	41	-	-	85	36	85	-20	-20	-20
	T5	-20	56	56	56	-	-	100	51	100	-20	-20	-20
	T4	-20	64	64	64	-	-	135	56	135	-20	-20	-20
	T3 T1	-20	64	64	64	-	-	150	54	150	-20	-20	-20

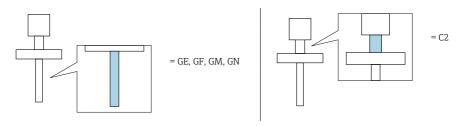



		P1		P2		P2+		Р3		P4		P5	
= B, C		T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta								
	Т6	-20	41	41	41	-	-	85	37	85	-20	-20	-20
	T5	-20	56	56	56	-	-	100	52	100	-20	-20	-20
	T4	-20	64	64	64	-	-	135	58	135	-20	-20	-20
	T3 T1	-20	64	64	64	-	-	200	53	200	-20	-20	-20



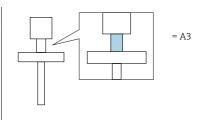



		P1		P2		P2+		P3		P4		P5	
= B, C		T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta	T <sub>p</sub>	Ta
	T6 T1	-40	41	41	41	-	-	80	32	80	-40	-40	-40




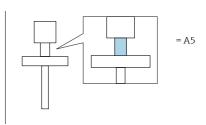

		P1		P2		P2+		Р3		P4		P5	
= B		T <sub>p</sub>	Ta	T <sub>p</sub>	Ta								
	Т6	-40	41	41	41	-	-	85	33	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	48	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	52	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	150	47	150	-40	-40	-40

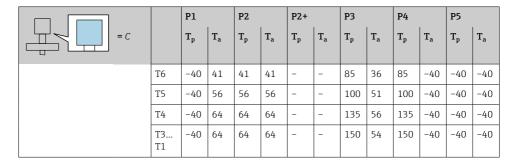



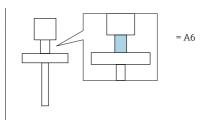

		P1		P2		P2+		P3		P4		P5	
= B, C		T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	T <sub>a</sub>	T <sub>p</sub>	Ta
	Т6	-40	41	41	41	-	-	85	37	85	-40	-40	-40
	T5	-40	56	56	56	-	-	100	52	100	-40	-40	-40
	T4	-40	64	64	64	-	-	135	58	135	-40	-40	-40
	T3 T1	-40	64	64	64	-	-	200	53	200	-40	-40	-40

#### Connection data Cable entry: Connection compartment

#### Ex ic

*Basic specification, Position 1, 2 = BH, IH*Not relevant.

#### Ex ec

Basic specification, Position 1, 2 = BG, IG

Cable gland: Basic specification, Position 6 = A

Basic specification, Position 5 = B, C

preferably for Position 5 = B

Thread	Clamping range	Material	Sealing insert	O-ring
M20x1,5	ø 7 to 12 mm	1.4404	NBR	EPDM (ø 17x2)

#### preferably for Position 5 = C

Thread	Clamping range	Material	Sealing insert	O-ring
M20x1,5	ø 8 to 10.5 mm <sup>1)</sup> (ø 6.5 to 13 mm) <sup>2)</sup>	Ms, nickel-plated	Silicone	EPDM (ø 17x2)

- 1) Standard
- 2) Separate clamping inserts available
- Only suitable for fixed installation. The operator must pay attention to a suitable strain relief of the cable.
- The cable glands are suitable for a low risk of mechanical danger (4 Joule) and must be mounted in a protected position if larger impact energy levels are expected.
- To maintain the ingress protection of the enclosure: Install the enclosure cover, cable glands and blind plugs correctly.

#### Cable entry: Electronics compartment

Cable gland: Basic specification, Position 4 = M

Not relevant.

#### Terminals

Optional specification, ID Nx = NA

(Overvoltage protection Type OVP10 and Type OVP20)

When using the internal overvoltage protection: No changes to the connection values.

Optional specification, ID Nx = NF

When using the Bluetooth® module: No changes to the connection values.

#### Ex ic

Basic specification, Position 1, 2 = BH, IH

Power supply and signal circuit with protection type: intrinsic safety  $\operatorname{Ex}$  ic IIC,  $\operatorname{Ex}$  ic IIB.

*Basic specification, Position 3 = A* 

# $\begin{aligned} & \textbf{Terminal 1 (+), 2 (-)} \\ & \textbf{Power supply} \\ & \textbf{U}_i = 35 \text{ V} \\ & \textbf{I}_i = \text{not applicable} \\ & \text{(current-controlled circuit)} \\ & \textbf{P}_i = \text{not applicable} \\ & \text{effective inner inductance } \textbf{L}_i = 0 \\ & \text{effective inner capacitance } \textbf{C}_i = 12 \text{ nF} \end{aligned}$

#### *Basic specification, Position 3 = B*

Terminal 1 (+), 2 (-)	Terminal 3 (+), 4 (-)
Power supply	Switch output (PFS)
$\begin{split} &U_i = 35 \text{ V} \\ &I_i = \text{not applicable} \\ &\text{(current-controlled circuit)} \\ &P_i = \text{not applicable} \end{split}$	$\begin{split} &U_i = 35 \text{ V} \\ &I_i = \text{not applicable} \\ &\text{(current-controlled circuit)} \\ &P_i = 1 \text{ W} \end{split}$
$ \begin{array}{l} \mbox{effective inner inductance} \ L_i = 0 \\ \mbox{effective inner capacitance} \ C_i = 5 \ nF \end{array} $	$ \begin{array}{c} \mbox{effective inner inductance} \ L_i = 0 \\ \mbox{effective inner capacitance} \ C_i = 6 \ \mbox{nF} \end{array} $

#### Basic specification, Position 3 = C

Terminal 1 (+), 2 (-)	Terminal 3 (+), 4 (-)
Power supply	Output 4 to 20 mA
$\begin{aligned} &U_i = 30 \text{ V} \\ &I_i = \text{not applicable} \\ &\text{(current-controlled circuit)} \\ &P_i = \text{not applicable} \end{aligned}$	$\begin{aligned} &U_i = 30 \text{ V} \\ &I_i = \text{not applicable} \\ &P_i = \text{not applicable} \end{aligned}$
	$ \begin{array}{c} \text{effective inner inductance } L_i = 0 \\ \text{effective inner capacitance } C_i = 30 \text{ nF} \end{array} $

#### Service interface (CDI)

Taking the following values into consideration, the device can be connected to the certified Endress+Hauser FXA291 service tool or a similar interface:

#### Service interface

 $U_i = 7.3 \text{ V}$ 

effective inner inductance  $L_i$  = negligible effective inner capacitance  $C_i$  = negligible

 $U_0 = 7.3 \text{ V}$ 

 $I_0 = 60 \text{ mA}$ 

 $P_0 = 110 \text{ mW}$ 

L <sub>o</sub> (mH) =	5.00	2.00	1.00	0.50	0.20	0.15	0.10	0.05	0.02	0.01	0.005	0.002	0.001
C <sub>o</sub> (μF) <sup>1)</sup> =	0.73	1.20	1.60	2.00	2.60	-	3.20	4.00	5.50	7.30	10.00	12.70	12.70
C <sub>o</sub> (µF) <sup>2)</sup> =	-	0.49	0.90	1.40	-	2.00	-	-	-	-	-	-	-

- Values according to PTB "ispark" program
- 2) Values according to IEC/EN 60079-25, Annex C

#### Ex ec

Basic specification, Position 1, 2 = BG, IG

Power supply and signal circuit with protection type: not intrinsically safe.

*Basic specification, Position 3 = A* 

#### Terminal 1 (+), 2 (-)

Power supply

 $U_N = 35 V_{DC}$ 

 $U_{\rm m} = 250 \, \rm V$ 

 $I_N = 4 \text{ to } 20 \text{ mA}$ 

 $I_{max} = 22 \text{ mA}$ 

 $P_{N} = 0.7 \text{ W}$ 

Basic specification, Position 3 = B

The power consumption of I/O modules with passive PFS output can be limited for certain applications.

- Recommended: Power consumption = 1 W. This is obtained for a supply voltage at the terminals of 27 V<sub>DC</sub>.
- For higher supply voltages ( $U_{max}$ ): Insert a serial resistance ( $R_V$ ) in order to limit the power consumption, see table below.

#### Table for the PFS serial resistance $(R_V)$ :

Power consumption	1.0 W			
Total power consumption	1.88 W			
Internal resistance R <sub>I</sub>	760 Ω			

U <sub>max</sub> [V]	R <sub>V</sub> min
35	205 Ω
34	177 Ω
33	150 Ω
32	122 Ω
31	95 Ω
30	67 Ω
29	39 Ω
28	12 Ω
27	0 Ω

For values associated with a higher or lower internal power consumption please contact Endress+Hauser.

Terminal 1 (+), 2 (-)	Terminal 3 (+), 4 (-)
Power supply	Switch output (PFS)
$\begin{array}{l} U_{N} = 35 \; V_{DC} \\ U_{m} = 250 \; V \\ I_{N} = 4 \; to \; 20 \; mA \\ I_{max} = 22 \; mA \\ P_{N} = 0.7 \; W \end{array}$	$\begin{aligned} &U_{N} = 35 \ V_{DC} \\ &U_{m} = 250 \ V \\ &P_{N} = 0.7 \ W \end{aligned}$

#### Basic specification, Position 3 = C

Terminal 1 (+), 2 (-)	Terminal 3 (+), 4 (-)				
Power supply	Output 4 to 20 mA				
$\begin{array}{l} U_{N} = 30 \; V_{DC} \\ U_{m} = 250 \; V \\ I_{N} = 4 \; to \; 20 \; mA \\ I_{max} = 22 \; mA \\ P_{N} = 0.7 \; W \end{array}$	$\begin{array}{l} U_{N} = 30 \; V_{DC} \\ U_{m} = 250 \; V \\ I_{N} = 4 \; to \; 20 \; mA \\ I_{max} = 22 \; mA \\ P_{N} = 0.7 \; W \end{array}$				

#### Service interface (CDI)

In connection with: *Basic specification, Position* 4 = A, C, E

Taking the following values into consideration, the device can be connected to the Endress+Hauser FXA291 service tool or a similar interface:

#### Service interface

 $U_{N} = 6.5 \text{ V}$ 

In connection with: *Basic specification, Position 4 = L, M, N* 

Taking the following values into consideration, the device can be connected to the certified Endress+Hauser FXA291 service tool or a similar interface:

#### Service interface

 $U_i = 7.3 \text{ V}$ 

effective inner inductance  $L_i$  = negligible effective inner capacitance  $C_i$  = negligible

 $U_0 = 7.3 \text{ V}$ 

 $I_0 = 60 \text{ mA}$ 

 $P_0 = 110 \text{ mW}$ 

L <sub>o</sub> (mH) =	5.00	2.00	1.00	0.50	0.20	0.15	0.10	0.05	0.02	0.01	0.005	0.002	0.001
$C_o (\mu F)^{-1} =$	0.73	1.20	1.60	2.00	2.60	-	3.20	4.00	5.50	7.30	10.00	12.70	12.70
$C_o (\mu F)^{2)} =$	-	0.49	0.90	1.40	-	2.00	-	-	-	-	-	-	-

- 1) Values according to PTB "ispark" program
- 2) Values according to IEC/EN 60079-25, Annex C



www.addresses.endress.com