Safety Instructions Cerabar PMC71B, PMP71B

Services

II 1/2 D Ex ta/tb IIIC T_{200} xxx°C Da/Db II 2 D Ex tb IIIC T_L xxx°C Db

UK CA

XA02514P-B/00/EN/02.23-00

71613932 2023-09-13







XA02514P-B

Cerabar PMC71B, PMP71B

Table of contents

Associated documentation 4
Supplementary documentation
Certificates and declarations
Manufacturer address 4
Other standards
Extended order code 5
Safety instructions: General
Safety instructions: Specific conditions of use
Safety instructions: Installation
Temperature tables
Connection data 12

XAO2514P-B Cerabar PMC71B, PMP71B

Associated documentation

To commission the device, please observe the Operating Instructions pertaining to the device:

PMC71B

BA02010P, TI01507P

PMP71B

BA02012P, TI01509P

Supplementary documentation

Explosion protection brochure: CP00021Z

The explosion protection brochure is available on the Internet:

www.endress.com/Downloads

Certificates and declarations

UK Declaration of Conformity

Declaration Number:

UK 00025

The UK Declaration of Conformity is available:

In the download area of the Endress+Hauser website: www.endress.com -> Downloads -> Declaration ->

Type: UKCA Declaration -> Product Code: ...

UKCA type-examination certificate

Certificate number:

CML 21UKEX2338X

List of applied standards: See UK Declaration of Conformity.

Manufacturer address

Endress+Hauser SE+Co. KG

Hauptstraße 1

79689 Maulburg, Germany

Address of the manufacturing plant: See nameplate.

Other standards

Among other things, the following standards shall be observed in their current version for proper installation:

- IEC/EN 60079-14: "Explosive atmospheres Part 14: Electrical installations design, selection and erection"
- EN 1127-1: "Explosive atmospheres Explosion prevention and protection - Part 1: Basic concepts and methodology"

Extended order code

The extended order code is indicated on the nameplate, which is affixed to the device in such a way that it is clearly visible. Additional information about the nameplate is provided in the associated Operating Instructions.

Structure of the extended order code

PMx71B	-	******	+	A*B*C*D*E*F*G*.
(Device		(Basic		(Optional
type)		specifications)		specifications)

* = Placeholder

At this position, an option (number or letter) selected from the specification is displayed instead of the placeholders.

Basic specifications

The features that are absolutely essential for the device (mandatory features) are specified in the basic specifications. The number of positions depends on the number of features available. The selected option of a feature can consist of several positions.

Optional specifications

The optional specifications describe additional features for the device (optional features). The number of positions depends on the number of features available. The features have a 2-digit structure to aid identification (e.g. JA). The first digit (ID) stands for the feature group and consists of a number or a letter (e.g. J = Test, Certificate). The second digit constitutes the value that stands for the feature within the group (e.g. A = 3.1 material (wetted parts), inspection certificate).

More detailed information about the device is provided in the following tables. These tables describe the individual positions and IDs in the extended order code which are relevant to hazardous locations.

Extended order code: Cerabar



The following specifications reproduce an extract from the product structure and are used to assign:

- This documentation to the device (using the extended order code on the nameplate).
- The device options cited in the document.

Device type

PMC71B. PMP71B

XA02514P-B Cerabar PMC71B, PMP71B

Basic specifications

Position 1, 2 (Approval)		
Selected option Description		Description
PMC71B PMP71B	UG	UK Ex II 1/2 D Ex ta/tb IIIC T ₂₀₀ xxx°C Da/Db UK Ex II 2 D Ex tb IIIC T _L xxx°C Db

Position 3, 4 (Output)			
Selected option		Description	
PMC71B	BA	2-wire, 4-20 mA HART	
PMP71B	DA	2-wire, PROFIBUS PA	
	FA	2-wire, PROFINET, 10Mbit/s (APL)	

Position 5 (Display, Operation)		
Selected option		Description
PMC71B	M	Prepared for display FHX50B + Gland M20
PMP71B	N	Prepared for display FHX50B + Thread NPT1/2
	0	Prepared for display FHX50B + Thread M20

Position 6 (Housing, Material)		
Selected option		Description
PMC71B	В	Single compartment; Alu, coated
PMP71B	J	Dual compartment; Alu, coated
	К	Dual compartment; 316L

Position 7 (Electrical Connection)			
Selected option		Description	
PMC71B	В	Gland M20, brass nickel plated, IP66/68 NEMA Type 4X/6P	
PMP71B	С	Gland M20, 316L, IP66/68 NEMA Type 4X/6P	
	F	Thread M20, IP66/68 NEMA Type 4X/6P	
	G	Thread G1/2, IP66/68 NEMA Type 4X/6P	
	Н	Thread NPT1/2, IP66/68 NEMA Type 4X/6P	

Position 10	Position 10 (Diaphragm Seal Type)		
Selected option		Description	
PMP71B	G	Temperature isolator	
	М	m capillary, 316L	
	N	m capillary, PVC>316L	
	0	m capillary, PTFE>316L	
	R	ft capillary, 316L	
	S	ft capillary, PVC>316L	
	T	ft capillary, PTFE>316L	

Optional specifications

ID Ex (Application Package)		
Selected option		Description
PMC71B EC High temperature version, 150°C/30		High temperature version, 150°C/302°F process

Safety instructions: General

- The device is intended to be used in explosive atmospheres as defined in the scope of EN IEC 60079-0 or equivalent national standards. If no potentially explosive atmospheres are present or if additional protective measures have been taken: The device may be operated according to the manufacturer's specifications.
- Devices suitable for zone separation (marked Ga/Gb or Da/Db) are always suitable for installation in the less critical zone (Gb or Db).
 Due to space limitations the corresponding marking maybe not indicated on the nameplate.
- Comply with the installation and safety instructions in the Operating Instructions.
- Staff must meet the following conditions for mounting, electrical installation, commissioning and maintenance of the device:
 - Be suitably qualified for their role and the tasks they perform
 - Be trained in explosion protection
 - $\, \blacksquare \,$ Be familiar with national regulations
- Install the device according to the manufacturer's instructions and national regulations.
- Do not operate the device outside the specified electrical, thermal and mechanical parameters.


XA02514P-B Cerabar PMC71B, PMP71B

- Only use the device in media to which the wetted materials have sufficient durability.
- Avoid electrostatic charging:
 - Of plastic surfaces (e.g. enclosure, sensor element, special varnishing, attached additional plates, ...)
 - Of isolated capacities (e.g. isolated metallic plates)
- Alterations to the device can affect the explosion protection and must be carried out by staff authorized to perform such work by Endress+Hauser

Safety instructions: Specific conditions of use

- In the case of process connections made of polymeric material or with polymeric coatings, avoid electrostatic charging of the plastic surfaces.
- For light metal flanges or flange faces (e.g. titanium, zirconium), avoid sparks caused by impact and friction.
- To avoid electrostatic charging: Do not rub surfaces with a dry cloth.
- In the event of additional or alternative special varnishing on the enclosure or other metal parts or for adhesive plates:
 - Observe the danger of electrostatic charging and discharge.
 - Do not install in the vicinity of processes (≤ 0.5 m) generating strong electrostatic charges.
- Avoid sparks caused by impact and friction.

Safety instructions: Installation

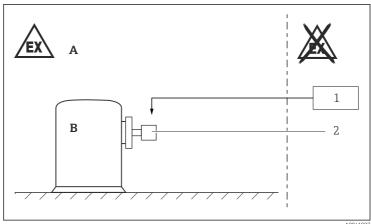

A0041997

- A Zone 21, Electronic
- B Zone 20 or Zone 21. Process
- 1 Power supply
- 2 PMC71B, PMP71B

- After aligning (rotating) the enclosure, retighten the fixing screw.
- Do not open in a potentially explosive dust atmosphere.
- Seal the cable entry or piping tight (see protection type of enclosure in the "Temperature tables" chapter).
- Before operation:
 - Screw in the cover all the way.
 - Tighten the securing screw on the cover.

Basic specification, Position 5 = N

Observe the requirements according to IEC/EN 60079-14 for conduit systems and the wiring- and installation instructions of the suitable Safety Instructions (XA). In addition, observe national regulations and standards for conduit systems.

Permitted ambient conditions

II 1/2 D Ex ta/tb IIIC T₂₀₀ xxx°C Da/Db

Process Zone 20		Enclosure Zone 21
Continuous dust submersion	Ĺ	Dust accumulation or temporary explosive dust atmosphere
Continuous explosive dust atmosphere and deposits	•	Dust accumulation or temporary explosive dust atmosphere

II 2 D Ex tb IIIC T_L xxx°C Db

Process	Enclosure
Zone 21	Zone 21
Continuous dust deposits or temporary explosive dust atmosphere	Dust accumulation or temporary explosive dust atmosphere

XA02514P-B Cerabar PMC71B, PMP71B

Temperature tables



- The specified surface temperature takes into account all direct heat influences from process heat and self-heating at the enclosure.
 - Surface temperatures at the process side maybe higher and must be considered by the user (e.g. at high temperature process connections).
 - The T-marking is based on the process temperature of the compact designs.
 - The specified ambient and process temperature ranges exclusively refer to the explosion protection and must not be exceeded. Operationally permitted ambient temperature ranges can be restricted depending on the version: See Operating Instructions.
 - Do not exceed the max. ambient temperature at the enclosure.
 - The process temperatures refer to the temperature at the separation membrane.

For detailed information see Technical Information.

Basic specification, Position 6 = K When using the stainless steel enclosure: Reduce the admissible ambient temperature by 5 K.

Protection type of enclosure: IP66/67

Device Type PMC71B

II 1/2 D Ex ta/tb IIIC T₂₀₀ 125°C Da/Db II 2 D Ex tb IIIC T_L 125°C Db

Maximum surface temperature	Process temperature range	Ambient temperature range
T125 ℃	-40 °C ≤ T _p ≤ +70 °C	-40 °C ≤ T _a ≤ +65 °C
	$-40 ^{\circ}\text{C} \le T_{p} \le +100 ^{\circ}\text{C}$	-40 °C ≤ T _a ≤ +60 °C
	-40 °C ≤ T _p ≤ +125 °C	-40 °C ≤ T _a ≤ +55 °C

II 1/2 D Ex ta/tb IIIC T_{200} 150°C Da/Db II 2 D Ex tb IIIC T_I. 150°C Db

Optional specification, ID Ex = EC

Maximum surface temperature	Process temperature range	Ambient temperature range
T150 ℃	$-40 ^{\circ}\text{C} \le T_p \le +125 ^{\circ}\text{C}$	$-40 ^{\circ}\text{C} \le T_a \le +60 ^{\circ}\text{C}$
	-40 °C ≤ T _p ≤ +150 °C	-40 °C ≤ T _a ≤ +55 °C

Specific conditions of use:

- The surface temperature is
 - for equipment protection level (EPL) Da: T_{200} 125 °C / 150 °C (with 200 mm dust deposit)
 - \bullet and equipment protection level (EPL) Db: T_L 125 °C / 150 °C (with dust accumulation $T_L)$
- \blacksquare The surface temperature is for equipment protection level (EPL) Db: T_L 125 °C / 150 °C (with dust accumulation $T_L)$
- T_L marking:

The assigned surface temperature without dust layer is the same.

Device Type PMP71B

II 1/2 D Ex ta/tb IIIC T_{200} 125°C Da/Db II 2 D Ex tb IIIC T_L 125°C Db

Maximum surface temperature	Process temperature range	Ambient temperature range
T125℃	-40 °C ≤ T _p ≤ +80 °C	$-40 ^{\circ}\text{C} \le T_{\text{a}} \le +65 ^{\circ}\text{C}$
	$-40 ^{\circ}\text{C} \le T_{p} \le +100 ^{\circ}\text{C}$	-40 °C ≤ T _a ≤ +60 °C
	-40 °C ≤ T _p ≤ +125 °C	-40 °C ≤ T _a ≤ +50 °C

Basic specification, Position 10 = G

Maximum surface temperature	Process temperature range	Ambient temperature range
T125℃	$-40 ^{\circ}\text{C} \le T_p \le +190 ^{\circ}\text{C}$	$-40 ^{\circ}\text{C} \le T_{a} \le +60 ^{\circ}\text{C}$
	$-40 ^{\circ}\text{C} \le T_p \le +290 ^{\circ}\text{C}$	-40 °C ≤ T _a ≤ +55 °C
	$-40 ^{\circ}\text{C} \le T_{p} \le +400 ^{\circ}\text{C}$	$-40 ^{\circ}\text{C} \le T_{\text{a}} \le +50 ^{\circ}\text{C}$

Basic specification, Position 10 = M, N, O, R, S, T

Maximum surface temperature	Process temperature range	Ambient temperature range
T125 ℃	-40 °C ≤ T _p ≤ +190 °C	-40 °C ≤ T _a ≤ +70 °C
	-40 °C ≤ T _p ≤ +290 °C	
	-40 °C ≤ T _p ≤ +400 °C	

XA02514P-B Cerabar PMC71B, PMP71B

Specific conditions of use:

- The surface temperature is
 - for equipment protection level (EPL) Da: T₂₀₀ 125 °C (with 200 mm dust deposit)
 - and equipment protection level (EPL) Db: T_L 125 °C (with dust accumulation T_L)
- The surface temperature is for equipment protection level (EPL) Db: T_L 125 °C (with dust accumulation T_L)
- T_L n

T_L marking:

The assigned surface temperature without dust layer is the same.

Connection data

Basic specification, Position 3 = BA

Power supply

 $U \le 35 V_{DC}$ P < 1 W

Basic specification, Position 3 = DA

Power supply

 $U \le 32 V_{DC}$

 $P \le 0.7 W$

Basic specification, Position 3 = FA

Power supply

 $U \le 15 V_{DC}$

 $P \le 0.7 W$

In connection with: *Basic specification, Position 5 = M, N, O* Installation according to the specifications of FHX50B.



Only the type of protection suitable for the device shall be connected!

Cable entry: Connection compartment Ex tb

Cable gland: *Basic specification, Position* 7 = B

Thread	Clamping range	Material	Sealing insert	O-ring
M20x1,5	ø 8 to 10.5 mm	Ms, nickel-plated	Silicone	EPDM (ø 17x2)

Cable gland: Basic specification, Position 7 = C

Thread	Clamping range	Material	Sealing insert	O-ring
M20x1,5	ø 7 to 12 mm	1.4404	NBR	EPDM (ø 17x2)



- The tightening torque refers to cable glands installed by the manufacturer:
 - Recommended: 3.5 Nm
 - Maximum: 10 Nm
 - This value may be different depending on the type of cable. However, the maximum value must not be exceeded.
- Only suitable for fixed installation. The operator must pay attention to a suitable strain relief of the cable.
- The cable glands are suitable for a low risk of mechanical danger (4 Joule) and must be mounted in a protected position if larger impact energy levels are expected.
- To maintain the ingress protection of the enclosure: Install the enclosure cover, cable glands and blind plugs correctly.





www.addresses.endress.com