Technical Information iTHERM TM402

Resistance thermometer for hygienic and aseptic applications



Imperial version with basic technology for all standard applications, permanent insert

Applications

- Specially designed for use in hygienic and aseptic applications in the Food & Beverages and Life Sciences industries
- Measuring range: -50 to +200 °C (-58 to +392 °F)
- Pressure range up to 40 bar (580 psi)
- Protection class: up to IP69K
- Can be used in non-hazardous areas

Temperature transmitter

All Endress+Hauser transmitters are available with enhanced accuracy and reliability compared to directly wired sensors. Easy customizing by choosing one of the following outputs and communication protocols:

- Analog output 4 to 20 mA, HART®
- Bluetooth[®] connectivity (optional)

Your benefits

- Best price-performance ratio and fast delivery time
- User-friendly and reliable from product selection to maintenance
- International certification: hygiene standards as per 3-A, EHEDG, ASME BPE, FDA, TSE Certificate of Suitability
- Wide range of process connections
- Sensor assembly TM402 meets PMO requirements by US FDA for dairies



Table of contents

Function and system design iTHERM Hygiene line	3 3 4
Input	5 5
Output Output signal Family of temperature transmitters	5 5 5
Wiring . Wiring diagrams for RTD . Cable entries . Connector . Overvoltage protection .	6 6 7 7 8
	8 8 9 9 9 10
Installation	
Orientation	10 10 10
Orientation Installation instructions Environment Ambient temperature range Storage temperature Humidity Climate class Degree of protection Shock and vibration resistance	10
Orientation Installation instructions Environment Ambient temperature range Storage temperature Humidity Climate class Degree of protection Shock and vibration resistance Electromagnetic compatibility (EMC) Process Process temperature range Thermal shock Process pressure range	10 10 13 13 13 13 13

Certificates and approvals	20
Hygiene standard	20
Materials in contact with food/product (FCM)	20
Other standards and guidelines	21
Material resistance	21
Surface purity	21
Ordering information	21
Accessories	22
Device-specific accessories	22
Communication-specific accessories	22
Service-specific accessories	23
System components	24
Supplementary documentation	24

Function and system design


iTHERM Hygiene line


This thermometer is part of the product line of modular thermometers for hygienic and aseptic applications.

Differentiating factors when selecting a suitable thermometer





TM41x characterizes the device that uses cutting-edge technology, with features such as a replaceable insert, quick-fastening extension neck (iTHERM QuickNeck), vibration-resistant and fast-response sensor technology iTHERM StrongSens and QuickSens) and approval for use in hazardous areas

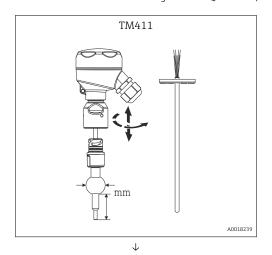

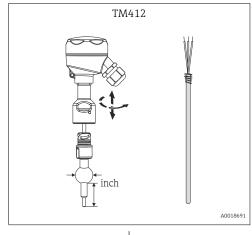

TM40x characterizes the device that uses basic technology, with features such as a fixed, non-replaceable insert, application in non-hazardous areas, standard extension neck, low-cost unit

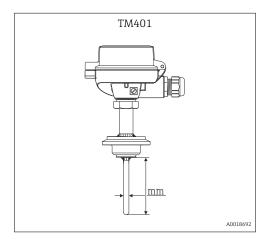

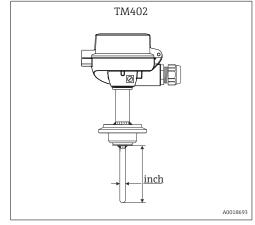

Measuring principle

Resistance thermometer (RTD)

These resistance thermometers use a Pt100 temperature sensor according to IEC 60751. The temperature sensor is a temperature-sensitive platinum resistor with a resistance of 100 Ω at 0 °C (32 °F) and a temperature coefficient α = 0.003851 °C⁻¹.

There are generally two different kinds of platinum resistance thermometers:

- Wire wound (WW): Here, a double coil of fine, high-purity platinum wire is located in a ceramic support. This is then sealed top and bottom with a ceramic protective layer. Such resistance thermometers not only facilitate very reproducible measurements but also offer good long-term stability of the resistance/temperature characteristic within temperature ranges up to 600 °C (1112 °F). This type of sensor is relatively large in size and it is comparatively sensitive to vibrations.
- Thin film platinum resistance thermometers (TF): A very thin, ultrapure platinum layer, approx. 1 µm thick, is vaporized in a vacuum on a ceramic substrate and then structured photolithographically. The platinum conductor paths formed in this way create the measuring resistance. Additional covering and passivation layers are applied and reliably protect the thin platinum layer from contamination and oxidation, even at high temperatures.

The primary advantages of thin film temperature sensors over wire wound versions are their smaller sizes and better vibration resistance. A relatively low principle-based deviation of the resistance/ temperature characteristic from the standard characteristic of IEC 60751 can frequently be observed among TF sensors at high temperatures. As a result, the tight limit values of tolerance category A as per IEC 60751 can only be observed with TF sensors at temperatures up to approx. $300 \,^{\circ}\text{C}$ (572 $^{\circ}\text{F}$).


Thermocouples (TC)

Thermocouples are comparatively simple, robust temperature sensors which use the Seebeck effect for temperature measurement: if two electrical conductors made of different materials are connected at a point, a weak electrical voltage can be measured between the two open conductor ends if the conductors are subjected to a thermal gradient. This voltage is called thermoelectric voltage or electromotive force (emf.). Its magnitude depends on the type of conducting materials and the temperature difference between the "measuring point" (the junction of the two conductors) and the "cold junction" (the open conductor ends). Accordingly, thermocouples primarily only measure differences in temperature. The absolute temperature at the measuring point can be determined from these if the associated temperature at the cold junction is known or is measured separately and compensated for. The material combinations and associated thermoelectric voltage/temperature characteristics of the most common types of thermocouple are standardized in the IEC 60584 and ASTM E230/ANSI MC96.1 standards.

Measuring system

Endress+Hauser offers a complete portfolio of optimized components for the temperature measuring point – everything you need for the seamless integration of the measuring point into the overall facility. This includes:

- Power supply unit/barrier
- Display units
- Data managers
- Overvoltage protection
- For more information, see the brochure 'System Products and Data Managers Solutions for the loop' (FA00016K)

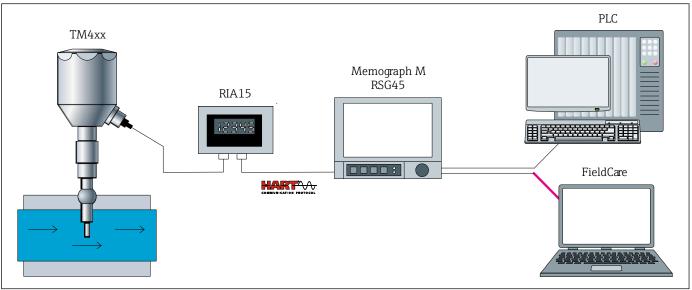

■ 1 Example of application, measuring point layout with additional Endress+Hauser components

4 Endress+Hauser

A003376

- iTHERM TM4x2: Installed RTD thermometer with integrated HART® head transmitter
- Display unit RIA15:
 - Display of 4 to 20 mA measured values or HART® process variables
 - Loop-powered
 - Voltage drop ≤1 V (HART® ≤1.9 V)
- Data Management Memograph M RSG45:
 - Tamper-proof data storage and access (FDA 21 CFR 11)
 - HART $\!^{\scriptscriptstyle{(\!R\!)}}$ gateway functionality; Up to 40 HART $\!^{\scriptscriptstyle{(\!R\!)}}$ devices connected at a time
 - Communication capabilities: Modbus, Profibus DP, PROFINET, EtherNet/IP
- PLC / FieldCare: Field Data Manager Software MS20 Automatic service for report generation, printing reports, read out of data, storing of data, secure export, pdf generation Read out measured data via online interface or from mass storage Online visualization of instantaneous values ("live data") . More information on this can be found in the Technical Information, see "Documentation".

Input

Measured variable

Temperature (temperature-linear transmission behavior)

Measuring range

Sensor type	Measuring range
Pt100 thin-film	−50 to +200 °C (−58 to +392 °F)

Output

Output signal

Generally, the measured value can be transmitted in one of two ways:

- Directly-wired sensors sensor measured values forwarded without a transmitter.
- Via all common protocols by selecting an appropriate Endress+Hauser iTEMP temperature transmitter. All the transmitters listed below are mounted directly in the terminal head and wired with the sensory mechanism.

Family of temperature transmitters

Thermometers fitted with iTEMP transmitters are an installation-ready complete solution to improve temperature measurement by significantly increasing accuracy and reliability, when compared to direct wired sensors, as well as reducing both wiring and maintenance costs.

PC programmable head transmitters

They offer a high degree of flexibility, thereby supporting universal application with low inventory storage. The iTEMP transmitters can be configured quickly and easily at a PC. Endress+Hauser offers free configuration software which can be downloaded from the Endress+Hauser Website. More information can be found in the Technical Information.

HART® head transmitters

The transmitter is a 2-wire device with one or two measuring inputs and one analog output. The device not only transfers converted signals from resistance thermometers and thermocouples, it also transfers resistance and voltage signals using HART $^{\circ}$ communication. Swift and easy operation, visualization and maintenance using universal device configuration tools like FieldCare, DeviceCare or FieldCommunicator 375/475. Integrated Bluetooth $^{\circ}$ interface for the wireless display of measured values and configuration via E+H SmartBlue (app), optional. For more information, see the Technical Information.

Advantages of the iTEMP transmitters:

- Dual or single sensor input (optionally for certain transmitters)
- $\ \ \, \blacksquare$ Unsurpassed reliability, accuracy and long-term stability in critical processes
- Mathematical functions
- Monitoring of the thermometer drift, sensor backup functionality, sensor diagnostic functions
- Sensor-transmitter matching for dual sensor input transmitter, based on Callendar/Van Dusen coefficients


Wiring

- i
- According to the 3-A[®] Standard electrical connecting cables must be smooth, corrosion-resistant and easy to clean.
- \blacksquare Grounding or shield connections are possible via special ground terminals on the terminal head. $\Rightarrow \ \ \, \boxminus \ \, 16$

Wiring diagrams for RTD


According to the 3-A Sanitary Standard and the EHEDG, electrical connecting cables must be smooth, corrosion-resistant and easy to clean.

Type of sensor connection

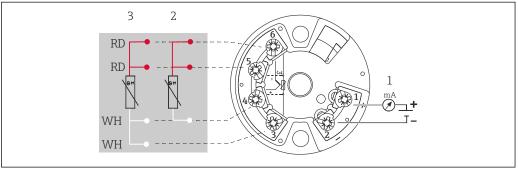


A00456

- \blacksquare 2 Head mounted transmitter TMT18x (single input). Only available with screw terminals.
- 1 Power supply head transmitter and analog output 4 to 20 mAor bus connection
- 2 3-wire
- 3 4-wire

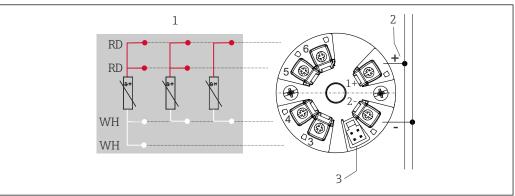


A004717

- 3 Head mounted transmitter TMT31 (single input)
- 1 RTD sensor input: 4-, 3- and 2-wire
- 2 Power supply
- 3 CDI interface

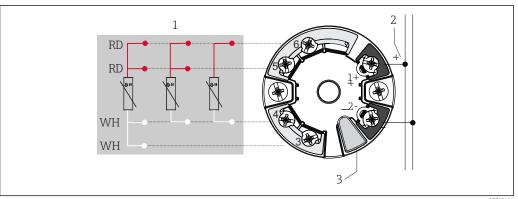

- € 4 $Head\ mounted\ transmitter\ TMT7x\ (single\ input).\ Fitted\ with\ spring\ terminals\ if\ screw\ terminals\ are\ not$ explicitly selected.
- Sensor Input 1
- Bus connection and supply voltage
- Display connection

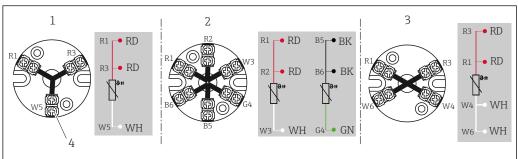

- **₽** 5 Terminal block mounted
- 3-wire single
- 2 x 3-wire single
- 4-wire single
- Outside screw

Cable entries

Connector

PIN assignment of the M12 connectors, connection combinations

Connector	M12 connector 4-pin					
PIN number	1 2 3 4					
Electrical connection (te	Electrical connection (terminal head)					
Flying leads		Not connected	(not insulated)			
3-wire terminal block (1x Pt100)	RD	RD	W	TH .		
4-wire terminal block (1x Pt100)	, KD	KD -	WH	WH		
1x TMT 4 to 20 mA or HART®	+	i	-	i		
PIN position and color code		4 3	1 BN 2 GNYE 3 BU 4 GY	A0018929		

Abbreviations

i	RD	WH	BN	GNYE	BU	GY
Insulated ¹⁾	Red	White	Brown	Green- yellow	Blue	Gray

1) Wires marked 'I' are not connected and are insulated with heat shrink tubes.

Overvoltage protection

To protect against overvoltage in the power supply and signal/communication cables for the thermometer electronics, Endress+Hauser offers the HAW562 surge arrester for DIN rail mounting and the HAW569 for field housing installation.

For more information see the Technical Information 'HAW562 Surge arrester' TI01012K and 'HAW569 Surge arrester' TI01013K.


Performance characteristics

Reference conditions

These data are relevant for determining the accuracy of the temperature transmitters used. More information on this can be found in the Technical Information of the iTEMP temperature transmitters.

Maximum measured error

RTD resistance thermometer corresponding to IEC 60751

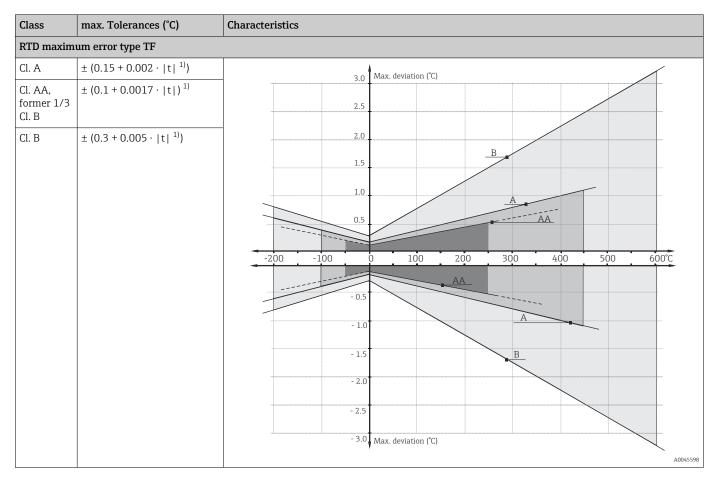

1) |t| = absolute value °C

For measurement errors in $^{\circ}$ F, calculate using equations in $^{\circ}$ C, then multiply the outcome by 1.8.

8

Temperature ranges for compliance with the tolerance classes

Sensor type	Operating temperature range	Class B	Class A	Class AA
Pt100 thin film sensor (TF)	−50 to 200 °C (−58 to 392 °F)	-	−30 to 200 °C (−22 to 392 °F)	-

Influence of ambient temperature

Depends on the head transmitter used. For details, see Technical Information. $\label{eq:continuous}$

Self heating

RTD elements are passive resistances that are measured using an external current. This measurement current causes a self-heating effect in the RTD element itself which in turn creates an additional measurement error. In addition to the measurement current, the size of the measurement error is also affected by the temperature conductivity and flow velocity of the process. This self-heating error is negligible when an Endress+Hauser iTEMP temperature transmitter (very small measurement current) is connected.

Response time

Tests in water at 0.4 m/s (1.3 ft/s), according to IEC 60751; 10 K temperature step change.

		1x Pt100 thin-film s	ensor
Pipe diameter	Shape of tip	Response time	
		t ₅₀	t ₉₀
	Straight	5 s	11 s
Ø6.35 mm (¼ in)	Reduced 4.76 mm (³ / ₁₆ in) x 19.05 mm (0.75 in)	3.5 s	9 s
Ø9.53 mm (⅔ in)	Reduced 4.76 mm (³ / ₁₆ in) x 19.05 mm (0.75 in)	5 s	10.5 s



Response time without transmitter.

Calibration

Calibration of thermometers

Calibration involves comparing the measured values of a device under test (DUT) with those of a more precise calibration standard using a defined and reproducible measurement method. The aim is to determine the deviation of the DUT's measured values from the true value of the measured variable. Two different methods are used for thermometers:

- Calibration at fixed-point temperatures, e.g. at the freezing point of water at 0 °C,
- Calibration compared against a precise reference thermometer.

The thermometer to be calibrated must display the fixed point temperature or the temperature of the reference thermometer as accurately as possible. Temperature-controlled calibration baths with very homogeneous thermal values, or special calibration furnaces into which the DUT and the reference thermometer, where necessary, can project to a sufficient degree, are typically used for thermometer calibrations.

The measurement uncertainty can increase due to heat dissipation errors and short immersion lengths. The existing measurement uncertainty is listed on the individual calibration certificate.

For accredited calibrations according to ISO17025, the measurement uncertainty shouldn't be twice as high as the accredited measurement uncertainty. If this is exceeded, only a factory calibration can be performed.

Evaluation of thermometers

If a calibration with an acceptable uncertainty of measurement and transferable measurement results is not possible, Endress+Hauser offers customers a thermometer evaluation measurement service, if technically feasible. This is the case when:

- The process connections/flanges are too big or the immersion length (IL) is too short to allow the DUT to be immersed sufficiently in the calibration bath or furnace (see the following table), or
- Due to heat conduction along the thermometer tube, the resulting sensor temperature generally deviates significantly from the actual bath/furnace temperature.

The measured value of the DUT is determined using the maximum possible immersion depth and the specific measuring conditions and measurement results are documented on an evaluation certificate.

For the device, Endress+Hauser offers standard calibrations at a reference temperature of -20 to +200 °C (-4 to +392 °F) based on the ITS90 (International Temperature Scale). Calibrations in other temperature ranges are available from your Endress+Hauser sales center on request. Calibrations are traceable to national and international standards. The calibration certificate is referenced to the serial number of the thermometer.

Insulation resistance

Insulation resistance $\geq 100~\text{M}\Omega$ at ambient temperature, measured between the terminals and the outer jacket with a minimum voltage of $100~\text{V}_{DC}$.

Installation


Orientation

No restrictions. However, self-draining in the process must be guaranteed. If there is an opening to detect leaks at the process connection, this opening must be at the lowest possible point.

Installation instructions


The immersion length of the thermometer can influence the accuracy. If the immersion length is too small then errors in the measurement are caused by heat conduction via the process connection and the container wall. If installing into a pipe then the immersion length should ideally be half of the pipe diameter.

Installation possibilities: Pipes, tanks or other plant components

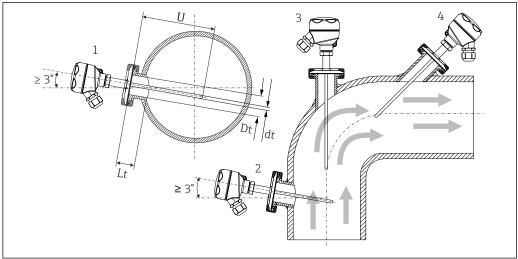

- € 6 Installation examples
- 1, 2 Perpendicular to flow direction, installed at a minimum angle of 3° to ensure self-draining
- Inclined installation in pipes with a small nominal diameter
- Immersion length
- The requirements of the EHEDG and the 3-A Sanitary Standard must be adhered to. Installation instructions EHEDG/cleanability: Lt ≤ (Dt-dt) Installation instructions 3-A/cleanability: Lt \leq 2(Dt-dt)
- In the case of pipes with a small nominal diameter, it is advisable for the tip of the thermometer to project well into the process so that it extends past the pipe axis. Installation at an angle (4) could be another solution. When determining the immersion length or installation depth all the parameters of the thermometer and of the medium to be measured must be taken into account (e.g. flow velocity, process pressure).

Pay attention to the exact position of the sensor element in the thermometer tip.

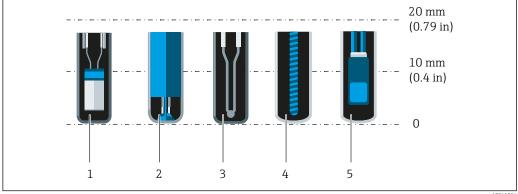


- StrongSens or TrustSens at 5 to 7 mm (0.2 to 0.28 in)
- QuickSens at 0.5 to 1.5 mm (0.02 to 0.06 in)
- 3 Thermocouple (not grounded) at 3 to 5 mm (0.12 to 0.2 in)
- Wire wound sensor at 5 to 20 mm (0.2 to 0.79 in)
- Standard thin-film sensor at 5 to 10 mm (0.2 to 0.39 in)

To keep the influence of heat dissipation to a minimum and to achieve the best possible measurement results, 20 to 25 mm (0.79 to 0.98 in) should be in contact with the medium in addition to the actual sensor element.

This results in the following recommended minimum immersion lengths


- TrustSens or StrongSens 30 mm (1.18 in)
- QuickSens 25 mm (0.98 in)
- Wire wound sensor 45 mm (1.77 in)
- Standard thin-film sensor 35 mm (1.38 in)

It is particularly important to take this into consideration for T-pieces, as the immersion length is very short on account of their design, and the measured error is higher as a result. It is therefore recommended to use elbow pieces with QuickSens sensors.

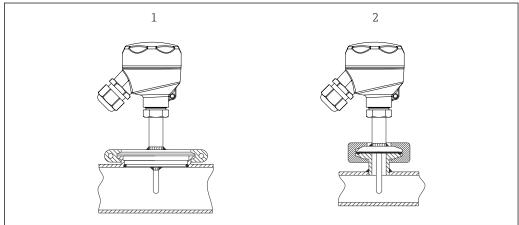

A0018881

- 7 Process connections for thermometer installation in pipes with small nominal diameters
- 1 $Varivent^{\circ}$ process connection D = 50 mm for DN25 pipes
- 2 Clamp or micro-clamp

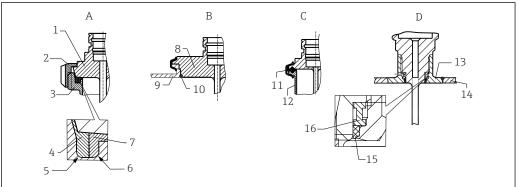

A0040345

\blacksquare 8 Detailed installation instructions for hygiene-compliant installation

- A Milk pipe connection according to DIN 11851, only in connection with EHEDG certified and self-centering sealing ring
- 1 Sensor with milk pipe connection
- 2 Groove slip-on nut
- 3 Counterpart connection
- 4 Centering ring
- 5 RO.4
- 6 R0.4
- 7 Sealing ring
- B Varivent® process connection for VARINLINE® housing
- 8 Sensor with Varivent connection
- 9 Counterpart connection
- 10 O-ring
- C Clamp according to ISO 2852
- 11 Molded seal
- 12 Counterpart connection
- D Process connection Liquiphant-M G1", horizontal installation
- 13 Weld-in adapter
- 14 Vessel wall
- 15 O-ring
- 16 Thrust collar

12

NOTICE

The following actions must be taken if a sealing ring (O-ring) or seal fails:

- ► The thermometer must be removed.
- The thread and the O-ring joint/sealing surface must be cleaned.
- The sealing ring or seal must be replaced.
- CIP must be performed after installation.

In the case of weld-in connections, exercise the necessary degree of care when performing the welding work on the process side:

- 1. Use suitable welding material.
- 2. Flush-weld or weld with welding radius \geq 3.2 mm (0.13 in).
- 3. Avoid crevices, folds or gaps.
- **4.** Ensure the surface is honed and polished, Ra \leq 0.76 μm (30 μin).

Pay attention to the following when installing the thermometer to ensure that the cleanability is not affected:

- 1. The installed sensor is suitable for CIP (cleaning in place). Cleaning is performed together with the pipe or tank. In the case of internal tank fixtures using process connection nozzles, it is important to ensure that the cleaning assembly directly sprays this area so that it is cleaned
- 2. The Varivent® couplings enable flush-mount installation.

Environment

Ambient temperature range	Terminal head	Temperature in °C (°F)			
	Without mounted head transmitter	Depends on the terminal head used and the cable gland or fieldbus connector, see Terminal heads' section $\rightarrow \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ $			
	With mounted head transm	itter -40 to 85 °C (-40 to 185 °F)			
Storage temperature	For information, see the a	ambient temperature.			
Humidity	Depends on the transmitter used. If Endress+Hauser iTEMP head transmitters are used: Condensation permitted as per IEC 60 068-2-33 Maximum relative humidity: 95% as per IEC 60068-2-30				
Climate class	As per EN 60654-1, Class C				
Degree of protection	Max. IP69K, depending on the design (terminal head, connector, etc.)				
Shock and vibration resistance	The Endress+Hauser inserts meet the requirements of IEC 60751 which specify shock and vibrat resistance of 3g in the range from 10 to 500 Hz. The vibration resistance at the measuring point depends on the sensor type and design, see the following table:				
	Version Vibration resistance for the sensor tip				
	P+100 (TF) 30 m/s ² (3a)				

Version	Vibration resistance for the sensor tip
Pt100 (TF)	30 m/s ² (3g)

Electromagnetic compatibility (EMC)

Depends on the head transmitter used. For details see the Technical Information.

Process

Process temperature range	Maximum -50 to +200 °C (-58 to +392 °F)	

Thermal shock

Thermal shock resistance in CIP/SIP process with a temperature increase from +5 to +130 °C (+41 to +266 °F) within 2 seconds.

Process pressure range


The maximum possible process pressure depends on various influencing factors, such as the design, process connection and process temperature. For information on the maximum possible process pressures for the individual process connections, see the 'Process connection' section. $\rightarrow \implies 18$



It is possible to check the mechanical loading capacity as a function of the installation and process conditions online in the Thermowell (TW) Sizing Module for thermowells in the Endress+Hauser Applicator software. See 'Accessories' section.

Example of the permitted flow velocity depending on the immersion length and process medium $\,$

The highest flow velocity tolerated by the thermometer diminishes with increasing insert immersion length exposed to the stream of the fluid. In addition it is dependent on the diameter of the thermometer tip, on the kind of measuring medium, on the process temperature and on the process pressure. The following figures exemplify the maximum permitted flow velocities in water and superheated steam at a process pressure of 40 bar (580 PSI).

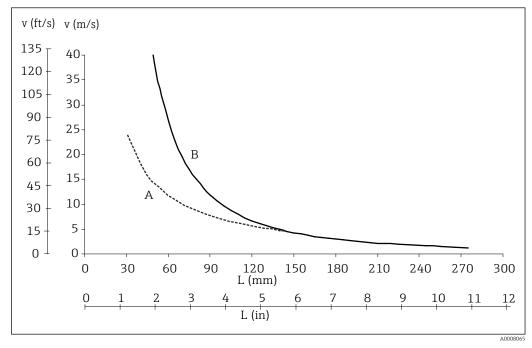

- 9 Permitted flow velocities, thermowell diameter 6.35 mm (¼ in)
- A Medium water at $T = 50 \,^{\circ}\text{C}$ (122 °F)
- B Medium superheated steam at $T = 400 \,^{\circ}\text{C}$ (752 °F)
- L Immersion length exposed to flow
- v Flow velocity


Medium - state of aggregation

Gaseous or liquid (also with high viscosity, e.g. yogurt).

Mechanical construction

Design, dimensions

All dimensions in mm (in).

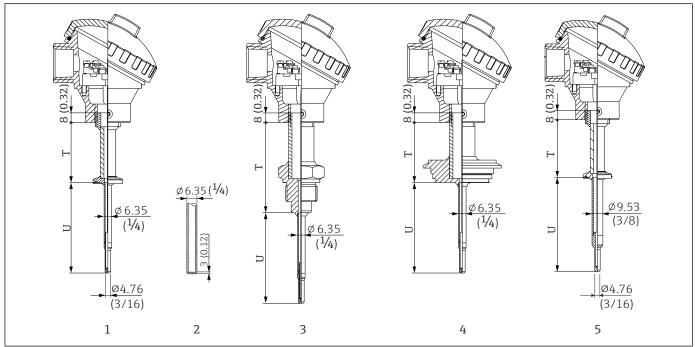

Δ0034462

- 1 Thermometer with clamp process connection and $\emptyset 6.35$ mm ($\frac{1}{4}$ in) thermowell with reduced tip 4.76 mm ($\frac{3}{16}$ in)
- 2 Optional for all thermometers with \emptyset 6.35 mm ($\frac{1}{4}$ in) thermowell: straight tip shape
- 3 Thermometer with ISO228 process connection and \emptyset 6.35 mm ($\frac{1}{4}$ in) thermowell with reduced tip \emptyset 4.76 mm ($\frac{3}{16}$ in)
- 4 Thermometer with Varivent process connection and \emptyset 6.35 mm ($\frac{1}{4}$ in) thermowell with reduced \emptyset 4.76 mm ($\frac{3}{16}$ in)
- Thermometer with clamp process connection and Ø9.53 mm ($\frac{3}{8}$ in) thermowell with reduced tip Ø4.76 mm ($\frac{3}{16}$ in)
- T Length of extension neck
- U Immersion length

Weight

Depending on the configuration

Material

The temperatures for continuous operation specified in the following table are only intended as reference values for use of the various materials in air and without any significant compressive load.

The maximum operating temperatures can be reduced considerably in cases where abnormal conditions such as high mechanical load occur or in aggressive media.

Designation	Recommended max. temperature for continuous use in air	Properties
AISI 316L	650 °C (1202 °F) 1)	 Austenitic, stainless steel High corrosion resistance in general Particularly high corrosion resistance in chlorine-based and acidic, non-oxidizing atmospheres through the addition of molybdenum (e.g. phosphoric and sulfuric acids, acetic and tartaric acids with a low concentration) Increased resistance to intergranular corrosion and pitting The wetted part from a 316L thermowell withstand a passivation process with a 3% sulphuric acid Available with 3-A marked sensors

1) Can be used to a limited extent up to $800\,^{\circ}$ C ($1472\,^{\circ}$ F) for low compressive loads and in non-corrosive media. Contact your Endress+Hauser sales team for further information.

Surface roughness


Values for wetted surfaces:

Standard surface, mechanically polished ¹⁾	$R_a \le 0.76 \ \mu m \ (30 \ \mu in)$
Mechanically polished, buffed ²⁾	$R_a \leq 0.38 \ \mu m \ (15 \ \mu in)$


- 1) Or equivalent treatment that guarantees R_{a} max
- 2) Not compliant with ASME BPE


Terminal heads

As a special feature, Endress+Hauser offers terminal heads with optimized terminal accessibility for easy installation and maintenance.

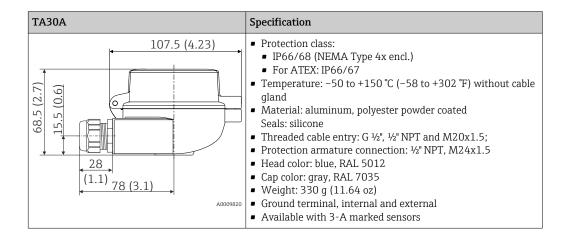

16

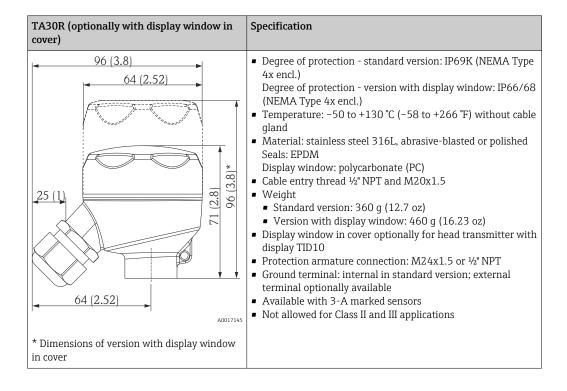

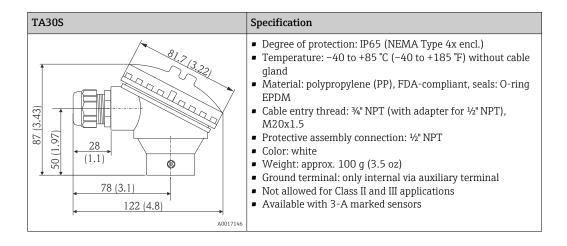

Cable glands and fieldbus connectors

Туре	Suitable for cable entry	Degree of protection	Temperature range
Cable gland, polyamide	½" NPT, ¾" NPT, M20x1.5	IP68	-40 to +100 °C (-40 to +212 °F)
Cable giand, polyamide	½" NPT, M20x1.5	IP69K	−20 to +95 °C (−4 to +203 °F)
Fieldbus connector (M12, 4-pin)	½" NPT, M20x1.5	IP67, NEMA Type 6	-40 to +105 °C (-40 to +221 °F)

Process connections

All dimensions in mm (in).

Туре	Version	Dime	nsions	Technical properties	Conformity
туре	Ød: 1)	ØD	Øa	recinical properties	Comorning
Clamp according to ISO 2852	Tri-clamp ¾" (DN18) Form A	25 mm (0.98 in)	-	■ P _{max.} = 16 bar (232 psi), depends on clamp ring and	ASME BPE type A
ØD	Clamp ISO 2852 ½" (DN12 - 21.3) Form B	34 mm (1.34 in)	16 to 25.3 mm (0.63 to 0.99 in	suitable seal 3-A marked	ISO 2852
	Tri-clamp 1" - 1½" (DN25 - 38) Form B	50.5 mm (1.99 in)	29 to 42.4 mm (1.14 to 1.67 in	 P_{max.} = 16 bar (232 psi), depends on clamp ring and suitable seal 3-A marked and EHEDG 	ASME BPE type B
øg øg	Tri-clamp 2" (DN40 - 51) Form B	64 mm (2.52 in)	44.8 to 55.8 m m (1.76 to 2.2 in)	certified (combined with Combifit seal)	
Form B					
Form A: In compliance with ASME BPE Type A Form B: In compliance with ASME BPE Type B and ISO 2852					

1) Pipes in accordance with ISO 2037 and BS 4825 Part 1 $\,$

			Dimensions		
Туре	Version G	L1 thread length	A	1 (SW/AF)	Technical properties
Thread according to ISO 228 (for Liquiphant weld-in adapter)	G¾" for FTL20 adapter	16 mm (0.63 in)	25.5 mm (1 in)	32	■ P _{max.} = 25 bar (362 psi) at max. 150 °C (302 °F) ■ P _{max.} = 40 bar (580 psi) at max. 100 °C (212 °F) ■ In connection with
G L1 A	G¾" for FTL50 adapter				FTL31/33/50 adapter, see TI00426F for details about 3-A conformity and EHEDG
A0009572	G1" for FTL50 adapter	18.6 mm (0.73 in)	29.5 mm (1.16 in)	41	tested O-ring Minimum extension neck lengths: ≥ 76.2 mm (3 in)

Туре	Version		Dime	nsions			Technical properties
Type	Version	ØD	ØA	ØВ	h	P _{max} .	
Varivent [®]	Type F	50 mm (1.97 in)	145 mm (5.71 in)	135 mm (5.31 in)	24 mm (0.95 in)		
ØA ØB ØD A0021307	Type N	68 mm (2.67 in)	165 mm (6.5 in)	155 mm (6.1 in)	24.5 mm (0.96 in)	10 bar (145 psi)	 3-A marked and EHEDG certified ASME BPE compliance

The VARINLINE® housing connection flange is suitable for weld-in into the conical or torispherical head in tanks or containers with a small diameter (≤ 1.6 m (5.25 ft)) and up to a wall thickness of 8 mm (0.31 in).


Туре		Technical properties
Varivent® for VARINLINE® housing for installation in pipes		 3-A marked and EHEDG certified ASME BPE compliance
	A0009564	
Dimensions		

Version	Dimensions			P _{max} .	
Version	ØD	ØD Øi		r max.	
		OD 1½": 34.9 mm (1.37 in)	OD 1½": 38.1 mm (1.5 in)		
Type N, according to DIN 11866, series C	68 mm (2.67 in)	OD 2": 47.2 mm (1.86 in)	OD 2": 50.8 mm (2 in)	OD 1½" to OD 2½": 16 bar (232 psi)	
,			OD 2½": 63.5 mm (2.5 in)		
Type N, according to DIN	68 mm (2.67 in)	OD 3": 73 mm (2.87 in)	OD 3": 76.2 mm (3 in)	OD 3" to OD 4": 10 bar (145 psi)	
11866, series C	00 11111 (2.07 111)	OD 4": 97.6 mm (3.84 in)	OD 4": 101.6 mm (4 in)	OD 3 (0 OD 4 . 10 bai (143 psi)	
Type F, according to DIN 11866, series C	50 mm (1.97 in)	OD 1": 22.2 mm (0.87 in)	OD 1": 25.4 mm (1 in)	16 bar (232 psi)	

Tip shape

The thermal response time, the reduction of the flow cross-section and the mechanical load that occurs in the process are the criteria that matter when selecting the shape of the tip. Advantages of using reduced thermometer tips:

- $\ \ \, \blacksquare$ A smaller tip shape has less impact on the flow characteristics of the pipe carrying the medium.
- The flow characteristics are optimized, thereby increasing the stability of the thermowell.
- Endress+Hauser offers users a range of thermowell tips to meet every requirement:
 - Straight tip
 - Reduced tip with ϕ 4.76 mm (3 ₁₆ in): walls of lower thickness significantly reduce the response times of the overall measuring point
 - Reduced tip for Tee and Elbow thermowell with ϕ 4.5 mm (0.18 in)

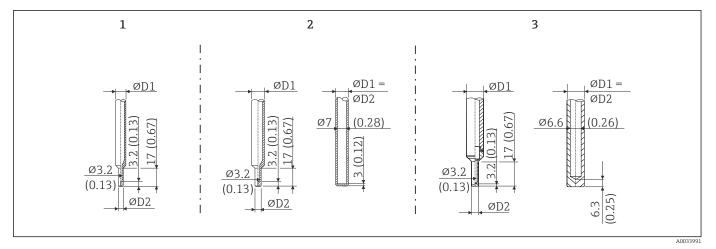

■ 10 Thermowell tips available (reduced or straight)

Item No.	Thermowell (ØD1)	Tip (ΦD2)	Insert (ØID)
1	Φ6.35 mm (½ in)	Reduced tip with ϕ 4.76 mm ($^{3}/_{16}$ in)	Φ3 mm (0.12 in)
2	φ9.53 mm (¾ in)	 Reduced tip with Φ4.76 mm (³/₁₆ in) Straight tip 	 φ3 mm (0.12 in) φ6.35 mm (¹/₄ in) or 6 mm (0.24 in)
3	Φ12.7 mm (½ in)	• Reduced tip with $\phi 4.76$ mm ($\frac{3}{16}$ in) • Straight tip	 φ3 mm (0.12 in) φ6.35 mm (¹/₄ in) or 6 mm (0.24 in)

It is possible to check the mechanical loading capacity as a function of the installation and process conditions online in the TW Sizing Module for thermowells in the Endress+Hauser Applicator software. See 'Accessories' section. → 🗎 22

Certificates and approvals

Current certificates and approvals that are available for the product can be selected via the Product Configurator at www.endress.com:

- 1. Select the product using the filters and search field.
- 2. Open the product page.
- 3. Select **Configuration**.

Hygiene standard

- EHEDG certification, type EL CLASS I. EHEDG certified/tested process connections. → 🖺 18
- ASME BPE, Declaration of Conformity, can be ordered for options indicated
- FDA-compliant
- All surfaces in contact with the medium are free from materials derived from bovine animals or other livestock (ADI/TSE)

Materials in contact with food/product (FCM)

The materials of the thermometer in contact with food/product (FCM) comply with the following European regulations:

- (EC) No. 1935/2004, Article 3, paragraph 1, Articles 5 and 17 on materials and articles intended to come into contact with food.
- (EC) No. 2023/2006 on good manufacturing practice for materials and articles intended to come into contact with food.
- (EU) No. 10/2011 on plastic materials and articles intended to come into contact with food.

Other standards and guidelines

- IEC 60529: Degrees of protection provided by enclosures (IP code)
- IEC 61010-1: Safety requirements for electrical equipment for measurement, control and laboratory use
- IEC 60751: Industrial platinum resistance thermometers
- ASTM E 1137/E1137M-2008: Standard Specification for Industrial Platinum Resistance Thermometers
- EN 50281-1-1: Electrical apparatus protected by enclosures
- DIN EN 50446: Terminal heads
- IEC 61326-1: Electromagnetic compatibility (electrical equipment for measurement, control and laboratory use EMC requirements)
- PMO: Pasteurized Milk Ordinance 2001 Revision, U.S. Food and Drug Administration, Center for Food Safety & Applied Nutrition

Material resistance

Material resistance - including resistance of housing - to the following Ecolab cleaning/disinfection agents:

- P3-topax 66
- P3-topactive 200
- P3-topactive 500
- P3-topactive OKTO
- And demineralized water

Surface purity

Free from oil and grease, optional

Ordering information

Detailed ordering information is available from your nearest sales organization www.addresses.endress.com or in the Product Configurator at www.endress.com:

- 1. Select the product using the filters and search field.
- 2. Open the product page.
- 3. Select **Configuration**.

i

Product Configurator - the tool for individual product configuration

- Up-to-the-minute configuration data
- Depending on the device: Direct input of measuring point-specific information such as measuring range or operating language
- Automatic verification of exclusion criteria
- Automatic creation of the order code and its breakdown in PDF or Excel output format
- Ability to order directly in the Endress+Hauser Online Shop

Accessories

Various accessories, which can be ordered with the device or subsequently from Endress+Hauser, are available for the device. Detailed information on the order code in question is available from your local Endress+Hauser sales center or on the product page of the Endress+Hauser website: www.endress.com.

Device-specific accessories

Weld-in adapter



For more information about order codes and hygienic compliance of the adapters and spare parts, see Technical Information (TI00426F).

Weld-in adapter	A0008246	A0008251	A0008256	A0011924	A0008248	A0008253
	G ¾", d=29 for pipe-mounting	G ¾", d=50 for vessel-mounting	G ¾", d=55 with flange	G 1", d=53 without flange	G 1", d=60 with flange	G 1" adjustable
Material	316L (1.4435)	316L (1.4435)	316L (1.4435)	316L (1.4435)	316L (1.4435)	316L (1.4435)
Roughness μm (μin) process side	≤1.5 (59.1)	≤0.8 (31.5)	≤0.8 (31.5)	≤0.8 (31.5)	≤0.8 (31.5)	≤0.8 (31.5)



Maximum process pressure for the weld-in adapters:

- 25 bar (362 PSI) at maximum 150 °C (302 °F)
- 40 bar (580 PSI) at maximum 100 °C (212 °F)

Communication-specific
accessories

Configuration kit TXU10	Configuration kit for PC-programmable transmitter with setup software and interface cable for PC with USB port Order code: TXU10-xx
Commubox FXA195 HART	For intrinsically safe HART communication with FieldCare via the USB interface. For details, see Technical Information TI00404F
Wireless HART adapter SWA70	Is used for the wireless connection of field devices. The WirelessHART adapter can be easily integrated into field devices and existing infrastructures, offers data protection and transmission safety and can be operated in parallel with other wireless networks with minimum cabling complexity. For details, see Operating Instructions BA00061S

Service-specific accessories

Accessories	Description
Applicator	Software for selecting and sizing Endress+Hauser measuring devices: Calculation of all the necessary data for identifying the optimum measuring device: e.g. pressure loss, accuracy or process connections. Graphic illustration of the calculation results
	Administration, documentation and access to all project-related data and parameters over the entire life cycle of a project.
	Applicator is available: Via the Internet: https://portal.endress.com/webapp/applicator On CD-ROM for local PC installation.

Configurator	Product Configurator - the tool for individual product configuration Up-to-the-minute configuration data Depending on the device: Direct input of measuring point-specific information such as measuring range or operating language Automatic verification of exclusion criteria Automatic creation of the order code and its breakdown in PDF or Excel output format Ability to order directly in the Endress+Hauser Online Shop
	The Configurator is available on the Endress+Hauser website: www.endress.com -> Click "Corporate" -> Select country -> Click "Products" -> Select the product using the filters and search field -> Open product page -> The "Configure" button to the right of the product image opens the Product Configurator.

W@M	Life cycle management for your plant W@M supports with a wide range of software applications over the entire process: from planning and procurement, to the installation, commissioning and operation of the measuring devices. All the relevant device information, such as the device status, spare parts and device-specific documentation, is available for every device over the entire life cycle. The application already contains the data of your Endress+Hauser device. Endress +Hauser also takes care of maintaining and updating the data records.
	W@M is available: ■ Via the Internet: www.endress.com/lifecyclemanagement ■ On CD-ROM for local PC installation.

FieldCare SFE500	FDT-based plant asset management tool from Endress+Hauser. It can configure all smart field units in your system and helps you manage them. By using the status information, it is also a simple but effective way of checking their status and condition.
	For details, see Operating Instructions BA00027S and BA00065S

DeviceCare SFE100	Configuration tool for devices via fieldbus protocols and Endress+Hauser service protocols. DeviceCare is the tool developed by Endress+Hauser for the configuration of Endress+Hauser devices. All smart devices in a plant can be configured via a point-to-point or point-to-bus connection. The user-friendly menus enable transparent and intuitive access to the field devices.
	For details, see Operating Instructions BA00027S

Accessories	Description			
Display RIA15	It is integrated in the 4 to 20 mA or HART® loop and transmits the measuring signal or HART® process variables in digital form. The process display unit does not require an external power supply. It is powered directly from the current loop. For details, see the "Technical Information" document TI01043K			
Memograph M, RSG45	Advanced Data Manager with tamper-proof data storage and access (FDA 21 CFR 11) HART® gateway functionality; Up to 40 HART® devices connected at a time Communication capabilities: Modbus, Profibus DP, PROFINET, EtherNet/IP. For details, see the "Technical Information" document TI01180R			

Supplementary documentation

The following types of documentation are available on the product pages and in the Download Area of the Endress+Hauser website (www.endress.com/downloads) (depending on the selected device version):

Document	Purpose and content of the document		
Technical Information (TI)	Planning aid for your device The document contains all the technical data on the device and provides an overview of the accessories and other products that can be ordered for the device.		
Brief Operating Instructions (KA)	Guide that takes you quickly to the 1st measured value The Brief Operating Instructions contain all the essential information from incoming acceptance to initial commissioning.		
Operating Instructions (BA)	Your reference document The Operating Instructions contain all the information that is required in various phases of the life cycle of the device: from product identification, incoming acceptance and storage, to mounting, connection, operation and commissioning through to troubleshooting, maintenance and disposal.		
Description of Device Parameters (GP)	Reference for your parameters The document provides a detailed explanation of each individual parameter. The description is aimed at those who work with the device over the entire life cycle and perform specific configurations.		
Safety Instructions (XA)	Depending on the approval, Safety Instructions (XA) are supplied with the device. The Safety Instructions are an integral part of the Operating Instructions. Information on the Safety Instructions (XA) that are relevant for		
Supplementary device-dependent documentation (SD/FY)	the device is provided on the nameplate. Always comply strictly with the instructions in the relevant supplementary documentation. The supplementary documentation is an integral part of the device documentation.		







www.addresses.endress.com