Technical Information **Proline Promass 80S, 83S**

Coriolis flowmeter

Products





Easy-to-clean flowmeter with self-drainable single-tube system & extended transmitter functionality

Application

- Measuring principle operates independently of physical fluid properties such as viscosity or density
- Dedicated for applications requiring optimal cleanability under hygienic conditions

Device properties

- Large range of hygienic process connections
- 3A and EHEDG conform
- Fast recovery from CIP/SIP
- Device in compact or remote version

Promass 83

- 4-line backlit display with touch control
- HART, PROFIBUS PA/DP, Modbus RS485, FF, EtherNet/IP

Your benefits

- Reduced installation costs fully self-drainable tube design enables compact horizontal mounting
- Fewer process measuring points multivariable measurement (flow, density, temperature)
- Space-saving installation no in/outlet run needs

Promass 83

- Quality software for filling & dosing, density & concentration, advanced diagnostics
- Flexible data transfer options numerous communication types
- Automatic recovery of data for servicing



Table of contents

Function and system design	.3
Measuring principle	
Measuring system	. 4
Input	.4
Measured variable	
Measuring range	
Operable flow range	
Input signal	
Output	.6
Output signal	
Signal on alarm	
Load	
Low flow cut off	
Galvanic isolation	
Switching output	
3	
Power supply	Я
Terminal assignment	
Supply voltage	
Power consumption	
Power supply failure	
Electrical connection	
Electrical connection Remote version	
Potential equalization	
Cable entries	
Cable specification Remote version	
Performance characteristics	12
Reference operating conditions	
Maximum measured error	
Repeatability	
Response time	
Influence of fluid temperature	
Influence of fluid pressure	
Design fundamentals	
g	
Installation	16
Mounting location	Tρ
UHEIHAHOH	
	17
Installation instructions	17 18
Installation instructions	17 18 18
Installation instructions	17 18 18 18
Installation instructions	17 18 18 18
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions	17 18 18 18 18
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment	17 18 18 18 18
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment Ambient temperature range	17 18 18 18 18 19
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment Ambient temperature range Storage temperature	17 18 18 18 18 19 19
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment Ambient temperature range Storage temperature Degree of protection	17 18 18 18 18 19 19
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment Ambient temperature range Storage temperature Degree of protection Shock resistance	17 18 18 18 18 19 19 19 19
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment Ambient temperature range Storage temperature Degree of protection Shock resistance Vibration resistance	17 18 18 18 18 19 19 19 19
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment Ambient temperature range Storage temperature Degree of protection Shock resistance	17 18 18 18 18 19 19 19 19
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment Ambient temperature range Storage temperature Degree of protection Shock resistance Vibration resistance Electromagnetic compatibility (EMC)	17 18 18 18 19 19 19 19 19
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment Ambient temperature range Storage temperature Degree of protection Shock resistance Vibration resistance Electromagnetic compatibility (EMC) Process	17 18 18 18 19 19 19 19 19 19
Installation instructions Inlet and outlet runs Length of connecting cable Special installation instructions Environment Ambient temperature range Storage temperature Degree of protection Shock resistance Vibration resistance Electromagnetic compatibility (EMC)	17 18 18 18 19 19 19 19 19 19

Medium density Fluid pressure range (nominal pressure) Pressure-temperature rating Limiting flow Pressure loss System pressure	19 20 23 23 23
Heating	23
Mechanical construction Design/dimensions Weight Materials Process connections Surface roughness	24 45 46 46
Operability	47 47
Certificates and approvals CE mark C-Tick symbol Ex approval Sanitary compatibility TSE compliance Functional safety HART certification FOUNDATION Fieldbus certification PROFIBUS DP/PA certification Modbus certification Pressure measuring device approval Other standards and guidelines	48 48 48 48 48 48 48 48 49
Ordering Information	49
Accessories	50 50 51
Documentation	52
Registered trademarks	52

Function and system design

Measuring principle

The measuring principle is based on the controlled generation of Coriolis forces. These forces are always present when both translational and rotational movements are superimposed.

 $F_C = 2 \cdot \Delta m \ (v \cdot \omega)$

 F_C = Coriolis force

 $\Delta m = moving mass$


 ω = rotational velocity

v = velocity of the moving mass in a rotating or oscillating system

The amplitude of the Coriolis force depends on the moving mass Δm , its velocity v in the system, and thus on the mass flow. Instead of a constant angular velocity ω , the Promass sensor uses oscillation.

This causes the tube through which the fluid is flowing to oscillate. The Coriolis forces produced at the measuring tubes cause a phase shift in the tube oscillations (see illustration):

- If there is zero flow, i.e. when the fluid stands still, the oscillation measured at points A and B has the same phase, and thus there is no phase difference (1).
- Mass flow causes deceleration of the oscillation at the inlet of the tubes (2) and acceleration at the outlet (3).

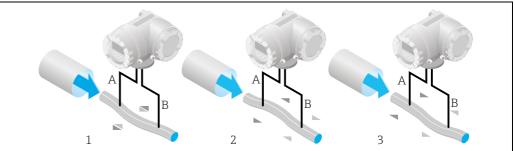

a00033

The phase difference (A-B) increases with increasing mass flow. Electrodynamic sensors register the tube oscillations at the inlet and outlet. The system balance required for proper measurement is created by exciting an eccentrically arranged swinging mass to antiphase oscillation. This patented TMB™ system (Torsion Mode Balanced System) guarantees perfect measurements, even in changing process and environmental conditions. Therefore, the device is just as easy to install as the familiar two-tube systems. Consequently, no special measures for attachment are required in front of or behind the sensor. The measuring principle operates independently of temperature, pressure, viscosity, conductivity and flow profile.

Density measurement

The measuring tube is continuously excited at its resonance frequency. A change in the mass and thus the density of the oscillating system (comprising the measuring tube and fluid) results in a corresponding, automatic adjustment in the oscillation frequency. Resonance frequency is thus a function of fluid density. The microprocessor utilizes this relationship to obtain a density signal.

Temperature measurement


The temperature of the measuring tube is determined in order to calculate the compensation factor due to temperature effects. This signal corresponds to the process temperature and is also available as an output.

Measuring system


The measuring system consists of a transmitter and a sensor. Two versions are available:

- Compact version: transmitter and sensor form a mechanical unit.
- Remote version: transmitter and sensor are mounted physically separate from one another.

Transmitter

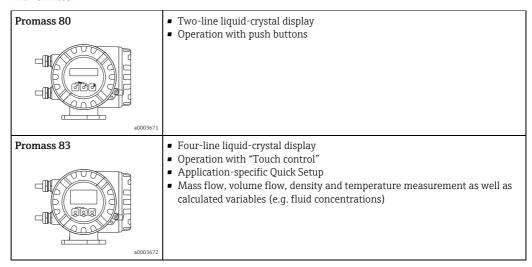

Sensor

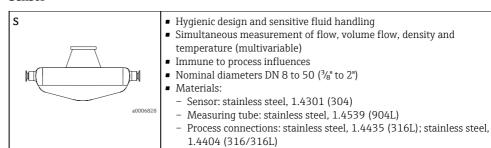

Input

Measured variable

 Mass flow (proportional to the phase difference between two sensors mounted on the measuring tube to register a phase shift in the oscillation)

– Surface quality: Ra_{max} 0.8 μm (32 μin) (mechanical polished)

- Fluid density (proportional to resonance frequency of the measuring tube)
- Fluid temperature (measured with temperature sensors)

Measuring range

Measuring ranges for liquids

DN		Range for full scale values (liquids) $\dot{m}_{min(F)}$ to $\dot{m}_{max(F)}$		
[mm]	[in]	[kg/h]	[lb/min]	
8	3/8	0 to 2000	0 to 73.50	
15	1/2	0 to 6500	0 to 238.9	
25	1	0 to 18000	0 to 661.5	
40	1 ½	0 to 45 000	0 to 1654	
50	2	0 to 70000	0 to 2573	

Measuring ranges for gases

The full scale values depend on the density of the gas. Use the formula below to calculate the full scale

 $\dot{\mathbf{m}}_{\max(G)} = \dot{\mathbf{m}}_{\max(F)} \cdot \rho_{(G)} / \mathbf{x} \left[\mathbf{kg/m}^3 \right]$

 $\dot{m}_{max(G)}$ = max. full scale value for gas [kg/h]

 $\dot{m}_{max(F)}$ = max. full scale value for liquid [kg/h]

 $\rho_{(G)}$ = Gas density in [kg/m³] at operating conditions

DN		_
[mm]	[in]	X
8	3/8"	60
15	1/2"	80
25	1"	90
40	1 1/2"	90
50	2"	90

Here, $_{max(G)}$ can never be greater than $_{max(F)}$

Calculation example for gas:

- Sensor type: Promass S, DN 50
- Gas: air with a density of 60.3 kg/m³ (at 20 °C and 50 bar)
- Measuring range (liquid): 70000 kg/h
- x = 90 (for Promass S, DN 50)

Max. possible full scale value:

 $\dot{m}_{max(G)} = \dot{m}_{max(F)} \cdot \rho_{(G)} \div x \; [kg/m^3] = 70\,000 \; kg/h \cdot 60.3 \; kg/m^3 \div 90 \; kg/m^3 = 46900 \; kg/h$

Recommended full scale values

See information in the "Limiting flow" section $\rightarrow \triangleq 23 \text{ ff.}$

Operable flow range

Greater than 1000: 1. Flow rates above the preset full scale value do not overload the amplifier, i.e. the totalizer values are registered correctly.

Input signal

Status input (auxiliary input)

U = 3 to 30 V DC, $R_i = 5$ k Ω , galvanically isolated.

Configurable for: totalizer reset, positive zero return, error message reset, zero point adjustment start, batching start/stop (optional), totalizer reset for batching (optional).

Status input (auxiliary input) with PROFIBUS DP

U = 3 to 30 V DC, $R_i = 3$ k Ω , galvanically isolated.

Switch level: ± 3 to ± 30 V DC, independent of polarity.

Configurable for: positive zero return, error message reset, zero point adjustment start, batching start/ stop (optional), totalizer reset for batching (optional).

Status input (auxiliary input) with Modbus RS485

U = 3 to 30 V DC, $R_i = 3$ k Ω , galvanically isolated.

Switch level: ± 3 to ± 30 V DC, independent of polarity.

Configurable for: totalizer reset, positive zero return, error message reset, zero point adjustment start.

Current input (only Promass 83)

Active/passive selectable, galvanically isolated, resolution: 2 µA

- Active: 4 to 20 mA, R_L < 700 Ω , U_{out} = 24 V DC, short-circuit proof Passive: 0/4 to 20 mA, R_i = 150 Ω , U_{max} = 30 V DC

Output

Output signal

Promass 80

Current output:

Active/passive selectable, galvanically isolated, time constant selectable (0.05 to 100 s), full scale value selectable, temperature coefficient: typically 0.005% o.r./ $^{\circ}$ C, resolution: 0.5 μ A

- Active: 0/4 to 20 mA, $R_L < 700 \Omega$ (for HART: $R_L \ge 250 \Omega$)
- Passive: 4 to 20 mA; supply voltage U_S 18 to 30 V DC; $R_i \ge 150 \Omega$

Pulse/frequency output:

Passive, open collector, 30 V DC, 250 mA, galvanically isolated.

- Frequency output: full scale frequency 2 to 1000 Hz (f_{max} = 1250 Hz), on/off ratio 1:1, pulse width max 2 s
- Pulse output: pulse value and pulse polarity selectable, pulse width configurable (0.5 to 2000 ms)

PROFIBUS PA interface:

- PROFIBUS PA in accordance with EN 50170 Volume 2, IEC 61158-2 (MBP), galvanically isolated
- Profile Version 3.0
- Current consumption = 11 mA
- Permitted supply voltage: 9 to 32 V
- Bus connection with integrated reverse polarity protection
- Error current FDE (Fault Disconnection Electronic) = 0 mA
- Data transmission rate: 31.25 kBit/s
- Signal encoding: Manchester II
- Function blocks: 4 × Analog Input, 2 × Totalizer
- Output data: Mass flow, Volume flow, Density, Temperature, Totalizer
- Input data: Positive zero return (ON/OFF), Zero point adjustment, Measuring mode, Totalizer control
- Bus address can be configured via miniature switches or via the local display (optional)

Promass 83

Current output:

Active/passive selectable, galvanically isolated, time constant selectable (0.05 to 100 s), full scale value selectable, temperature coefficient: typically 0.005% o.r./°C, resolution: 0.5 μA

- Active: 0/4 to 20 mA, $R_L < 700 \Omega$ (for HART: $R_L \ge 250 \Omega$)
- Passive: 4 to 20 mA; supply voltage U_S 18 to 30 V DC; $R_i \ge 150 \Omega$

Pulse/frequency output:

active/passive selectable, galvanically isolated

- Active: 24 V DC, 25 mA (max. 250 mA during 20 ms), $R_L > 100 \Omega$
- \blacksquare Passive: open collector, 30 V DC, 250 mA
- Frequency output: full scale frequency 2 to 10000 Hz (f_{max} = 12500 Hz), on/off ratio 1:1, pulse width max. 2 s
- Pulse output: pulse value and pulse polarity selectable, pulse width configurable (0.05 to 2000 ms)

HART protocol

Order code "Power supply; Display", option A, B, C, D, E, F, G, H, X, 7, 8 (HART 5)

Valid until software: 3.01.XX

Order code "Power supply; Display", option P, Q, R, S, T, U, 4, 5 (HART 7)

Valid as of software: 3.07.XX

PROFIBUS DP interface:

- PROFIBUS DP in accordance with EN 50170 Volume 2
- Profile Version 3.0
- Data transmission rate: 9.6 kBaud to 12 MBaud
- Automatic data transmission rate recognition
- Signal encoding: NRZ Code
- Function blocks: 6 × Analog Input, 3 × Totalizer

- Output data: Mass flow, Volume flow, Corrected volume flow, Density, Reference density, Temperature, Totalizers 1 to 3
- Input data: Positive zero return (ON/OFF), Zero point adjustment, Measuring mode, Totalizer control
- Bus address can be configured via miniature switches or via the local display (optional)

PROFIBUS PA interface:

- PROFIBUS PA in accordance with EN 50170 Volume 2, IEC 61158-2 (MBP), galvanically isolated
- Data transmission rate: 31.25 kBit/s
- Current consumption: 11 mA
- Permitted supply voltage: 9 to 32 V
- Bus connection with
 - integrated reverse polarity protection
- Error current FDE (Fault Disconnection Electronic): 0 mA
- Signal encoding: Manchester II
- Function blocks: 6 × Analog Input, 3 × Totalizer
- Output data: Mass flow, Volume flow, Corrected volume flow, Density, Reference density, Temperature, Totalizers 1 to 3
- Input data: Positive zero return (ON/OFF), Zero point adjustment, Measuring mode, Totalizer control
- Bus address can be configured via miniature switches or via the local display (optional)
- Available output combination → 🖺 8

Modbus interface:

- Modbus device type: slave
- Address range: 1 to 247
- Supported function codes: 03, 04, 06, 08, 16, 23
- Broadcast: supported with the function codes 06, 16, 23
- Physical interface: RS485 in accordance with EIA/TIA-485 standard
- Supported baud rate: 1200, 2400, 4800, 9600, 19200, 38400, 57600, 115200 Baud
- Transmission mode: RTU or ASCII
- Response times:
 - Direct data access = typically 25 to 50 ms
 - Auto-scan buffer (data range) = typically 3 to 5 ms
- Possible output combinations → 🖺 8

FOUNDATION Fieldbus interface:

- FOUNDATION Fieldbus H1, IEC 61158-2, galvanically isolated
- Data transmission rate: 31.25 kBit/s
- Current consumption: 12 mA
- Permitted supply voltage: 9 to 32 V
- Error current FDE (Fault Disconnection Electronic): 0 mA
- Bus connection with integrated reverse polarity protection
- Signal encoding: Manchester II
- ITK Version 5.01
- Function blocks:
 - 8 × Analog Input (Execution time: per18 ms)
 - 1 × Digital Output (18 ms)
 - 1 × PID (25 ms)
 - $-1 \times Arithmetic (20 ms)$
 - 1 × Input Selector (20 ms)
 - $-1 \times Signal Characterizer (20 ms)$
 - 1 × Integrator (18 ms)
- Number of VCRs: 38
- Number of link objects in VFD: 40
- Function blocks: 7 × Analog Input, 1 × Digital Output, 1 × PID
- Output data: Mass flow, Volume flow, Corrected volume flow, Density, Reference density, Temperature, Totalizers 1 to 3
- Input data: Positive zero return (ON/OFF), Zero point adjustment, Measuring mode, Reset totalizer
- Link Master (LM) function is supported

Signal on alarm

Current output

Failsafe mode selectable (e.g. in accordance with NAMUR Recommendation NE 43)

Pulse/frequency output

Failsafe mode selectable

Status output (Promass 80)

Nonconductive in the event of a fault or if the power supply fails

Relay output (Promass 83)

Dead in the event of a fault or if the power supply fails

Load See "Output signal"

Low flow cut off Switch points for low flow cut off are selectable.

Galvanic isolation All circuits for inputs, outputs, and power supply are galvanically isolated from each other.

Switching output

Status output (Promass 80)

- Open collector
- Max. 30 V DC, 250 mA
- Galvanically isolated
- Configurable for: error messages, Empty Pipe Detection (EPD), flow direction, limit values

Relay output (Promass 83)

- Max. 30 V, 0.5 A AC; 60 V, 0.1 A DC
- Galvanically isolated
- Normally closed (NC or break) or normally open (NO or make) contacts available (factory setting: relay 1 = NO, relay 2 = NC)

Power supply

Terminal assignment

Promass 80

Order characteristic		Terminal No. (inputs/outputs)				
for "inputs/outsputs"	20 (+) / 21 (-)	22 (+) / 23 (-)	24 (+) / 25 (-)	26 (+) / 27 (-)		
A	-	-	Frequency output	Current output, HART		
D	Status input	Status output	Frequency output	Current output, HART		
Н	-	-	-	PROFIBUS PA		
S	-	-	Frequency output Ex i, passive	Current output Ex i active, HART		
Т	-	-	Frequency output Ex i, passive	Current output Ex i passive, HART		
8	Status input	Frequency output	Current output 2	Current output 1, HART		

Promass 83

The inputs and outputs on the communication board can be either permanently assigned (fixed) or variable (flexible), depending on the version ordered (see table). Replacements for modules which are defective or which have to be replaced can be ordered as accessories.

Order characteristic	Terminal No. (inputs/ outputs)				
for "inputs/outsputs", option	20 (+) / 21 (-)	22 (+) / 23 (-)	24 (+) / 25 (-)	26 (+) / 27 (-)	
Fixed communication bo	ards (permanent as	ssignment)			
A	-	-	Frequency output	Current output, HART	
В	Relay output	Relay output	Frequency output	Current output, HART	
F	-	-	-	PROFIBUS PA, Ex i	
G	-	-	-	FOUNDATION Fieldbus Ex i	
Н	-	-	-	PROFIBUS PA	
J	-	-	+5V (ext. termination)	PROFIBUS DP	
К	-	-	-	FOUNDATION Fieldbus	
Q	-	-	Status input	Modbus RS485	
R	-	-	Current output 2 Ex i, active	Current output 1 Ex i active, HART	
S	-	-	Frequency output Ex i, passive	Current output Ex i active, HART	
Т	-	-	Frequency output Ex i, passive	Current output Ex i passive, HART	
U	-	-	Current output 2 Ex i, passive	Current output 1 Ex i passive, HART	
Flexible communication	boards				
С	Relay output 2	Relay output 1	Frequency output	Current output, HART	
D	Status input	Relay output	Frequency output	Current output, HART	
Е	Status input	Relay output	Current output 2	Current output 1, HART	
L	Status input	Relay output 2	Relay output 1	Current output, HART	
M	Status input	Frequency output 2	Frequency output 1	Current output, HART	
N	Current output	Frequency output	Status input	Modbus RS485	
P	Current output	Frequency output	Status input	PROFIBUS DP	
V	Relay output 2	Relay output 1	Status input	PROFIBUS DP	
W	Relay output	Current output 3	Current output 2	Current output 1, HART	
0	Status input	Current output 3	Current output 2	Current output 1, HART	
2	Relay output	Current output 2	Frequency output	Current output 1, HART	
3	Current input	Relay output	Current output 2	Current output 1, HART	
4	Current input	Relay output	Frequency output	Current output, HART	
5	Status input	Current input	Frequency output	Current output, HART	
6	Status input	Current input	Current output 2	Current output 1, HART	
7	Relay output 2	Relay output 1	Status input	Modbus RS485	

Supply voltage	85 to 260 V AC, 45 to 65 Hz 20 to 55 V AC, 45 to 65 Hz 16 to 62 V DC
Power consumption	AC: <15 VA (including sensor) DC: <15 W (including sensor)
	Switch-on current: ■ Max. 13.5 A (< 50 ms) at 24 V DC ■ Max. 3 A (< 5 ms) at 260 V AC

Power supply failure

Promass 80

Lasting min. 1 power cycle:


- EEPROM saves measuring system data if the power supply fails
- HistoROM/S-DAT: exchangeable data storage chip with sensor specific data (nominal diameter, serial number, calibration factor, zero point, etc.)

Promass 83

Lasting min. 1 power cycle:

- EEPROM and T-DAT save the measuring system data if the power supply fails.
- HistoROM/S-DAT: exchangeable data storage chip with sensor specific data (nominal diameter, serial number, calibration factor, zero point, etc.)

Electrical connection

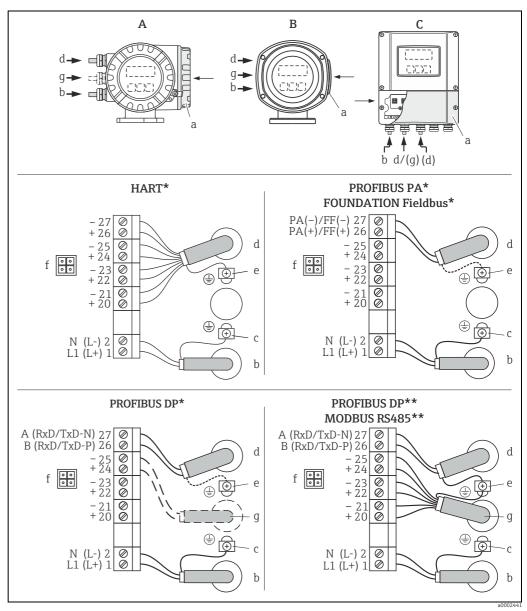

Connecting the transmitter, cable cross-section: $\max. 2.5 \text{ mm}^2$


- View A (field housing)
- View B (stainless steel field housing)
 View C (wall-mount housing) В С
- Fixed communication board
- Flexible communication board Connection compartment cover
- Cable for power supply: 85 to 260 V AC, 20 to 55 V AC, 16 to 62 V DC
 - Terminal No. 1: L1 for AC, L+ for DC Terminal No. 2: N for AC, L- for DC Ground terminal for protective ground
- Signal cable: see Terminal assignment $\rightarrow \blacksquare 8$
- Fieldbus cable:

Terminal No. 26: DP (B) / PA (+) / FF (+) / Modbus RS485 (B) / (PA, FF: with reverse polarity protection) Terminal No. 27: DP (A) / PA (-) / FF (-) / Modbus RS485 (A) / (PA, FF: with reverse polarity protection) Ground terminal for signal cable shield / fieldbus cable / RS485 line Service adapter for connecting service interface FXA 193 (Fieldcheck, FieldCare) Signal cable: see Terminal assignment $\rightarrow \boxtimes$ 8

- - Cable for external termination (only for PROFIBUS DP with permanent assignment communication board): Terminal No. 24: +5 V

Terminal No. 25: DGND

Electrical connection Remote version

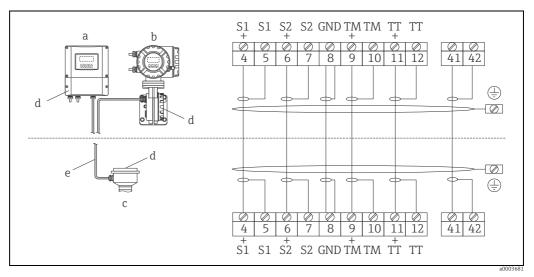

Connecting the remote version

- a Wall-mount housing: non-hazardous area and ATEX II3G, zone 2 → see separate "Ex documentation"
- b Wall-mount housing: ATEX II2G, Zone 1 /FM/CSA \rightarrow see separate "Ex documentation"
- c Connection housing sensor
- d Cover for connection compartment or connection housing
- e Connecting cable

Terminal No.: 4/5 = gray; 6/7 = green; 8 = yellow; 9/10 = pink; $1\frac{1}{12} = white$; 41/42 = brown

Potential equalization

No special measures for potential equalization are required. For instruments for use in hazardous areas, observe the corresponding guidelines in the specific Ex documentation.

Cable entries

Power-supply and signal cables (inputs/outputs):

- Cable entry M20 × 1.5 (8 to 12 mm / 0.31" to 0.47")
- Thread for cable entries, ½" NPT, G ½"

Connecting cable for remote version:

- \blacksquare Cable entry M20 \times 1.5 (8 to 12 mm / 0.31" to 0.47")
- Thread for cable entries, ½" NPT, G ½"

Cable specification Remote version

- $6 \times 0.38 \text{ mm}^2 \text{ PVC}$ cable with common shield and individually shielded cores
- Conductor resistance: $\leq 50 \Omega/\text{km} (\leq 0.015 \Omega/\text{ft})$
- Capacitance: core/shield: ≤ 420 pF/m (≤128 pF/ft)
- Cable length: max. 20 m (65 ft)
- Permanent operating temperature: max. +105 °C (+221 °F)

Operation in zones of severe electrical interference:

The measuring device complies with the general safety requirements in accordance with EN 61010, the EMC requirements of IEC/EN 61326, and NAMUR recommendation NE 21/43.

Performance characteristics

Reference operating conditions

- Error limits following ISO 11631
- Water with 15 to 45 °C (59 to 113 °F); 2 to 6 bar (29 to 87 psi)
- Data according to calibration protocol
- Accuracy based on accredited calibration rigs that are traced to ISO 17025

To obtain measured errors, use the Applicator sizing tool *Applicator*: $\rightarrow \triangleq 51$.

Maximum measured error

Design fundamentals → 🖺 15

o.r. = of reading; $1 \text{ g/cm}^3 = 1 \text{ kg/l}$; T = fluid temperature

Base accuracy

Mass flow and volume flow (liquids)

Promass 83S:

■ ±0.10% o.r.

Promass 80S:

■ ±0.15% o.r.

Mass flow (gases)

±0.50% o.r.

Density (liquids)

- Reference conditions: ±0.0005 g/cm³
- Field density calibration: ±0.0005 g/cm³ (valid after field density calibration under process conditions)
- Standard density calibrations: ± 0.01 g/cm³ (valid over the entire measuring range of the sensor \rightarrow $\stackrel{ o}{=}$ 19)
- Special density calibration: ± 0.002 g/cm³ (optional, valid range: +5 to +80 °C (+41 to +176 °F) and 0 to 2.0 g/cm³)

Temperature

 $\pm 0.5 \,^{\circ}\text{C} \pm 0.005 \cdot \text{T} \,^{\circ}\text{C} \, (\pm 1 \,^{\circ}\text{F} \pm 0.003 \cdot (\text{T} - 32) \,^{\circ}\text{F})$

Zero point stability

DN		Zero poin	t stability
[mm]	[in]	[kg/h]	[lb/min]
8	3/8"	0.20	0.007
15	1/2"	0.65	0.024
25	1"	1.80	0.066
40	1½"	4.50	0.165
50	2"	7.00	0.257

Flow values

Flow values as turndown parameter depending on nominal diameter.

SI units

DN	1:1	1:10	1:20	1:50	1:100	1:500
[mm]	[kg/h]	[kg/h]	[kg/h]	[kg/h]	[kg/h]	[kg/h]
8	2000	200.0	100.0	40.00	20.00	4.000
15	6500	650.0	625.0	130.0	65.00	13.00
25	18000	1800	900.0	360.0	180.0	36.00
40	45 000	4500	2250	900.0	450.0	90.00
50	70000	7000	3500	1400	700.0	140.0

US units

DN	1:1	1:10	1:20	1:50	1:100	1:500
[in]	[lb/min]	[lb/min]	[lb/min]	[lb/min]	[lb/min]	[lb/min]
3/8"	73.50	7.350	3.675	1.470	0.735	0.147
1/2"	238.9	23.89	11.95	4.778	2.389	0.478
1"	661.5	66.15	33.08	13.23	6.615	1.323
1½"	1654	165.4	82.70	33.08	16.54	3.308
2"	2573	257.3	128.7	51.46	25.73	5.146

Accuracy of outputs

o.r. = of reading; o.f.s. = of full scale value

The output accuracy must be factored into the measured error if analog outputs are used, but can be ignored for fieldbus outputs (e.g. Modbus RS485, EtherNet/IP).

Current output

Accuracy: Max. ± 0.05 % o.f.s. or ± 5 μA

Pulse/frequency output

Accuracy: Max. ±50 % ppm o.r.

Repeatability

Design fundamentals $\rightarrow \blacksquare 15$

o.r. = of reading; $1 \text{ g/cm}^3 = 1 \text{ kg/l}$; T = fluid temperature

Base repeatability

Mass flow and volume flow (liquids)

Promass 80S, 83S: ±0.05% o.r.

Mass flow (gases)

Promass 80S, 83S: ±0.25% o.r.

Density (liquids)

 $\pm 0.00025 \text{ g/cm}^3$

Temperature

 $\pm 0.25 \,^{\circ}\text{C} \pm 0.0025 \cdot \text{T} \,^{\circ}\text{C} \, (\pm 0.45 \,^{\circ}\text{F} \pm 0.0015 \cdot (\text{T}-32) \,^{\circ}\text{F})$

Response time

- The response time depends on the configuration (damping).
- Response time in the event of erratic changes in the measured variable (only mass flow): after 100 ms 95 % of the full scale value.

Influence of fluid temperature

When there is a difference between the temperature for zero point adjustment and the process temperature, the typical measured error of the Promass sensor is $\pm 0.0002\%$ of the full scale value / °C ($\pm 0.0001\%$ of the full scale value / °F).

Influence of fluid pressure

The table below shows the effect on accuracy of mass flow due to a difference between calibration pressure and process pressure.

D	N	Promass S
[mm]	[in]	[% o.r./bar]
8	3/8"	-0.002
15	1/2"	-0.006
25	1"	-0.005
40	1½"	-0.005
50	2"	-0.005

Design fundamentals

o.r. = of reading

BaseAccu = base accuracy in % o.r.

BaseRepeat = base repeatability in % o.r.


Calculation of the maximum measured error depending on flowrate

Flowrate (in flow units consistent with the zero point stability value $\rightarrow \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ $	Maximum measured error in % o.r.
$\geq \frac{\text{ZeroPoint}}{\text{BaseAccu}} \cdot 100$	± BaseAccu
$< \frac{\text{ZeroPoint}}{\text{BaseAccu}} \cdot 100$	$\pm \frac{ZeroPoint}{MeasValue} \cdot 100$

Calculation of the repeatability depending on flowrate

Flowrate (in flow units consistent with the zero point stability value $\rightarrow \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ $	Repeatability in % o.r.
$\geq \frac{\frac{1}{2} \cdot ZeroPoint}{BaseRepeat} \cdot 100$	± BaseRepeat
$< \frac{1/2 \cdot ZeroPoint}{BaseRepeat} \cdot 100$	± ½ · ZeroPoint / MeasValue · 100

Example for maximum measured error

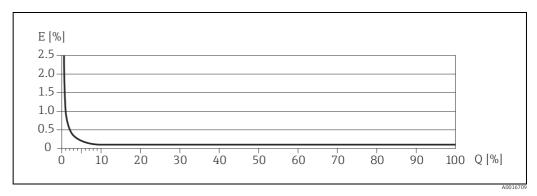

E = Error: Maximum measured error as % o.r. (example Promass 83S)

Q = Flow rate as %


Installation

Mounting location

Entrained air or gas bubbles in the measuring tube can result in an increase in measuring errors.


Therefore, avoid the following mounting locations in the pipe installation:

- Highest point of a pipeline. Risk of air accumulating.
- Directly upstream of a free pipe outlet in a vertical pipeline.

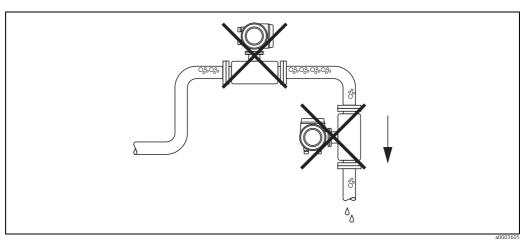

Mounting location

Notwithstanding the above, the installation proposal below permits installation in an open vertical pipeline. Pipe restrictions or the use of an orifice with a smaller cross-section than the nominal diameter prevent the sensor running empty while measurement is in progress.

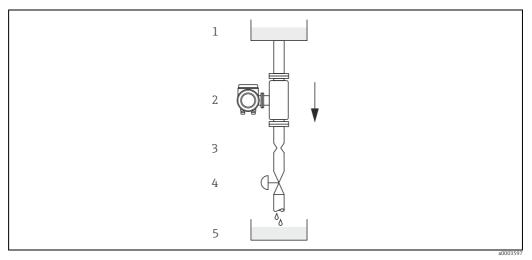

Installation in a down pipe (e.g. for batching applications)

- Supply tank
- Orifice plate, pipe restriction (see Table following page)
- Batching tank

D	N	Ø Orifice plate, pipe restriction				
[mm]	[in]	[mm]	[in]			
8	3/8"	6	0.24			
15	1/2"	10	0.39			
25	1"	14	0.55			
40	1½"	22	0.87			
50	2"	28	1.10			

Orientation

Make sure that the direction of the arrow on the nameplate of the sensor matches the direction of flow (direction of fluid flow through the pipe.

Vertical (Fig. V)

Recommended orientation with upward direction of flow. When fluid is not flowing, entrained solids will sink down and gases will rise away from the measuring tube. The measuring tubes can be completely drained and protected against solids buildup.


Horizontal (Fig. H1, H2, H3)

The transmitter can be installed in any orientation in a horizontal pipe run.

Orientation:	Vertikal	Horizontal, Transmitter head up	Horizontal, Transmitter head down	Horizontal, Transmitter head to the side
	a0004572	a0004576	a0004580	a0007558
	Fig. V	Fig. H1	Fig. H2	Fig. H3
Standard, Compact version	VV	✓ ✓ 1)	VV	VV
Standard, Remote version	VV	∨∨ 1)	VV	VV

✓ = Recommended orientation; **✓** = Orientation recommended in certain situations;

When using a bent measuring tube and horizontal installation, the position of the sensor has to be matched to the fluid properties!

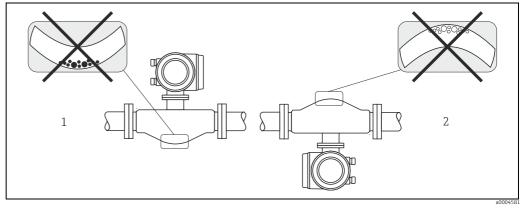

Horizontal installation for sensors with a bent measuring tube

- Not suitable for fluids with entrained solids. Risk of solids accumulating.
- Not suitable for outgassing fluids. Risk of air accumulating.

x = Impermissible orientation

 $^{^{1)}}$ To ensure that the maximum permitted ambient temperature for the transmitter is not exceeded, for low-temperature fluids, we recommend the horizontal orientation with the transmitter head up (Fig. H1) or the vertical orientation (Fig. V).

Installation instructions

Note the following points:

- No special measures such as supports are necessary. External forces are absorbed by the construction
 of the instrument, for example the secondary containment.
- The high oscillation frequency of the measuring tubes ensures that the correct operation of the measuring system is not influenced by pipe vibrations.
- No special precautions need to be taken for fittings which create turbulence (valves, elbows, T-pieces etc.), as long as no cavitation occurs.
- For mechanical reasons and to protect the pipe, support is recommended for heavy sensors.

Inlet and outlet runs

There are no installation requirements regarding inlet and outlet runs.


Length of connecting cable

Max. 20 meters (65 ft), remote version

Special installation instructions

It is not necessary to support the sensor under any circumstances for operational performance. If the requirement exists to support the sensor the following recommendation should be followed.

Hygienic connections (mounting clamp with lining between clamp and instrument)

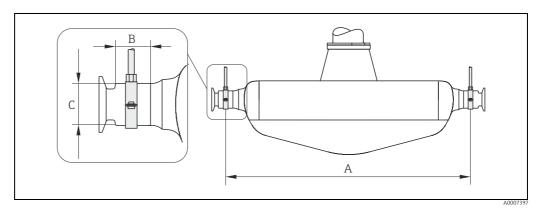

Mounted with mounting clamp

D	N	A	A	I	3	С			
[mm]	[in]	[mm]	[in]	[mm]	[in]	[mm]	[in]		
8	3/8"	298	11.73	33.0	1.30	28	1.10		
15	1/2"	402	15.83	33.0	1.30	28	1.10		
25	1"	542	21.34	33.0	1.30	38	1.50		
40	1½"	750	29.53	36.5	1.44	56	2.20		
50	2"	1019	40.12	44.1	1.74	75	2.95		

Zero point adjustment

Experience shows that the zero point adjustment is advisable only in special cases:

- To achieve highest measuring accuracy also with small flow rates.
- Under extreme process or operating conditions (e.g. very high process temperatures or very highviscosity fluids).

Environment

Ambient temperature range

Sensor, transmitter:

- Standard: -20 to +60 °C (-4 to +140 °F)
- Optional: -40 to +60 °C (-40 to +140 °F)
- Install the device at a shady location. Avoid direct sunlight, particularly in warm climatic regions.
- At ambient temperatures below $-20 \,^{\circ}\text{C}$ ($-4 \,^{\circ}\text{F}$) the readability of the display may be impaired.

Storage temperature

 $-40 \text{ to } +80 \,^{\circ}\text{C} \, (-40 \text{ to } +175 \,^{\circ}\text{F}), \text{ preferably } +20 \,^{\circ}\text{C} \, (+68 \,^{\circ}\text{F})$

Degree of protection

Standard: IP 67 (NEMA 4X) for transmitter and sensor

Shock resistance

According to IEC/EN 60068-2-31

Vibration resistance

Acceleration up to 1 g, 10 to 150 Hz, following IEC/EN 60068-2-6

Electromagnetic compatibility (EMC)

As per IEC/EN 61326 and NAMUR recommendation NE 21

Process

Fluid temperature range

Sensor

-50 to +150 °C (-58 to +302 °F)

Medium density

0 to 5000 kg/ m^3 (0 to 312 lb/ft³)

Fluid pressure range (nominal pressure)

Flanges

- According to DIN PN 40 to 63
- According to ASME B16.5 Cl 150, Cl 300
- JIS 10K, 20K, 40K

Secondary containment pressure rating

The sensor housing is filled with dry nitrogen and protects the electronics and mechanics inside.

The following secondary containment pressure rating is only valid for a fully welded sensor housing and/or a device equipped with closed purge connections (never opened, as delivered).

D	N		ainment rating safety factor ≥ 4)	Burst pressure of secondary containment			
[mm]	[in]	[bar]	[psi]	[bar]	[psi]		
8	3/8"	25	362	190	2755		
15	1/2"	25	362	175	2535		
25	1"	25	362	165	2930		
40	11/2"	16	232	64	925		
50	50 2"		145	54	780		

Note!

In case a danger of measuring tube failure exists due to process characteristics, e.g. with corrosive process fluids, we recommend the use of sensors whose secondary containment is equipped with special pressure monitoring connections (ordering option). With the help of these connections, fluid collected in the secondary containment in the event of tube failure can be bled off. This is especially important in high pressure gas applications. These connections can also be used for gas circulation and/or gas detection (dimensions $\Rightarrow \triangleq 24$).

Do not open the purge connections unless the containment can be filled immediately with a dry inert gas. Use only low gauge pressure to purge. Maximum pressure: 5 bar (72.5 psi).


If a device equipped with purge connections is connected to the purge system, the maximum pressure rating is defined by the purge system itself or the device, whichever is lower.

Pressure-temperature rating

The following pressure-temperature ratings refer to the entire sensor and not just the process connection.

Flange according to EN 1092-1 (DIN 2501)


Flange material: 1.4404 (F316/F316L)

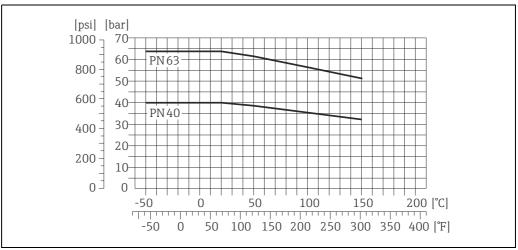

A0020965-EI

Flange according to ASME B16.5


Flange material: 1.4404 (F316/F316L)

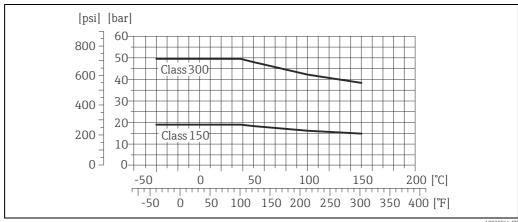

A0020966-EN


JIS B2220 flange

Flange material: 1.4404 (316/316L)

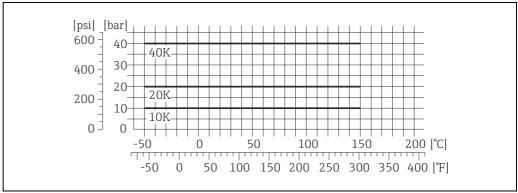

DIN 11851 thread


Connection material: 1.4435 (316L)

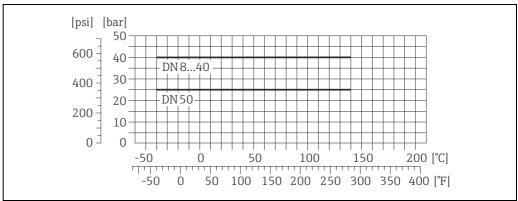

DIN 11851 allows for applications up to $+140 \, ^{\circ}\mathrm{C}$ ($+284 \, ^{\circ}\mathrm{F}$) if suitable sealing materials are used. Please take this into account when selecting seals and counterparts as these components can limit the pressure and temperature range.


DIN 11864-1A thread; DIN 11864-3A clamp

Connection material: 1.4435 (316L)

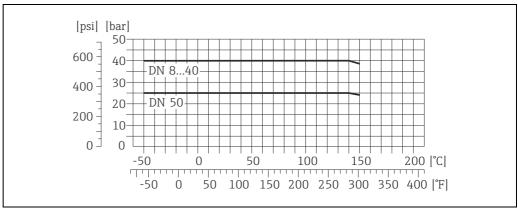


DIN 11864-2A flange

Flange material: 1.4435 (316L)

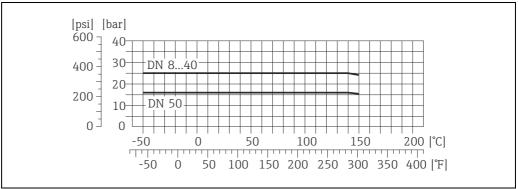

SMS 1145 thread


Connection material: 1.4435 (316L)

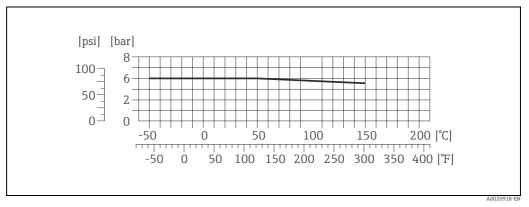

SMS 1145 allows for applications up to 6 bar (87 psi) if suitable sealing materials are used. Please take this into account when selecting seals and counterparts as these components can limit the pressure and temperature range.

ISO 2853 thread

Connection material: 1.4435 (316L)

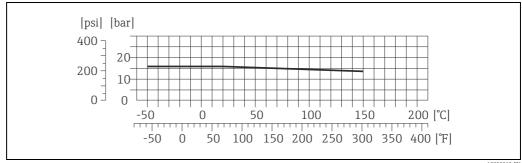

Tri-Clamp

The Clamp connections are suited up to a maximum pressure of 16 bar (232 psi). Please observe the operating limits of the clamp and seal used as they could be under 16 bar (232 psi). The clamp and the seal are not included in the scope of supply.

Limiting flow

See information in the "Measuring range" section $\rightarrow \triangleq 4$

Select nominal diameter by optimizing between required flow range and permissible pressure loss. See the "Measuring range" section for a list of maximum possible full scale values.

- The minimum recommended full scale value is approx. 1/20 of the max. full scale value.
- In most applications, 20 to 50% of the maximum full scale value can be considered ideal
- Select a lower full scale value for abrasive substances such as fluids with entrained solids (flow velocity <1 m/s (<3 ft/s))
- For gas measurement the following rules apply:
 - Flow velocity in the measuring tubes should not be more than half the sonic velocity (0.5 Mach)
 - The maximum mass flow depends on the density of the gas: formula \rightarrow $\stackrel{\triangle}{=}$ 5

Pressure loss

To calculate the pressure loss, use the *Applicator* sizing tool ($\rightarrow \boxtimes 51$).

System pressure

It is important to ensure that cavitation does not occur, because it would influence the oscillation of the measuring tube. No special measures need to be taken for fluids which have properties similar to water under normal conditions.

In the case of liquids with a low boiling point (hydrocarbons, solvents, liquefied gases) or in suction lines, it is important to ensure that pressure does not drop below the vapor pressure and that the liquid does not start to boil. It is also important to ensure that the gases that occur naturally in many liquids do not outgas. Such effects can be prevented when system pressure is sufficiently high.

Therefore, the following locations should be preferred for installation:

- Downstream from pumps (no danger of vacuum)
- At the lowest point in a vertical pipe

Heating

Some fluids require suitable measures to avoid heat transfer at the sensor. Heating can be electric, e.g. with heated elements, or by means of hot water or steam pipes made of copper or heating jackets.

- Risk of electronics overheating! Make sure that the maximum permissible ambient temperature for
 the transmitter is not exceeded. Consequently, make sure that the adapter between the sensor and
 transmitter and the connection housing of the remote version always remain free of insulating
 material. Note that a certain orientation might be required, depending on the fluid temperature →
 17.
- If using an electric trace heating system whose heating is regulated via phase angle control or pulse packages, influence on the measured values cannot be ruled out due to magnetic fields (i.e. for values that are greater than the values approved by the EN standard (sine 30 A/m)). In such cases, the sensor must be magnetically shielded.

The secondary containment can be shielded with tin plates or electric sheets without preferential direction (e.g. V330-35A) with the following properties:

- Relative magnetic permeability $\mu_r \ge 300$
- Plate thickness d \geq 0.35 mm (0.014")


Special heating jackets, which can be ordered separately from Endress+Hauser as an accessory, are available for the sensors.

Mechanical construction

Design/dimensions

Dimensions	
Field housing compact version, powder-coated die-cast aluminum	→ 🖺 25
Transmitter compact version, stainless steel	→ 🖺 27
Transmitter connection housing remote version (II2G, Zone 1)	→ 🖺 27
Transmitter remote version, wall-mount housing (non hazardous area and II3G, zone 2)	→ 🖺 28
Transmitter remote version, connection housing	→ 🖺 29
Process connections in SI units	
Flange according to EN 1092-1 (DIN 2501), PN 40 Flange according to EN 1092-1 (DIN 2501), PN 63	→ 🖺 30
Flange according to ASME B16.5, Cl 150 Flange according to ASME B16.5, Cl 300	→ 🖺 31
JIS B2220 flange, 10K JIS B2220 flange, 20K JIS B2220 flange, 40K	→ 🖺 32
Tri-Clamp, DIN 11866 line C Tri-Clamp 1", DIN 11866 line C Tri-Clamp ¾", DIN 11866 line C Tri-Clamp ½", DIN 11866 line C	→ 🖺 33
DIN 11851 thread, DIN 11866 line A DIN 11851 thread Rd 28 × $^{1}\!\!/_{8}$ ", DIN 11866 line A	→ 🖺 34
DIN 11864-1A thread, DIN 11866 line A	→ 🖺 35
DIN 11864-2A flange, DIN 11866 line A, flange with notch	→ 🖺 36
DIN 11864-3A clamp, DIN 11866 line A, with notch	→ 🖺 37
DIN 32676 clamp, DIN 11866 line A	→ 🖺 38
ISO 2852 clamp, ISO 2037	→ 🖺 39
ISO 2853 thread, ISO 2037	→ 🖺 40
SMS 1145 thread	→ 🖺 41
Process connections in US units	
Flange according to ASME B16.5, Cl 150 Flange according to ASME B16.5, Cl 300	→ 🖺 42
Tri-Clamp, DIN 11866 line C Tri-Clamp 1", DIN 11866 line C Tri-Clamp ¾", DIN 11866 line C Tri-Clamp ½", DIN 11866 line C	→ 🖺 43
SMS 1145 thread	→ 🖺 44
Purge connections, secondary containment monitoring	→ 🖺 45

Field housing compact version, powder-coated die-cast aluminum

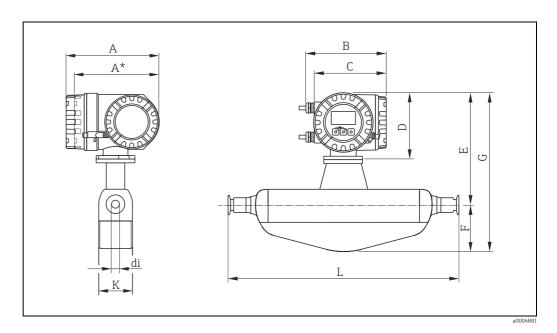

Dimensions in SI units

DN	Α	A*	В	С	D	Е	F	G	K	L	di
8	227	207	187	168	160	280	108	388	92	1)	1)
15	227	207	187	168	160	280	108	388	92	1)	1)
25	227	207	187	168	160	280	121	401	92	1)	1)
40	227	207	187	168	160	304	173	477	132	1)	1)
50	227	207	187	168	160	315	241	556	167	1)	1)

Dimensions in US units

DN	Α	A*	В	С	D	Е	F	G	K	L	di
3/8"	9.08	8.28	7.48	6.72	6.4	11.02	4.25	15.28	3.62	1)	1)
1/2"	9.08	8.28	7.48	6.72	6.4	11.02	4.25	15.28	3.62	1)	1)
1"	9.08	8.28	7.48	6.72	6.4	11.02	4.76	15.79	3.62	1)	1)
11/2"	9.08	8.28	7.48	6.72	6.4	11.97	6.81	18.78	5.20	1)	1)
2"	9.08	8.28	7.48	6.72	6.4	12.40	9.49	21.89	6.57	1)	1)


^{* (}without local display)

1) dependent on respective process connection
All dimensions in [mm]

^{* (}without local display)

1) dependent on respective process connection
All dimensions in [in]

Field housing compact version (II2G, Zone 1), powder-coated die-cast aluminum

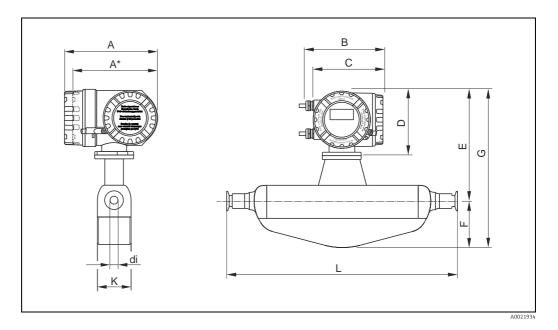

Dimensions in SI units

DN	Α	A*	В	С	D	Е	F	G	K	L	di
8	240	217	206	186	178	298	108	406	92	1)	1)
15	240	217	206	186	178	298	108	406	92	1)	1)
25	240	217	206	186	178	298	121	419	92	1)	1)
40	240	217	206	186	178	322	173	495	132	1)	1)
50	240	217	206	186	178	333	241	574	167	1)	1)

Dimensions in US units

DN	Α	A*	В	С	D	E	F	G	K	L	di
3/8"	9.45	8.54	8.11	7.32	7.01	11.02	4.95	15.98	3.62	1)	1)
1/2"	9.45	8.54	8.11	7.32	7.01	11.02	4.95	15.98	3.62	1)	1)
1"	9.45	8.54	8.11	7.32	7.01	11.02	5.46	16.49	3.62	1)	1)
1½"	9.45	8.54	8.11	7.32	7.01	11.97	7.51	19.48	5.20	1)	1)
2"	9.45	8.54	8.11	7.32	7.01	12.40	10.19	22.59	6.57	1)	1)


^{* (}without local display)

1) dependent on respective process connection
All dimensions in [mm]

^{* (}without local display)

1) dependent on respective process connection
All dimensions in [in]


Transmitter compact version, stainless steel

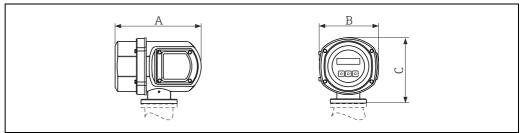

Dimensions in SI and US units

A	A	I	3	С			
[mm]	[in]	[mm]	[in]	[mm]	[in]		
225	8.86	153	6.02	168	6.61		

Transmitter connection housing remote version (II2G, Zone 1)

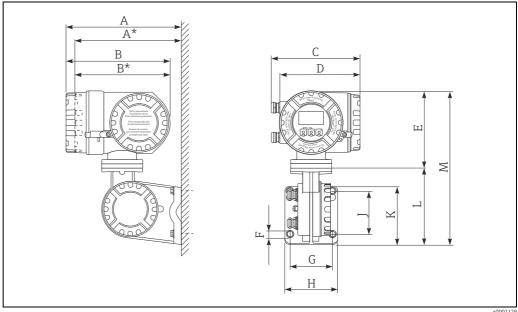

Dimensions in SI units

Α	A*	В	В*	С	D	Е	FØ	G	Н	J	К	L	М
265	242	240	217	206	186	178	8.6 (M8)	100	130	100	144	170	348


* Blind version (without local display) All dimensions in [mm]

Dimensions in US units

Α	A*	В	В*	С	D	Е	FØ	G	Н	J	К	L	М
10.4	9.53	9.45	8.54	8.11	7.32	7.01	0,34 (M8)	3.94	5.12	3.94	5.67	6.69	13.7

 * Blind version (without local display) All dimensions in [in]

$Transmitter\ remote\ version,\ wall-mount\ housing\ (non\ hazardous\ area\ and\ II3G,\ zone\ 2)$

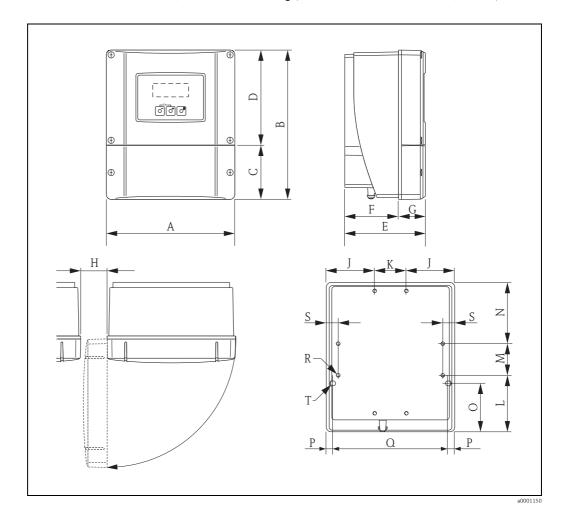

Dimensions (SI units)

А	В	С	D	E	F	G	Н	J	K
215	250	90.5	159.5	135	90	45	> 50	81	53
L	M	N	0	Р	Q	R	S	Т	1)
95	53	102	81.5	11.5	192	8 × M5	20	2 × Ø	Ø 6.5


 $^{^{1)}\,\}mbox{Securing}$ screw for wall mounting: M6 (screw head max. 10.5 mm) All dimensions in [mm]

Dimensions (US units)

А	В	С	D	E	F	G	Н	J	К
8.46	9.84	3.56	6.27	5.31	3.54	1.77	> 1.97	3.18	2.08
L	M	N	0	Р	Q	R	S	Т	1)
3.74	2.08	4.01	3.20	0.45	7.55	8 × M5	0.79	2 × Ø	0.26

 $^{^{1)}\,\}mbox{Securing}$ screw for wall mounting: M6 (screw head max. 0.41") All dimensions in [in]

Transmitter remote version, connection housing

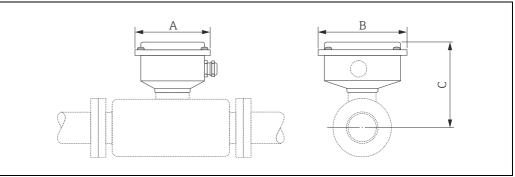

a0002516

Dimensions in SI units

DN	A	В	С
8	118.5	137.5	138
15	118.5	137.5	138
25	118.5	137.5	138
40	118.5	137.5	152
50	118.5	137.5	167

All dimensions in [mm]


Dimensions in US units

DN	A	В	С
3/8"	4.67	5.41	5.43
1/2"	4.67	5.41	5.43
1"	4.67	5.41	5.43
11/2"	4.67	5.41	5.98
2"	4.67	5.41	6.57
3"	4.67	5.41	7.72

All dimensions in [in]

Process connections in SI units

Flange according to EN 1092-1 (DIN 2501), PN 40 Flange according to EN 1092-1 (DIN 2501), PN 63 $\,$

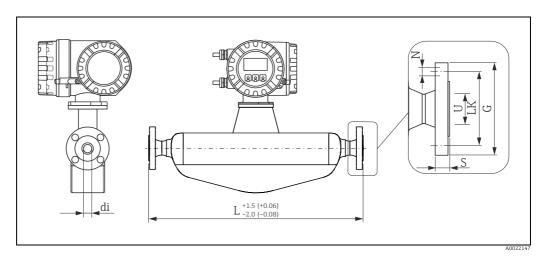

Engineering unit mm (in)


Surface roug	Flange according to EN 1092-1 (DIN 2501), PN 40: 1.4404 (F316/F316L) Surface roughness (flange): EN 1092-1 Form B1 (DIN 2526 Form C), Ra 3.2 to 12.5 µm Order code for "Process connection", option D2Z											
DN	G	L	N	S	LK	U	di					
8 1)	95.0	336	4 × Ø14	17.0	65.0	17.30	8.31					
15	95.0	440	4 × Ø14	20.0	65.0	17.30	12.00					
25	115.0	580	4 × Ø14	19.0	85.0	28.50	17.60					
40	150.0	794	4 × Ø18	21.0	110.0	43.10	26.00					
50	165.0	1071	4 × Ø18	25.0	125.0	54.50	40.50					

¹⁾ DN 8 with DN 15 flange as standard All dimensions in [mm]

Surface roug	3	e): EN 1092-1	01), PN 63: 1.4 Form B1 (DIN tion D3Z	•	,	2 μm					
DN	DN G L N S LK U di										
50	50 180.0 1083 4 × Ø22 29.0 135.0 54.50 40.50										

All dimensions in [mm]

Flange according to ASME B16.5, Cl 150 Flange according to ASME B16.5, Cl 300

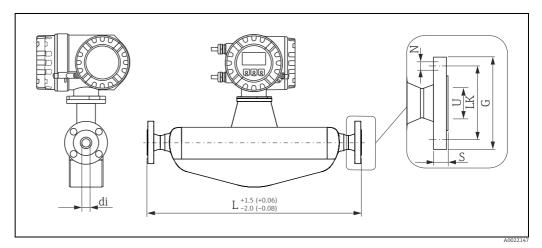

Engineering unit mm (in)


Surface roug	Flange according to ASME B16.5, Cl 150: 1.4404 (F316/F316L) Surface roughness (flange): Ra 126 to 248 µm Order code for "Process connection", option AAZ												
DN	DN G L N S LK U di												
8 1)	88.9	336	4 × Ø15.7	17.1	60.5	15.70	8.31						
15	88.9	440	4 × Ø15.7	17.1	60.5	15.70	12.00						
25	108.0	580	4 × Ø15.7	17.6	79.2	26.70	17.60						
40	127.0	794	4 × Ø15.7	18.6	98.6	40.90	26.00						
50	152.4	1071	4 × Ø19.1	25.1	120.7	52.60	40.50						

 $^{^{1)}}$ DN 8 with DN 15 flange as standard All dimensions in [mm]

Surface roug	Flange according to ASME B16.5, Cl 300: 1.4404 (F316/F316L) Surface roughness (flange): Ra 126 to 248 µm Order code for "Process connection", option ABZ											
DN	G	L	N	S	LK	U	di					
8 1)	95.2	336	4 × Ø15.7	16.6	66.5	15.70	8.31					
15	95.2	440	4 × Ø15.7	16.6	66.5	15.70	12.00					
25	123.9	580	4 × Ø19.1	18.1	88.9	26.70	17.60					
40	155.4	794	4 × Ø22.3	24.6	114.3	40.90	26.00					
50	165.1	1071	8 × Ø19.1	27.6	127.0	52.60	40.50					

 $^{^{1)}}$ DN 8 with DN 15 flange as standard All dimensions in [mm]

JIS B2220 flange, 10K JIS B2220 flange, 20K JIS B2220 flange, 40K

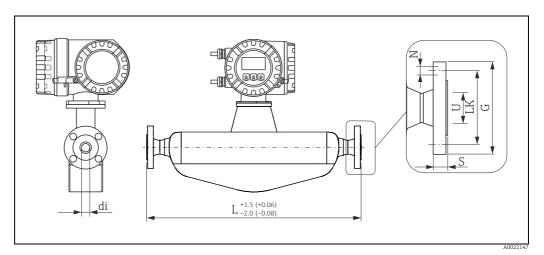

Engineering unit mm (in)

JIS B2220 flange, 10K: 1.4404 (F316/F316L) Surface roughness (flange): Ra 3.2 to 6.3 µm Order code for "Process connection", option NEZ										
DN G L N S LK U di										
50	155	1071	4 × Ø19	16.0	120.0	50.00	40.50			

All dimensions in [mm]

Surface roug	JIS B2220 flange, 20K: 1.4404 (F316/F316L) Surface roughness (flange): Ra 3.2 to 6.3 µm Order code for "Process connection", option NDZ											
DN	G	L	N	S	LK	U	di					
8 1)	95	336	4 × Ø15	16.0	70.0	15.00	8.31					
15	95	440	4 × Ø15	16.0	70.0	15.00	12.00					
25	125	580	4 × Ø19	17.5	90.0	25.00	17.60					
40	140	794	4 × Ø19	20.0	105.0	40.00	26.00					
50	155	1071	8 × Ø19	27.5	120.0	50.00	40.50					


¹⁾ DN 8 with DN 15 flange as standard All dimensions in [mm]

Surface roug	JIS B2220 flange, 40K: 1.4404 (F316/F316L) Surface roughness (flange): Ra 3.2 to 6.3 µm Order code for "Process connection", option NGZ											
DN	G	L	N	S	LK	U	di					
8 1)	115	336	4 × Ø19	21.0	80.0	15.00	8.31					
15	115	440	4 × Ø19	21.0	80.0	15.00	12.00					
25	130	589	4 × Ø19	22.0	95.0	25.00	17.60					
40	160	804	4 × Ø23	26.0	120.0	38.00	26.00					
50	165	1071	8 × Ø19	26.0	130.0	50.00	40.50					

¹⁾ DN 8 with DN 15 flange as standard All dimensions in [mm]

Tri-Clamp, DIN 11866 line C Tri-Clamp 1", DIN 11866 line C Tri-Clamp ¾", DIN 11866 line C Tri-Clamp ½", DIN 11866 line C

All Tri-Clamp connections correspond to the relevant ASME BPE hygienic clamp dimensions.

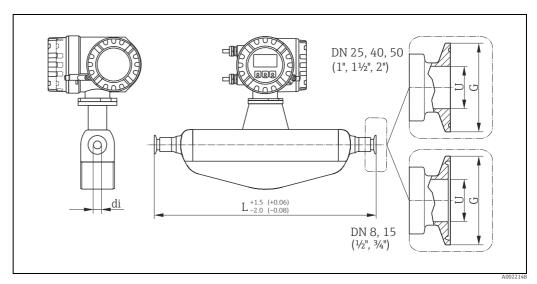

Engineering unit mm (in)

Tri-Clamp, DIN 11866 line C: 1.4435 (316L) Surface roughness: Ra \leq 0.8 μ m/150 grit Order code for "Process connection", option FTM								
DN Clamp G L U di								
8	1/2"	25.0	362	9.40	8.31			
15	3/4"	25.0	466	15.75	12.00			
25	1"	50.4	606	22.10	17.60			
40	1½"	50.4	818	34.80	26.00			
50	2"	63.9	1096	47.50	40.50			

All dimensions in [mm]

Tri-Clamp 1", DIN 11866 line C: 1.4435 (316L) Surface roughness: Ra \leq 0.8 μ m/150 grit Order code for "Process connection", option FAB						
DN Clamp G L U di						
8	1"	50.4	362	22.10	8.31	
15	1"	50.4	466	22.10	12.00	

All dimensions in [mm]


	Tri-Clamp $^{3}4$ ", DIN 11866 line C: 1.4435 (316L) Surface roughness: Ra $\leq 0.8~\mu m/150~grit$ Order code for "Process connection", option FPE					
DN Clamp G L U di						di
	8	3/4"	25.0	362	15.75	8.31

All dimensions in [mm]

Tri-Clamp ½", DIN 11866 line C: 1.4435 (316L) Surface roughness: Ra $\leq 0.8~\mu m/150~grit$ Order code for "Process connection", option FUG					
DN Clamp G L U di					
15	1/2"	25.0	466	9.40	12.00

All dimensions in [mm]

DIN 11851 thread, DIN 11866 line A DIN 11851 thread Rd 28 \times $^{1}\!\!\!/_{8}$ ", DIN 11866 line A

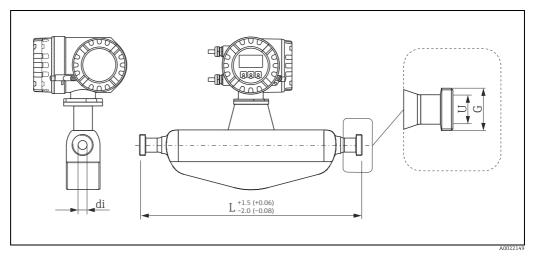

Engineering unit mm (in)


DIN 11851 thread, DIN 11866 line A: 1.4435 (316L) Surface roughness: Ra ≤ 0.8 µm/150 grit Order code for "Process connection", option FMD							
DN G L U di							
8	Rd 34 × 1/8"	362	16.00	8.31			
15	Rd 34 × 1/8"	466	16.00	12.00			
25	Rd 52 × 1/6"	606	26.00	17.60			
40	Rd 65 × 1/6"	825	38.00	26.00			
50	Rd 78 × 1/6"	1107	50.00	40.50			

All dimensions in [mm]

DIN 11851 thread Rd $28 \times \frac{1}{6}$ ", DIN 11866 line A: 1.4435 (316L) Surface roughness: Ra \leq 0.8 μ m/150 grit Order code for "Process connection", option FGD							
DN	G L U di						
8	Rd 28 × 1/8"	362	10.00	8.31			
15	Rd 28 × 1/8"	466	10.00	12.00			

All dimensions in [mm]

DIN 11864-1A thread, DIN 11866 line A

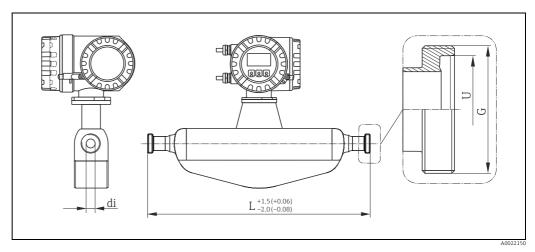


Engineering unit mm (in)

DN 11864-1A thread, DIN 11866 line A: 1.4435 (316L) Surface roughness: Ra \leq 0.8 μ m/150 grit Order code for "Process connection", option FLH							
DN G L U di							
8	Rd 34 × 1/8"	362	16.00	8.31			
15	Rd 34 × 1/8"	466	16.00	12.00			
25	Rd 52 × 1/6"	620	26.00	17.60			
40	Rd 65 × 1/6"	825	38.00	26.00			
50	Rd 78 × 1/6"	1107	50.00	40.50			

All dimensions in [mm]

DIN 11864-2A flange, DIN 11866 line A, flange with notch

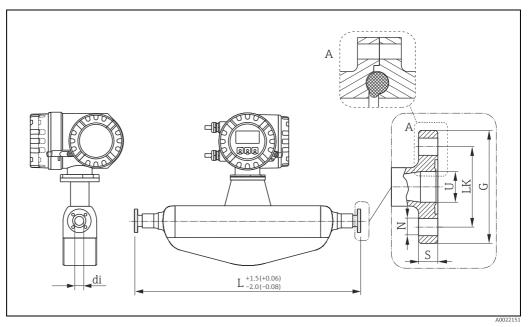


Detail A: The flange has the smaller groove for the O-ring on the sensor side. When mounting the sensor the corresponding flange must have accordingly a larger groove. Engineering unit mm (in).

Surface roug	DIN 11864-2A flange DIN 11866 line A, flange with notch: 1.4435 (316L) Surface roughness: Ra \leq 0.8 μ m/150 grit Order code for "Process connection", option FKG								
DN	DN G L N S LK U di								
8	59.0	384	4 × Ø9	10	42	16.00	8.31		
15	59.0	488	4 × Ø9	10	42	16.00	12.00		
25	70.0	626	4 × Ø9	10	53	26.00	17.60		
40	82.0	840	4 × Ø9	10	65	38.00	26.00		
50	94.0	1120	4 × Ø9	10	77	50.00	40.50		

All dimensions in [mm]

DIN 11864-3A clamp, DIN 11866 line A, with notch

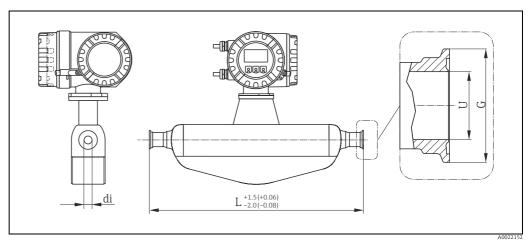


Engineering unit mm (in)

DIN 11864-3A clamp, DIN 11866 line A, with notch: 1.4435 (316L) Surface roughness: Ra ≤ 0.8 µm/150 grit Order code for "Process connection", option FWA							
DN	G	L	U	di			
8	34.0	370	16.00	8.31			
15	34.0	474	16.00	12.00			
25	50.5	614	26.00	17.60			
40	64.0	825	38.00	26.00			
50	77.5	1096	50.00	40.50			

All dimensions in [mm]

DIN 32676 clamp, DIN 11866 line A

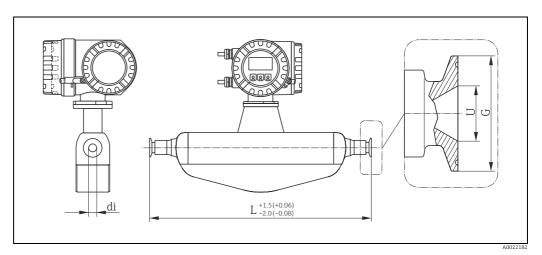


Engineering unit mm (in)

DIN 32676 clamp, DIN 11866 line A: 1.4435 (316L) Surface roughness: Ra \leq 0.8 μ m/150 grit Order code for "Process connection", option FDW							
DN	G	L	U	di			
8	34.0	362	16.00	8.31			
15	34.0	466	16.00	12.00			
25	50.5	606	26.00	17.60			
40	50.5	819	38.00	26.00			
50	64.0	1097	50.00	40.50			

All dimensions in [mm]

ISO 2852 clamp, ISO 2037

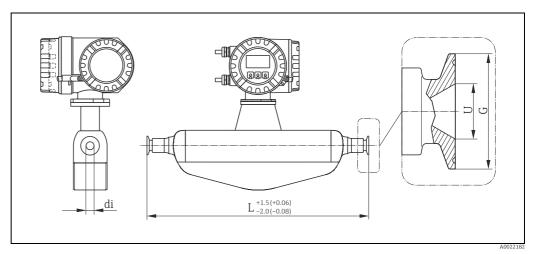


Engineering unit mm (in)

ISO 2852 clamp, ISO 2037: 1.4435 (316L) Surface roughness: Ra \leq 0.8 μ m/150 grit Order code for "Process connection", option FEA							
DN	G	L	U	di			
8	50.5	362	22.60	8.31			
15	50.5	466	22.60	12.00			
25	50.5	606	22.60	17.60			
40	50.5	818	35.60	26.00			
50	64.0	1096	48.60	40.50			

All dimensions in [mm]

ISO 2853 thread, ISO 2037

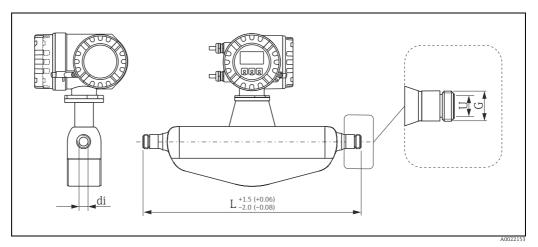


Engineering unit mm (in)

ISO 2853 thread, ISO 2037: 1.4435 (316L) Surface roughness: Ra ≤ 0.8 µm/150 grit Order code for "Process connection", option FJG							
DN	G	L	U	di			
8	37.13	370	22.60	8.31			
15	37.13	474	22.60	12.00			
25	37.13	614	22.60	17.60			
40	50.65	829	35.60	26.00			
50	64.10	1107	48.60	40.50			

All dimensions in [mm]

SMS 1145 thread

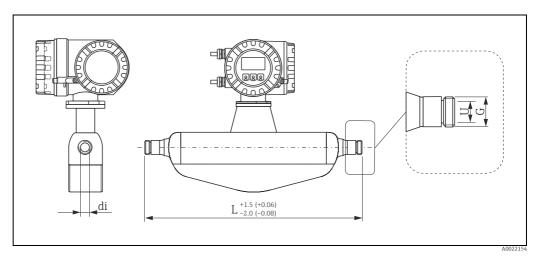


Engineering unit mm (in)

SMS 1145 thread: 1.4435 (316L) Surface roughness: Ra \leq 0.8 μ m/150 grit Order code for "Process connection", option FSD							
DN	G	L	U	di			
8	Rd 40 × 1/6"	362	22.50	8.31			
15	Rd 40 × 1/6"	466	22.50	12.00			
25	Rd 40 × 1/6"	606	22.50	17.60			
40	Rd 60 × 1/6"	829	35.50	26.00			
50	Rd 70 × 1/6"	1107	48.50	40.50			

All dimensions in [mm]

Process connections in US units

Flange according to ASME B16.5, Cl 150 Flange according to ASME B16.5, Cl 300

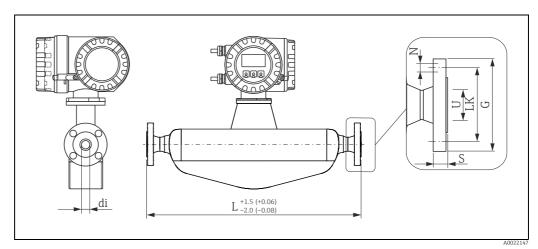

Engineering unit mm (in)


Flange according to ASME B16.5, Cl 150: 1.4404 (F316/F316L) Surface roughness (flange): Ra 126 to 248 µin Order code for "Process connection", option AAZ								
DN	G	L	N	S	LK	U	di	
3/8" 1)	3.50	13.23	4 × Ø0.62	0.67	2.38	0.62	0.33	
1/2"	3.50	17.32	4 × Ø0.62	0.67	2.38	0.62	0.47	
1"	4.25	22.83	4 × Ø0.62	0.69	3.12	1.05	0.69	
1 1/2"	5.00	32.26	4 × Ø0.62	0.73	3.88	1.61	1.02	
2"	6.00	42.17	4 × Ø0.75	0.99	4.75	2.07	1.59	

 $^{^{1)}}$ DN $^{3}\!/\!_{8}$ with DN $^{1}\!/\!_{2}$ flange as standard All dimensions in [in]

Surface roug	Flange according to ASME B16.5, Cl 300: 1.4404 (F316/F316L) Surface roughness (flange): Ra 126 to 248 µin Order code for "Process connection", option ABZ								
DN	G	L	N	S	LK	U	di		
3/8" 1)	3.75	13.23	4 × Ø0.62	0.65	2.62	0.62	0.33		
1/2"	3.75	17.32	4 × Ø0.62	0.65	2.62	0.62	0.47		
1"	4.88	22.83	4 × Ø0.75	0.71	3.50	1.05	0.69		
1 1/2"	6.12	32.26	4 × Ø0.88	0.97	4.50	1.61	1.02		
2"	6.50	42.17	8 × Ø0.75	1.09	5.00	2.07	1.59		

 $^{1)}$ DN $^3\!/\!\!\mathrm{g}"$ with DN $^1\!/\!\!\mathrm{s}"$ flange as standard All dimensions in [in]

Tri-Clamp, DIN 11866 line C Tri-Clamp 1", DIN 11866 line C Tri-Clamp ¾", DIN 11866 line C Tri-Clamp ½", DIN 11866 line C

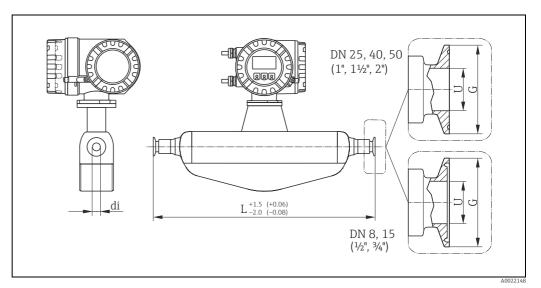

Engineering unit mm (in)

Tri-Clamp, DIN 11866 line C: 1.4435 (316L) Surface roughness: Ra \leq 32 μ in/150 grit Order code for "Process connection", option FTM							
DN	Clamp	G	L	Ŭ	di		
3/8"	1/2"	0.98	14.25	0.37	0.33		
1/2"	3/4"	0.98	18.35	0.62	0.47		
1"	1"	1.98	23.86	0.87	0.69		
1 ½"	1½"	1.98	32.20	1.37	1.02		
2"	2"	2.52	43.15	1.87	1.59		

All dimensions in [in]

Tri-Clamp 1", DIN 11866 line C: 1.4435 (316L) Surface roughness: Ra \leq 32 μ in/150 grit Order code for "Process connection", option FAB)						
DN	Clamp	G	L	U	di	
3/8"	1"	1.98	14.25	0.87	0.33	
1/2"	1"	1.98	18.35	0.87	0.47	

All dimensions in [in]


Tri-Clamp 34 ", DIN 11866 line C: 1.4435 (316L) Surface roughness: Ra \leq 32 μ in/150 grit Order code for "Process connection", option FPE						
DN	Clamp	G	L	Ŭ	di	
3/8"	3/4"	0.98	14.25	0.62	0.33	

All dimensions in [in]

Tri-Clamp ½", DIN 11866 line C: 1.4435 (316L) Surface roughness: Ra \leq 32 μ in/150 grit Order code for "Process connection", option FUG					
DN	Clamp	G	L	U	di
1/2"	1/2"	0.98	18.35	0.37	0.47

All dimensions in [in]

SMS 1145 thread

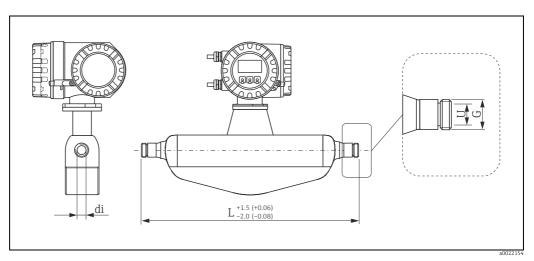


Engineering unit mm (in)

SMS 1145 thread: 1.4435 (316L) Surface roughness: Ra ≤ 32 µin/150 grit Order code for "Process connection", option FSD							
DN	G	L	U	di			
3/8"	Rd 40 × 1/6"	14.25	0.89	0.33			
1/2"	Rd 40 × 1/6"	18.35	0.89	0.47			
1"	Rd 40 × 1/6"	23.86	0.89	0.69			
1 ½"	Rd 60 × 1/6"	32.64	1.40	1.02			
2"	Rd 70 × 1/6"	43.58	1.91	1.59			

All dimensions in [in]

Purge connections, secondary containment monitoring

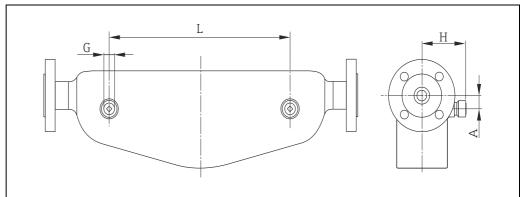

a0003288

DN		G	Α		Н		L	
[mm]	[in]		[mm]	[in]	[mm]	[in]	[mm]	[in]
8	3/8"	½"-NPT	25	0.98	82	3.23	110	4.34
15	1/2"	½"-NPT	25	0.98	82	3.23	204	8.04
25	1"	½"-NPT	25	0.98	82	3.23	348	13.54
40	1½"	½"-NPT	45	1.77	102	4.02	526	20.70
50	2"	½"-NPT	58	2.28	119.5	4.70	763	30.04

Weight

- Compact version: see table below
- Remote version
 - Sensor: see table below
 - Wall-mount housing: 5 kg (11 lb)

Weight in SI units

DN [mm]	8	15	25	40	50
Compact version	13	15	21	43	80
Remote version	11	13	19	41	78

All values (weight) refer to devices with EN/DIN PN 40 flanges. Weight information in $\lfloor kg \rfloor$

Weight in US units

DN [in]	3/8"	1/2"	1"	1½"	2"
Compact version	29	33	46	95	176
Remote version	24	29	42	90	172

All values (weight) refer to devices with EN/DIN PN 40 flanges. Weight information in [lb]

Materials

Transmitter housing

Compact version

- Powder coated die-cast aluminium
- Stainless steel housing: stainless steel, 1.4301 (304)
- Window material: glass or polycarbonate

Remote version

- Remote field housing: powder-coated die-cast aluminium
- Wall-mount housing: powder coated die-cast aluminium
- Window material: glass

Sensor housing, containment

- Acid and alkali-resistant outer surface
- Stainless steel, 1.4301 (304)

Connection housing, sensor (remote version)

Stainless steel, 1.4301 (304)

Process connections

- Flanges according to EN 1092-1 (DIN 2501); Flanges according to ASME B16.5; JIS B2220 flange: stainless steel, 1.4404 (316/316L);
- All other process connections: stainless steel, 1.4435 (316L)

Measuring tubes

Stainless steel, 1.4539 (904L)

Process connections

- Flanges:
 - according to EN 1092-1 (DIN 2501)
 - according to ASME B16.5
 - JIS B2220
 - DIN 11864-2A
- Threaded connection:
 - DIN 11864-1A
 - DIN 11851
 - SMS 1145ISO 2853
- Clamp connection:
 - Tri-Clamp
 - DIN 11864-3A
 - DIN 32676
 - ISO 2852

Surface roughness

Surface roughness of process wetted parts.

Wetted parts surface finish (measuring tube and process connection)

- $Ra_{max} = 0.8 \mu m$ (32 μ in) mechanically polished
- $Ra_{max} = 0.4 \mu m$ (16 μ in) mechanically polished

Operability

Local operation

Display elements

- Liquid-crystal display: backlit, two lines (Promass 80) or four lines (Promass 83) with 16 characters per line
- Selectable display of different measured values and status variables
- At ambient temperatures below -20 °C (-4 °F) the readability of the display may be impaired.

Operating elements

Promass 80:

- Local operation with three keys (□±E)
- Quick Setup menus for straightforward commissioning

Promass 83:

- Local operation with three optical keys (□±E)
- Application-specific Quick Setup menus for straightforward commissioning

Language group

Language groups available for operation in different countries:

Valid until software version 3.01.xx				
Order code	Option	1	Content	
Power Supply; Display	WEA Western Europe and America		English, German, Spanish, Italian, French, Dutch and Portuguese	
	EES	Eastern Europe and Scandinavia	English, Russian, Polish, Norwegian, Finnish, Swedish and Czech	
	SEA	South and East Asia	English, Japanese, Indonesian	
	only Pi	romass 83		
	CN	China	English, Chinese	

Valid as of software version 3.07.xx (only Promass 83)			
Order code	Option	Content	
Power Supply; Display	P, Q	English, German, Spanish, Italian, French	
	R, S	English, Russian, Portuguese, Dutch, Czech	
	T, U	English, Japanese, Swedish, Norwegian, Finnish	
	4, 5	English, Chinese, Indonesian, Polish	

You can change the language group via the operating program "FieldCare".

Remote operation

Promass 80

Remote operation via HART, PROFIBUS PA

Promass 83

Remote operation via HART, PROFIBUS PA/DP, FOUNDATION fieldbus, Modbus RS485

Certificates	and	an	provals
CCI CILICACCO	WII.	\sim P	protato

CE mark	The measuring system is in conformity with the statutory requirements of the EC Directives. Endress+Hauser confirms successful testing of the device by affixing to it the CE mark.
C-Tick symbol	The measuring system complies with the EMC requirements of the "Australian Communications and Media Authority (ACMA)"
Ex approval	Information about currently available Ex versions (ATEX, FM, CSA, IECEx, NEPSI etc.) can be supplied by your Endress+Hauser Sales Center on request. All information relevant to explosion protection is available in separate Ex documents that you can order as necessary.
Sanitary compatibility	 3A approval EHEDG tested
TSE compliance Endress+Hauser declare, that no material with animal origin or ingredients of animal origin used during the entire production of Promass sensors produced in our Reinach / Switzerland, France, Greenwood / USA or Aurangabad/India production facilities. In addition we do not use any material of animal origin during the polishing processes. Endress+Hauser therefore can confirm to TSE compliance.	
Functional safety	SIL -2: accordance IEC 61508/IEC 61511-1 (FDIS)
	"4 to 20 mA" output according to the following order code: A, B, C, D, E, L, M, R, S, T, U, W, 0, 2, 3, 4, 5, 6, 8 See also "Terminal assignment" $\rightarrow \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ $
HART certification	The flowmeter has successfully passed all the test procedures carried out and is certified and registered by the HCF (Hart Communication Foundation). The device thus meets all the requirements of the following specifications: Certified in accordance with HART Revisions 5 and 7 (device certification number: available on request) The measuring device can also be operated with certified devices of other manufacturers (interoperability).
FOUNDATION Fieldbus certification	The flow device has successfully passed all the test procedures carried out and is certified and registered by the Fieldbus Foundation. The device thus meets all the requirements of the following specifications:
	 Certified to FOUNDATION Fieldbus Specification The device meets all the specifications of the FOUNDATION Fieldbus H1. Interoperability Test Kit (ITK), revision status 5.01 (device certification number: on request) The device can also be operated with certified devices of other manufacturers Physical Layer Conformance Test of the Fieldbus Foundation
PROFIBUS DP/PA certification	The flow device has successfully passed all the test procedures carried out and is certified and registered by the PNO (PROFIBUS User Organization). The device thus meets all the requirements of the following specifications:
	 Certified in accordance with PROFIBUS Profile Version 3.0 (device certification no.: available on request) The device can also be operated with certified devices of other manufacturers (interoperability)
Modbus certification	The measuring device meets all the requirements of the Modbus/TCP conformity test and has the "Modbus/TCP Conformance Test Policy, Version 2.0". The measuring device has successfully passed all the test procedures carried out and is certified by the "Modbus/TCP Conformance Test Laboratory" of the University of Michigan.

Pressure measuring device approval

The measuring devices can be ordered with or without PED (Pressure Equipment Directive). If a device with PED is required, this must be ordered explicitly. For devices with nominal diameters less than or equal to DN 25 (1"), this is neither possible nor necessary.

- With the identification PED/G1/III on the sensor nameplate, Endress+Hauser confirms conformity with the "Basic safety requirements" of Appendix I of the Pressure Equipment Directive 97/23/EC.
- Devices with this identification (with PED) are suitable for the following types of fluid:
 - Fluids of Group 1 and 2 with a steam pressure greater than, or smaller and equal to 0.5 bar (7.3 psi)
 - Unstable gases
- Devices without this identification (without PED) are designed and manufactured according to good engineering practice. They correspond to the requirements of Art. 3, Section 3 of the Pressure Equipment Directive 97/23/EC. Their application is illustrated in Diagrams 6 to 9 in Appendix II of the Pressure Equipment Directive 97/23/EC.

Other standards and guidelines

■ EN 60529

Degrees of protection by housing (IP code)

■ EN 61010-1

Protection Measures for Electrical Equipment for Measurement, Control, Regulation and Laboratory Procedures

■ EN 61508

Functional Safety of Electrical/Electronic/Programmable Electronic Safety-related Systems

■ IFC/FN 61326

"Emission in accordance with Class A requirements". Electromagnetic compatibility (EMC requirements)

■ NAMUR NE 21

Electromagnetic compatibility (EMC) of industrial process and laboratory control equipment

NAMIIR NF 43

Standardization of the signal level for the breakdown information of digital transmitters with analog output signal

■ NAMUR NE 53

Software of field devices and signal-processing devices with digital electronics

Ordering Information

Detailed ordering information is available from the following sources:

- In the Product Configurator on the Endress+Hauser website: www.endress.com → Select country
 → Instruments → Select device → Product page function: Configure this product
- From your Endress+Hauser Sales Center: www.endress.com/worldwide

Product Configurator - the tool for individual product configuration

- Up-to-the-minute configuration data
- Depending on the device: Direct input of measuring point-specific information such as measuring range or operating language
- Automatic verification of exclusion criteria
- Automatic creation of the order code and its breakdown in PDF or Excel output format
- Ability to order directly in the Endress+Hauser Online Shop

Accessories

Various accessories, which can be ordered with the device or subsequently from Endress+Hauser, are available for the device. Detailed information on the order code in question is available from your local Endress+Hauser sales center or on the product page of the Endress+Hauser website: www.endress.com.

Device-specific accessories

For the Transmitter

Accessories	Description	
Transmitter	Transmitter for replacement or for stock. Use the order code to define the following specifications:	
	 Approvals Degree of protection, version Cable entries, Display, power supply, operation Software Outputs, inputs 	
Inputs/outputs for Proline Promass 83 HART	Conversion kit with appropriate plug-in point modules for converting the input/output configuration in place to date to a new version.	
Software packages for Proline Promass 83	Software add-ons on F-Chip, can be ordered individually: Advanced diagnostics Batching functions Concentration measurement	
Mounting set for transmitter		

For the Sensor

Accessories	Description
Heating jacket	Is used to stabilize the temperature of the fluids in the sensor. Water, water vapor and other non-corrosive liquids are permitted for use as fluids. If using oil as a heating medium, please consult with Endress+Hauser. For details, see Operating Instructions BA00099D

Communication-specific accessories

Accessories	Description
HART Communicator Field Xpert handheld terminal	Handheld terminal for remote parameterization and for obtaining measured values via the current output HART (4 to 20 mA). Contact your Endress +Hauser representative for more information.
Commubox FXA195 HART	The Commubox FXA195 connects intrinsically safe smart transmitters with the HART protocol with the USB port of a personal computer. This enables remote operation of the transmitter with operating software (e.g. FieldCare). Power is supplied to the Commubox via the USB port.

Service-specific accessories

Accessories	Description
Applicator	Software for selecting and sizing Endress+Hauser measuring devices: Calculation of all the necessary data for identifying the optimum flowmeter: e.g. nominal diameter, pressure loss, accuracy or process connections Graphic illustration of the calculation results
	Administration, documentation and access to all project-related data and parameters over the entire life cycle of a project.
	Applicator is available: Via the Internet: https://wapps.endress.com/applicator On CD-ROM for local PC installation
W@M	Life cycle management for your plant. W@M supports you with a wide range of software applications over the entire process: from planning and procurement, to the installation, commissioning and operation of the measuring devices. All the relevant device information, such as the device status, spare parts and device-specific documentation, is available for every device over the entire life cycle. The application already contains the data of your Endress+Hauser device. Endress+Hauser also takes care of maintaining and updating the data records.
	W@M is available: Via the Internet: www.endress.com/lifecyclemanagement On CD-ROM for local PC installation
Fieldcheck	Tester/simulator for testing flowmeters in the field. When used in conjunction with the "FieldCare" software package, test results can be imported into a database, printed and used for official certification. Contact your Endress+Hauser representative for more information.
FieldCare	FieldCare is Endress+Hauser's FDT-based plant asset management tool and allows the configuration and diagnosis of intelligent field devices. By using status information, you also have a simple but effective tool for monitoring devices. The Proline flowmeters are accessed via a service interface or via the service interface FXA193.
FXA193	Service interface from the measuring device to the PC for operation via FieldCare.

System components

Accessories	Description
Memograph M graphic display recorder	The Memograph M graphic display recorder provides information on all the relevant process variables. Measured values are recorded correctly, limit values are monitored and measuring points analyzed. The data are stored in the 256 MB internal memory and also on a DSD card or USB stick. Memograph M boasts a modular design, intuitive operation and a comprehensive security concept. The ReadWin® 2000 PC software is part of the standard package and is used for configuring, visualizing and archiving the data captured. The mathematics channels which are optionally available enable continuous monitoring of specific power consumption, boiler efficiency and other parameters which are important for efficient energy management.

Documentation

- Flow measuring technology (FA00005D)
- Technical Information
 - Promass 80A, 83A (TI00054D)
 - Promass 80E, 83E (TI00061D)
 - Promass 80F, 83F (TI00101D)
 - Promass 80H, 83H (TI00074D
 - Promass 80I, 83I (TI00075D)
 - Promass 80P, 83P (TI00078D)
- Operating Instructions/Description of Device Functions
 - Promass 80 HART (BA00057D/BA00058D)
 - Promass 80 PROFIBUS PA (BA00072D/BA00073D)
 - Promass 83 HART (BA00059D/BA00060D)
 - Promass 83 FOUNDATION Fieldbus (BA00065D/BA00066D)
 - Promass 83 PROFIBUS DP/PA (BA00063D/BA00064D)
 - Promass 83 Modbus (BA00107D/BA00108D)
- Supplementary documentation on Ex-ratings: ATEX, FM, CSA, IECEx NEPSI
- Functional safety manual Promass 80, 83 (SD00077D)

Registered trademarks

KALREZ® and VITON®

Registered trademarks of E.I. Du Pont de Nemours & Co., Wilmington, USA

TRI-CI AMP®

Registered trademark of Ladish & Co., Inc., Kenosha, USA

SWAGELOK®

Registered trademark of Swagelok & Co., Solon, USA

HART[®]

Registered trademark of HART Communication Foundation, Austin, USA

PROFIBUS®

Registered trademark of the PROFIBUS User Organization, Karlsruhe, Germany

FOUNDATION™ Fieldbus

Registered trademark of the Fieldbus FOUNDATION, Austin, USA

Modbus®

Registered trademark of the Modbus Organization

HistoROM™, S-DAT®, T-DAT™, F-CHIP®, Fieldcheck®, FieldCare®, Applicator®

Registered or registration-pending trademarks of Endress+Hauser Flowtec AG, Reinach, CH



